


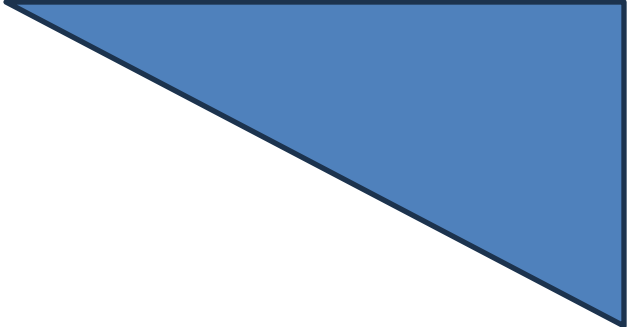

Occupational Safety and Health Standards Board

Public and Business Meeting

Meeting Agenda

OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD

2520 Venture Oaks Way, Suite 350
Sacramento, CA 95833
(916) 274-5721
www.dir.ca.gov/oshsb



MISSION STATEMENT

The mission of the Occupational Safety and Health Standards Board is to promote, adopt, and maintain reasonable and enforceable standards that will ensure a safe and healthy workplace for California workers.

AGENDA

OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD MEETING

PLEASE NOTE: In accordance with section 11123 of the Government Code, Board members as well as members of the public may elect to participate via videoconference.

**August 20, 2026
10:00 a.m.**

In-Person:

City Clerk's Office Alameda
Council Chambers
2263 Santa Clara Ave., Room 380
Alameda, CA 94501

Videoconference:

1. Go to <https://tkoworks.zoom.us/j/87501250331>
2. Enter Webinar ID: 875 0125 0331
3. Join the meeting through the Zoom application OR through your web browser
4. Videoconference will be opened to the public at 9:50 a.m.



Teleconference:

1. Dial 1 (669) 444-9171
2. Enter Webinar ID: 875 0125 0331 and follow the prompts
3. Teleconference will be opened to the public at 9:50 a.m.

Live video stream and audio stream (English and Spanish):

1. Go to <https://videobookcase.com/california/oshsb/>
2. Video stream and audio stream will launch as the meeting starts at 10:00 a.m.

Public Comment Queue:

If attending the Occupational Safety and Health Standards Board (Board) meeting in person, you will be added to the public comment queue upon completing a comment card on the day of the meeting.

If attending the meeting remotely and you wish to comment on agenda items, you may submit a request to be added to the public comment queue either in advance of or during the meeting through one of the following methods:

ONLINE: Provide your information through the online comment queue portal at <https://videobookcase.org/oshsb/public-comment-queue-form/>

PHONE: Call **(510) 868-2730** to access the automated comment queue voicemail and provide†: 1) your name as you would like it listed; 2) your affiliation or organization; and 3) the topic you would like to comment on.

† Information requested is voluntary and not required to address the Board.

I. CALL TO ORDER AND INTRODUCTIONS

- A. Spanish translation instructions

II. REMARKS FROM THE CHAIR**III. BUSINESS MEETING**

Note: The purpose of the Business Meeting is for the Board to conduct its monthly business. All matters on this agenda are subject to discussion and action as determined to be appropriate by the Board Chair.

For item D below, public comment will be limited to two minutes per speaker or four minutes for speakers requiring concurrent English translation.

A. PROPOSED SAFETY ORDERS FOR ADOPTION

1. TITLE 8: **CONSTRUCTION SAFETY ORDERS**

Section 1630

Elevators for Hoisting Workers

- Briefing by Board staff on proposed regulation for adoption
- Public comment on proposed regulation for adoption
- Board discussion and vote

B. BAGLEY-KEENE GUIDANCE

- Briefing by staff on Bagley-Keene guidance on open meeting act
- Public comment
- Board discussion

C. NEW BUSINESS

- Process Safety Management and Chemical Plants
 - Briefing by Joseph M. Alioto Jr., Chairman
 - Public Comment
 - Board Discussion

D. PROPOSED VARIANCE DECISIONS FOR ADOPTION

- Consent Calendar
- Vote on consent calendar

E. REPORTS

- Executive Officer's Report
- Legislative Update
- Cal/OSHA Report
- State Response Subcommittee Report

F. PUBLIC COMMENT ON NON-AGENDA ITEMS OR TO PROPOSE NEW OR REVISED STANDARDS

This portion of the meeting is open to any interested person proposing new or revised standards to the Board or commenting on occupational safety and health issues (Labor Code section 142.2) not on the agenda. The Board is prohibited to act on items that are not noticed on the agenda but may refer items to staff for future consideration.

Public comment will be limited to two minutes per speaker or four minutes for speakers requiring concurrent English translation.

The Board encourages comments on occupational safety and health matters not included on the monthly agenda. If you have a comment and cannot attend during the non-agenda comment period, OSHSB staff will do their best to read emailed comments into the record. Please send your non-agenda comment to oshsb_nacomment@dir.ca.gov by 5:00 PM the day prior to the meeting. Your comment should be clear, concise and 500 words or less.

Any individual or group wanting to make a presentation during the Public Meeting should visit <https://www.dir.ca.gov/oshsb/presentations-for-oshsb.html> for further information.

G. COMMENTS BY BOARD MEMBERS

Any Board member may identify a topic of interest during the Board meeting. However, the Board may not substantially discuss or act on any matter raised during the meeting that is not included on this agenda, except to decide to place the matter on the agenda of a future meeting. (GC sections 11125 & 11125.7(a).).

H. CLOSED SESSION

- Public comment on Closed Session Agenda Items

Pending Decisions

- Permanent Variance No. 20-V-096 (Tutor Perini/O&G JV)
- Permanent Variance No. 23-V-580 (Dragados)
- Permanent Variance No. 20-V-300 (Pepsi Bottling Group, LLC)

Matters Pending Litigation

- Western States Petroleum Association (WSPA) v. California Occupational Safety and Health Standards Board (OSHSB), et al. United States District Court (Eastern District of California) Case No. 2:19-CV-01270
- WSPA v. OSHSB, et al., County of Sacramento, CA Superior Court Case No. 34-2019-00260210

I. RETURN TO OPEN SESSION

- Report from closed session

J. ADJOURNMENT OF THE MEETING

Next Meeting: September 17, 2026
Town of Truckee-Town Hall
Council Chambers
10183 Truckee Airport Road
Truckee, CA 96161
10:00 a.m.

CLOSED SESSION

- If necessary, consideration of personnel matters. (GC section 11126(a)(1)).
- If necessary, consideration of pending litigation pursuant to GC section 11126(e)(1).
- If necessary, to deliberate on a pending decision. (GC section 11126(c)(3)).

PUBLIC COMMENT

Public Hearing

During the Public Hearing, members of the public may provide comments regarding standards that have been noticed to the public for a 45-day comment period. An individual wishing to comment must complete a speaker comment card. Efforts will be made to accommodate everyone who signs up to speak. However, given time constraints, there is no guarantee that all who have signed up will be able to address the Board.

Each individual who submits a comment card will get up to two minutes to speak. The Board Chair may extend the speaking time allotted when practical. The total time for public comment is 120 minutes unless extended by the Board Chair.

Business Meeting Non-Agendized

During the Business Meeting Non-Agendized, members of the public can address the Board on items of interest that are within the Board's jurisdiction but are not on the noticed agenda. The Board is not permitted to take action on items that are not on the noticed agenda but may refer items to staff for future consideration. The Board reserves the right to limit the time for speakers.

DISABILITY ACCOMMODATION NOTICE


Under Government Code section 11123(a), all meetings of a state body are open and public, and all persons are permitted to attend any meeting of a state body, except as otherwise provided in the Bagley-Keene Open Meeting Act.

If disability-related modifications or accommodations are required to participate in the meeting, please contact the Diversity and Inclusion Office at DIO@DIR.CA.GOV. To ensure the availability of your requested accommodation, please submit your request at least 10 days in advance.

Please contact the [California Relay Service](#) by dialing 711 or (800) 735-2929 (TTY) or (800) 855-3000 (TTY-Spanish).

TRANSLATION

Requests for translation services should be made no later than five (5) days before the meeting. Request may be made to by email to oshsb@dir.ca.gov.

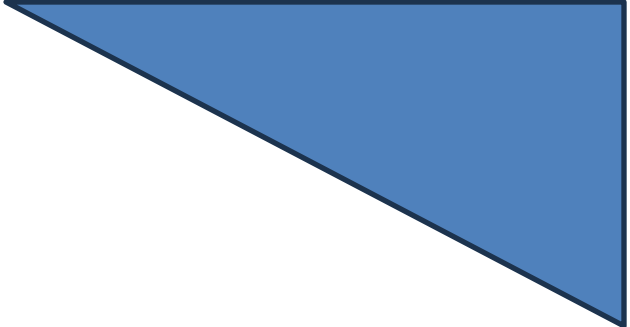

Occupational Safety and Health Standards Board

Public and Business Meeting

Meeting Notice

**OCCUPATIONAL SAFETY
AND HEALTH STANDARDS BOARD**

2520 Venture Oaks Way, Suite 350
Sacramento, CA 95833
(916) 274-5721
Website address www.dir.ca.gov/oshsb

**NOTICE OF PUBLIC MEETING AND BUSINESS MEETING
OF THE OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD**

Pursuant to Government Code section 11346.4 and the provisions of Labor Code Sections 142.1, 142.2, 142.3, 142.4, and 144.6, the Occupational Safety and Health Standards Board ("Board") of the State of California has set the time and place for a Public Meeting and Business Meeting:

QR Code for Access:



On **August 20, 2026**, at 10:00 a.m.
City Clerk's Office Alameda
Council Chambers
2263 Santa Clara Avenue, Room 380
Alameda, California 94501

as well as via the following:

- Videoconference at <https://tkoworks.zoom.us/j/87501250331>
- Teleconference at (669) 444-9171 (Webinar ID 875 0125 0331)
- Live video stream and audio stream (English and Spanish) at: <https://videobookcase.com/california/oshsb/>

At the Public Meeting, the Board will make time available to receive comments or proposals from interested persons on any item concerning occupational safety and health.


At the Business Meeting, the Board will conduct its monthly business.

DISABILITY ACCOMMODATION NOTICE: Disability accommodation is available upon request. Any person with a disability requiring an accommodation, auxiliary aid or service, or a modification of policies or procedures to ensure effective communication and access to the public hearings/meetings of the Board should contact the Disability Accommodation Coordinator at (916) 274-5721 or the state-wide Disability Accommodation Coordinator at 1 (866) 326-1616 (toll free). The state-wide Coordinator can also be reached through the California Relay Service, by dialing 711 or 1 (800) 735-2929 (TTY) or 1 (800) 855-3000 (TTY-Spanish).

Accommodations can include modifications of policies or procedures or provision of auxiliary aids or services. Accommodations include, but are not limited to, an Assistive Listening System (ALS), a Computer-Aided Transcription System or Communication Access Realtime Translation (CART), a sign-language interpreter, documents in Braille, large print or on computer disk, and audio cassette recording. Accommodation requests should be made as soon as possible. Requests for an ALS or CART should be made no later than five (5) days before the hearing.

OCCUPATIONAL SAFETY AND HEALTH
STANDARDS BOARD

A handwritten signature in blue ink, appearing to read "Joseph M. Alioto Jr.". Below the signature is a horizontal line.
JOSEPH M. ALIOTO JR., Chairman

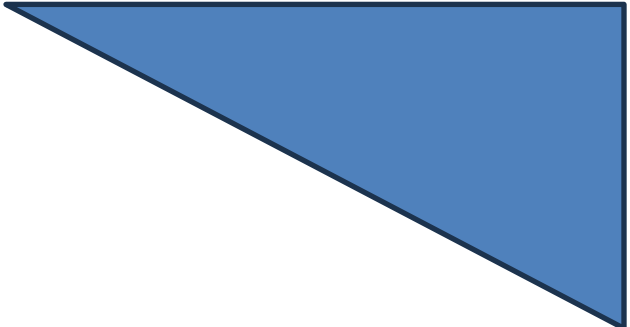

Occupational Safety and Health Standards Board

Business Meeting Standards for Adoption

Elevators for Hoisting Workers

MOVED, That the following resolution be adopted:

WHEREAS, On January 30, 2026, the Occupational Safety and Health Standards Board, pursuant to Government Code Section 11346.4, fixed the time and place for a Public Hearing to consider the revisions to Title 8, Construction Safety Orders, Section 1630, Elevators for Hoisting Workers.

WHEREAS, Such Public Hearing was held in person in Palm Springs, California and via teleconference and videoconference, on March 19, 2026, and there are now before the Occupational Safety and Health Standards Board the proposed revisions to Title 8, Construction Safety Orders, Section 1630, Elevators for Hoisting Workers, be it

RESOLVED By the Occupational Safety and Health Standards Board in regular meeting held in person in Alameda, California and via teleconference and videoconference, on August 20, 2026, that the proposed revisions to Title 8, Construction Safety Orders, Section 1630, Elevators for Hoisting Workers, be adopted.

RESOLVED That the Occupational Safety and Health Standards Board shall file with the Office of Administrative Law a sufficient number of copies of said filing documents and a copy of the rulemaking file for use by the Office of Administrative Law.

OCCUPATIONAL SAFETY AND HEALTH
STANDARDS BOARD

JOSEPH M. ALIOTO JR., CHAIRMAN

Certified As A Regulation
Of the Occupational Safety
And Health Standards Board

BY: _____
Millicent Robinette, Executive Officer

DATED: August 20, 2026

TITLE 8

CONSTRUCTION SAFETY ORDERS

SECTION 1630

[ELEVATORS FOR HOISTING WORKERS](#)

HYPERLINKS TO RULEMAKING DOCUMENTS:

[TEXT FOR BOARD CONSIDERATION](#)


[FINAL STATEMENT OF REASONS](#)

[INITIAL STATEMENT OF REASONS](#)

ELEVATORS FOR HOISTING WORKERS

[15-DAY NOTICE \(JUNE 12, 2026\)](#)

[15-DAY MODIFIED TEXT](#)

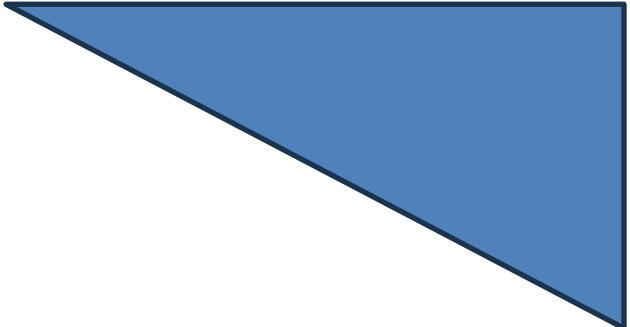

Occupational Safety and Health Standards Board

Business Meeting Proposed Variance Decisions

Prepared by the Department of Industrial Relations
Available on the DIR web page: [Standards Board \(OSHSB\) 2026 Meeting Schedule](#)

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application to Modify Permanent Variance by:

Santa Clara University

Permanent Variance No: 10-V-063M1

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The following person or entity ("Applicant") has applied for a modification of permanent variance from a provision of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Preexisting Permanent Variance No.	Applicant Name	Preexisting Variance Address of Record
10-V-063	Santa Clara University	Donohoe Alumni House Building 103 - 500 El Camino Real Santa Clara, CA

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026, via videoconference, by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit in accordance with section 426.
2. At the hearing, David Machado appeared as the Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application for Modification of Permanent Variance
PD2	OSHSB Notice of Hearing
PD3	Cal/OSHA Review of Variance Application

PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the safety regulation requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. The Applicant requests modification of the address of the unchanging variance location specified within Board records for each conveyance the subject of previously granted Permanent Variance No. 10-V-063 therewith.
2. The Application declared to be wholly truthful under penalty of perjury by Application signatory, states facts upon which reasonably may be based a finding that the address, specified in the records of the Board, at which Permanent Variance No. 10-V-063M1 is in effect, in fact is more completely, and correctly the different combination of addresses specified in below subsection D.1.
3. Cal/OSHA has evaluated the request for modification of variance location address, finds no issue with it, and recommends that the application for modification be granted subject to the same conditions of the Decision and Order in Permanent Variance No. 10-V-063 therewith.
4. The Board finds the above subpart C.2 referenced declaration to be credible, uncontroverted, and consistent with available, sufficient facts, and of no bearing as to the finding of equivalent occupational health and safety upon which Grant of preexisting Permanent Variance No. 10-V-063 therewith was based.
5. The Board finds the correct address by which to designate the location of each conveyance the subject of Permanent Variance No. 10-V-063, to be:

Bannan Alumni House
Building 103 - 500 El Camino Real
Santa Clara, CA

D. Decision and Order

1. Permanent Variance Application No. 10-V-063M1 is conditionally GRANTED, thereby modifying Board records, such that, without change in variance location, each conveyance being the subject of Permanent Variance No. 10-V-063 therewith, shall have the following address designation:

Bannan Alumni House
Building 103 - 500 El Camino Real
Santa Clara, CA

2. Permanent Variance No. 10-V-063 therewith, being only modified as to the subject location address specified in above Decision and Order section 1, is otherwise unchanged and remaining in full force and effect, as hereby incorporated by reference into this Decision and Order of Permanent Variance No. 10-V-063M1.
3. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives

are to be notified of docketed permanent variance applications pursuant to sections 411.2 and 411.3.

4. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in the manner prescribed.

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 28, 2026



Kelly Chau, Hearing Officer

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application to Modify Permanent Variance by:

3357-3359 26th Street and 1122 Capp Street Owners Association

Permanent Variance No: 23-V-223M1

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The following person or entity ("Applicant") has applied for a modification of permanent variance from a provision of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Preexisting Permanent Variance No.	Preexisting Variance Holder of Record	Preexisting Variance Address of Record
23-V-223	Uplift Ventures LLC	3359 26th St. San Francisco, CA

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026, via videoconference, by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit in accordance with section 426.
2. At the hearing, Gianmatteo Costanza appeared as the Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application for Modification of Permanent Variance
PD2	OSHSB Notice of Hearing
PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the safety regulation requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. The Applicant requests modification of the address of the unchanging variance location specified within Board records for each conveyance the subject of previously granted Permanent Variance No. 23-V-223 therewith.
2. The Applicant requests modification of the variance holder specified within Board records for each conveyance the subject of previously granted Permanent Variance No. 23-V-223 therewith.
3. The modification application submitted by applicant, declared to be wholly truthful under penalty of perjury by the signatory, states facts upon which reasonably may be based a finding that the 3357-3359 26th Street and 1122 Capp Street Owners Association became the owner of the conveyance(s) subject to the existing variance, and that the address, specified in the records of the Board, at which Permanent Variance 23-V-223 is in effect, in fact is more completely, and correctly the different combination of addresses specified in below subsection C.6.
4. Cal/OSHA has evaluated the aforementioned request for modification, finds no issue with it, and recommends that the application for modification be granted subject to the same conditions of the Decision and Order in Permanent Variance No. 23-V-223 therewith.
5. The Board finds the declaratory statements of the Applicant signatory to be credible, uncontroverted, and consistent with available, sufficient facts, and of no bearing as to the finding of equivalent occupational health and safety upon which, in substantial part, grant of preexisting Permanent Variance No. 23-V-223 therewith was based.
6. The Board finds the correct address by which to designate the location of each conveyance the subject of Permanent Variance No. 23-V-223M1, to be:

1122 Capp St.
San Francisco, CA

7. The Board finds the current person or entity having custody of each conveyance the subject of Permanent Variance No. 23-V-223M1, to be:

3357-3359 26th Street and 1122 Capp Street Owners Association

D. Decision and Order

1. Permanent Variance Application No. 23-V-223M1 is conditionally GRANTED, as specified below, such that, without change in variance location, each conveyance being the subject of Permanent Variance No. 23-V-223 therewith, shall have the following address designation:

1122 Capp St.
San Francisco, CA

2. Additionally, the person or entity holding Permanent Variance No(s). 23-V-223M1 and No. 23-V-223 therewith, shall be:

3. Permanent Variance No. 23-V-223 therewith, being only modified as specified in above Decision and Order sections 1 and 2, is otherwise unchanged and remaining in full force and effect, as hereby incorporated by reference into this Decision and Order of Permanent Variance No. 23-V-223M1.
4. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications pursuant to sections 411.2 and 411.3.
5. The Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in the manner prescribed.

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 28, 2026



Kelly Chau, Hearing Officer

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application to Modify Permanent Variance by:

AREC RR WOODLAKE JV LLC

Permanent Variance No: 24-V-312M1

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The following person or entity ("Applicant") has applied for a modification of permanent variance from a provision of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Preexisting Permanent Variance No.	Applicant Name	Preexisting Variance Address of Record
24-V-312	AREC RR WOODLAKE JV LLC	520 Media Pl. Sacramento, CA

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026, via videoconference, by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit in accordance with section 426.
2. At the hearing, Pete Cuellar, with SCHINDLER ELEVATOR CORPORATION, appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application for Modification of Permanent Variance
PD2	OSHSB Notice of Hearing
PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

-
4. Official notice is taken of the Board's files, records, recordings and decisions concerning the safety regulation requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. The Applicant requests modification of the address of the unchanging variance location specified within Board records for each conveyance the subject of previously granted Permanent Variance No. 24-V-312 therewith.
2. The Application declared to be wholly truthful under penalty of perjury by Application signatory, states facts upon which reasonably may be based a finding that the address, specified in the records of the Board, at which Permanent Variance No. 24-V-312M1 is in effect, in fact is more completely, and correctly the different combination of addresses specified in below subsection D.1.
3. Cal/OSHA has evaluated the request for modification of variance location address, finds no issue with it, and recommends that the application for modification be granted subject to the same conditions of the Decision and Order in Permanent Variance No. 24-V-312 therewith.
4. The Board finds the above subpart C.2 referenced declaration to be credible, uncontroverted, and consistent with available, sufficient facts, and of no bearing as to the finding of equivalent occupational health and safety upon which Grant of preexisting Permanent Variance No. 24-V-312 therewith was based.
5. The Board finds the correct address by which to designate the location of each conveyance the subject of Permanent Variance No. 24-V-312, to be:

Location 1:
Elevator #1
520 Media Pl.
Sacramento, CA

Location 2:
Elevator #2
540 Media Pl.
Sacramento, CA

D. Decision and Order

1. Permanent Variance Application No. 24-V-312M1 is conditionally GRANTED, thereby modifying Board records, such that, without change in variance location, each conveyance being the subject of Permanent Variance No. 24-V-312 therewith, shall have the following address designation:


Location 1:
Elevator #1
520 Media Pl.
Sacramento, CA

Location 2:
Elevator #2
540 Media Pl.
Sacramento, CA

2. Permanent Variance No. 24-V-312 therewith, being only modified as to the subject location address specified in above Decision and Order section 1, is otherwise unchanged and remaining in full force and effect, as hereby incorporated by reference into this Decision and Order of Permanent Variance No. 24-V-312M1.
3. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications pursuant to sections 411.2 and 411.3.
4. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in the manner prescribed.

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 28, 2026

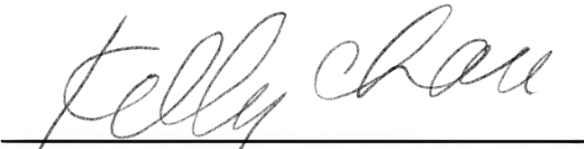

Kelly Chau, Hearing Officer

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application to Modify Permanent Variance by:

Sunnyside, L.P.

Permanent Variance No: 24-V-421M1

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The following person or entity ("Applicant") has applied for a modification of permanent variance from a provision of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Preexisting Permanent Variance No.	Applicant Name	Preexisting Variance Address of Record
24-V-421	Sunnyside, L.P.	1408 W. 62nd St. Los Angeles, CA

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026, via videoconference, by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit in accordance with section 426.
2. At the hearing, Pete Cuellar, with SCHINDLER ELEVATOR CORPORATION, appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application for Modification of Permanent Variance
PD2	OSHSB Notice of Hearing
PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

-
4. Official notice is taken of the Board's files, records, recordings and decisions concerning the safety regulation requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. The Applicant requests modification of the address of the unchanging variance location specified within Board records for each conveyance the subject of previously granted Permanent Variance No. 24-V-421 therewith.
2. The Application declared to be wholly truthful under penalty of perjury by Application signatory, states facts upon which reasonably may be based a finding that the address, specified in the records of the Board, at which Permanent Variance No. 24-V-421M1 is in effect, in fact is more completely, and correctly the different combination of addresses specified in below subsection D.1.
3. Cal/OSHA has evaluated the request for modification of variance location address, finds no issue with it, and recommends that the application for modification be granted subject to the same conditions of the Decision and Order in Permanent Variance No. 24-V-421 therewith.
4. The Board finds the above subpart C.2 referenced declaration to be credible, uncontroverted, and consistent with available, sufficient facts, and of no bearing as to the finding of equivalent occupational health and safety upon which Grant of preexisting Permanent Variance No. 24-V-421 therewith was based.
5. The Board finds the correct address by which to designate the location of each conveyance the subject of Permanent Variance No. 24-V-421, to be:

6201 S. Normandie Ave.
Los Angeles, CA

D. Decision and Order

1. Permanent Variance Application No. 24-V-421M1 is conditionally GRANTED, thereby modifying Board records, such that, without change in variance location, each conveyance being the subject of Permanent Variance No. 24-V-421 therewith, shall have the following address designation:

6201 S. Normandie Ave.
Los Angeles, CA
2. Permanent Variance No. 24-V-421 therewith, being only modified as to the subject location address specified in above Decision and Order section 1, is otherwise unchanged and remaining in full force and effect, as hereby incorporated by reference into this Decision and Order of Permanent Variance No. 24-V-421M1.
3. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications pursuant to sections 411.2 and 411.3.

4. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in the manner prescribed.

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 28, 2026



Kelly Chau, Hearing Officer

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application to Modify Permanent Variance by:

University of California Santa Barbara

Permanent Variance No: 25-V-485M1

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The following person or entity ("Applicant") has applied for a modification of permanent variance from a provision of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Preexisting Permanent Variance No.	Applicant Name	Preexisting Variance Address of Record
25-V-485	University of California Santa Barbara	UCSB San Benito Student Housing 584 Mesa Rd. Santa Barbara, CA

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026, via videoconference, by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit in accordance with section 426.
2. At the hearing, Dan Leacox, with Leacox & Associates, and Wolter Geesink with Otis Elevator Company appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application for Modification of Permanent Variance
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the safety regulation requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. The Applicant requests modification of the address of the unchanging variance location specified within Board records for each conveyance the subject of previously granted Permanent Variance No. 25-V-485 therewith.
2. The Application declared to be wholly truthful under penalty of perjury by Application signatory, states facts upon which reasonably may be based a finding that the address, specified in the records of the Board, at which Permanent Variance No. 25-V-485M1 is in effect, in fact is more completely, and correctly the different combination of addresses specified in below subsection D.1.
3. Cal/OSHA has evaluated the request for modification of variance location address, finds no issue with it, and recommends that the application for modification be granted subject to the same conditions of the Decision and Order in Permanent Variance No. 25-V-485 therewith.
4. The Board finds the above subpart C.2 referenced declaration to be credible, uncontroverted, and consistent with available, sufficient facts, and of no bearing as to the finding of equivalent occupational health and safety upon which Grant of preexisting Permanent Variance No. 25-V-485 therewith was based.
5. The Board finds the correct address by which to designate the location of each conveyance the subject of Permanent Variance No. 25-V-485, to be:

UCSB San Benito Student Housing
584 Henry T. Yang Dr.
Santa Barbara, CA

D. Decision and Order

1. Permanent Variance Application No. 25-V-485M1 is conditionally GRANTED, thereby modifying Board records, such that, without change in variance location, each conveyance being the subject of Permanent Variance No. 25-V-485 therewith, shall have the following address designation:

UCSB San Benito Student Housing
584 Henry T. Yang Dr.
Santa Barbara, CA

2. Permanent Variance No. 25-V-485 therewith, being only modified as to the subject location address specified in above Decision and Order section 1, is otherwise unchanged and remaining in full force and effect, as hereby incorporated by reference into this Decision and Order of Permanent Variance No. 25-V-485M1.

3. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications pursuant to sections 411.2 and 411.3.
4. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in the manner prescribed.

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 23, 2026



Kelly Chau, Hearing Officer

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

TK Elevator EOX

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-276	330 Distel Circle, LP	330 Distel Circle Los Altos, CA	2
26-V-279	1725 15 th Street LLC	1721 5 th St. San Francisco, CA	1
26-V-291	SMDT Partners LLC	477 Ninth Ave. San Mateo, CA	3
26-V-292	4141 Whitsett Management LLC	4155 Whitsett Ave. Studio City, CA	2
26-V-294	Kapital Alameda LLC	2685 The Alameda, Santa Clara, CA	1
26-V-320	Emperial Hospitality LLC	1338 Woodward St. Yuba City, CA	2
26-V-321	Board of Trustees of the California State University	6000 J St. Sacramento, CA	2
26-V-322	University Retirement Community at Davis	1010 Spirit St. Davis, CA	2
26-V-324	Kaiser Foundation Health Plan, Inc.	26980 Encanto Dr. Menifee, CA	2
26-V-357	West Valley Mission Community College	14000 Fruitvale Ave. Saratoga, CA	1

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et

seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, James Day, with TK Elevator Corporation, appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing
PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Applicant proposes to install a standard railing on the car top and believes equivalent or superior safety is achieved by complying with ASME A17.1-2019, 2.14.1.7.1. This standard allows the railing to be in-set in order to create a space around the top rail to provide greater clearances when the hand is placed on the rail. The EOX standard rail is-inset approximately 3.75 inches. TKE will bevel any area of exposed cartop outside the standard rail greater than 4". By meeting the requirements in ASME A17.1-2019 and any additional beveling is how the applicant believes equivalent or superior safety is achieved.
2. Applicant proposes to utilize an engineered belt-type suspension product (ECSB) that arranges steel tension members longitudinally in an elastomeric coating using specifically designed fastenings for attachment. The Applicant asserts that the proposed ECSB suspension complies with the more recent edition of ASME A17.1-2019, which contains specific requirements for this type of suspension means. The Applicant asserts that proposed suspension means provides equivalent safety through compliance with the provisions contained in ASME A17.1-2019, ASME A17.6-2017 and the following:
 - A. Belt tension monitoring.
 - B. Slack belt detection (Broken suspension)
 - C. Slip detection (traction loss)
 - D. Factor of safety in accordance with the code.

E. Residual Strength Detection Device (RSDD) accepted by Cal/OSHA.

F. Visual inspections of the suspension elements at 6 months, and annually thereafter.

G. Maintain manufacturer's quality control in accordance with ASME A17.6-2017 section 3.6.

3. The Applicant proposes the use of SIL-rated software and circuits to direct the removal of power to the elevator's driving machine. The Applicant asserts that their SIL-rated software and circuits meet the requirements of ASME A17.1-2019, section 2.26.9, for the use of SIL-rated systems in this role, providing equivalent safety to the existing ESO.
4. The Applicant asserts that their proposed motor control system meets the requirements of ASME A17.1-2019, section 2.26.9 for the use of SIL-rated circuits in this role and provides equivalent safety to the existing ESO.
5. The applicant asserts that equivalent safety is attained by relocating the inspection transfer switch and the seismic reset switch to the "Control Room". Newer standards define spaces and rooms beyond a machine room (Machine Space, Control Space, etc.). The applicant through TKE believes equivalent safety is achieved by complying with the requirements in ASME A17.1-2019, section 2.26.1.4. machine rooms control rooms and control spaces are secured by a Group 1 security key, which would limit access to elevator personnel only.

D. Relevant Safety Orders

Variance Request No. 1 (ASME A17.1-2004, section 2.14.1.7.1)

2.14.1.7.1 A standard railing conforming to 2.10.2 shall be provided on the outside perimeter of the car top on all sides where the perpendicular distance between the edges of the car top and the adjacent hoistway enclosure exceeds 300 mm (12 in.) horizontal clearance.

Variance Request No. 2a (ASME A17.1-2004, section 2.20.1)

2.20.1 Suspension Means

Elevator cars shall be suspended by steel wire ropes attached to the car frame or passing around sheaves attached to the car frame specified in 2.15.1. Ropes that have previously been installed and used on another installation shall not be reused.

Only iron (low carbon steel) or steel wire ropes, having the commercial classification "Elevator Wire Rope," or wire rope specifically constructed for elevator use, shall be used for the suspension of elevator cars and for the suspension of counterweights. The wire material for ropes shall be manufactured by the open hearth or electric furnace process or their equivalent.

Variance Request No. 2b1 (ASME A17.1-2004, section 2.20.2[.1])

2.20.2.1 On Crosshead Data Plate.

The crosshead data plate required by 2.16.3 shall bear the following wire rope data:

- (a) the number of ropes*
- (b) the diameter in millimeters (mm) or inches (in.)*
- (c) the manufacturer's rated breaking strength per rope in kilo Newton (kN) or pounds (lb)*

Variance Request No. 2b2 (ASME A17.1-2004, section 2.20.2.2)

2.20.2.2 On Rope Data Tag.

A metal data tag shall be securely attached to one of the wire rope fastenings. This data tag shall bear the following wire rope data:

- (a) the diameter in millimeters (mm) or inches (in.)*

[...]

- (f) whether the ropes were nonpreformed or preformed*

[...]

Variance Request No. 2c (ASME A17.1-2004, section 2.20.3)

2.20.3 Factor of Safety

The factor of safety of the suspension wire ropes shall be not less than shown in Table 2.20.3. Figure 8.2.7 gives the minimum factor of safety for intermediate rope speeds. The factor of safety shall be based on the actual rope speed corresponding to the rated speed of the car.

The factor of safety shall be calculated by the following formula:

$$f = \frac{(S \times N)}{W}$$

where

N = number of runs of rope under load. For 2:1 roping, N shall be two times the number of ropes used, etc.

S = manufacturer's rated breaking strength of one rope

W = maximum static load imposed on all car ropes with the car and its rated load at any position in the hoistway

Variance Request No. 2d (ASME A17.1-2004, section 2.20.4)

2.20.4 Minimum Number and Diameter of Suspension Ropes

The minimum number of hoisting ropes used shall be three for traction elevators and two for drum type elevators.

Where a car counterweight is used, the number of counterweight ropes used shall be not less than two.

The term "diameter," where used in reference to ropes, shall refer to the nominal diameter as given by the rope manufacturer.

The minimum diameter of hoisting and counterweight ropes shall be 9.5 mm (0.375 in.). Outer wires of the ropes shall be not less than 0.56 mm (0.024 in.) in diameter.

Variance Request No. 2e (ASME A17.1-2004, section 2.20.9[.1])

2.20.9 Suspension Rope Fastening

2.20.9.1 Type of Rope Fastenings. The car and counterweight ends of suspension wire ropes, or the stationary hitch ends where multiple roping is used, shall be fastened in such a manner that all portions of the rope, except the portion inside the rope sockets, shall be readily visible.

Fastening shall be

(a) by individual tapered rope sockets (see 2.20.9.4) or other types of rope fastenings that have undergone adequate tensile engineering tests, provided that

- (1) such fastenings conform to 2.20.9.2 and 2.20.9.3;
- (2) the rope socketing is such as to develop at least 80% of the ultimate breaking strength of the strongest rope to be used in such fastenings; or
- (b) by individual wedge rope sockets (see 2.20.9.5); and
- (c) Ubolt type rope clamps or similar devices shall not be used for suspension rope fastenings.

Variance Request No. 3 (ASME A17.1-2004, section 2.26.1.4[.4](a))

2.26.1.4.4 Machine Room Inspection Operation. When machine room inspection operation is provided, it shall conform to 2.26.1.4.1, and the transfer switch shall be (a) location in the machine room.

Variance Request No. 4a (ASME A17.1-2004, section 2.26.9.4)

2.26.9.4 Redundant devices used to satisfy 2.26.9.3 in the determination of the occurrence of a single ground, or the failure of any single magnetically operated switch, contactor or relay, or of any single solid state device, or any single device that limits the leveling or truck zone, or a software system failure, shall be checked prior to each start of the elevator from a landing, when on automatic operation. When a single ground or failure, as specified in 2.26.9.3, occurs, the car shall not be permitted to restart. Implementation of redundancy by a software system is permitted, provided that the removal of power from the driving machine motor and brake shall not be solely dependent on software controlled means.

Variance Request No. 4b (ASME A17.1-2004, section 2.26.9.6.1)

2.26.9.6.1 Two separate means shall be provided to independently inhibit the flow of alternating current through the solid state devices that connect the direct current power source to the alternating current driving motor. At least one of the means shall be an electromechanical relay.

Variance Request No. 5 (ASME A17.1-2004, section 8.4.10.1.1(a)(2)(b))

8.4.10.1.1 Earthquake Equipment (See Also Fig. 8.4.10.1.1)

(a) All traction elevators operating at a rated speed of 0.75 m/s (150 ft/min) or more and having counterweights located in the same hoistway shall be provided with the following:

(1) seismic zone 3 or greater: a minimum of one seismic switch per building

(2) seismic zone 2 or greater:

(a) a displacement switch for each elevator

(b) an identified momentary reset button or switch for each elevator, located in the control panel in the elevator machine room [see 8.4.10.1.3(i)]

E. Decision and Order

Applicant is hereby conditionally GRANTED Permanent Variance as specified below, and to the limited extent, as of the date the Board adopts this Proposed Decision, with respect to the section A specified number of TKE EOX MRL elevator(s), at the specified location, each shall conditionally hold permanent variance from the following subparts of ASME A17.1-2004, currently incorporated by reference into section 3141 of the Elevator Safety Orders:

- CarTop Railing: 2.14.1.7.1 (Limited to the extent necessary to permit the use of an inset cartop railing)
- Suspension Means: 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, and 2.20.9.1 (Limited to the extent necessary to permit the use of the elastomeric-coated steel belts in lieu of circular steel suspension ropes)
- Inspection transfer switch: 2.26.1.4.4(a) (Limited to the extent necessary to permit the inspection transfer switch to reside at a location other than the machine room)
- Software Reliant Means to Remove Power: 2.26.9.4 (Limited to the extent necessary to permit the exclusive use of SIL-rated software systems as a means to remove power from the driving machine motor and brake)
- SIL-Rated Circuitry to Inhibit Current Flow: 2.26.9.6.1 (Limited to the extent necessary to permit the use of SIL-rated circuitry in place of an electromechanical relay to inhibit current flow to the drive motor)
- Seismic reset switch: 8.4.10.1.1(a)(2)(b) (Limited to the extent necessary to permit the seismic reset switch to reside at a location other than the machine room)

Inset Car Top Railing (Variance Request No. 1):

1.0 Any and all inset car top railings shall comply with the following:

1.1 Serviceable equipment shall be positioned so that mechanics and inspectors do not have to stand on or climb over the railings to perform adjustments, maintenance, repairs or inspections. The Applicant shall not permit trained elevator mechanics or elevator service personnel to stand or climb over the car top railing.

1.2 The distance that the railing can be inset shall be limited to not more than six inches (6").

1.3 All exposed areas of the car top outside the car top railing where the distance from the railing to the edge of the car top exceeds two inches (2"), shall be beveled with metal, at an angle of not less than 75 degrees with the horizontal, from the mid or top rail to the outside of the car top, such that no person or object can stand, sit, kneel, rest, or be placed in the exposed areas.

1.4 The top surface of the beveled area and/or car top outside the railing, shall be clearly marked. The markings shall consist of alternating 4" diagonal red and white stripes.

1.5 The Applicant shall provide durable signs with lettering not less than 1/2 inch on a contrasting background on each inset railing; each sign shall state:

**CAUTION
STAY INSIDE RAILING**

**NO LEANING BEYOND RAILING
NO STEPPING ON, OR BEYOND, RAILING**

- 1.6 The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing will be measured from the car top and not from the required bevel).

Suspension Means (Variance Request No. 2):

- 2.0 The elevator suspension system shall comply with the following:
- 2.1 The elastomeric coated steel belts (ECSBs) and their associated fastenings shall conform to the applicable requirements of ASME A17.1-2019, sections:
- 2.20.4.3 – Minimum Number of Suspension Members
- 2.20.3 – Factor of Safety
- 2.20.9 – Suspension Member Fastening
- 2.2 Additionally, ECSBs shall meet or exceed all requirements of ASME A17.6-2017, Standard for Elevator Suspension, Compensation, and Governor Systems, Part 3 Noncircular Elastomeric Coated Steel Suspension Members for Elevators.
- 2.3 The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection and testing of the ECSBs and fastenings and related monitoring and detection systems and criteria for ECSB replacement, and the Applicant shall make those procedures and criteria available to the Certified Competent Conveyance Mechanic (CCCM) at the location of the elevator, and to Cal/OSHA upon request.
- 2.4 ECSB mandatory replacement criteria shall include:
- 2.4.1. Any exposed wire, strand or cord;
- 2.4.2. Any wire, strand or cord breaks through the elastomeric coating;
- 2.4.3. Any evidence of rouging (steel tension element corrosion) on any part of the elastomeric coated steel suspension member;
- 2.4.4. Any deformation in the elastomeric suspension member such as, but not limited to, kinks or bends.
- 2.5 Traction drive sheaves shall have a minimum diameter of 100 mm and used in conjunction with Brugg Drahtseil AG belts, type 8000728993 or 125AL002. The maximum speed of ECSBs running on 100 mm drive sheaves shall be no greater than 6.1 m/s (1200 fpm).
- 2.6 If any one (1) ECSB needs replacement, the complete set of suspension members on the elevator shall be replaced. Exception: If a new suspension member is damaged during installation, and prior to any contemporaneously installed ECSB having been placed into service, it is permissible to replace the individual damaged suspension member. ECSBs that have been installed on another installation shall not be re used.
- 2.7 A traction loss detection means shall be provided that conforms to the requirements of ASME

A17.1-2019, section 2.20.8.1. The means shall be tested for correct function annually in accordance with ASME A17.1-2019, section 8.6.4.19.12.

- 2.8 A broken suspension member detection means shall be provided that conforms to the requirements of ASME A17.1-2019, section 2.20.8.2. The means shall be tested for correct function annually in accordance with ASME A17.1-2019, section 8.6.4.19.13(a).
- 2.9 An elevator controller integrated bend cycle monitoring system shall monitor actual ECSB bend cycles, by means of continuously counting, and storing in nonvolatile memory, the number of trips that the ECSB makes traveling, and thereby being bent, over the elevator sheaves. The bend cycle limit monitoring means shall automatically stop the car normally at the next available landing before the bend cycle correlated residual strength of any single ECSB member drops below (60%) sixty percent of full rated strength. The monitoring means shall prevent the car from restarting. Notwithstanding any less frequent periodic testing requirement per Addendum 2 (Cal/OSHA Circular Letter), the bend cycle monitoring system shall be tested semiannually in accordance with the procedures required per above Conditions 2.3 and 2.4.
- 2.10 The elevator crosshead data plate shall comply with the requirements of ASME A17.1-2019, section 2.20.2.1.
- 2.11 A suspension means data tag shall be provided that complies with the requirements of ASME A17.1-2019, section 2.20.2.2.
- 2.12 Comprehensive visual inspections of the entire length of each and all installed suspension members, in conformity with above Conditions 2.3 and 2.4 specified criteria, shall be conducted and documented every six (6) months of operation, and subsequent inspections annually by a CCCM.
- 2.13 The Applicant shall be subject to the requirements per hereto attached, and inhere incorporated, Addendum 1, "Suspension Means Replacement Reporting Condition."
- 2.14 Records of all tests and inspections shall be maintenance records subject to ASME A17.12004, sections 8.6.1.2, and 8.6.1.4, respectively.
- 2.15 The subject elevators(s) shall be equipped with a TK Elevator Model 104DP001 Residual Strength Detection Device accepted by Cal/OSHA on May 4, 2021 or Cal/OSHA accepted equivalent device.

Control and Operating Circuits

Combined Software Redundant Devices with Software Removal of Power from Driving Motor and Brake (Variance Request No. 4a)

Removal of Power from Driving Motor Without Electromechanical Switches (Variance Request No. 4b)

- 3.0 The SIL rated circuitry used to provide device/circuit redundancy and to inhibit electrical current flow in accordance with ASME A17.12004, sections 2.26.9.4 and 2.26.9.6.1 shall comply with the following:
- 3.1 The SIL rated systems and related circuits shall consist of: the driving-machine motor control system shall consist of a TKE, model HVI-22 or HVI-44, High Voltage Inverter containing a Safe Torque Off printed circuit board assembly (STO). The STO shall be labeled or marked with a SIL rating (not less than SIL3), the name or mark of the certifying organization and

SIL certification number FS/71/220, followed by the applicable revision number (as in FS/71/220/23/1060).

- 3.2 The software system and related circuits shall be certified for compliance with the applicable requirements of ASME A17.1-2019 Section 2.26.9.3.2(b), 2.26.4.3.2, 2.26.9.6.1(b) and 2.26.9.4.
- 3.3 The access door or cover of the enclosures containing the SIL rated components shall be clearly labeled or tagged on their exterior with the statement:

**Assembly contains SIL rated devices.
Refer to maintenance Control Program and wiring diagrams
prior to performing work.**

- 3.4 Unique maintenance procedures or methods required for the inspection, testing, or replacement of the SIL rated circuits shall be developed and a copy maintained in the elevator machine/control room/space. The procedures or methods shall include clear color photographs of each SIL rated component, with notations identifying parts and locations.
- 3.5 Wiring diagrams that include part identification, SIL, and certification information shall be maintained in the elevator machine/control room/space.
- 3.6 A successful test of the SIL rated circuits shall be conducted initially and not less than annually in accordance with the testing procedure. The test shall demonstrate that SIL rated devices, safety functions, and related circuits operate as intended.
- 3.7 Any alterations to the SIL rated circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the alteration of SIL rated devices, the alterations shall be made in conformance with ASME A17.1-2019, section 8.7.1.9.
- 3.8 Any replacement of the SIL rated circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the replacement of SIL rated devices, the replacement shall be made in conformance with ASME A17.1-2019, section 8.6.3.14.
- 3.9 Any repairs to the SIL rated circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the repair of SIL rated devices, the repairs shall be made in conformance with ASME A17.1-2019, section 8.6.2.6.
- 3.10 Any space containing SIL rated circuits shall be maintained within the temperature and humidity range specified by TKE. The temperature and humidity range shall be posted on each enclosure containing SIL rated software or circuits.
- 3.11 Field software changes to the SIL rated system are not permitted. Any changes to the SIL rated system's circuitry will require recertification and all necessary updates to the documentation and diagrams required by Conditions 3.4 and 3.5 above.


Inspection Transfer Switch and Seismic Reset Switch (Variance Request Nos. 3 and 5):

- 4.0 Inspection Transfer switch and Seismic Reset switch placement and enclosure shall comply with the following:

- 4.1 If the inspection transfer switch required by ASME A17.1-2004, section 2.26.1.4.4, does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the control/machinery room/space containing the elevator's control equipment in an enclosure secured by a lock openable by a Group 1 security key. The enclosure is to remain locked at all times when not in use.
- 4.2 If the seismic reset switch does not reside in the machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the control/machinery room/space containing the elevator's control equipment in an enclosure secured by a lock openable by a Group 1 security key. The enclosure is to remain locked at all times when not in use.
- 5.0 The elevator shall be serviced, maintained, adjusted, tested, and inspected only by CCCM having been trained, and competent, to perform those tasks on the TKE EOX MRL elevator system in accordance with written procedures and criteria, including as required per above Conditions 2.3, and 2.4.
- 6.0 Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and all applicable requirements met, including conditions of this permanent variance, prior to a Permit to Operate the elevator being issued. The elevator shall not be placed in full service prior to the Permit to Operate being issued by Cal/OSHA.
- 7.0 The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications pursuant to sections 411.2, and 411.3.
- 8.0 This Decision and Order shall remain in effect unless duly modified or revoked upon application by Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in the procedural manner prescribed.

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 29, 2026

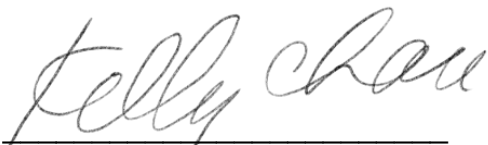

Kelly Chau, Hearing Officer

ADDENDUM 1

SUSPENSION MEANS REPLACEMENT REPORTING REQUIREMENTS

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future):
Cal/OSHA Elevator Unit, Attn: Engineering section, 2 MacArthur Place Suite 700, Santa Ana, CA 92707.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State issued conveyance number, complete address, and Permanent Variance file number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, and certification expiration date of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which

case, the information to be reported shall be the information required by the ASME provision as modified by the variance.

- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.

In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2(a) above.

ADDENDUM 2

CIRCULAR LETTER E-10-04, October 6, 2010

TO: Installers, Manufacturers of Conveyances and Related Equipment and, Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a nonfunctional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be nonfunctional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA Elevator Unit HQ

ADDENDUM 3

- A. A Residual Strength Detection Device (RSDD) shall continuously monitor all Elastomeric Coated Steel Belt suspension members (ECSB), automatically stopping the car if the residual strength of any belt drops below 60%. The RSDD shall prevent the elevator from restarting after a normal stop at a landing. The RSDD shall device shall apply a form of electrical current and/or signal through the entire length of the steel tension elements of the ECSB and measure the current and/or signal on its return. The values measured shall be continuously compared to values that have been correlated to the remaining residual strength of the ECSB through testing. The required RSDD shall not rely upon giant magnetoresistance technology, or other magnetic measurement means, for residual strength detection or monitoring.

The RSDD must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room or controller location. The removed RSDD must be replaced or returned to proper service within 30 days. If upon routine inspection, the RSDD device is found to be in a nonfunctional state, the date and findings are to be conspicuously documented in the elevator machine room or controller location.

If upon inspection by Cal/OSHA, the RSDD is found to be nonfunctional or removed, and the required documentation is not in place, the elevator will be removed from service. If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

- B. On or before November 21 2021, and thereafter, the above specified and documented RSDD shall be installed and operational on the subject elevator.
- C. A successful functionality test of each RSDD shall be conducted once a year, and a copy of completed testing documentation conspicuously located in the machine room or within proximity of the controller.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

KONE Monospace 500 Elevators & Medical Emergency Elevator Car Dimensions (Group IV)

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-277	SAEW JATC JOINT APPRENTICESHIP TRAINING TRUST	2832 El Centro Rd. Sacramento, CA	1

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Fuei Saetern, with KONE INC., appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table

PD2	OSHSB Notice of Hearing
PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each respective Applicant intends to utilize the KONE, Inc. Monospace 500 type elevator, in the quantity, at the location, specified per the above section A.1 table.
2. The installation contract for this elevator was or will be signed on or after May 1, 2008, thus making the elevator subject to the Group IV Elevator Safety Orders.
3. Each Applicant proposes to use hoisting ropes that are 8 mm in diameter which also consist of 0.51 mm diameter outer wires, in variance from the express requirements of ASME A17.1-2004, section 2.20.4.
4. In relevant part, ASME A17.1-2004, section 2.20.4 states:

2.20.4 Minimum Number and Diameter of Suspension Ropes

...The minimum diameter of hoisting and counterweight ropes shall be 9.5 mm (0.375 in.). Outer wires of the ropes shall be not less than 0.56 mm (0.024 in.) in diameter.

5. An intent of ASME A17.1-2004, section 2.20.4, is to ensure that the number, diameter, and construction of suspension ropes are adequate to provide safely robust and durable suspension means over the course of the ropes' foreseen service life.
6. KONE has represented to Cal/OSHA, having established an engineering practice for purposes of Monospace 500 elevator design, of meeting or exceeding the minimum factor of safety of 12 for 8 mm suspension members, as required in ASME A17.1-2010 - under which, given that factor of safety, supplemental broken suspension member protection is not required.
7. Also, each Applicant proposes as a further means of maintaining safety equivalence, monitoring the rope in conformity with the criteria specified within the *Inspector's Guide to 6 mm Diameter Governor and 8 mm Diameter Suspension Ropes for KONE Elevators* (per Application attachment "B", or as thereafter revised by KONE subject Cal/OSHA approval).
8. In addition, each Applicant has proposed to utilize 6 mm diameter governor ropes in variance from Title 8, section 3141, incorporated ASME A17.1-2004, section 2.18.5.1.
9. ASME A17.1-2004, section 2.18.5.1, specifies, in relevant part:

2.18.5.1 Material and Factor of Safety.

... [Governor ropes] not less than 9.5 mm (0.375 in.) in diameter. The factor of safety of governor ropes shall be not less than 5...

10. The Board takes notice of section 3141.7, subpart (a)(10):

A reduced diameter governor rope of equivalent construction and material to that required by ASME A17.1-2004, is permissible if the factor of safety as related to the strength necessary to activate the safety is 5 or greater;

11. Applicants propose use of 6mm governor rope having a safety factor of 5 or greater, in conformity with section 3141.7(a)(10), the specific parameters of which, being expressly set out within the Elevator Safety Orders (ESO), take precedence over more generally referenced governor rope diameter requirements per ASME A17.1-2004, section 2.18.5.1. Accordingly, the governor rope specifications being presently proposed, inclusive of a factor of safety of 5 or greater, would comply with current requirements, and therefore not be subject to issuance of permanent variance.
12. Absent evident diminution in elevator safety, over the past decade the Board has issued numerous permanent variances for use in KONE (Ecospace) elevator systems of 8 mm diameter suspension rope materially similar to that presently proposed (e.g. Permanent Variance Nos. 06-V-203, 08-V-245, and 13-V-303).
13. As noted by the Board in permanent Variance Nos. 18-V-044, and 18-V-045, Decision and Order Findings, subpart B.17 (hereby incorporated by reference), the strength of wire rope operating as an elevator's suspension means does not remain constant over its years of projected service life. With increasing usage cycles, a reduction in the cross-sectional area of the wire rope normally occurs, resulting in decreased residual strength. This characteristic is of particular relevance to the present matter because, decreasing wire rope diameter is associated with a higher rate of residual strength loss. This foreseeable reduction in cross-sectional area primarily results from elongation under sheave rounding load, as well as from wear, and wire or strand breaks. However, these characteristics need not compromise elevator safety when properly accounted for in the engineering of elevator suspension means, and associated components.
14. The presently proposed wire rope is Wuxi Universal steel rope Co LTD. 8 mm 8x19S+8x7+PP, with a manufacturer rated breaking strength of 35.8 kN, and an outer wire diameter of less than 0.56 mm, but not less than 0.51 mm. Cal/OSHA's safety engineer has scrutinized the material and structural specifications, and performance testing data, of this particular proposed rope, and concluded it will provide for safety equivalent to ESO compliant 9.5 mm wire rope, with 0.56 mm outer wire (under conditions of use included within the below Decision and Order).
15. The applicant supplies tabulated data regarding the "Maximum Static Load on All Suspension Ropes." To obtain the tabulated data, the applicant uses the following formula derived from ASME A17.1-2004, section 2.20.3:

$$W = \frac{(S \times N)}{f} \quad \text{where:}$$

W = maximum static load imposed on all car ropes with the car and its rated load at any position in the hoistway

N = number of runs of rope under load. For 2:1 roping, N shall be two times the number of ropes used, etc.

S = manufacturer's rated breaking strength of one rope

f = the factor of safety from Table 2.20.3

16. ASME A17.1-2010 sections 2.20.3 and 2.20.4 utilize the same formula, but provide for use of suspension ropes having a diameter smaller than 9.5 mm, under specified conditions, key among them being that use of ropes having a diameter of between 8 mm to 9.5 mm be engineered with a factor of safety of 12 or higher. This is a higher minimum factor of safety than that proposed by Applicant but a minimum recommended by Cal/OSHA as a condition of variance necessary to the achieving of safety equivalence to 9.5 mm rope.
17. Cal/OSHA is in accord with Applicant, in proposing as a condition of safety equivalence, that periodic physical examination of the wire ropes be performed to confirm the ropes continue to meet the criteria set out in the (Application attachment) *Inspector's Guide to 6 mm Diameter Governor and 8 mm Diameter Suspension Ropes for KONE Elevators*. Adherence to this condition will provide an additional assurance of safety equivalence, regarding smaller minimum diameter suspension rope outer wire performance over the course of its service life.
18. Applicant requests a permanent variance from section 3041, subdivision (e)(1)(C), which states:
 - (1) All buildings and structures constructed after the effective date of this order that are provided with one or more passenger elevators shall be provided with not less than one passenger elevator designed and designated to accommodate the loading and transport of an ambulance gurney or stretcher maximum size 22 ½ in. (572 mm) by 75 in. (1.90 m) in its horizontal position and arranged to serve all landings in conformance with the following:

...

(C) The elevator car shall have a minimum inside car platform of 80 in. (2.03 m) wide by 51 in. (1.30 m) deep.

The intent of this language is to ensure that there is enough space to accommodate the access and egress of a gurney and medical personnel inside of a medical service elevator.

This standard is made applicable to Group IV by section 3141.7, subdivision (b), which reads, "Elevators utilized to provide medical emergency service shall comply with Group II, section 3041(e)."
19. Applicant proposes to comply with the requirements of the 2019 California Building Code, section 3002.4.1a in the design of its medical emergency service elevator. That section requires:

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5-inch (127 mm) radius corners] in the horizontal, open position.

The purpose of this requirement is to ensure that an elevator designated for emergency medical service will accommodate a minimum of two emergency personnel with an ambulance gurney or stretcher.
20. Cal/OSHA, by way of written submission to the record (Exhibit PD3), and stated position at hearing, is of the well informed opinion that grant of permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment,

and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each Application being the subject of this proceeding, per above section A.1 table, is conditionally GRANTED, to the extent that each such Applicant shall be issued permanent variance from section 3141 incorporated ASME A17.1-2004, section 2.20.4, in as much as it precludes use of suspension rope of between 8 mm and 9.5 mm, or outer wire of between 0.51 mm and 0.56 mm in diameter, at such locations and numbers of Group IV KONE Monospace 500 elevators identified in each respective Application, subject to the following conditions:

1. The diameter of the hoisting steel ropes shall be not less than 8 mm (0.315 in) diameter and the roping ratio shall be two to one (2:1).
2. The outer wires of the suspension ropes shall be not less than 0.51 mm (0.02 in.) in diameter.
3. The number of suspension ropes shall be not fewer than those specified per hereby incorporated Decision and Order Appendix 1 Table.
4. The ropes shall be inspected annually for wire damage (rouge, valley break etc.) in accordance with "KONE, Inc. Inspector's Guide to 6 mm diameter and 8 mm diameter steel ropes for KONE Elevators" (per Application Exhibit B, or as thereafter amended by KONE subject to Cal/OSHA approval).
5. A rope inspection log shall be maintained and available in the elevator controller room/space at all times.
6. The elevator rated speed shall not exceed those speeds specified per the Decision and Order Appendix 1 Table.
7. The maximum suspended load shall not exceed those weights (plus 5%) specified per the Decision and Order Appendix 1 Table.
8. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of the elevator equipment in the hoistway is required. If the service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
9. The installation shall meet the suspension wire rope factor of safety requirements of ASME A17.1-2013 section 2.20.3.
10. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing or testing the elevators shall be provided a copy of this variance decision.
11. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be

inspected by Cal/OSHA and a "Permit to Operate" issued before the elevator is placed in service.

12. The Applicant shall comply with suspension means replacement reporting condition per hereby incorporated Decision and Order Appendix 2.
13. All medical emergency service elevator(s) shall comply with the following:
 - a. The requirements of the 2019 California Building Code (CBC) section 3002.4.1a:

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5-inch (127 mm) radius corners] in the horizontal, open position.
 - b. All medical emergency service elevator(s) shall be identified in the building construction documents in accordance with the 2019 California Building Code, section 3002.4a.
 - c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).
14. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications pursuant to sections 411.2 and 411.3.
15. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in the procedural manner prescribed.

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 23, 2026



Kelly Chau, Hearing Officer

APPENDIX 1

File Number	Elevator ID	Minimum Suspension Ropes Per Elevator	Maximum Suspended Weight Per Elevator	Maximum Speed	Rated Capacity
26-V-277	Elev. 1	7	12247	150	3500

APPENDIX 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Otis Medical Emergency Elevator Car Dimensions

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-281	District Council 16 of the International Union of Painters and Allied Trades (DC16 IUPAT)	65 Oak Grove St. San Francisco, CA	

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Dan Leacox, with Leacox & Associates, and Wolter Geesink with Otis Elevator Company appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table

PD2	OSHSB Notice of Hearing
PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact and Applicable Regulations

1. Applicant requests a permanent variance from section 3041, subdivision (e)(1)(C), which states:

(1) All buildings and structures constructed after the effective date of this order that are provided with one or more passenger elevators shall be provided with not less than one passenger elevator designed and designated to accommodate the loading and transport of an ambulance gurney or stretcher maximum size 22 ½ in. (572 mm) by 75 in. (1.90 m) in its horizontal position and arranged to serve all landings in conformance with the following:

...

(C) The elevator car shall have a minimum inside car platform of 80 in. (2.03 m) wide by 51 in. (1.30 m) deep.

The intent of this language is to ensure that there is enough space to accommodate the access and egress of a gurney and medical personnel inside of a medical service elevator.

This standard is made applicable to Group IV by section 3141.7, subdivision (b), which reads, "Elevators utilized to provide medical emergency service shall comply with Group II, section 3041(e)."

2. Applicant proposes to comply with the requirements of the 2019 California Building Code, section 3002.4.1a in the design of its medical emergency service elevator. That section requires:

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5-inch (127 mm) radius corners] in the horizontal, open position.

The purpose of this requirement is to ensure that an elevator designated for emergency medical service will accommodate a minimum of two emergency personnel with an ambulance gurney or stretcher.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A.1 table shall have permanent variances from sections 3041, subdivision (e)(1)(C) and 3141.7, subdivision (b) subject of the following conditions:

1. All medical emergency service elevator(s) shall comply with the requirements of the 2019 California Building Code section 3002.4.1a:

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5-inch (127 mm) radius corners] in the horizontal, open position.

2. All medical emergency service elevator(s) shall be identified in the building construction documents in accordance with the 2019 California Building Code, section 3002.4a.
3. Dimensional drawings and other information necessary to demonstrate compliance with the conditions of this permanent variance decision shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).
4. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing, or testing the elevators shall be provided a copy of this variance decision.
5. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and all applicable requirements met, including conditions of this permanent variance, prior to a Permit to Operate the elevator being issued. The elevator shall not be placed in service prior to the Permit to Operate being issued by Cal/OSHA.
6. Applicant shall notify its employees and their authorized representative, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications pursuant to sections 411.2 and 411.3.
7. This Decision and Order shall remain in effect unless duly modified or revoked upon application by Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in accordance with then in effect administrative procedures of the Board.

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 23, 2026



Kelly Chau, Hearing Officer

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Otis Gen2S/Gen3Edge/Gen3 Core Elevator & Medical Emergency Car Dimensions

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-282	10910 Huston, LP	10910 W. Huston St. North Hollywood, CA	1

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Dan Leacox, with Leacox & Associates, and Wolter Geesink with Otis Elevator Company appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each Applicant intends to utilize Otis Gen3 Edge/Gen2S/Gen3 Core elevators at the locations and in the numbers stated in the above section A.1 table. Applicant may utilize the variance from minimum inside car platform dimensions for other elevators designated for emergency medical service at the same variance location.
2. The installation contracts for these elevators were or will be signed on or after May 1, 2008, making the elevators subject to the Group IV Elevator Safety Orders.
3. The Board incorporates by reference the relevant findings in previous Board decisions:
 - a. Items D.3 through D.9 of the Proposed Decision adopted by the Board on July 18, 2013 for Permanent Variance No. 12-V-093;
 - b. Item D.4 of the Proposed Decision adopted by the Board on September 25, 2014 for Permanent Variance No. 14-V-206;
 - c. Item B of the Proposed Decision adopted by the Board on September 15, 2022 for Permanent Variance No. 22-V-302 regarding medical emergency car dimensions; and
 - d. Items C and D of the Proposed Decision adopted by the Board on June 20, 2024 for Permanent Variance No. 24-V-193 regarding the Gen3 Core elevator equivalent safety.
4. Cal/OSHA, by way of written submissions to the record (Exhibit PD-3), and position stated at hearing, is of the well informed opinion that grant of requested permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment, and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the Elevator Safety Order requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A table shall have permanent variances from the following sections of ASME A17.1-2004 that section 3141 makes applicable to the elevators the subject of those applications:

- **Car top railing:** sections 2.14.1.7.1 (to permit an inset car top railing, if, in fact, the car top railing is inset);
- **Speed governor over-speed switch:** 2.18.4.2.5(a) (to permit the use of the speed reducing system proposed by the Applicants, where the speed reducing switch resides in the controller algorithms, rather than on the governor, with the necessary speed input supplied by the main encoder signal from the motor);
- **Governor rope diameter:** 2.18.5.1 (to allow the use of reduced diameter governor rope);
- **Pitch diameter:** 2.18.7.4 (to permit the use of the speed-reducing system proposed by the Applicant, where the rope sheave pitch diameter is not less than 180 mm [7.1 in.]);
- **Suspension means:** 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4 and 2.20.9.5.4—the variances from these “suspension means” provisions to permit the use of Otis Gen2 flat coated steel suspension belts in lieu of conventional steel suspension ropes;
- **Inspection transfer switch:** 2.26.1.4.4(a) (to allow the inspection transfer switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room); and
- **Seismic reset switch:** 8.4.10.1.1(a)(2)(b) (to allow the seismic reset switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room).
- **Minimum Inside Car Platform Dimensions:** 3041(e)(1)(C) and 3141.7(b) (to comply with the performance-based requirements of the 2019 California Building Code section 3002.4.1a)

These variances apply to the locations and numbers of elevators stated in the section A table (so long as the elevators are Gen3 Edge/Gen2S Group and Gen3 Core & Medical Emergency Elevator Car Dimensions (Group IV) that are designed, equipped, and installed in accordance with, and are otherwise consistent with, and are subject to the following conditions:

1. The suspension system shall comply with the following:
 - a. The coated steel belt and connections shall have factors of safety equal to those permitted for use by section 3141 [ASME A17.1-2004, section 2.20.3] on wire rope suspended elevators.
 - b. Steel coated belts that have been installed and used on another installation shall not be reused.
 - c. The coated steel belt shall be fitted with a monitoring device which has been accepted by Cal/OSHA and which will automatically stop the car if the residual strength of any single belt drops below 60 percent. If the residual strength of any single belt drops below 60 percent, the device shall prevent the elevator from restarting after a normal stop at a landing.
 - d. Upon initial inspection, the readings from the monitoring device shall be documented and submitted to Cal/OSHA.
 - e. A successful test of the monitoring device’s functionality shall be conducted at least once a year (the record of the annual test of the monitoring device shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - f. The coated steel belts used shall be accepted by Cal/OSHA.

2. With respect to each elevator subject to this variance, the applicant shall comply with Cal/OSHA Circular Letter E-10-04, the substance of which is attached hereto as Addendum 1 and incorporated herein by this reference.
3. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection, and testing of the belts and monitoring device and criteria for belt replacement, and the applicant shall make those procedures and criteria available to Cal/OSHA upon request.
4. The flat coated steel belts shall be provided with a metal data tag that is securely attached to one of those belts. This data tag shall bear the following flat steel coated belt data:
 - a. The width and thickness in millimeters or inches;
 - b. The manufacturer's rated breaking strength in (kN) or (lbf);
 - c. The name of the person or organization that installed the flat coated steel belts;
 - d. The month and year the flat coated steel belts were installed;
 - e. The month and year the flat coated steel belts were first shortened;
 - f. The name or trademark of the manufacturer of the flat coated steel belts; and
 - g. Lubrication information.
5. There shall be a crosshead data plate of the sort required by section 2.20.2.1, and that plate shall bear the following flat steel coated belt data:
 - a. The number of belts;
 - b. The belt width and thickness in millimeters or inches; and
 - c. The manufacturer's rated breaking strength per belt in (kN) or (lbf).
6. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of elevator equipment in the hoistway is required. If service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
7. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on railings to perform adjustment, maintenance, repairs or inspections. The applicant shall not permit anyone to stand on or climb over the car top railing.
 - b. The distance that the car top railing may be inset shall be limited to no more than 6 inches.
 - c. All exposed areas outside the car top railing shall preclude standing or placing objects or persons which may fall and shall be beveled from the mid- or top rail to the outside of the car top.
 - d. The top of the beveled area and/or car top outside the railing, shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
 - e. The applicant shall provide durable signs with lettering not less than ½ inch on a

contrasting background on each inset railing; each sign shall state:

**CAUTION
DO NOT STAND ON OR CLIMB OVER RAILING**

- f. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing shall be measured from the car top and not from the required bevel).
- 8. If the seismic reset switch does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
- 9. If the inspection transfer switch required by ASME A17.1, rule 2.26.1.4.4(a) does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
- 10. When the inspection and testing panel is located in the hoistway door jamb, the inspection and test control panel shall be openable only by use of a Security Group I restricted key.
- 11. The governor speed-reducing switch function shall comply with the following:
 - a. It shall be used only with direct drive machines; i.e., no gear reduction is permitted between the drive motor and the suspension means.
 - b. The velocity encoder shall be coupled to the driving machine motor shaft. The “C” channel of the encoder shall be utilized for velocity measurements required by the speed reducing system. The signal from “C” channel of the encoder shall be verified with the “A” and “B” channels for failure. If a failure is detected then an emergency stop shall be initiated.
 - c. Control system parameters utilized in the speed-reducing system shall be held in non-volatile memory.
 - d. It shall be used in conjunction with approved car-mounted speed governors only.
 - e. It shall be used in conjunction with an effective traction monitoring system that detects a loss of traction between the driving sheave and the suspension means. If a loss of traction is detected, then an emergency stop shall be initiated.
 - f. A successful test of the speed-reducing switch system’s functionality shall be conducted at least once a year (the record of the annual test of the speed-reducing switch system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - g. A successful test of the traction monitoring system’s functionality shall be conducted at least once a year (the record of the annual test of the traction monitoring system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - h. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the maintenance, inspection, and testing of the speed-reducing switch and traction monitoring systems. The Applicant shall make the procedures available to Cal/OSHA upon

request.

12. The speed governor rope and sheaves shall comply with the following:

- a. The governor shall be used in conjunction with a 6 mm (0.25 in.) diameter steel governor rope with 6-strand, regular lay construction.
- b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
- c. The governor sheaves shall have a pitch diameter of not less than 180 mm (7.1 in.).

13. All medical emergency service elevators shall comply with the following:

- a. The requirements of the 2019 California Building Code (CBC), section 3002.4.1a;

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5inch (127 mm) radius corners] in the horizontal, open position.

- b. All medical emergency service elevators shall be identified in the building construction documents in accordance with the 2019 CBC, section 3002.4a.
- c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).

- 14. The elevator shall be serviced, maintained, adjusted, tested, and inspected only by Certified Competent Conveyance Mechanics who have been trained to, and are competent to, perform those tasks on the Gen3 Edge/Gen2S/Gen3 Core elevator system in accordance with the written procedures and criteria required by Condition No. 3 and in accordance with the terms of this permanent variance.
- 15. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing, or testing of the elevators shall be provided a copy of this variance decision.
- 16. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and a Permit to Operate shall be issued before the elevator is placed in service.
- 17. The Applicant shall be subject to the Suspension Means – Replacement Reporting Condition stated in Addendum 2, as hereby incorporated by this reference.
- 18. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications.
- 19. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in

accordance with the Board's procedural regulations at section 426, subdivision (b).

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 23, 2026



Kelly Chau, Hearing Officer

ADDENDUM 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and, Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA-Elevator Unit HQS

ADDENDUM 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Otis Gen2S/Gen3Edge/Gen3 Core Elevator & Medical Emergency Car Dimensions

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-283	Beacon Owner, LLC	155 West 6th St. Los Angeles, CA	3

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Dan Leacox, with Leacox & Associates, and Wolter Geesink with Otis Elevator Company appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each Applicant intends to utilize Otis Gen3 Edge/Gen2S/Gen3 Core elevators at the locations and in the numbers stated in the above section A.1 table. Applicant may utilize the variance from minimum inside car platform dimensions for other elevators designated for emergency medical service at the same variance location.
2. The installation contracts for these elevators were or will be signed on or after May 1, 2008, making the elevators subject to the Group IV Elevator Safety Orders.
3. The Board incorporates by reference the relevant findings in previous Board decisions:
 - a. Items D.3 through D.9 of the Proposed Decision adopted by the Board on July 18, 2013 for Permanent Variance No. 12-V-093;
 - b. Item D.4 of the Proposed Decision adopted by the Board on September 25, 2014 for Permanent Variance No. 14-V-206;
 - c. Item B of the Proposed Decision adopted by the Board on September 15, 2022 for Permanent Variance No. 22-V-302 regarding medical emergency car dimensions; and
 - d. Items C and D of the Proposed Decision adopted by the Board on June 20, 2024 for Permanent Variance No. 24-V-193 regarding the Gen3 Core elevator equivalent safety.
4. Cal/OSHA, by way of written submissions to the record (Exhibit PD-3), and position stated at hearing, is of the well informed opinion that grant of requested permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment, and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the Elevator Safety Order requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A table shall have permanent variances from the following sections of ASME A17.1-2004 that section 3141 makes applicable to the elevators the subject of those applications:

- **Car top railing:** sections 2.14.1.7.1 (to permit an inset car top railing, if, in fact, the car top railing is inset);
- **Speed governor over-speed switch:** 2.18.4.2.5(a) (to permit the use of the speed reducing system proposed by the Applicants, where the speed reducing switch resides in the controller algorithms, rather than on the governor, with the necessary speed input supplied by the main encoder signal from the motor);
- **Governor rope diameter:** 2.18.5.1 (to allow the use of reduced diameter governor rope);
- **Pitch diameter:** 2.18.7.4 (to permit the use of the speed-reducing system proposed by the Applicant, where the rope sheave pitch diameter is not less than 180 mm [7.1 in.]);
- **Suspension means:** 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4 and 2.20.9.5.4—the variances from these “suspension means” provisions to permit the use of Otis Gen2 flat coated steel suspension belts in lieu of conventional steel suspension ropes;
- **Inspection transfer switch:** 2.26.1.4.4(a) (to allow the inspection transfer switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room); and
- **Seismic reset switch:** 8.4.10.1.1(a)(2)(b) (to allow the seismic reset switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room).
- **Minimum Inside Car Platform Dimensions:** 3041(e)(1)(C) and 3141.7(b) (to comply with the performance-based requirements of the 2019 California Building Code section 3002.4.1a)

These variances apply to the locations and numbers of elevators stated in the section A table (so long as the elevators are Gen3 Edge/Gen2S Group and Gen3 Core & Medical Emergency Elevator Car Dimensions (Group IV) that are designed, equipped, and installed in accordance with, and are otherwise consistent with, and are subject to the following conditions:

1. The suspension system shall comply with the following:
 - a. The coated steel belt and connections shall have factors of safety equal to those permitted for use by section 3141 [ASME A17.1-2004, section 2.20.3] on wire rope suspended elevators.
 - b. Steel coated belts that have been installed and used on another installation shall not be reused.
 - c. The coated steel belt shall be fitted with a monitoring device which has been accepted by Cal/OSHA and which will automatically stop the car if the residual strength of any single belt drops below 60 percent. If the residual strength of any single belt drops below 60 percent, the device shall prevent the elevator from restarting after a normal stop at a landing.
 - d. Upon initial inspection, the readings from the monitoring device shall be documented and submitted to Cal/OSHA.
 - e. A successful test of the monitoring device’s functionality shall be conducted at least once a year (the record of the annual test of the monitoring device shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - f. The coated steel belts used shall be accepted by Cal/OSHA.

2. With respect to each elevator subject to this variance, the applicant shall comply with Cal/OSHA Circular Letter E-10-04, the substance of which is attached hereto as Addendum 1 and incorporated herein by this reference.
3. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection, and testing of the belts and monitoring device and criteria for belt replacement, and the applicant shall make those procedures and criteria available to Cal/OSHA upon request.
4. The flat coated steel belts shall be provided with a metal data tag that is securely attached to one of those belts. This data tag shall bear the following flat steel coated belt data:
 - a. The width and thickness in millimeters or inches;
 - b. The manufacturer's rated breaking strength in (kN) or (lbf);
 - c. The name of the person or organization that installed the flat coated steel belts;
 - d. The month and year the flat coated steel belts were installed;
 - e. The month and year the flat coated steel belts were first shortened;
 - f. The name or trademark of the manufacturer of the flat coated steel belts; and
 - g. Lubrication information.
5. There shall be a crosshead data plate of the sort required by section 2.20.2.1, and that plate shall bear the following flat steel coated belt data:
 - a. The number of belts;
 - b. The belt width and thickness in millimeters or inches; and
 - c. The manufacturer's rated breaking strength per belt in (kN) or (lbf).
6. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of elevator equipment in the hoistway is required. If service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
7. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on railings to perform adjustment, maintenance, repairs or inspections. The applicant shall not permit anyone to stand on or climb over the car top railing.
 - b. The distance that the car top railing may be inset shall be limited to no more than 6 inches.
 - c. All exposed areas outside the car top railing shall preclude standing or placing objects or persons which may fall and shall be beveled from the mid- or top rail to the outside of the car top.
 - d. The top of the beveled area and/or car top outside the railing, shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
 - e. The applicant shall provide durable signs with lettering not less than ½ inch on a

contrasting background on each inset railing; each sign shall state:

**CAUTION
DO NOT STAND ON OR CLIMB OVER RAILING**

- f. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing shall be measured from the car top and not from the required bevel).
- 8. If the seismic reset switch does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
- 9. If the inspection transfer switch required by ASME A17.1, rule 2.26.1.4.4(a) does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
- 10. When the inspection and testing panel is located in the hoistway door jamb, the inspection and test control panel shall be openable only by use of a Security Group I restricted key.
- 11. The governor speed-reducing switch function shall comply with the following:
 - a. It shall be used only with direct drive machines; i.e., no gear reduction is permitted between the drive motor and the suspension means.
 - b. The velocity encoder shall be coupled to the driving machine motor shaft. The “C” channel of the encoder shall be utilized for velocity measurements required by the speed reducing system. The signal from “C” channel of the encoder shall be verified with the “A” and “B” channels for failure. If a failure is detected then an emergency stop shall be initiated.
 - c. Control system parameters utilized in the speed-reducing system shall be held in non-volatile memory.
 - d. It shall be used in conjunction with approved car-mounted speed governors only.
 - e. It shall be used in conjunction with an effective traction monitoring system that detects a loss of traction between the driving sheave and the suspension means. If a loss of traction is detected, then an emergency stop shall be initiated.
 - f. A successful test of the speed-reducing switch system’s functionality shall be conducted at least once a year (the record of the annual test of the speed-reducing switch system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - g. A successful test of the traction monitoring system’s functionality shall be conducted at least once a year (the record of the annual test of the traction monitoring system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - h. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the maintenance, inspection, and testing of the speed-reducing switch and traction monitoring systems. The Applicant shall make the procedures available to Cal/OSHA upon

request.

12. The speed governor rope and sheaves shall comply with the following:

- a. The governor shall be used in conjunction with a 6 mm (0.25 in.) diameter steel governor rope with 6-strand, regular lay construction.
- b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
- c. The governor sheaves shall have a pitch diameter of not less than 180 mm (7.1 in.).

13. All medical emergency service elevators shall comply with the following:

- a. The requirements of the 2019 California Building Code (CBC), section 3002.4.1a;

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5inch (127 mm) radius corners] in the horizontal, open position.

- b. All medical emergency service elevators shall be identified in the building construction documents in accordance with the 2019 CBC, section 3002.4a.
- c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).

14. The elevator shall be serviced, maintained, adjusted, tested, and inspected only by Certified Competent Conveyance Mechanics who have been trained to, and are competent to, perform those tasks on the Gen3 Edge/Gen2S/Gen3 Core elevator system in accordance with the written procedures and criteria required by Condition No. 3 and in accordance with the terms of this permanent variance.
15. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing, or testing of the elevators shall be provided a copy of this variance decision.
16. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and a Permit to Operate shall be issued before the elevator is placed in service.
17. The Applicant shall be subject to the Suspension Means – Replacement Reporting Condition stated in Addendum 2, as hereby incorporated by this reference.
18. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications.
19. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in

accordance with the Board's procedural regulations at section 426, subdivision (b).

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 28, 2026



Kelly Chau, Hearing Officer

ADDENDUM 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and, Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA-Elevator Unit HQS

ADDENDUM 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Otis Gen2S/Gen3Edge/Gen3 Core Elevator & Medical Emergency Car Dimensions

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-284	Century WLAVA 4 LP	11460 Gorham Ave. Los Angeles, CA	2

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Dan Leacox, with Leacox & Associates, and Wolter Geesink with Otis Elevator Company appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each Applicant intends to utilize Otis Gen3 Edge/Gen2S/Gen3 Core elevators at the locations and in the numbers stated in the above section A.1 table. Applicant may utilize the variance from minimum inside car platform dimensions for other elevators designated for emergency medical service at the same variance location.
2. The installation contracts for these elevators were or will be signed on or after May 1, 2008, making the elevators subject to the Group IV Elevator Safety Orders.
3. The Board incorporates by reference the relevant findings in previous Board decisions:
 - a. Items D.3 through D.9 of the Proposed Decision adopted by the Board on July 18, 2013 for Permanent Variance No. 12-V-093;
 - b. Item D.4 of the Proposed Decision adopted by the Board on September 25, 2014 for Permanent Variance No. 14-V-206;
 - c. Item B of the Proposed Decision adopted by the Board on September 15, 2022 for Permanent Variance No. 22-V-302 regarding medical emergency car dimensions; and
 - d. Items C and D of the Proposed Decision adopted by the Board on June 20, 2024 for Permanent Variance No. 24-V-193 regarding the Gen3 Core elevator equivalent safety.
4. Cal/OSHA, by way of written submissions to the record (Exhibit PD-3), and position stated at hearing, is of the well informed opinion that grant of requested permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment, and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the Elevator Safety Order requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A table shall have permanent variances from the following sections of ASME A17.1-2004 that section 3141 makes applicable to the elevators the subject of those applications:

- **Car top railing:** sections 2.14.1.7.1 (to permit an inset car top railing, if, in fact, the car top railing is inset);
- **Speed governor over-speed switch:** 2.18.4.2.5(a) (to permit the use of the speed reducing system proposed by the Applicants, where the speed reducing switch resides in the controller algorithms, rather than on the governor, with the necessary speed input supplied by the main encoder signal from the motor);
- **Governor rope diameter:** 2.18.5.1 (to allow the use of reduced diameter governor rope);
- **Pitch diameter:** 2.18.7.4 (to permit the use of the speed-reducing system proposed by the Applicant, where the rope sheave pitch diameter is not less than 180 mm [7.1 in.]);
- **Suspension means:** 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4 and 2.20.9.5.4—the variances from these “suspension means” provisions to permit the use of Otis Gen2 flat coated steel suspension belts in lieu of conventional steel suspension ropes;
- **Inspection transfer switch:** 2.26.1.4.4(a) (to allow the inspection transfer switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room); and
- **Seismic reset switch:** 8.4.10.1.1(a)(2)(b) (to allow the seismic reset switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room).
- **Minimum Inside Car Platform Dimensions:** 3041(e)(1)(C) and 3141.7(b) (to comply with the performance-based requirements of the 2019 California Building Code section 3002.4.1a)

These variances apply to the locations and numbers of elevators stated in the section A table (so long as the elevators are Gen3 Edge/Gen2S Group and Gen3 Core & Medical Emergency Elevator Car Dimensions (Group IV) that are designed, equipped, and installed in accordance with, and are otherwise consistent with, and are subject to the following conditions:

1. The suspension system shall comply with the following:
 - a. The coated steel belt and connections shall have factors of safety equal to those permitted for use by section 3141 [ASME A17.1-2004, section 2.20.3] on wire rope suspended elevators.
 - b. Steel coated belts that have been installed and used on another installation shall not be reused.
 - c. The coated steel belt shall be fitted with a monitoring device which has been accepted by Cal/OSHA and which will automatically stop the car if the residual strength of any single belt drops below 60 percent. If the residual strength of any single belt drops below 60 percent, the device shall prevent the elevator from restarting after a normal stop at a landing.
 - d. Upon initial inspection, the readings from the monitoring device shall be documented and submitted to Cal/OSHA.
 - e. A successful test of the monitoring device’s functionality shall be conducted at least once a year (the record of the annual test of the monitoring device shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - f. The coated steel belts used shall be accepted by Cal/OSHA.

2. With respect to each elevator subject to this variance, the applicant shall comply with Cal/OSHA Circular Letter E-10-04, the substance of which is attached hereto as Addendum 1 and incorporated herein by this reference.
3. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection, and testing of the belts and monitoring device and criteria for belt replacement, and the applicant shall make those procedures and criteria available to Cal/OSHA upon request.
4. The flat coated steel belts shall be provided with a metal data tag that is securely attached to one of those belts. This data tag shall bear the following flat steel coated belt data:
 - a. The width and thickness in millimeters or inches;
 - b. The manufacturer's rated breaking strength in (kN) or (lbf);
 - c. The name of the person or organization that installed the flat coated steel belts;
 - d. The month and year the flat coated steel belts were installed;
 - e. The month and year the flat coated steel belts were first shortened;
 - f. The name or trademark of the manufacturer of the flat coated steel belts; and
 - g. Lubrication information.
5. There shall be a crosshead data plate of the sort required by section 2.20.2.1, and that plate shall bear the following flat steel coated belt data:
 - a. The number of belts;
 - b. The belt width and thickness in millimeters or inches; and
 - c. The manufacturer's rated breaking strength per belt in (kN) or (lbf).
6. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of elevator equipment in the hoistway is required. If service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
7. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on railings to perform adjustment, maintenance, repairs or inspections. The applicant shall not permit anyone to stand on or climb over the car top railing.
 - b. The distance that the car top railing may be inset shall be limited to no more than 6 inches.
 - c. All exposed areas outside the car top railing shall preclude standing or placing objects or persons which may fall and shall be beveled from the mid- or top rail to the outside of the car top.
 - d. The top of the beveled area and/or car top outside the railing, shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
 - e. The applicant shall provide durable signs with lettering not less than ½ inch on a

contrasting background on each inset railing; each sign shall state:

**CAUTION
DO NOT STAND ON OR CLIMB OVER RAILING**

- f. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing shall be measured from the car top and not from the required bevel).
- 8. If the seismic reset switch does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
- 9. If the inspection transfer switch required by ASME A17.1, rule 2.26.1.4.4(a) does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
- 10. When the inspection and testing panel is located in the hoistway door jamb, the inspection and test control panel shall be openable only by use of a Security Group I restricted key.
- 11. The governor speed-reducing switch function shall comply with the following:
 - a. It shall be used only with direct drive machines; i.e., no gear reduction is permitted between the drive motor and the suspension means.
 - b. The velocity encoder shall be coupled to the driving machine motor shaft. The “C” channel of the encoder shall be utilized for velocity measurements required by the speed reducing system. The signal from “C” channel of the encoder shall be verified with the “A” and “B” channels for failure. If a failure is detected then an emergency stop shall be initiated.
 - c. Control system parameters utilized in the speed-reducing system shall be held in non-volatile memory.
 - d. It shall be used in conjunction with approved car-mounted speed governors only.
 - e. It shall be used in conjunction with an effective traction monitoring system that detects a loss of traction between the driving sheave and the suspension means. If a loss of traction is detected, then an emergency stop shall be initiated.
 - f. A successful test of the speed-reducing switch system’s functionality shall be conducted at least once a year (the record of the annual test of the speed-reducing switch system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - g. A successful test of the traction monitoring system’s functionality shall be conducted at least once a year (the record of the annual test of the traction monitoring system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - h. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the maintenance, inspection, and testing of the speed-reducing switch and traction monitoring systems. The Applicant shall make the procedures available to Cal/OSHA upon

request.

12. The speed governor rope and sheaves shall comply with the following:

- a. The governor shall be used in conjunction with a 6 mm (0.25 in.) diameter steel governor rope with 6-strand, regular lay construction.
- b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
- c. The governor sheaves shall have a pitch diameter of not less than 180 mm (7.1 in.).

13. All medical emergency service elevators shall comply with the following:

- a. The requirements of the 2019 California Building Code (CBC), section 3002.4.1a;

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5inch (127 mm) radius corners] in the horizontal, open position.

- b. All medical emergency service elevators shall be identified in the building construction documents in accordance with the 2019 CBC, section 3002.4a.
- c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).

- 14. The elevator shall be serviced, maintained, adjusted, tested, and inspected only by Certified Competent Conveyance Mechanics who have been trained to, and are competent to, perform those tasks on the Gen3 Edge/Gen2S/Gen3 Core elevator system in accordance with the written procedures and criteria required by Condition No. 3 and in accordance with the terms of this permanent variance.
- 15. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing, or testing of the elevators shall be provided a copy of this variance decision.
- 16. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and a Permit to Operate shall be issued before the elevator is placed in service.
- 17. The Applicant shall be subject to the Suspension Means – Replacement Reporting Condition stated in Addendum 2, as hereby incorporated by this reference.
- 18. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications.
- 19. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in

accordance with the Board's procedural regulations at section 426, subdivision (b).

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 29, 2026



Kelly Chau, Hearing Officer

ADDENDUM 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and, Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA-Elevator Unit HQS

ADDENDUM 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Otis Gen2S/Gen3Edge/Gen3 Core Elevator & Medical Emergency Car Dimensions

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-285	Grace Villas LP	216 S. Ave 24 Los Angeles, CA	1

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Dan Leacox, with Leacox & Associates, and Wolter Geesink with Otis Elevator Company appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each Applicant intends to utilize Otis Gen3 Edge/Gen2S/Gen3 Core elevators at the locations and in the numbers stated in the above section A.1 table. Applicant may utilize the variance from minimum inside car platform dimensions for other elevators designated for emergency medical service at the same variance location.
2. The installation contracts for these elevators were or will be signed on or after May 1, 2008, making the elevators subject to the Group IV Elevator Safety Orders.
3. The Board incorporates by reference the relevant findings in previous Board decisions:
 - a. Items D.3 through D.9 of the Proposed Decision adopted by the Board on July 18, 2013 for Permanent Variance No. 12-V-093;
 - b. Item D.4 of the Proposed Decision adopted by the Board on September 25, 2014 for Permanent Variance No. 14-V-206;
 - c. Item B of the Proposed Decision adopted by the Board on September 15, 2022 for Permanent Variance No. 22-V-302 regarding medical emergency car dimensions; and
 - d. Items C and D of the Proposed Decision adopted by the Board on June 20, 2024 for Permanent Variance No. 24-V-193 regarding the Gen3 Core elevator equivalent safety.
4. Cal/OSHA, by way of written submissions to the record (Exhibit PD-3), and position stated at hearing, is of the well informed opinion that grant of requested permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment, and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the Elevator Safety Order requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A table shall have permanent variances from the following sections of ASME A17.1-2004 that section 3141 makes applicable to the elevators the subject of those applications:

- **Car top railing:** sections 2.14.1.7.1 (to permit an inset car top railing, if, in fact, the car top railing is inset);
- **Speed governor over-speed switch:** 2.18.4.2.5(a) (to permit the use of the speed reducing system proposed by the Applicants, where the speed reducing switch resides in the controller algorithms, rather than on the governor, with the necessary speed input supplied by the main encoder signal from the motor);
- **Governor rope diameter:** 2.18.5.1 (to allow the use of reduced diameter governor rope);
- **Pitch diameter:** 2.18.7.4 (to permit the use of the speed-reducing system proposed by the Applicant, where the rope sheave pitch diameter is not less than 180 mm [7.1 in.]);
- **Suspension means:** 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4 and 2.20.9.5.4—the variances from these “suspension means” provisions to permit the use of Otis Gen2 flat coated steel suspension belts in lieu of conventional steel suspension ropes;
- **Inspection transfer switch:** 2.26.1.4.4(a) (to allow the inspection transfer switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room); and
- **Seismic reset switch:** 8.4.10.1.1(a)(2)(b) (to allow the seismic reset switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room).
- **Minimum Inside Car Platform Dimensions:** 3041(e)(1)(C) and 3141.7(b) (to comply with the performance-based requirements of the 2019 California Building Code section 3002.4.1a)

These variances apply to the locations and numbers of elevators stated in the section A table (so long as the elevators are Gen3 Edge/Gen2S Group and Gen3 Core & Medical Emergency Elevator Car Dimensions (Group IV) that are designed, equipped, and installed in accordance with, and are otherwise consistent with, and are subject to the following conditions:

1. The suspension system shall comply with the following:
 - a. The coated steel belt and connections shall have factors of safety equal to those permitted for use by section 3141 [ASME A17.1-2004, section 2.20.3] on wire rope suspended elevators.
 - b. Steel coated belts that have been installed and used on another installation shall not be reused.
 - c. The coated steel belt shall be fitted with a monitoring device which has been accepted by Cal/OSHA and which will automatically stop the car if the residual strength of any single belt drops below 60 percent. If the residual strength of any single belt drops below 60 percent, the device shall prevent the elevator from restarting after a normal stop at a landing.
 - d. Upon initial inspection, the readings from the monitoring device shall be documented and submitted to Cal/OSHA.
 - e. A successful test of the monitoring device’s functionality shall be conducted at least once a year (the record of the annual test of the monitoring device shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - f. The coated steel belts used shall be accepted by Cal/OSHA.

2. With respect to each elevator subject to this variance, the applicant shall comply with Cal/OSHA Circular Letter E-10-04, the substance of which is attached hereto as Addendum 1 and incorporated herein by this reference.
3. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection, and testing of the belts and monitoring device and criteria for belt replacement, and the applicant shall make those procedures and criteria available to Cal/OSHA upon request.
4. The flat coated steel belts shall be provided with a metal data tag that is securely attached to one of those belts. This data tag shall bear the following flat steel coated belt data:
 - a. The width and thickness in millimeters or inches;
 - b. The manufacturer's rated breaking strength in (kN) or (lbf);
 - c. The name of the person or organization that installed the flat coated steel belts;
 - d. The month and year the flat coated steel belts were installed;
 - e. The month and year the flat coated steel belts were first shortened;
 - f. The name or trademark of the manufacturer of the flat coated steel belts; and
 - g. Lubrication information.
5. There shall be a crosshead data plate of the sort required by section 2.20.2.1, and that plate shall bear the following flat steel coated belt data:
 - a. The number of belts;
 - b. The belt width and thickness in millimeters or inches; and
 - c. The manufacturer's rated breaking strength per belt in (kN) or (lbf).
6. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of elevator equipment in the hoistway is required. If service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
7. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on railings to perform adjustment, maintenance, repairs or inspections. The applicant shall not permit anyone to stand on or climb over the car top railing.
 - b. The distance that the car top railing may be inset shall be limited to no more than 6 inches.
 - c. All exposed areas outside the car top railing shall preclude standing or placing objects or persons which may fall and shall be beveled from the mid- or top rail to the outside of the car top.
 - d. The top of the beveled area and/or car top outside the railing, shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
 - e. The applicant shall provide durable signs with lettering not less than ½ inch on a

contrasting background on each inset railing; each sign shall state:

**CAUTION
DO NOT STAND ON OR CLIMB OVER RAILING**

- f. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing shall be measured from the car top and not from the required bevel).
- 8. If the seismic reset switch does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
- 9. If the inspection transfer switch required by ASME A17.1, rule 2.26.1.4.4(a) does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
- 10. When the inspection and testing panel is located in the hoistway door jamb, the inspection and test control panel shall be openable only by use of a Security Group I restricted key.
- 11. The governor speed-reducing switch function shall comply with the following:
 - a. It shall be used only with direct drive machines; i.e., no gear reduction is permitted between the drive motor and the suspension means.
 - b. The velocity encoder shall be coupled to the driving machine motor shaft. The “C” channel of the encoder shall be utilized for velocity measurements required by the speed reducing system. The signal from “C” channel of the encoder shall be verified with the “A” and “B” channels for failure. If a failure is detected then an emergency stop shall be initiated.
 - c. Control system parameters utilized in the speed-reducing system shall be held in non-volatile memory.
 - d. It shall be used in conjunction with approved car-mounted speed governors only.
 - e. It shall be used in conjunction with an effective traction monitoring system that detects a loss of traction between the driving sheave and the suspension means. If a loss of traction is detected, then an emergency stop shall be initiated.
 - f. A successful test of the speed-reducing switch system’s functionality shall be conducted at least once a year (the record of the annual test of the speed-reducing switch system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - g. A successful test of the traction monitoring system’s functionality shall be conducted at least once a year (the record of the annual test of the traction monitoring system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - h. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the maintenance, inspection, and testing of the speed-reducing switch and traction monitoring systems. The Applicant shall make the procedures available to Cal/OSHA upon

request.

12. The speed governor rope and sheaves shall comply with the following:

- a. The governor shall be used in conjunction with a 6 mm (0.25 in.) diameter steel governor rope with 6-strand, regular lay construction.
- b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
- c. The governor sheaves shall have a pitch diameter of not less than 180 mm (7.1 in.).

13. All medical emergency service elevators shall comply with the following:

- a. The requirements of the 2019 California Building Code (CBC), section 3002.4.1a;

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5inch (127 mm) radius corners] in the horizontal, open position.

- b. All medical emergency service elevators shall be identified in the building construction documents in accordance with the 2019 CBC, section 3002.4a.
- c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).

- 14. The elevator shall be serviced, maintained, adjusted, tested, and inspected only by Certified Competent Conveyance Mechanics who have been trained to, and are competent to, perform those tasks on the Gen3 Edge/Gen2S/Gen3 Core elevator system in accordance with the written procedures and criteria required by Condition No. 3 and in accordance with the terms of this permanent variance.
- 15. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing, or testing of the elevators shall be provided a copy of this variance decision.
- 16. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and a Permit to Operate shall be issued before the elevator is placed in service.
- 17. The Applicant shall be subject to the Suspension Means – Replacement Reporting Condition stated in Addendum 2, as hereby incorporated by this reference.
- 18. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications.
- 19. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in

accordance with the Board's procedural regulations at section 426, subdivision (b).

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 29, 2026



Kelly Chau, Hearing Officer

ADDENDUM 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and, Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA-Elevator Unit HQS

ADDENDUM 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Otis Gen2S/Gen3Edge/Gen3 Core Elevator & Medical Emergency Car Dimensions

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-286	La Trinidad Senior Apartments, L.P.	3565 E. 1st St. Los Angeles, CA	1

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Dan Leacox, with Leacox & Associates, and Wolter Geesink with Otis Elevator Company appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each Applicant intends to utilize Otis Gen3 Edge/Gen2S/Gen3 Core elevators at the locations and in the numbers stated in the above section A.1 table. Applicant may utilize the variance from minimum inside car platform dimensions for other elevators designated for emergency medical service at the same variance location.
2. The installation contracts for these elevators were or will be signed on or after May 1, 2008, making the elevators subject to the Group IV Elevator Safety Orders.
3. The Board incorporates by reference the relevant findings in previous Board decisions:
 - a. Items D.3 through D.9 of the Proposed Decision adopted by the Board on July 18, 2013 for Permanent Variance No. 12-V-093;
 - b. Item D.4 of the Proposed Decision adopted by the Board on September 25, 2014 for Permanent Variance No. 14-V-206;
 - c. Item B of the Proposed Decision adopted by the Board on September 15, 2022 for Permanent Variance No. 22-V-302 regarding medical emergency car dimensions; and
 - d. Items C and D of the Proposed Decision adopted by the Board on June 20, 2024 for Permanent Variance No. 24-V-193 regarding the Gen3 Core elevator equivalent safety.
4. Cal/OSHA, by way of written submissions to the record (Exhibit PD-3), and position stated at hearing, is of the well informed opinion that grant of requested permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment, and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the Elevator Safety Order requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A table shall have permanent variances from the following sections of ASME A17.1-2004 that section 3141 makes applicable to the elevators the subject of those applications:

- **Car top railing:** sections 2.14.1.7.1 (to permit an inset car top railing, if, in fact, the car top railing is inset);
- **Speed governor over-speed switch:** 2.18.4.2.5(a) (to permit the use of the speed reducing system proposed by the Applicants, where the speed reducing switch resides in the controller algorithms, rather than on the governor, with the necessary speed input supplied by the main encoder signal from the motor);
- **Governor rope diameter:** 2.18.5.1 (to allow the use of reduced diameter governor rope);
- **Pitch diameter:** 2.18.7.4 (to permit the use of the speed-reducing system proposed by the Applicant, where the rope sheave pitch diameter is not less than 180 mm [7.1 in.]);
- **Suspension means:** 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4 and 2.20.9.5.4—the variances from these “suspension means” provisions to permit the use of Otis Gen2 flat coated steel suspension belts in lieu of conventional steel suspension ropes;
- **Inspection transfer switch:** 2.26.1.4.4(a) (to allow the inspection transfer switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room); and
- **Seismic reset switch:** 8.4.10.1.1(a)(2)(b) (to allow the seismic reset switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room).
- **Minimum Inside Car Platform Dimensions:** 3041(e)(1)(C) and 3141.7(b) (to comply with the performance-based requirements of the 2019 California Building Code section 3002.4.1a)

These variances apply to the locations and numbers of elevators stated in the section A table (so long as the elevators are Gen3 Edge/Gen2S Group and Gen3 Core & Medical Emergency Elevator Car Dimensions (Group IV) that are designed, equipped, and installed in accordance with, and are otherwise consistent with, and are subject to the following conditions:

1. The suspension system shall comply with the following:
 - a. The coated steel belt and connections shall have factors of safety equal to those permitted for use by section 3141 [ASME A17.1-2004, section 2.20.3] on wire rope suspended elevators.
 - b. Steel coated belts that have been installed and used on another installation shall not be reused.
 - c. The coated steel belt shall be fitted with a monitoring device which has been accepted by Cal/OSHA and which will automatically stop the car if the residual strength of any single belt drops below 60 percent. If the residual strength of any single belt drops below 60 percent, the device shall prevent the elevator from restarting after a normal stop at a landing.
 - d. Upon initial inspection, the readings from the monitoring device shall be documented and submitted to Cal/OSHA.
 - e. A successful test of the monitoring device’s functionality shall be conducted at least once a year (the record of the annual test of the monitoring device shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - f. The coated steel belts used shall be accepted by Cal/OSHA.

2. With respect to each elevator subject to this variance, the applicant shall comply with Cal/OSHA Circular Letter E-10-04, the substance of which is attached hereto as Addendum 1 and incorporated herein by this reference.
3. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection, and testing of the belts and monitoring device and criteria for belt replacement, and the applicant shall make those procedures and criteria available to Cal/OSHA upon request.
4. The flat coated steel belts shall be provided with a metal data tag that is securely attached to one of those belts. This data tag shall bear the following flat steel coated belt data:
 - a. The width and thickness in millimeters or inches;
 - b. The manufacturer's rated breaking strength in (kN) or (lbf);
 - c. The name of the person or organization that installed the flat coated steel belts;
 - d. The month and year the flat coated steel belts were installed;
 - e. The month and year the flat coated steel belts were first shortened;
 - f. The name or trademark of the manufacturer of the flat coated steel belts; and
 - g. Lubrication information.
5. There shall be a crosshead data plate of the sort required by section 2.20.2.1, and that plate shall bear the following flat steel coated belt data:
 - a. The number of belts;
 - b. The belt width and thickness in millimeters or inches; and
 - c. The manufacturer's rated breaking strength per belt in (kN) or (lbf).
6. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of elevator equipment in the hoistway is required. If service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
7. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on railings to perform adjustment, maintenance, repairs or inspections. The applicant shall not permit anyone to stand on or climb over the car top railing.
 - b. The distance that the car top railing may be inset shall be limited to no more than 6 inches.
 - c. All exposed areas outside the car top railing shall preclude standing or placing objects or persons which may fall and shall be beveled from the mid- or top rail to the outside of the car top.
 - d. The top of the beveled area and/or car top outside the railing, shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
 - e. The applicant shall provide durable signs with lettering not less than ½ inch on a

contrasting background on each inset railing; each sign shall state:

**CAUTION
DO NOT STAND ON OR CLIMB OVER RAILING**

- f. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing shall be measured from the car top and not from the required bevel).
- 8. If the seismic reset switch does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
- 9. If the inspection transfer switch required by ASME A17.1, rule 2.26.1.4.4(a) does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
- 10. When the inspection and testing panel is located in the hoistway door jamb, the inspection and test control panel shall be openable only by use of a Security Group I restricted key.
- 11. The governor speed-reducing switch function shall comply with the following:
 - a. It shall be used only with direct drive machines; i.e., no gear reduction is permitted between the drive motor and the suspension means.
 - b. The velocity encoder shall be coupled to the driving machine motor shaft. The “C” channel of the encoder shall be utilized for velocity measurements required by the speed reducing system. The signal from “C” channel of the encoder shall be verified with the “A” and “B” channels for failure. If a failure is detected then an emergency stop shall be initiated.
 - c. Control system parameters utilized in the speed-reducing system shall be held in non-volatile memory.
 - d. It shall be used in conjunction with approved car-mounted speed governors only.
 - e. It shall be used in conjunction with an effective traction monitoring system that detects a loss of traction between the driving sheave and the suspension means. If a loss of traction is detected, then an emergency stop shall be initiated.
 - f. A successful test of the speed-reducing switch system’s functionality shall be conducted at least once a year (the record of the annual test of the speed-reducing switch system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - g. A successful test of the traction monitoring system’s functionality shall be conducted at least once a year (the record of the annual test of the traction monitoring system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - h. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the maintenance, inspection, and testing of the speed-reducing switch and traction monitoring systems. The Applicant shall make the procedures available to Cal/OSHA upon

request.

12. The speed governor rope and sheaves shall comply with the following:

- a. The governor shall be used in conjunction with a 6 mm (0.25 in.) diameter steel governor rope with 6-strand, regular lay construction.
- b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
- c. The governor sheaves shall have a pitch diameter of not less than 180 mm (7.1 in.).

13. All medical emergency service elevators shall comply with the following:

- a. The requirements of the 2019 California Building Code (CBC), section 3002.4.1a;

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5inch (127 mm) radius corners] in the horizontal, open position.

- b. All medical emergency service elevators shall be identified in the building construction documents in accordance with the 2019 CBC, section 3002.4a.
- c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).

14. The elevator shall be serviced, maintained, adjusted, tested, and inspected only by Certified Competent Conveyance Mechanics who have been trained to, and are competent to, perform those tasks on the Gen3 Edge/Gen2S/Gen3 Core elevator system in accordance with the written procedures and criteria required by Condition No. 3 and in accordance with the terms of this permanent variance.
15. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing, or testing of the elevators shall be provided a copy of this variance decision.
16. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and a Permit to Operate shall be issued before the elevator is placed in service.
17. The Applicant shall be subject to the Suspension Means – Replacement Reporting Condition stated in Addendum 2, as hereby incorporated by this reference.
18. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications.
19. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in

accordance with the Board's procedural regulations at section 426, subdivision (b).

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 29, 2026



Kelly Chau, Hearing Officer

ADDENDUM 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and, Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA-Elevator Unit HQS

ADDENDUM 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Otis Gen2S/Gen3Edge/Gen3 Core Elevator & Medical Emergency Car Dimensions

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-287	La Jolla Cove Motel & Hotel Apartments, LLC	The Shores Building 1155 Coast Blvd. La Jolla, CA	2

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Dan Leacox, with Leacox & Associates, and Wolter Geesink with Otis Elevator Company appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table

PD2	OSHSB Notice of Hearing
PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each Applicant intends to utilize Otis Gen3 Edge/Gen2S/Gen3 Core elevators at the locations and in the numbers stated in the above section A.1 table. Applicant may utilize the variance from minimum inside car platform dimensions for other elevators designated for emergency medical service at the same variance location.
2. The installation contracts for these elevators were or will be signed on or after May 1, 2008, making the elevators subject to the Group IV Elevator Safety Orders.
3. The Board incorporates by reference the relevant findings in previous Board decisions:
 - a. Items D.3 through D.9 of the Proposed Decision adopted by the Board on July 18, 2013 for Permanent Variance No. 12-V-093;
 - b. Item D.4 of the Proposed Decision adopted by the Board on September 25, 2014 for Permanent Variance No. 14-V-206;
 - c. Item B of the Proposed Decision adopted by the Board on September 15, 2022 for Permanent Variance No. 22-V-302 regarding medical emergency car dimensions; and
 - d. Items C and D of the Proposed Decision adopted by the Board on June 20, 2024 for Permanent Variance No. 24-V-193 regarding the Gen3 Core elevator equivalent safety.
4. Cal/OSHA, by way of written submissions to the record (Exhibit PD-3), and position stated at hearing, is of the well informed opinion that grant of requested permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment, and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the Elevator Safety Order requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A table shall have permanent variances from the following sections of ASME A17.1-2004 that section 3141 makes applicable to the elevators the

subject of those applications:

- **Car top railing:** sections 2.14.1.7.1 (to permit an inset car top railing, if, in fact, the car top railing is inset);
- **Speed governor over-speed switch:** 2.18.4.2.5(a) (to permit the use of the speed reducing system proposed by the Applicants, where the speed reducing switch resides in the controller algorithms, rather than on the governor, with the necessary speed input supplied by the main encoder signal from the motor);
- **Governor rope diameter:** 2.18.5.1 (to allow the use of reduced diameter governor rope);
- **Pitch diameter:** 2.18.7.4 (to permit the use of the speed-reducing system proposed by the Applicant, where the rope sheave pitch diameter is not less than 180 mm [7.1 in.]);
- **Suspension means:** 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4 and 2.20.9.5.4—the variances from these “suspension means” provisions to permit the use of Otis Gen2 flat coated steel suspension belts in lieu of conventional steel suspension ropes;
- **Inspection transfer switch:** 2.26.1.4.4(a) (to allow the inspection transfer switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room); and
- **Seismic reset switch:** 8.4.10.1.1(a)(2)(b) (to allow the seismic reset switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room).
- **Minimum Inside Car Platform Dimensions:** 3041(e)(1)(C) and 3141.7(b) (to comply with the performance-based requirements of the 2019 California Building Code section 3002.4.1a)

These variances apply to the locations and numbers of elevators stated in the section A table (so long as the elevators are Gen3 Edge/Gen2S Group and Gen3 Core & Medical Emergency Elevator Car Dimensions (Group IV) that are designed, equipped, and installed in accordance with, and are otherwise consistent with, and are subject to the following conditions:

1. The suspension system shall comply with the following:
 - a. The coated steel belt and connections shall have factors of safety equal to those permitted for use by section 3141 [ASME A17.1-2004, section 2.20.3] on wire rope suspended elevators.
 - b. Steel coated belts that have been installed and used on another installation shall not be reused.
 - c. The coated steel belt shall be fitted with a monitoring device which has been accepted by Cal/OSHA and which will automatically stop the car if the residual strength of any single belt drops below 60 percent. If the residual strength of any single belt drops below 60 percent, the device shall prevent the elevator from restarting after a normal stop at a landing.
 - d. Upon initial inspection, the readings from the monitoring device shall be documented and submitted to Cal/OSHA.
 - e. A successful test of the monitoring device’s functionality shall be conducted at least once a year (the record of the annual test of the monitoring device shall be a maintenance

record subject to ASME A17.1-2004, section 8.6.1.4).

- f. The coated steel belts used shall be accepted by Cal/OSHA.
2. With respect to each elevator subject to this variance, the applicant shall comply with Cal/OSHA Circular Letter E-10-04, the substance of which is attached hereto as Addendum 1 and incorporated herein by this reference.
3. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection, and testing of the belts and monitoring device and criteria for belt replacement, and the applicant shall make those procedures and criteria available to Cal/OSHA upon request.
4. The flat coated steel belts shall be provided with a metal data tag that is securely attached to one of those belts. This data tag shall bear the following flat steel coated belt data:
 - a. The width and thickness in millimeters or inches;
 - b. The manufacturer's rated breaking strength in (kN) or (lbf);
 - c. The name of the person or organization that installed the flat coated steel belts;
 - d. The month and year the flat coated steel belts were installed;
 - e. The month and year the flat coated steel belts were first shortened;
 - f. The name or trademark of the manufacturer of the flat coated steel belts; and
 - g. Lubrication information.
5. There shall be a crosshead data plate of the sort required by section 2.20.2.1, and that plate shall bear the following flat steel coated belt data:
 - a. The number of belts;
 - b. The belt width and thickness in millimeters or inches; and
 - c. The manufacturer's rated breaking strength per belt in (kN) or (lbf).
6. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of elevator equipment in the hoistway is required. If service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
7. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on railings to perform adjustment, maintenance, repairs or inspections. The applicant shall not permit anyone to stand on or climb over the car top railing.
 - b. The distance that the car top railing may be inset shall be limited to no more than 6 inches.
 - c. All exposed areas outside the car top railing shall preclude standing or placing objects or persons which may fall and shall be beveled from the mid- or top rail to the outside of the car top.

- d. The top of the beveled area and/or car top outside the railing, shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
- e. The applicant shall provide durable signs with lettering not less than ½ inch on a contrasting background on each inset railing; each sign shall state:

CAUTION
DO NOT STAND ON OR CLIMB OVER RAILING

- f. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing shall be measured from the car top and not from the required bevel).
-
- 8. If the seismic reset switch does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
 - 9. If the inspection transfer switch required by ASME A17.1, rule 2.26.1.4.4(a) does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
 - 10. When the inspection and testing panel is located in the hoistway door jamb, the inspection and test control panel shall be openable only by use of a Security Group I restricted key.
 - 11. The governor speed-reducing switch function shall comply with the following:
 - a. It shall be used only with direct drive machines; i.e., no gear reduction is permitted between the drive motor and the suspension means.
 - b. The velocity encoder shall be coupled to the driving machine motor shaft. The “C” channel of the encoder shall be utilized for velocity measurements required by the speed reducing system. The signal from “C” channel of the encoder shall be verified with the “A” and “B” channels for failure. If a failure is detected then an emergency stop shall be initiated.
 - c. Control system parameters utilized in the speed-reducing system shall be held in non-volatile memory.
 - d. It shall be used in conjunction with approved car-mounted speed governors only.
 - e. It shall be used in conjunction with an effective traction monitoring system that detects a loss of traction between the driving sheave and the suspension means. If a loss of traction is detected, then an emergency stop shall be initiated.
 - f. A successful test of the speed-reducing switch system’s functionality shall be conducted at least once a year (the record of the annual test of the speed-reducing switch system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - g. A successful test of the traction monitoring system’s functionality shall be conducted at least once a year (the record of the annual test of the traction monitoring system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).

h. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the maintenance, inspection, and testing of the speed-reducing switch and traction monitoring systems. The Applicant shall make the procedures available to Cal/OSHA upon request.

12. The speed governor rope and sheaves shall comply with the following:

- a. The governor shall be used in conjunction with a 6 mm (0.25 in.) diameter steel governor rope with 6-strand, regular lay construction.
- b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
- c. The governor sheaves shall have a pitch diameter of not less than 180 mm (7.1 in.).

13. All medical emergency service elevators shall comply with the following:

- a. The requirements of the 2019 California Building Code (CBC), section 3002.4.1a;

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5inch (127 mm) radius corners] in the horizontal, open position.

- b. All medical emergency service elevators shall be identified in the building construction documents in accordance with the 2019 CBC, section 3002.4a.
- c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).

14. The elevator shall be serviced, maintained, adjusted, tested, and inspected only by Certified Competent Conveyance Mechanics who have been trained to, and are competent to, perform those tasks on the Gen3 Edge/Gen2S/Gen3 Core elevator system in accordance with the written procedures and criteria required by Condition No. 3 and in accordance with the terms of this permanent variance.

15. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing, or testing of the elevators shall be provided a copy of this variance decision.

16. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and a Permit to Operate shall be issued before the elevator is placed in service.

17. The Applicant shall be subject to the Suspension Means – Replacement Reporting Condition stated in Addendum 2, as hereby incorporated by this reference.

18. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives

are to be notified of docketed permanent variance applications.

19. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in accordance with the Board's procedural regulations at section 426, subdivision (b).

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 29, 2026



Kelly Chau, Hearing Officer

ADDENDUM 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and, Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA-Elevator Unit HQS

ADDENDUM 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Otis Gen2S/Gen3Edge/Gen3 Core Elevator & Medical Emergency Car Dimensions

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-289	Mulberry Gardens Family, L.P.	2560 Mulberry St. Riverside, CA	2

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Dan Leacox, with Leacox & Associates, and Wolter Geesink with Otis Elevator Company appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each Applicant intends to utilize Otis Gen3 Edge/Gen2S/Gen3 Core elevators at the locations and in the numbers stated in the above section A.1 table. Applicant may utilize the variance from minimum inside car platform dimensions for other elevators designated for emergency medical service at the same variance location.
2. The installation contracts for these elevators were or will be signed on or after May 1, 2008, making the elevators subject to the Group IV Elevator Safety Orders.
3. The Board incorporates by reference the relevant findings in previous Board decisions:
 - a. Items D.3 through D.9 of the Proposed Decision adopted by the Board on July 18, 2013 for Permanent Variance No. 12-V-093;
 - b. Item D.4 of the Proposed Decision adopted by the Board on September 25, 2014 for Permanent Variance No. 14-V-206;
 - c. Item B of the Proposed Decision adopted by the Board on September 15, 2022 for Permanent Variance No. 22-V-302 regarding medical emergency car dimensions; and
 - d. Items C and D of the Proposed Decision adopted by the Board on June 20, 2024 for Permanent Variance No. 24-V-193 regarding the Gen3 Core elevator equivalent safety.
4. Cal/OSHA, by way of written submissions to the record (Exhibit PD-3), and position stated at hearing, is of the well informed opinion that grant of requested permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment, and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the Elevator Safety Order requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A table shall have permanent variances from the following sections of ASME A17.1-2004 that section 3141 makes applicable to the elevators the subject of those applications:

- **Car top railing:** sections 2.14.1.7.1 (to permit an inset car top railing, if, in fact, the car top railing is inset);
- **Speed governor over-speed switch:** 2.18.4.2.5(a) (to permit the use of the speed reducing system proposed by the Applicants, where the speed reducing switch resides in the controller algorithms, rather than on the governor, with the necessary speed input supplied by the main encoder signal from the motor);
- **Governor rope diameter:** 2.18.5.1 (to allow the use of reduced diameter governor rope);
- **Pitch diameter:** 2.18.7.4 (to permit the use of the speed-reducing system proposed by the Applicant, where the rope sheave pitch diameter is not less than 180 mm [7.1 in.]);
- **Suspension means:** 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4 and 2.20.9.5.4—the variances from these “suspension means” provisions to permit the use of Otis Gen2 flat coated steel suspension belts in lieu of conventional steel suspension ropes;
- **Inspection transfer switch:** 2.26.1.4.4(a) (to allow the inspection transfer switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room); and
- **Seismic reset switch:** 8.4.10.1.1(a)(2)(b) (to allow the seismic reset switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room).
- **Minimum Inside Car Platform Dimensions:** 3041(e)(1)(C) and 3141.7(b) (to comply with the performance-based requirements of the 2019 California Building Code section 3002.4.1a)

These variances apply to the locations and numbers of elevators stated in the section A table (so long as the elevators are Gen3 Edge/Gen2S Group and Gen3 Core & Medical Emergency Elevator Car Dimensions (Group IV) that are designed, equipped, and installed in accordance with, and are otherwise consistent with, and are subject to the following conditions:

1. The suspension system shall comply with the following:
 - a. The coated steel belt and connections shall have factors of safety equal to those permitted for use by section 3141 [ASME A17.1-2004, section 2.20.3] on wire rope suspended elevators.
 - b. Steel coated belts that have been installed and used on another installation shall not be reused.
 - c. The coated steel belt shall be fitted with a monitoring device which has been accepted by Cal/OSHA and which will automatically stop the car if the residual strength of any single belt drops below 60 percent. If the residual strength of any single belt drops below 60 percent, the device shall prevent the elevator from restarting after a normal stop at a landing.
 - d. Upon initial inspection, the readings from the monitoring device shall be documented and submitted to Cal/OSHA.
 - e. A successful test of the monitoring device’s functionality shall be conducted at least once a year (the record of the annual test of the monitoring device shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - f. The coated steel belts used shall be accepted by Cal/OSHA.

2. With respect to each elevator subject to this variance, the applicant shall comply with Cal/OSHA Circular Letter E-10-04, the substance of which is attached hereto as Addendum 1 and incorporated herein by this reference.
3. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection, and testing of the belts and monitoring device and criteria for belt replacement, and the applicant shall make those procedures and criteria available to Cal/OSHA upon request.
4. The flat coated steel belts shall be provided with a metal data tag that is securely attached to one of those belts. This data tag shall bear the following flat steel coated belt data:
 - a. The width and thickness in millimeters or inches;
 - b. The manufacturer's rated breaking strength in (kN) or (lbf);
 - c. The name of the person or organization that installed the flat coated steel belts;
 - d. The month and year the flat coated steel belts were installed;
 - e. The month and year the flat coated steel belts were first shortened;
 - f. The name or trademark of the manufacturer of the flat coated steel belts; and
 - g. Lubrication information.
5. There shall be a crosshead data plate of the sort required by section 2.20.2.1, and that plate shall bear the following flat steel coated belt data:
 - a. The number of belts;
 - b. The belt width and thickness in millimeters or inches; and
 - c. The manufacturer's rated breaking strength per belt in (kN) or (lbf).
6. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of elevator equipment in the hoistway is required. If service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
7. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on railings to perform adjustment, maintenance, repairs or inspections. The applicant shall not permit anyone to stand on or climb over the car top railing.
 - b. The distance that the car top railing may be inset shall be limited to no more than 6 inches.
 - c. All exposed areas outside the car top railing shall preclude standing or placing objects or persons which may fall and shall be beveled from the mid- or top rail to the outside of the car top.
 - d. The top of the beveled area and/or car top outside the railing, shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
 - e. The applicant shall provide durable signs with lettering not less than ½ inch on a

contrasting background on each inset railing; each sign shall state:

**CAUTION
DO NOT STAND ON OR CLIMB OVER RAILING**

- f. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing shall be measured from the car top and not from the required bevel).
8. If the seismic reset switch does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
9. If the inspection transfer switch required by ASME A17.1, rule 2.26.1.4.4(a) does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
10. When the inspection and testing panel is located in the hoistway door jamb, the inspection and test control panel shall be openable only by use of a Security Group I restricted key.
11. The governor speed-reducing switch function shall comply with the following:
 - a. It shall be used only with direct drive machines; i.e., no gear reduction is permitted between the drive motor and the suspension means.
 - b. The velocity encoder shall be coupled to the driving machine motor shaft. The "C" channel of the encoder shall be utilized for velocity measurements required by the speed reducing system. The signal from "C" channel of the encoder shall be verified with the "A" and "B" channels for failure. If a failure is detected then an emergency stop shall be initiated.
 - c. Control system parameters utilized in the speed-reducing system shall be held in non-volatile memory.
 - d. It shall be used in conjunction with approved car-mounted speed governors only.
 - e. It shall be used in conjunction with an effective traction monitoring system that detects a loss of traction between the driving sheave and the suspension means. If a loss of traction is detected, then an emergency stop shall be initiated.
 - f. A successful test of the speed-reducing switch system's functionality shall be conducted at least once a year (the record of the annual test of the speed-reducing switch system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - g. A successful test of the traction monitoring system's functionality shall be conducted at least once a year (the record of the annual test of the traction monitoring system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - h. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the maintenance, inspection, and testing of the speed-reducing switch and traction monitoring systems. The Applicant shall make the procedures available to Cal/OSHA upon

request.

12. The speed governor rope and sheaves shall comply with the following:

- a. The governor shall be used in conjunction with a 6 mm (0.25 in.) diameter steel governor rope with 6-strand, regular lay construction.
- b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
- c. The governor sheaves shall have a pitch diameter of not less than 180 mm (7.1 in.).

13. All medical emergency service elevators shall comply with the following:

- a. The requirements of the 2019 California Building Code (CBC), section 3002.4.1a;

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5inch (127 mm) radius corners] in the horizontal, open position.

- b. All medical emergency service elevators shall be identified in the building construction documents in accordance with the 2019 CBC, section 3002.4a.
- c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).

- 14. The elevator shall be serviced, maintained, adjusted, tested, and inspected only by Certified Competent Conveyance Mechanics who have been trained to, and are competent to, perform those tasks on the Gen3 Edge/Gen2S/Gen3 Core elevator system in accordance with the written procedures and criteria required by Condition No. 3 and in accordance with the terms of this permanent variance.
- 15. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing, or testing of the elevators shall be provided a copy of this variance decision.
- 16. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and a Permit to Operate shall be issued before the elevator is placed in service.
- 17. The Applicant shall be subject to the Suspension Means – Replacement Reporting Condition stated in Addendum 2, as hereby incorporated by this reference.
- 18. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications.
- 19. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in

accordance with the Board's procedural regulations at section 426, subdivision (b).

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 29, 2026



Kelly Chau, Hearing Officer

ADDENDUM 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and, Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA-Elevator Unit HQS

ADDENDUM 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Otis Gen2S/Gen3Edge/Gen3 Core Elevator & Medical Emergency Car Dimensions

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-290	North Fair Oaks Apartments LP	2400 San Mateo Ave. Redwood City, CA	2

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Dan Leacox, with Leacox & Associates, and Wolter Geesink with Otis Elevator Company appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each Applicant intends to utilize Otis Gen3 Edge/Gen2S/Gen3 Core elevators at the locations and in the numbers stated in the above section A.1 table. Applicant may utilize the variance from minimum inside car platform dimensions for other elevators designated for emergency medical service at the same variance location.
2. The installation contracts for these elevators were or will be signed on or after May 1, 2008, making the elevators subject to the Group IV Elevator Safety Orders.
3. The Board incorporates by reference the relevant findings in previous Board decisions:
 - a. Items D.3 through D.9 of the Proposed Decision adopted by the Board on July 18, 2013 for Permanent Variance No. 12-V-093;
 - b. Item D.4 of the Proposed Decision adopted by the Board on September 25, 2014 for Permanent Variance No. 14-V-206;
 - c. Item B of the Proposed Decision adopted by the Board on September 15, 2022 for Permanent Variance No. 22-V-302 regarding medical emergency car dimensions; and
 - d. Items C and D of the Proposed Decision adopted by the Board on June 20, 2024 for Permanent Variance No. 24-V-193 regarding the Gen3 Core elevator equivalent safety.
4. Cal/OSHA, by way of written submissions to the record (Exhibit PD-3), and position stated at hearing, is of the well informed opinion that grant of requested permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment, and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the Elevator Safety Order requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A table shall have permanent variances from the following sections of ASME A17.1-2004 that section 3141 makes applicable to the elevators the subject of those applications:

- **Car top railing:** sections 2.14.1.7.1 (to permit an inset car top railing, if, in fact, the car top railing is inset);
- **Speed governor over-speed switch:** 2.18.4.2.5(a) (to permit the use of the speed reducing system proposed by the Applicants, where the speed reducing switch resides in the controller algorithms, rather than on the governor, with the necessary speed input supplied by the main encoder signal from the motor);
- **Governor rope diameter:** 2.18.5.1 (to allow the use of reduced diameter governor rope);
- **Pitch diameter:** 2.18.7.4 (to permit the use of the speed-reducing system proposed by the Applicant, where the rope sheave pitch diameter is not less than 180 mm [7.1 in.]);
- **Suspension means:** 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4 and 2.20.9.5.4—the variances from these “suspension means” provisions to permit the use of Otis Gen2 flat coated steel suspension belts in lieu of conventional steel suspension ropes;
- **Inspection transfer switch:** 2.26.1.4.4(a) (to allow the inspection transfer switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room); and
- **Seismic reset switch:** 8.4.10.1.1(a)(2)(b) (to allow the seismic reset switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room).
- **Minimum Inside Car Platform Dimensions:** 3041(e)(1)(C) and 3141.7(b) (to comply with the performance-based requirements of the 2019 California Building Code section 3002.4.1a)

These variances apply to the locations and numbers of elevators stated in the section A table (so long as the elevators are Gen3 Edge/Gen2S Group and Gen3 Core & Medical Emergency Elevator Car Dimensions (Group IV) that are designed, equipped, and installed in accordance with, and are otherwise consistent with, and are subject to the following conditions:

1. The suspension system shall comply with the following:
 - a. The coated steel belt and connections shall have factors of safety equal to those permitted for use by section 3141 [ASME A17.1-2004, section 2.20.3] on wire rope suspended elevators.
 - b. Steel coated belts that have been installed and used on another installation shall not be reused.
 - c. The coated steel belt shall be fitted with a monitoring device which has been accepted by Cal/OSHA and which will automatically stop the car if the residual strength of any single belt drops below 60 percent. If the residual strength of any single belt drops below 60 percent, the device shall prevent the elevator from restarting after a normal stop at a landing.
 - d. Upon initial inspection, the readings from the monitoring device shall be documented and submitted to Cal/OSHA.
 - e. A successful test of the monitoring device’s functionality shall be conducted at least once a year (the record of the annual test of the monitoring device shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - f. The coated steel belts used shall be accepted by Cal/OSHA.

2. With respect to each elevator subject to this variance, the applicant shall comply with Cal/OSHA Circular Letter E-10-04, the substance of which is attached hereto as Addendum 1 and incorporated herein by this reference.
3. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection, and testing of the belts and monitoring device and criteria for belt replacement, and the applicant shall make those procedures and criteria available to Cal/OSHA upon request.
4. The flat coated steel belts shall be provided with a metal data tag that is securely attached to one of those belts. This data tag shall bear the following flat steel coated belt data:
 - a. The width and thickness in millimeters or inches;
 - b. The manufacturer's rated breaking strength in (kN) or (lbf);
 - c. The name of the person or organization that installed the flat coated steel belts;
 - d. The month and year the flat coated steel belts were installed;
 - e. The month and year the flat coated steel belts were first shortened;
 - f. The name or trademark of the manufacturer of the flat coated steel belts; and
 - g. Lubrication information.
5. There shall be a crosshead data plate of the sort required by section 2.20.2.1, and that plate shall bear the following flat steel coated belt data:
 - a. The number of belts;
 - b. The belt width and thickness in millimeters or inches; and
 - c. The manufacturer's rated breaking strength per belt in (kN) or (lbf).
6. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of elevator equipment in the hoistway is required. If service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
7. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on railings to perform adjustment, maintenance, repairs or inspections. The applicant shall not permit anyone to stand on or climb over the car top railing.
 - b. The distance that the car top railing may be inset shall be limited to no more than 6 inches.
 - c. All exposed areas outside the car top railing shall preclude standing or placing objects or persons which may fall and shall be beveled from the mid- or top rail to the outside of the car top.
 - d. The top of the beveled area and/or car top outside the railing, shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
 - e. The applicant shall provide durable signs with lettering not less than ½ inch on a

contrasting background on each inset railing; each sign shall state:

**CAUTION
DO NOT STAND ON OR CLIMB OVER RAILING**

- f. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing shall be measured from the car top and not from the required bevel).
8. If the seismic reset switch does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
9. If the inspection transfer switch required by ASME A17.1, rule 2.26.1.4.4(a) does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
10. When the inspection and testing panel is located in the hoistway door jamb, the inspection and test control panel shall be openable only by use of a Security Group I restricted key.
11. The governor speed-reducing switch function shall comply with the following:
 - a. It shall be used only with direct drive machines; i.e., no gear reduction is permitted between the drive motor and the suspension means.
 - b. The velocity encoder shall be coupled to the driving machine motor shaft. The "C" channel of the encoder shall be utilized for velocity measurements required by the speed reducing system. The signal from "C" channel of the encoder shall be verified with the "A" and "B" channels for failure. If a failure is detected then an emergency stop shall be initiated.
 - c. Control system parameters utilized in the speed-reducing system shall be held in non-volatile memory.
 - d. It shall be used in conjunction with approved car-mounted speed governors only.
 - e. It shall be used in conjunction with an effective traction monitoring system that detects a loss of traction between the driving sheave and the suspension means. If a loss of traction is detected, then an emergency stop shall be initiated.
 - f. A successful test of the speed-reducing switch system's functionality shall be conducted at least once a year (the record of the annual test of the speed-reducing switch system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - g. A successful test of the traction monitoring system's functionality shall be conducted at least once a year (the record of the annual test of the traction monitoring system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - h. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the maintenance, inspection, and testing of the speed-reducing switch and traction monitoring systems. The Applicant shall make the procedures available to Cal/OSHA upon

request.

12. The speed governor rope and sheaves shall comply with the following:

- a. The governor shall be used in conjunction with a 6 mm (0.25 in.) diameter steel governor rope with 6-strand, regular lay construction.
- b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
- c. The governor sheaves shall have a pitch diameter of not less than 180 mm (7.1 in.).

13. All medical emergency service elevators shall comply with the following:

- a. The requirements of the 2019 California Building Code (CBC), section 3002.4.1a;

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5inch (127 mm) radius corners] in the horizontal, open position.

- b. All medical emergency service elevators shall be identified in the building construction documents in accordance with the 2019 CBC, section 3002.4a.
- c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).

- 14. The elevator shall be serviced, maintained, adjusted, tested, and inspected only by Certified Competent Conveyance Mechanics who have been trained to, and are competent to, perform those tasks on the Gen3 Edge/Gen2S/Gen3 Core elevator system in accordance with the written procedures and criteria required by Condition No. 3 and in accordance with the terms of this permanent variance.
- 15. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing, or testing of the elevators shall be provided a copy of this variance decision.
- 16. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and a Permit to Operate shall be issued before the elevator is placed in service.
- 17. The Applicant shall be subject to the Suspension Means – Replacement Reporting Condition stated in Addendum 2, as hereby incorporated by this reference.
- 18. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications.
- 19. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in

accordance with the Board's procedural regulations at section 426, subdivision (b).

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 29, 2026



Kelly Chau, Hearing Officer

ADDENDUM 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and, Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA-Elevator Unit HQS

ADDENDUM 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

TK Elevator Evolution (Group IV)

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-293	Pepperdine University	24255 Pacific Coast Hwy. Bldg. #62, Firestone Fieldhouse Malibu, CA	1

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, James Day, with TK Elevator Corporation, appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit

PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing
PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Applicant proposes to utilize inset car top railings and guards in compliance with ASME 17.1-2013, section 2.14.1.7.1 and the Vivante Westside, LLC File No. 18-V-364 (Nov. 20, 2020) decision (Vivante). Applicant further claims that the request is consistent with the Vivante, the Mack Urban, LLC, Permanent Variance No. 15-V-349 (Nov. 17, 2016), and the Patton Equities, LLC Permanent Variance No. 20-V-128 (Nov. 12, 2020) decisions (Patton Equities).
2. Applicant proposes to utilize noncircular elastomeric-coated steel belts ("ECSBs") rather than steel ropes in a machine room-less ("MRL") elevator installation, with updated data plates, data tags, and wedge sockets designed for use with ECSBs, as well as the appropriate factor of safety criteria conforming to ASME 17.1-2013, with a continuous residual strength detection device ("RSDD") compliant with the San Francisco Public Works (Permanent Variance No. 21-V-061, et al.) decisions.
3. The installation shall utilize the TK Elevator Model 104DP001 RSDD, accepted by Cal/OSHA on May 4, 2021.
4. Applicant proposes to comply with ASME A17.1-2013 sections 2.26.9.3, "Protection Against Failures", rather than the requirements of 2.26.9.3 and 2.26.9.4 in the ASME 2004 code.
5. Applicant proposes to use TKE's control systems, using the TKE TAC32T Controller with SIL3 rated elements, to provide equivalent safety to ASME A17.1-2004, section 2.26.9.4 as a means to inhibit flow of Alternating Current to the Driving Motor in compliance with ASME A17.1-2013, section 2.26.9.6.
6. Applicant proposes to locate the Inspection Transfer Switch within the machinery/control room/space in the MRL installation, in compliance with ASME 17.1-2013, section 2.26.1.4.
7. Applicant proposes to locate the Seismic-Operation Reset Switch in the machinery/control room/space in the MRL installation.

D. Relevant Safety Orders

Variance Request No. 1 (ASME A17.1-2004, section 2.14.1.7.1)

2.14.1.7.1 A standard railing conforming to 2.10.2 shall be provided on the outside perimeter of the car top on all sides where the perpendicular distance between the edges of the car top and the adjacent hoistway enclosure exceeds 300 mm (12 in.) horizontal clearance.

Variance Request No. 2A (ASME A17.1-2004, section 2.20.1)

2.20.1 Suspension Means

Elevator cars shall be suspended by steel wire ropes attached to the car frame or passing around sheaves attached to the car frame specified in 2.15.1. Ropes that have previously been installed and used on another installation shall not be reused.

Only iron (low-carbon steel) or steel wire ropes, having the commercial classification "Elevator Wire Rope," or wire rope specifically constructed for elevator use, shall be used for the suspension of elevator cars and for the suspension of counterweights. The wire material for ropes shall be manufactured by the open-hearth or electric furnace process or their equivalent.

Variance Request No. 2B (ASME A17.1-2004, section 2.20.2[.1])

2.20.2.1 On Crosshead Data Plate.

The crosshead data plate required by 2.16.3 shall bear the following wire-rope data:

- (a) the number of ropes
- (b) the diameter in millimeters (mm) or inches (in.)
- (c) the manufacturer's rated breaking strength per rope in kilo Newton (kN) or pounds (lb)

Variance Request No. 2C (ASME A17.1-2004, section 2.20.2.2)

2.20.2.2 On Rope Data Tag.

A metal data tag shall be securely attached to one of the wire-rope fastenings. This data tag shall bear the following wire-rope data:

- (a) the diameter in millimeters (mm) or inches (in.)
- [...]
- (f) whether the ropes were nonpreformed or preformed
- [...]

Variance Request No. 2D. (ASME A17.1-2004, section 2.20.3)

2.20.3 Factor of Safety

The factor of safety of the suspension wire ropes shall be not less than shown in Table 2.20.3. Figure 8.2.7 gives the minimum factor of safety for intermediate rope speeds. The factor of safety shall be based on the actual rope speed corresponding to the rated speed of the car.

The factor of safety shall be calculated by the following formula:

$$f = \frac{(S \times N)}{W}$$

where:

N = number of runs of rope under load. For 2:1 roping, N shall be two times the number of ropes used, etc.

S = manufacturer's rated breaking strength of one rope

W = maximum static load imposed on all car ropes with the car and its rated load at any position in the hoistway

Variance Request No. 2E (ASME A17.1-2004, section 2.20.4)

2.20.4 Minimum Number and Diameter of Suspension Ropes

The minimum number of hoisting ropes used shall be three for traction elevators and two for drum-type elevators.

Where a car counterweight is used, the number of counterweight ropes used shall be not less than two.

The term "diameter," where used in reference to ropes, shall refer to the nominal diameter as given by the rope manufacturer.

The minimum diameter of hoisting and counterweight ropes shall be 9.5 mm (0.375 in.). Outer wires of the ropes shall be not less than 0.56 mm (0.024 in.) in diameter.

Variance Request No. 2F (ASME A17.1-2004, section 2.20.9[.1])

2.20.9 Suspension-Rope Fastening

2.20.9.1 Type of Rope Fastenings. The car and counterweight ends of suspension wire ropes, or the stationary hitch-ends where multiple roping is used, shall be fastened in such a manner that all portions of the rope, except the portion inside the rope sockets, shall be readily visible.

Fastening shall be

(a) by individual tapered rope sockets (see 2.20.9.4) or other types of rope fastenings that have undergone adequate tensile engineering tests, provided that

(1) such fastenings conform to 2.20.9.2 and 2.20.9.3;

(2) the rope socketing is such as to develop at least 80% of the ultimate breaking strength of the strongest rope to be used in such fastenings; or

(b) by individual wedge rope sockets (see 2.20.9.5); and

(c) U-bolt-type rope clamps or similar devices shall not be used for suspension rope fastenings.

Variance Request No. 3 (ASME A17.1-2004, section 2.26.9.4)

2.26.9.4 Redundant devices used to satisfy 2.26.9.3 in the determination of the occurrence of a single ground, or the failure of any single magnetically operated switch, contactor or relay, or of any single solid state device, or any single device that limits the leveling or truck zone, or a software system failure, shall be checked prior to each start of the elevator from a landing, when on automatic operation. When a single ground or failure, as specified in 2.26.9.3, occurs, the car shall not be permitted to restart. Implementation of redundancy by a software system is permitted, provided that the removal of power from the driving-machine motor and brake shall not be solely dependent on software-controlled means.

Variance Request No. 4 (ASME A17.1-2004, section 2.26.9.6.1)

2.26.9.6.1 Two separate means shall be provided to independently inhibit the flow of alternating-current through the solid state devices that connect the direct-current power source to the alternating-current driving motor. At least one of the means shall be an electromechanical relay.

Variance Request No. 5 (ASME A17.1-2004, section 2.26.1.4.4(a))

2.26.1.4.4 Machine Room Inspection Operation

(a) When machine room inspection operation is provided, it shall conform to 2.26.1.4.1, and the transfer switch shall be located in the machine room.

Variance Request No. 6 (ASME A17.1-2004, section 8.4.10.1.1(a)(2)(b))

8.4.10.1.1 Earthquake Equipment (See Also Fig. 8.4.10.1.1)

(a) All traction elevators operating at a rated speed of 0.75 m/s (150 ft/min) or more and having counterweights located in the same hoistway shall be provided with the following:

(1) seismic zone 3 or greater: a minimum of one seismic switch per building

(2) seismic zone 2 or greater:

(a) a displacement switch for each elevator

(b) an identified momentary reset button or switch for each elevator, located in the control panel in the elevator machine room [see 8.4.10.1.3(i)]

E. Decision and Order

Applicant is hereby conditionally GRANTED Permanent Variance as specified below, and to the limited extent, as of the date the Board adopts this Proposed Decision, with respect to the section A specified number of TKE EVO 200 elevator(s), at the specified location, each shall conditionally hold permanent variance from the following subparts of ASME A17.1-2004, currently incorporated by reference into section 3141 of the Elevator Safety Orders:

- Car-Top Railing: 2.14.1.7.1 (Limited to the extent necessary to permit the use of an inset car-top railing)
- Suspension Means: 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, and 2.20.9.1 (Limited to the extent necessary to permit the use of the elastomeric-coated steel belts in lieu of circular steel suspension ropes)
- Inspection transfer switch: 2.26.1.4.4(a) (Limited to the extent necessary to permit the inspection transfer switch to reside at a location other than the machine room)
- Software Reliant Means to Remove Power: 2.26.9.4 (Limited to the extent necessary to permit the exclusive use of SIL-rated software systems as a means to remove power from the driving machine motor and brake)
- SIL-Rated Circuitry to Inhibit Current Flow: 2.26.9.6.1 (Limited to the extent necessary to permit the use of SIL-rated circuitry in place of an electromechanical relay to inhibit current flow to the drive motor)
- Seismic reset switch: 8.4.10.1.1(a)(2)(b) (Limited to the extent necessary to permit the seismic reset switch to reside at a location other than the machine room)

Inset Car Top Railing (Variance Request No. 1):

1.0 Any and all inset car top railings shall comply with the following:

1.1 Serviceable equipment shall be positioned so that mechanics and inspectors do not have to stand on or climb over the railings to perform adjustments, maintenance, repairs or inspections. The Applicant shall not permit trained elevator mechanics or elevator service personnel to stand or climb over the car top railing.

1.2 The distance that the railing can be inset shall be limited to not more than six inches (6").

1.3 All exposed areas of the car top outside the car top railing where the distance from the railing to the edge of the car top exceeds two inches (2"), shall be beveled with metal, at an angle of not less than 75 degrees with the horizontal, from the mid or top rail to the outside of the car top, such that no person or object can stand, sit, kneel, rest, or be placed in the exposed areas.

1.4 The top surface of the beveled area and/or car top outside the railing, shall be clearly marked. The markings shall consist of alternating 4" diagonal red and white stripes.

1.5 The Applicant shall provide durable signs with lettering not less than 1/2 inch on a contrasting background on each inset railing; each sign shall state:

**CAUTION
STAY INSIDE RAILING
NO LEANING BEYOND RAILING
NO STEPPING ON, OR BEYOND, RAILING**

1.6 The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing will be measured from the car top and not from the required bevel).

Suspension Means (Variance Request No. 2):

2.0 The elevator suspension system shall comply with the following:

2.1 The elastomeric coated steel belts (ECSBs) and their associated fastenings shall conform to the applicable requirements of ASME A17.1-2013, sections:

2.20.4.3 – Minimum Number of Suspension Members

2.20.3 – Factor of Safety

2.20.9 – Suspension Member Fastening

2.2 Additionally, ECSBs shall meet or exceed all requirements of ASME A17.6-2010, Standard for Elevator Suspension, Compensation, and Governor Systems, Part 3 Noncircular Elastomeric Coated Steel Suspension Members for Elevators.

2.3 The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection and testing of the ECSBs and fastenings and related monitoring and detection systems and criteria for ECSB replacement, and the Applicant shall make those procedures and criteria available to the Certified Competent Conveyance Mechanic (CCCM) at the location of the elevator, and to Cal/OSHA upon request.

2.4 ECSB mandatory replacement criteria shall include:

2.4.1. Any exposed wire, strand or cord;

2.4.2. Any wire, strand or cord breaks through the elastomeric coating;

2.4.3. Any evidence of rouging (steel tension element corrosion) on any part of the elastomeric coated steel suspension member;

2.4.4. Any deformation in the elastomeric suspension member such as, but not limited to, kinks or bends.

2.5 Traction drive sheaves must have a minimum diameter of 112 mm. The maximum speed of ECSBs running on 112 mm drive sheaves shall be no greater than 6.1 m/s.

2.6 If any one (1) ECSB needs replacement, the complete set of suspension members on the elevator shall be replaced. Exception: If a new suspension member is damaged during installation, and prior to any contemporaneously installed ECSB having been placed into service, it is permissible to replace the individual damaged suspension member. ECSBs that have been installed on another installation shall not be re used.

2.7 A traction loss detection means shall be provided that conforms to the requirements of ASME A17.1-2013, section 2.20.8.1. The means shall be tested for correct function annually in accordance with ASME A17.1-2013, section 8.6.4.19.12.

2.8 A broken suspension member detection means shall be provided that conforms to the requirements of ASME A17.1-2013, section 2.20.8.2. The means shall be tested for correct function annually in accordance with ASME A17.1-2013, section 8.6.4.19.13(a).

2.9 An elevator controller integrated bend cycle monitoring system shall monitor actual ECSB bend cycles, by means of continuously counting, and storing in nonvolatile memory, the number of trips that the ECSB makes traveling, and thereby being bent, over the elevator sheaves. The bend cycle limit monitoring means shall automatically stop the car normally at the next available landing before the bend cycle correlated residual strength of any single ECSB member drops below (60%) sixty percent of full rated strength. The monitoring means shall prevent the car from restarting. Notwithstanding any less frequent periodic testing requirement per Addendum 2 (Cal/OSHA Circular Letter), the bend cycle monitoring system shall be tested semiannually in accordance with the procedures required per above Conditions 2.3 and 2.4.

2.10 The elevator crosshead data plate shall comply with the requirements of ASME A17.1-2013, section 2.20.2.1.

2.11 A suspension means data tag shall be provided that complies with the requirements of ASME A17.1-2013, section 2.20.2.2.

2.12 Comprehensive visual inspections of the entire length of each and all installed suspension members, in conformity with above Conditions 2.3 and 2.4 specified criteria, shall be conducted and documented every six (6) months by a CCCM.

2.13 The Applicant shall be subject to the requirements per hereto attached, and inhere incorporated, Addendum 1, "Suspension Means Replacement Reporting Condition."

2.14 Records of all tests and inspections shall be maintenance records subject to ASME A17.1-2004, sections 8.6.1.2, and 8.6.1.4, respectively.

2.15 The subject elevators(s) shall be equipped with a TK Elevator Model 104DP001 Residual Strength Detection Device accepted by Cal/OSHA on May 4, 2021 or Cal/OSHA accepted equivalent device.

Control and Operating Circuits

Combined Software Redundant Devices with Software Removal of Power from Driving Motor and Brake (Variance Request No. 3)

Removal of Power from Driving Motor Without Electro-mechanical Switches (Variance Request No. 4)

3.0 The SIL rated circuitry used to provide device/circuit redundancy and to inhibit electrical current flow in accordance with ASME A17.1-2004, sections 2.26.9.4 and 2.26.9.6.1 shall comply with the following:

3.1 The SIL rated systems and related circuits shall consist of:

3.1.1. ELGO LIMAX33 RED, (aka LIMAX3R-03-050-0500-CNXTG-RJU), Safe Magnetic Absolute Shaft Information System, labeled or marked with the SIL rating (not less than SIL 3), the name or mark of the certifying organization, and the SIL certification number (968/A 163), followed by the applicable revision number (as in 968/A 163.07/19).

3.1.2 Printed circuit board assembly SSOA (6300 AHE001), labeled or marked with the SIL rating (not less than SIL 3), the name or mark of the certifying organization, and the SIL certification number (968/FSP 1347), followed by the applicable revision number (as in 968/FSP 1347.00/16).

3.1.3 Two circuit board components (Serializer S3I and S3O), each labeled or marked with the SIL rating (not less than SIL 3), the name or mark of the certifying organization and the SIL certification number (968/A 162), followed by the applicable revision number (as in 968/A 162.04/18)

3.2 The software system and related circuits shall be certified for compliance with the applicable requirements of ASME A17.1-2013, section 2.26.4.3.2.

3.3 The access door or cover of the enclosures containing the SIL rated components shall be clearly labeled or tagged on their exterior with the statement:

**Assembly contains SIL rated devices.
Refer to maintenance Control Program and wiring diagrams
prior to performing work.**

3.4 Unique maintenance procedures or methods required for the inspection, testing, or replacement of the SIL rated circuits shall be developed and a copy maintained in the elevator machine/control room/space. The procedures or methods shall include clear color photographs of each SIL rated component, with notations identifying parts and locations.

3.5 Wiring diagrams that include part identification, SIL, and certification information shall be maintained in the elevator machine/control room/space.

3.6 A successful test of the SIL rated circuits shall be conducted initially and not less than annually in accordance with the testing procedure. The test shall demonstrate that SIL rated devices, safety functions, and related circuits operate as intended.

3.7 Any alterations to the SIL rated circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the alteration of SIL rated devices, the alterations shall be made in conformance with ASME A17.1-2013, section 8.7.1.9.

3.8 Any replacement of the SIL rated circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the replacement of SIL rated devices, the replacement shall be made in conformance with ASME A17.1-2013, section 8.6.3.14.

3.9 Any repairs to the SIL rated circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the repair of SIL rated devices, the repairs shall be made in conformance with ASME A17.1-2013, section 8.6.2.6.

3.10 Any space containing SIL rated circuits shall be maintained within the temperature and humidity range specified by TKE. The temperature and humidity range shall be posted on each enclosure containing SIL rated software or circuits.

3.11 Field software changes to the SIL rated system are not permitted. Any changes to the SIL rated

system's circuitry will require recertification and all necessary updates to the documentation and diagrams required by Conditions 3.4 and 3.5 above.

Inspection Transfer Switch and Seismic Reset Switch (Variance Request Nos. 5 and 6):

4.0 Inspection Transfer switch and Seismic Reset switch placement and enclosure shall comply with the following:

4.1 If the inspection transfer switch required by ASME A17.1-2004, section 2.26.1.4.4, does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the control/machinery room/space containing the elevator's control equipment in an enclosure secured by a lock openable by a Group 1 security key. The enclosure is to remain locked at all times when not in use.

4.2 If the seismic reset switch does not reside in the machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the control/machinery room/space containing the elevator's control equipment in an enclosure secured by a lock openable by a Group 1 security key. The enclosure is to remain locked at all times when not in use.

5.0 The elevator shall be serviced, maintained, adjusted, tested, and inspected only by CCCM having been trained, and competent, to perform those tasks on the TKE EVO 200 elevator system in accordance with written procedures and criteria, including as required per above Conditions 2.3, and 2.4.

6.0 Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and all applicable requirements met, including conditions of this permanent variance, prior to a Permit to Operate the elevator being issued. The elevator shall not be placed in full service prior to the Permit to Operate being issued by Cal/OSHA.

7.0 The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications pursuant to sections 411.2, and 411.3.

8.0 This Decision and Order shall remain in effect unless duly modified or revoked upon application by Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in the procedural manner prescribed by the Board's regulations.

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 28, 2026



Kelly Chau, Hearing Officer

ADDENDUM 1

SUSPENSION MEANS REPLACEMENT REPORTING REQUIREMENTS

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future):
Cal/OSHA Elevator Unit, Attn: Engineering section, 2 MacArthur Place Suite 700, Santa Ana, CA 92707.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State issued conveyance number, complete address, and Permanent Variance file number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, and certification expiration date of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which

case, the information to be reported shall be the information required by the ASME provision as modified by the variance.

- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.

In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2(a) above.

ADDENDUM 2

CIRCULAR LETTER E-10-04, October 6, 2010

TO: Installers, Manufacturers of Conveyances and Related Equipment and, Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a nonfunctional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be nonfunctional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA Elevator Unit HQ

ADDENDUM 3

- A. A Residual Strength Detection Device (RSDD) shall continuously monitor all Elastomeric Coated Steel Belt suspension members (ECSB), automatically stopping the car if the residual strength of any belt drops below 60%. The RSDD shall prevent the elevator from restarting after a normal stop at a landing. The RSDD shall device shall apply a form of electrical current and/or signal through the entire length of the steel tension elements of the ECSB and measure the current and/or signal on its return. The values measured shall be continuously compared to values that have been correlated to the remaining residual strength of the ECSB through testing. The required RSDD shall not rely upon giant magnetoresistance technology, or other magnetic measurement means, for residual strength detection or monitoring.

The RSDD must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room or controller location. The removed RSDD must be replaced or returned to proper service within 30 days. If upon routine inspection, the RSDD device is found to be in a nonfunctional state, the date and findings are to be conspicuously documented in the elevator machine room or controller location.

If upon inspection by Cal/OSHA, the RSDD is found to be nonfunctional or removed, and the required documentation is not in place, the elevator will be removed from service. If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

- B. On or before November 21 2021, and thereafter, the above specified and documented RSDD shall be installed and operational on the subject elevator.
- C. A successful functionality test of each RSDD shall be conducted once a year, and a copy of completed testing documentation conspicuously located in the machine room or within proximity of the controller.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Otis Gen2S/Gen3Edge/Gen3 Core Elevator & Medical Emergency Car Dimensions

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-295	Pacific Las Tunas Place LLC	9465 Las Tunas Dr. Temple City, CA	3

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Dan Leacox, with Leacox & Associates, and Wolter Geesink with Otis Elevator Company appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each Applicant intends to utilize Otis Gen3 Edge/Gen2S/Gen3 Core elevators at the locations and in the numbers stated in the above section A.1 table. Applicant may utilize the variance from minimum inside car platform dimensions for other elevators designated for emergency medical service at the same variance location.
2. The installation contracts for these elevators were or will be signed on or after May 1, 2008, making the elevators subject to the Group IV Elevator Safety Orders.
3. The Board incorporates by reference the relevant findings in previous Board decisions:
 - a. Items D.3 through D.9 of the Proposed Decision adopted by the Board on July 18, 2013 for Permanent Variance No. 12-V-093;
 - b. Item D.4 of the Proposed Decision adopted by the Board on September 25, 2014 for Permanent Variance No. 14-V-206;
 - c. Item B of the Proposed Decision adopted by the Board on September 15, 2022 for Permanent Variance No. 22-V-302 regarding medical emergency car dimensions; and
 - d. Items C and D of the Proposed Decision adopted by the Board on June 20, 2024 for Permanent Variance No. 24-V-193 regarding the Gen3 Core elevator equivalent safety.
4. Cal/OSHA, by way of written submissions to the record (Exhibit PD-3), and position stated at hearing, is of the well informed opinion that grant of requested permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment, and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the Elevator Safety Order requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A table shall have permanent variances from the following sections of ASME A17.1-2004 that section 3141 makes applicable to the elevators the subject of those applications:

- **Car top railing:** sections 2.14.1.7.1 (to permit an inset car top railing, if, in fact, the car top railing is inset);
- **Speed governor over-speed switch:** 2.18.4.2.5(a) (to permit the use of the speed reducing system proposed by the Applicants, where the speed reducing switch resides in the controller algorithms, rather than on the governor, with the necessary speed input supplied by the main encoder signal from the motor);
- **Governor rope diameter:** 2.18.5.1 (to allow the use of reduced diameter governor rope);
- **Pitch diameter:** 2.18.7.4 (to permit the use of the speed-reducing system proposed by the Applicant, where the rope sheave pitch diameter is not less than 180 mm [7.1 in.]);
- **Suspension means:** 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4 and 2.20.9.5.4—the variances from these “suspension means” provisions to permit the use of Otis Gen2 flat coated steel suspension belts in lieu of conventional steel suspension ropes;
- **Inspection transfer switch:** 2.26.1.4.4(a) (to allow the inspection transfer switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room); and
- **Seismic reset switch:** 8.4.10.1.1(a)(2)(b) (to allow the seismic reset switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room).
- **Minimum Inside Car Platform Dimensions:** 3041(e)(1)(C) and 3141.7(b) (to comply with the performance-based requirements of the 2019 California Building Code section 3002.4.1a)

These variances apply to the locations and numbers of elevators stated in the section A table (so long as the elevators are Gen3 Edge/Gen2S Group and Gen3 Core & Medical Emergency Elevator Car Dimensions (Group IV) that are designed, equipped, and installed in accordance with, and are otherwise consistent with, and are subject to the following conditions:

1. The suspension system shall comply with the following:
 - a. The coated steel belt and connections shall have factors of safety equal to those permitted for use by section 3141 [ASME A17.1-2004, section 2.20.3] on wire rope suspended elevators.
 - b. Steel coated belts that have been installed and used on another installation shall not be reused.
 - c. The coated steel belt shall be fitted with a monitoring device which has been accepted by Cal/OSHA and which will automatically stop the car if the residual strength of any single belt drops below 60 percent. If the residual strength of any single belt drops below 60 percent, the device shall prevent the elevator from restarting after a normal stop at a landing.
 - d. Upon initial inspection, the readings from the monitoring device shall be documented and submitted to Cal/OSHA.
 - e. A successful test of the monitoring device’s functionality shall be conducted at least once a year (the record of the annual test of the monitoring device shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - f. The coated steel belts used shall be accepted by Cal/OSHA.

2. With respect to each elevator subject to this variance, the applicant shall comply with Cal/OSHA Circular Letter E-10-04, the substance of which is attached hereto as Addendum 1 and incorporated herein by this reference.
3. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection, and testing of the belts and monitoring device and criteria for belt replacement, and the applicant shall make those procedures and criteria available to Cal/OSHA upon request.
4. The flat coated steel belts shall be provided with a metal data tag that is securely attached to one of those belts. This data tag shall bear the following flat steel coated belt data:
 - a. The width and thickness in millimeters or inches;
 - b. The manufacturer's rated breaking strength in (kN) or (lbf);
 - c. The name of the person or organization that installed the flat coated steel belts;
 - d. The month and year the flat coated steel belts were installed;
 - e. The month and year the flat coated steel belts were first shortened;
 - f. The name or trademark of the manufacturer of the flat coated steel belts; and
 - g. Lubrication information.
5. There shall be a crosshead data plate of the sort required by section 2.20.2.1, and that plate shall bear the following flat steel coated belt data:
 - a. The number of belts;
 - b. The belt width and thickness in millimeters or inches; and
 - c. The manufacturer's rated breaking strength per belt in (kN) or (lbf).
6. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of elevator equipment in the hoistway is required. If service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
7. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on railings to perform adjustment, maintenance, repairs or inspections. The applicant shall not permit anyone to stand on or climb over the car top railing.
 - b. The distance that the car top railing may be inset shall be limited to no more than 6 inches.
 - c. All exposed areas outside the car top railing shall preclude standing or placing objects or persons which may fall and shall be beveled from the mid- or top rail to the outside of the car top.
 - d. The top of the beveled area and/or car top outside the railing, shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
 - e. The applicant shall provide durable signs with lettering not less than ½ inch on a

contrasting background on each inset railing; each sign shall state:

**CAUTION
DO NOT STAND ON OR CLIMB OVER RAILING**

- f. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing shall be measured from the car top and not from the required bevel).
8. If the seismic reset switch does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
9. If the inspection transfer switch required by ASME A17.1, rule 2.26.1.4.4(a) does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
10. When the inspection and testing panel is located in the hoistway door jamb, the inspection and test control panel shall be openable only by use of a Security Group I restricted key.
11. The governor speed-reducing switch function shall comply with the following:
 - a. It shall be used only with direct drive machines; i.e., no gear reduction is permitted between the drive motor and the suspension means.
 - b. The velocity encoder shall be coupled to the driving machine motor shaft. The “C” channel of the encoder shall be utilized for velocity measurements required by the speed reducing system. The signal from “C” channel of the encoder shall be verified with the “A” and “B” channels for failure. If a failure is detected then an emergency stop shall be initiated.
 - c. Control system parameters utilized in the speed-reducing system shall be held in non-volatile memory.
 - d. It shall be used in conjunction with approved car-mounted speed governors only.
 - e. It shall be used in conjunction with an effective traction monitoring system that detects a loss of traction between the driving sheave and the suspension means. If a loss of traction is detected, then an emergency stop shall be initiated.
 - f. A successful test of the speed-reducing switch system’s functionality shall be conducted at least once a year (the record of the annual test of the speed-reducing switch system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - g. A successful test of the traction monitoring system’s functionality shall be conducted at least once a year (the record of the annual test of the traction monitoring system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - h. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the maintenance, inspection, and testing of the speed-reducing switch and traction monitoring systems. The Applicant shall make the procedures available to Cal/OSHA upon

request.

12. The speed governor rope and sheaves shall comply with the following:

- a. The governor shall be used in conjunction with a 6 mm (0.25 in.) diameter steel governor rope with 6-strand, regular lay construction.
- b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
- c. The governor sheaves shall have a pitch diameter of not less than 180 mm (7.1 in.).

13. All medical emergency service elevators shall comply with the following:

- a. The requirements of the 2019 California Building Code (CBC), section 3002.4.1a;

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5inch (127 mm) radius corners] in the horizontal, open position.

- b. All medical emergency service elevators shall be identified in the building construction documents in accordance with the 2019 CBC, section 3002.4a.
- c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).

- 14. The elevator shall be serviced, maintained, adjusted, tested, and inspected only by Certified Competent Conveyance Mechanics who have been trained to, and are competent to, perform those tasks on the Gen3 Edge/Gen2S/Gen3 Core elevator system in accordance with the written procedures and criteria required by Condition No. 3 and in accordance with the terms of this permanent variance.
- 15. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing, or testing of the elevators shall be provided a copy of this variance decision.
- 16. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and a Permit to Operate shall be issued before the elevator is placed in service.
- 17. The Applicant shall be subject to the Suspension Means – Replacement Reporting Condition stated in Addendum 2, as hereby incorporated by this reference.
- 18. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications.
- 19. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in

accordance with the Board's procedural regulations at section 426, subdivision (b).

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 29, 2026



Kelly Chau, Hearing Officer

ADDENDUM 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and, Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA-Elevator Unit HQS

ADDENDUM 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Otis Gen2S/Gen3Edge/Gen3 Core Elevator & Medical Emergency Car Dimensions

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-296	Raintree Partners	550 Encinitas Blvd Encinitas, CA	3

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Dan Leacox, with Leacox & Associates, and Wolter Geesink with Otis Elevator Company appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each Applicant intends to utilize Otis Gen3 Edge/Gen2S/Gen3 Core elevators at the locations and in the numbers stated in the above section A.1 table. Applicant may utilize the variance from minimum inside car platform dimensions for other elevators designated for emergency medical service at the same variance location.
2. The installation contracts for these elevators were or will be signed on or after May 1, 2008, making the elevators subject to the Group IV Elevator Safety Orders.
3. The Board incorporates by reference the relevant findings in previous Board decisions:
 - a. Items D.3 through D.9 of the Proposed Decision adopted by the Board on July 18, 2013 for Permanent Variance No. 12-V-093;
 - b. Item D.4 of the Proposed Decision adopted by the Board on September 25, 2014 for Permanent Variance No. 14-V-206;
 - c. Item B of the Proposed Decision adopted by the Board on September 15, 2022 for Permanent Variance No. 22-V-302 regarding medical emergency car dimensions; and
 - d. Items C and D of the Proposed Decision adopted by the Board on June 20, 2024 for Permanent Variance No. 24-V-193 regarding the Gen3 Core elevator equivalent safety.
4. Cal/OSHA, by way of written submissions to the record (Exhibit PD-3), and position stated at hearing, is of the well informed opinion that grant of requested permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment, and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the Elevator Safety Order requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A table shall have permanent variances from the following sections of ASME A17.1-2004 that section 3141 makes applicable to the elevators the subject of those applications:

- **Car top railing:** sections 2.14.1.7.1 (to permit an inset car top railing, if, in fact, the car top railing is inset);
- **Speed governor over-speed switch:** 2.18.4.2.5(a) (to permit the use of the speed reducing system proposed by the Applicants, where the speed reducing switch resides in the controller algorithms, rather than on the governor, with the necessary speed input supplied by the main encoder signal from the motor);
- **Governor rope diameter:** 2.18.5.1 (to allow the use of reduced diameter governor rope);
- **Pitch diameter:** 2.18.7.4 (to permit the use of the speed-reducing system proposed by the Applicant, where the rope sheave pitch diameter is not less than 180 mm [7.1 in.]);
- **Suspension means:** 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4 and 2.20.9.5.4—the variances from these “suspension means” provisions to permit the use of Otis Gen2 flat coated steel suspension belts in lieu of conventional steel suspension ropes;
- **Inspection transfer switch:** 2.26.1.4.4(a) (to allow the inspection transfer switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room); and
- **Seismic reset switch:** 8.4.10.1.1(a)(2)(b) (to allow the seismic reset switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room).
- **Minimum Inside Car Platform Dimensions:** 3041(e)(1)(C) and 3141.7(b) (to comply with the performance-based requirements of the 2019 California Building Code section 3002.4.1a)

These variances apply to the locations and numbers of elevators stated in the section A table (so long as the elevators are Gen3 Edge/Gen2S Group and Gen3 Core & Medical Emergency Elevator Car Dimensions (Group IV) that are designed, equipped, and installed in accordance with, and are otherwise consistent with, and are subject to the following conditions:

1. The suspension system shall comply with the following:
 - a. The coated steel belt and connections shall have factors of safety equal to those permitted for use by section 3141 [ASME A17.1-2004, section 2.20.3] on wire rope suspended elevators.
 - b. Steel coated belts that have been installed and used on another installation shall not be reused.
 - c. The coated steel belt shall be fitted with a monitoring device which has been accepted by Cal/OSHA and which will automatically stop the car if the residual strength of any single belt drops below 60 percent. If the residual strength of any single belt drops below 60 percent, the device shall prevent the elevator from restarting after a normal stop at a landing.
 - d. Upon initial inspection, the readings from the monitoring device shall be documented and submitted to Cal/OSHA.
 - e. A successful test of the monitoring device’s functionality shall be conducted at least once a year (the record of the annual test of the monitoring device shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - f. The coated steel belts used shall be accepted by Cal/OSHA.

2. With respect to each elevator subject to this variance, the applicant shall comply with Cal/OSHA Circular Letter E-10-04, the substance of which is attached hereto as Addendum 1 and incorporated herein by this reference.
3. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection, and testing of the belts and monitoring device and criteria for belt replacement, and the applicant shall make those procedures and criteria available to Cal/OSHA upon request.
4. The flat coated steel belts shall be provided with a metal data tag that is securely attached to one of those belts. This data tag shall bear the following flat steel coated belt data:
 - a. The width and thickness in millimeters or inches;
 - b. The manufacturer's rated breaking strength in (kN) or (lbf);
 - c. The name of the person or organization that installed the flat coated steel belts;
 - d. The month and year the flat coated steel belts were installed;
 - e. The month and year the flat coated steel belts were first shortened;
 - f. The name or trademark of the manufacturer of the flat coated steel belts; and
 - g. Lubrication information.
5. There shall be a crosshead data plate of the sort required by section 2.20.2.1, and that plate shall bear the following flat steel coated belt data:
 - a. The number of belts;
 - b. The belt width and thickness in millimeters or inches; and
 - c. The manufacturer's rated breaking strength per belt in (kN) or (lbf).
6. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of elevator equipment in the hoistway is required. If service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
7. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on railings to perform adjustment, maintenance, repairs or inspections. The applicant shall not permit anyone to stand on or climb over the car top railing.
 - b. The distance that the car top railing may be inset shall be limited to no more than 6 inches.
 - c. All exposed areas outside the car top railing shall preclude standing or placing objects or persons which may fall and shall be beveled from the mid- or top rail to the outside of the car top.
 - d. The top of the beveled area and/or car top outside the railing, shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
 - e. The applicant shall provide durable signs with lettering not less than ½ inch on a

contrasting background on each inset railing; each sign shall state:

**CAUTION
DO NOT STAND ON OR CLIMB OVER RAILING**

- f. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing shall be measured from the car top and not from the required bevel).
- 8. If the seismic reset switch does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
- 9. If the inspection transfer switch required by ASME A17.1, rule 2.26.1.4.4(a) does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
- 10. When the inspection and testing panel is located in the hoistway door jamb, the inspection and test control panel shall be openable only by use of a Security Group I restricted key.
- 11. The governor speed-reducing switch function shall comply with the following:
 - a. It shall be used only with direct drive machines; i.e., no gear reduction is permitted between the drive motor and the suspension means.
 - b. The velocity encoder shall be coupled to the driving machine motor shaft. The “C” channel of the encoder shall be utilized for velocity measurements required by the speed reducing system. The signal from “C” channel of the encoder shall be verified with the “A” and “B” channels for failure. If a failure is detected then an emergency stop shall be initiated.
 - c. Control system parameters utilized in the speed-reducing system shall be held in non-volatile memory.
 - d. It shall be used in conjunction with approved car-mounted speed governors only.
 - e. It shall be used in conjunction with an effective traction monitoring system that detects a loss of traction between the driving sheave and the suspension means. If a loss of traction is detected, then an emergency stop shall be initiated.
 - f. A successful test of the speed-reducing switch system’s functionality shall be conducted at least once a year (the record of the annual test of the speed-reducing switch system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - g. A successful test of the traction monitoring system’s functionality shall be conducted at least once a year (the record of the annual test of the traction monitoring system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - h. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the maintenance, inspection, and testing of the speed-reducing switch and traction monitoring systems. The Applicant shall make the procedures available to Cal/OSHA upon

request.

12. The speed governor rope and sheaves shall comply with the following:

- a. The governor shall be used in conjunction with a 6 mm (0.25 in.) diameter steel governor rope with 6-strand, regular lay construction.
- b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
- c. The governor sheaves shall have a pitch diameter of not less than 180 mm (7.1 in.).

13. All medical emergency service elevators shall comply with the following:

- a. The requirements of the 2019 California Building Code (CBC), section 3002.4.1a;

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5inch (127 mm) radius corners] in the horizontal, open position.

- b. All medical emergency service elevators shall be identified in the building construction documents in accordance with the 2019 CBC, section 3002.4a.
- c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).

- 14. The elevator shall be serviced, maintained, adjusted, tested, and inspected only by Certified Competent Conveyance Mechanics who have been trained to, and are competent to, perform those tasks on the Gen3 Edge/Gen2S/Gen3 Core elevator system in accordance with the written procedures and criteria required by Condition No. 3 and in accordance with the terms of this permanent variance.
- 15. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing, or testing of the elevators shall be provided a copy of this variance decision.
- 16. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and a Permit to Operate shall be issued before the elevator is placed in service.
- 17. The Applicant shall be subject to the Suspension Means – Replacement Reporting Condition stated in Addendum 2, as hereby incorporated by this reference.
- 18. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications.
- 19. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in

accordance with the Board's procedural regulations at section 426, subdivision (b).

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 29, 2026



Kelly Chau, Hearing Officer

ADDENDUM 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and, Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA-Elevator Unit HQS

ADDENDUM 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Otis Medical Emergency Elevator Car Dimensions

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-297	Sadeghian Rentals VB LLC	18171 Van Buren Blvd Riverside, CA	

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Dan Leacox, with Leacox & Associates, and Wolter Geesink with Otis Elevator Company appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact and Applicable Regulations

1. Applicant requests a permanent variance from section 3041, subdivision (e)(1)(C), which states:

(1) All buildings and structures constructed after the effective date of this order that are provided with one or more passenger elevators shall be provided with not less than one passenger elevator designed and designated to accommodate the loading and transport of an ambulance gurney or stretcher maximum size 22 ½ in. (572 mm) by 75 in. (1.90 m) in its horizontal position and arranged to serve all landings in conformance with the following:

...

(C) The elevator car shall have a minimum inside car platform of 80 in. (2.03 m) wide by 51 in. (1.30 m) deep.

The intent of this language is to ensure that there is enough space to accommodate the access and egress of a gurney and medical personnel inside of a medical service elevator.

This standard is made applicable to Group IV by section 3141.7, subdivision (b), which reads, "Elevators utilized to provide medical emergency service shall comply with Group II, section 3041(e)."

2. Applicant proposes to comply with the requirements of the 2019 California Building Code, section 3002.4.1a in the design of its medical emergency service elevator. That section requires:

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5-inch (127 mm) radius corners] in the horizontal, open position.

The purpose of this requirement is to ensure that an elevator designated for emergency medical service will accommodate a minimum of two emergency personnel with an ambulance gurney or stretcher.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A.1 table shall have permanent variances from sections 3041, subdivision (e)(1)(C) and 3141.7, subdivision (b) subject of the following conditions:


1. All medical emergency service elevator(s) shall comply with the requirements of the 2019 California Building Code section 3002.4.1a:

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5-inch (127 mm) radius corners] in the horizontal, open position.

2. All medical emergency service elevator(s) shall be identified in the building construction documents in accordance with the 2019 California Building Code, section 3002.4a.
3. Dimensional drawings and other information necessary to demonstrate compliance with the conditions of this permanent variance decision shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).
4. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing, or testing the elevators shall be provided a copy of this variance decision.
5. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and all applicable requirements met, including conditions of this permanent variance, prior to a Permit to Operate the elevator being issued. The elevator shall not be placed in service prior to the Permit to Operate being issued by Cal/OSHA.
6. Applicant shall notify its employees and their authorized representative, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications pursuant to sections 411.2 and 411.3.
7. This Decision and Order shall remain in effect unless duly modified or revoked upon application by Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in accordance with then in effect administrative procedures of the Board.

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 29, 2026

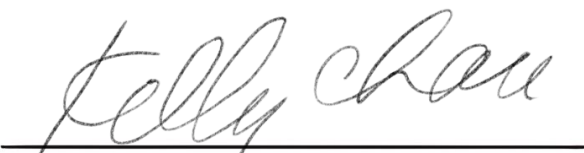

Kelly Chau, Hearing Officer

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Otis Gen2S/Gen3Edge/Gen3 Core Elevator & Medical Emergency Car Dimensions

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-298	City of Santa Cruz	Garage 210 Cathcart St. Santa Cruz, CA	1

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Dan Leacox, with Leacox & Associates, and Wolter Geesink with Otis Elevator Company appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table

PD2	OSHSB Notice of Hearing
PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each Applicant intends to utilize Otis Gen3 Edge/Gen2S/Gen3 Core elevators at the locations and in the numbers stated in the above section A.1 table. Applicant may utilize the variance from minimum inside car platform dimensions for other elevators designated for emergency medical service at the same variance location.
2. The installation contracts for these elevators were or will be signed on or after May 1, 2008, making the elevators subject to the Group IV Elevator Safety Orders.
3. The Board incorporates by reference the relevant findings in previous Board decisions:
 - a. Items D.3 through D.9 of the Proposed Decision adopted by the Board on July 18, 2013 for Permanent Variance No. 12-V-093;
 - b. Item D.4 of the Proposed Decision adopted by the Board on September 25, 2014 for Permanent Variance No. 14-V-206;
 - c. Item B of the Proposed Decision adopted by the Board on September 15, 2022 for Permanent Variance No. 22-V-302 regarding medical emergency car dimensions; and
 - d. Items C and D of the Proposed Decision adopted by the Board on June 20, 2024 for Permanent Variance No. 24-V-193 regarding the Gen3 Core elevator equivalent safety.
4. Cal/OSHA, by way of written submissions to the record (Exhibit PD-3), and position stated at hearing, is of the well informed opinion that grant of requested permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment, and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the Elevator Safety Order requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A table shall have permanent variances from the following sections of ASME A17.1-2004 that section 3141 makes applicable to the elevators the

subject of those applications:

- **Car top railing:** sections 2.14.1.7.1 (to permit an inset car top railing, if, in fact, the car top railing is inset);
- **Speed governor over-speed switch:** 2.18.4.2.5(a) (to permit the use of the speed reducing system proposed by the Applicants, where the speed reducing switch resides in the controller algorithms, rather than on the governor, with the necessary speed input supplied by the main encoder signal from the motor);
- **Governor rope diameter:** 2.18.5.1 (to allow the use of reduced diameter governor rope);
- **Pitch diameter:** 2.18.7.4 (to permit the use of the speed-reducing system proposed by the Applicant, where the rope sheave pitch diameter is not less than 180 mm [7.1 in.]);
- **Suspension means:** 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4 and 2.20.9.5.4—the variances from these “suspension means” provisions to permit the use of Otis Gen2 flat coated steel suspension belts in lieu of conventional steel suspension ropes;
- **Inspection transfer switch:** 2.26.1.4.4(a) (to allow the inspection transfer switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room); and
- **Seismic reset switch:** 8.4.10.1.1(a)(2)(b) (to allow the seismic reset switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room).
- **Minimum Inside Car Platform Dimensions:** 3041(e)(1)(C) and 3141.7(b) (to comply with the performance-based requirements of the 2019 California Building Code section 3002.4.1a)

These variances apply to the locations and numbers of elevators stated in the section A table (so long as the elevators are Gen3 Edge/Gen2S Group and Gen3 Core & Medical Emergency Elevator Car Dimensions (Group IV) that are designed, equipped, and installed in accordance with, and are otherwise consistent with, and are subject to the following conditions:

1. The suspension system shall comply with the following:
 - a. The coated steel belt and connections shall have factors of safety equal to those permitted for use by section 3141 [ASME A17.1-2004, section 2.20.3] on wire rope suspended elevators.
 - b. Steel coated belts that have been installed and used on another installation shall not be reused.
 - c. The coated steel belt shall be fitted with a monitoring device which has been accepted by Cal/OSHA and which will automatically stop the car if the residual strength of any single belt drops below 60 percent. If the residual strength of any single belt drops below 60 percent, the device shall prevent the elevator from restarting after a normal stop at a landing.
 - d. Upon initial inspection, the readings from the monitoring device shall be documented and submitted to Cal/OSHA.
 - e. A successful test of the monitoring device’s functionality shall be conducted at least once a year (the record of the annual test of the monitoring device shall be a maintenance

record subject to ASME A17.1-2004, section 8.6.1.4).

- f. The coated steel belts used shall be accepted by Cal/OSHA.
2. With respect to each elevator subject to this variance, the applicant shall comply with Cal/OSHA Circular Letter E-10-04, the substance of which is attached hereto as Addendum 1 and incorporated herein by this reference.
3. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection, and testing of the belts and monitoring device and criteria for belt replacement, and the applicant shall make those procedures and criteria available to Cal/OSHA upon request.
4. The flat coated steel belts shall be provided with a metal data tag that is securely attached to one of those belts. This data tag shall bear the following flat steel coated belt data:
 - a. The width and thickness in millimeters or inches;
 - b. The manufacturer's rated breaking strength in (kN) or (lbf);
 - c. The name of the person or organization that installed the flat coated steel belts;
 - d. The month and year the flat coated steel belts were installed;
 - e. The month and year the flat coated steel belts were first shortened;
 - f. The name or trademark of the manufacturer of the flat coated steel belts; and
 - g. Lubrication information.
5. There shall be a crosshead data plate of the sort required by section 2.20.2.1, and that plate shall bear the following flat steel coated belt data:
 - a. The number of belts;
 - b. The belt width and thickness in millimeters or inches; and
 - c. The manufacturer's rated breaking strength per belt in (kN) or (lbf).
6. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of elevator equipment in the hoistway is required. If service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
7. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on railings to perform adjustment, maintenance, repairs or inspections. The applicant shall not permit anyone to stand on or climb over the car top railing.
 - b. The distance that the car top railing may be inset shall be limited to no more than 6 inches.
 - c. All exposed areas outside the car top railing shall preclude standing or placing objects or persons which may fall and shall be beveled from the mid- or top rail to the outside of the car top.

- d. The top of the beveled area and/or car top outside the railing, shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
- e. The applicant shall provide durable signs with lettering not less than ½ inch on a contrasting background on each inset railing; each sign shall state:

CAUTION
DO NOT STAND ON OR CLIMB OVER RAILING

- f. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing shall be measured from the car top and not from the required bevel).
-
- 8. If the seismic reset switch does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
 - 9. If the inspection transfer switch required by ASME A17.1, rule 2.26.1.4.4(a) does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
 - 10. When the inspection and testing panel is located in the hoistway door jamb, the inspection and test control panel shall be openable only by use of a Security Group I restricted key.
 - 11. The governor speed-reducing switch function shall comply with the following:
 - a. It shall be used only with direct drive machines; i.e., no gear reduction is permitted between the drive motor and the suspension means.
 - b. The velocity encoder shall be coupled to the driving machine motor shaft. The “C” channel of the encoder shall be utilized for velocity measurements required by the speed reducing system. The signal from “C” channel of the encoder shall be verified with the “A” and “B” channels for failure. If a failure is detected then an emergency stop shall be initiated.
 - c. Control system parameters utilized in the speed-reducing system shall be held in non-volatile memory.
 - d. It shall be used in conjunction with approved car-mounted speed governors only.
 - e. It shall be used in conjunction with an effective traction monitoring system that detects a loss of traction between the driving sheave and the suspension means. If a loss of traction is detected, then an emergency stop shall be initiated.
 - f. A successful test of the speed-reducing switch system’s functionality shall be conducted at least once a year (the record of the annual test of the speed-reducing switch system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - g. A successful test of the traction monitoring system’s functionality shall be conducted at least once a year (the record of the annual test of the traction monitoring system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).

- h. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the maintenance, inspection, and testing of the speed-reducing switch and traction monitoring systems. The Applicant shall make the procedures available to Cal/OSHA upon request.

12. The speed governor rope and sheaves shall comply with the following:

- a. The governor shall be used in conjunction with a 6 mm (0.25 in.) diameter steel governor rope with 6-strand, regular lay construction.
- b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
- c. The governor sheaves shall have a pitch diameter of not less than 180 mm (7.1 in.).

13. All medical emergency service elevators shall comply with the following:

- a. The requirements of the 2019 California Building Code (CBC), section 3002.4.1a;

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5inch (127 mm) radius corners] in the horizontal, open position.

- b. All medical emergency service elevators shall be identified in the building construction documents in accordance with the 2019 CBC, section 3002.4a.
- c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).

- 14. The elevator shall be serviced, maintained, adjusted, tested, and inspected only by Certified Competent Conveyance Mechanics who have been trained to, and are competent to, perform those tasks on the Gen3 Edge/Gen2S/Gen3 Core elevator system in accordance with the written procedures and criteria required by Condition No. 3 and in accordance with the terms of this permanent variance.
- 15. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing, or testing of the elevators shall be provided a copy of this variance decision.
- 16. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and a Permit to Operate shall be issued before the elevator is placed in service.
- 17. The Applicant shall be subject to the Suspension Means – Replacement Reporting Condition stated in Addendum 2, as hereby incorporated by this reference.
- 18. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives

are to be notified of docketed permanent variance applications.

19. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in accordance with the Board's procedural regulations at section 426, subdivision (b).

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 29, 2026



Kelly Chau, Hearing Officer

ADDENDUM 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and, Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA-Elevator Unit HQS

ADDENDUM 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Otis Gen2S/Gen3Edge/Gen3 Core Elevator & Medical Emergency Car Dimensions

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-299	City of Santa Cruz	600 Ceder St. Santa Cruz, CA	1

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Dan Leacox, with Leacox & Associates, and Wolter Geesink with Otis Elevator Company appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each Applicant intends to utilize Otis Gen3 Edge/Gen2S/Gen3 Core elevators at the locations and in the numbers stated in the above section A.1 table. Applicant may utilize the variance from minimum inside car platform dimensions for other elevators designated for emergency medical service at the same variance location.
2. The installation contracts for these elevators were or will be signed on or after May 1, 2008, making the elevators subject to the Group IV Elevator Safety Orders.
3. The Board incorporates by reference the relevant findings in previous Board decisions:
 - a. Items D.3 through D.9 of the Proposed Decision adopted by the Board on July 18, 2013 for Permanent Variance No. 12-V-093;
 - b. Item D.4 of the Proposed Decision adopted by the Board on September 25, 2014 for Permanent Variance No. 14-V-206;
 - c. Item B of the Proposed Decision adopted by the Board on September 15, 2022 for Permanent Variance No. 22-V-302 regarding medical emergency car dimensions; and
 - d. Items C and D of the Proposed Decision adopted by the Board on June 20, 2024 for Permanent Variance No. 24-V-193 regarding the Gen3 Core elevator equivalent safety.
4. Cal/OSHA, by way of written submissions to the record (Exhibit PD-3), and position stated at hearing, is of the well informed opinion that grant of requested permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment, and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the Elevator Safety Order requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A table shall have permanent variances from the following sections of ASME A17.1-2004 that section 3141 makes applicable to the elevators the subject of those applications:

- **Car top railing:** sections 2.14.1.7.1 (to permit an inset car top railing, if, in fact, the car top railing is inset);
- **Speed governor over-speed switch:** 2.18.4.2.5(a) (to permit the use of the speed reducing system proposed by the Applicants, where the speed reducing switch resides in the controller algorithms, rather than on the governor, with the necessary speed input supplied by the main encoder signal from the motor);
- **Governor rope diameter:** 2.18.5.1 (to allow the use of reduced diameter governor rope);
- **Pitch diameter:** 2.18.7.4 (to permit the use of the speed-reducing system proposed by the Applicant, where the rope sheave pitch diameter is not less than 180 mm [7.1 in.]);
- **Suspension means:** 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4 and 2.20.9.5.4—the variances from these “suspension means” provisions to permit the use of Otis Gen2 flat coated steel suspension belts in lieu of conventional steel suspension ropes;
- **Inspection transfer switch:** 2.26.1.4.4(a) (to allow the inspection transfer switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room); and
- **Seismic reset switch:** 8.4.10.1.1(a)(2)(b) (to allow the seismic reset switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room).
- **Minimum Inside Car Platform Dimensions:** 3041(e)(1)(C) and 3141.7(b) (to comply with the performance-based requirements of the 2019 California Building Code section 3002.4.1a)

These variances apply to the locations and numbers of elevators stated in the section A table (so long as the elevators are Gen3 Edge/Gen2S Group and Gen3 Core & Medical Emergency Elevator Car Dimensions (Group IV) that are designed, equipped, and installed in accordance with, and are otherwise consistent with, and are subject to the following conditions:

1. The suspension system shall comply with the following:
 - a. The coated steel belt and connections shall have factors of safety equal to those permitted for use by section 3141 [ASME A17.1-2004, section 2.20.3] on wire rope suspended elevators.
 - b. Steel coated belts that have been installed and used on another installation shall not be reused.
 - c. The coated steel belt shall be fitted with a monitoring device which has been accepted by Cal/OSHA and which will automatically stop the car if the residual strength of any single belt drops below 60 percent. If the residual strength of any single belt drops below 60 percent, the device shall prevent the elevator from restarting after a normal stop at a landing.
 - d. Upon initial inspection, the readings from the monitoring device shall be documented and submitted to Cal/OSHA.
 - e. A successful test of the monitoring device’s functionality shall be conducted at least once a year (the record of the annual test of the monitoring device shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - f. The coated steel belts used shall be accepted by Cal/OSHA.

2. With respect to each elevator subject to this variance, the applicant shall comply with Cal/OSHA Circular Letter E-10-04, the substance of which is attached hereto as Addendum 1 and incorporated herein by this reference.
3. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection, and testing of the belts and monitoring device and criteria for belt replacement, and the applicant shall make those procedures and criteria available to Cal/OSHA upon request.
4. The flat coated steel belts shall be provided with a metal data tag that is securely attached to one of those belts. This data tag shall bear the following flat steel coated belt data:
 - a. The width and thickness in millimeters or inches;
 - b. The manufacturer's rated breaking strength in (kN) or (lbf);
 - c. The name of the person or organization that installed the flat coated steel belts;
 - d. The month and year the flat coated steel belts were installed;
 - e. The month and year the flat coated steel belts were first shortened;
 - f. The name or trademark of the manufacturer of the flat coated steel belts; and
 - g. Lubrication information.
5. There shall be a crosshead data plate of the sort required by section 2.20.2.1, and that plate shall bear the following flat steel coated belt data:
 - a. The number of belts;
 - b. The belt width and thickness in millimeters or inches; and
 - c. The manufacturer's rated breaking strength per belt in (kN) or (lbf).
6. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of elevator equipment in the hoistway is required. If service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
7. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on railings to perform adjustment, maintenance, repairs or inspections. The applicant shall not permit anyone to stand on or climb over the car top railing.
 - b. The distance that the car top railing may be inset shall be limited to no more than 6 inches.
 - c. All exposed areas outside the car top railing shall preclude standing or placing objects or persons which may fall and shall be beveled from the mid- or top rail to the outside of the car top.
 - d. The top of the beveled area and/or car top outside the railing, shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
 - e. The applicant shall provide durable signs with lettering not less than ½ inch on a

contrasting background on each inset railing; each sign shall state:

**CAUTION
DO NOT STAND ON OR CLIMB OVER RAILING**

- f. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing shall be measured from the car top and not from the required bevel).
- 8. If the seismic reset switch does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
- 9. If the inspection transfer switch required by ASME A17.1, rule 2.26.1.4.4(a) does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
- 10. When the inspection and testing panel is located in the hoistway door jamb, the inspection and test control panel shall be openable only by use of a Security Group I restricted key.
- 11. The governor speed-reducing switch function shall comply with the following:
 - a. It shall be used only with direct drive machines; i.e., no gear reduction is permitted between the drive motor and the suspension means.
 - b. The velocity encoder shall be coupled to the driving machine motor shaft. The “C” channel of the encoder shall be utilized for velocity measurements required by the speed reducing system. The signal from “C” channel of the encoder shall be verified with the “A” and “B” channels for failure. If a failure is detected then an emergency stop shall be initiated.
 - c. Control system parameters utilized in the speed-reducing system shall be held in non-volatile memory.
 - d. It shall be used in conjunction with approved car-mounted speed governors only.
 - e. It shall be used in conjunction with an effective traction monitoring system that detects a loss of traction between the driving sheave and the suspension means. If a loss of traction is detected, then an emergency stop shall be initiated.
 - f. A successful test of the speed-reducing switch system’s functionality shall be conducted at least once a year (the record of the annual test of the speed-reducing switch system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - g. A successful test of the traction monitoring system’s functionality shall be conducted at least once a year (the record of the annual test of the traction monitoring system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - h. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the maintenance, inspection, and testing of the speed-reducing switch and traction monitoring systems. The Applicant shall make the procedures available to Cal/OSHA upon

request.

12. The speed governor rope and sheaves shall comply with the following:

- a. The governor shall be used in conjunction with a 6 mm (0.25 in.) diameter steel governor rope with 6-strand, regular lay construction.
- b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
- c. The governor sheaves shall have a pitch diameter of not less than 180 mm (7.1 in.).

13. All medical emergency service elevators shall comply with the following:

- a. The requirements of the 2019 California Building Code (CBC), section 3002.4.1a;

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5inch (127 mm) radius corners] in the horizontal, open position.

- b. All medical emergency service elevators shall be identified in the building construction documents in accordance with the 2019 CBC, section 3002.4a.
- c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).

- 14. The elevator shall be serviced, maintained, adjusted, tested, and inspected only by Certified Competent Conveyance Mechanics who have been trained to, and are competent to, perform those tasks on the Gen3 Edge/Gen2S/Gen3 Core elevator system in accordance with the written procedures and criteria required by Condition No. 3 and in accordance with the terms of this permanent variance.
- 15. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing, or testing of the elevators shall be provided a copy of this variance decision.
- 16. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and a Permit to Operate shall be issued before the elevator is placed in service.
- 17. The Applicant shall be subject to the Suspension Means – Replacement Reporting Condition stated in Addendum 2, as hereby incorporated by this reference.
- 18. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications.
- 19. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in

accordance with the Board's procedural regulations at section 426, subdivision (b).

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 29, 2026



Kelly Chau, Hearing Officer

ADDENDUM 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and, Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA-Elevator Unit HQS

ADDENDUM 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Otis Gen2S/Gen3Edge/Gen3 Core Elevator & Medical Emergency Car Dimensions

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-300	City of Santa Cruz	Library 700 Cedar St. Santa Cruz, CA	1

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Dan Leacox, with Leacox & Associates, and Wolter Geesink with Otis Elevator Company appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table

PD2	OSHSB Notice of Hearing
PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each Applicant intends to utilize Otis Gen3 Edge/Gen2S/Gen3 Core elevators at the locations and in the numbers stated in the above section A.1 table. Applicant may utilize the variance from minimum inside car platform dimensions for other elevators designated for emergency medical service at the same variance location.
2. The installation contracts for these elevators were or will be signed on or after May 1, 2008, making the elevators subject to the Group IV Elevator Safety Orders.
3. The Board incorporates by reference the relevant findings in previous Board decisions:
 - a. Items D.3 through D.9 of the Proposed Decision adopted by the Board on July 18, 2013 for Permanent Variance No. 12-V-093;
 - b. Item D.4 of the Proposed Decision adopted by the Board on September 25, 2014 for Permanent Variance No. 14-V-206;
 - c. Item B of the Proposed Decision adopted by the Board on September 15, 2022 for Permanent Variance No. 22-V-302 regarding medical emergency car dimensions; and
 - d. Items C and D of the Proposed Decision adopted by the Board on June 20, 2024 for Permanent Variance No. 24-V-193 regarding the Gen3 Core elevator equivalent safety.
4. Cal/OSHA, by way of written submissions to the record (Exhibit PD-3), and position stated at hearing, is of the well informed opinion that grant of requested permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment, and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the Elevator Safety Order requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A table shall have permanent variances from the following sections of ASME A17.1-2004 that section 3141 makes applicable to the elevators the

subject of those applications:

- **Car top railing:** sections 2.14.1.7.1 (to permit an inset car top railing, if, in fact, the car top railing is inset);
- **Speed governor over-speed switch:** 2.18.4.2.5(a) (to permit the use of the speed reducing system proposed by the Applicants, where the speed reducing switch resides in the controller algorithms, rather than on the governor, with the necessary speed input supplied by the main encoder signal from the motor);
- **Governor rope diameter:** 2.18.5.1 (to allow the use of reduced diameter governor rope);
- **Pitch diameter:** 2.18.7.4 (to permit the use of the speed-reducing system proposed by the Applicant, where the rope sheave pitch diameter is not less than 180 mm [7.1 in.]);
- **Suspension means:** 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4 and 2.20.9.5.4—the variances from these “suspension means” provisions to permit the use of Otis Gen2 flat coated steel suspension belts in lieu of conventional steel suspension ropes;
- **Inspection transfer switch:** 2.26.1.4.4(a) (to allow the inspection transfer switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room); and
- **Seismic reset switch:** 8.4.10.1.1(a)(2)(b) (to allow the seismic reset switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room).
- **Minimum Inside Car Platform Dimensions:** 3041(e)(1)(C) and 3141.7(b) (to comply with the performance-based requirements of the 2019 California Building Code section 3002.4.1a)

These variances apply to the locations and numbers of elevators stated in the section A table (so long as the elevators are Gen3 Edge/Gen2S Group and Gen3 Core & Medical Emergency Elevator Car Dimensions (Group IV) that are designed, equipped, and installed in accordance with, and are otherwise consistent with, and are subject to the following conditions:

1. The suspension system shall comply with the following:
 - a. The coated steel belt and connections shall have factors of safety equal to those permitted for use by section 3141 [ASME A17.1-2004, section 2.20.3] on wire rope suspended elevators.
 - b. Steel coated belts that have been installed and used on another installation shall not be reused.
 - c. The coated steel belt shall be fitted with a monitoring device which has been accepted by Cal/OSHA and which will automatically stop the car if the residual strength of any single belt drops below 60 percent. If the residual strength of any single belt drops below 60 percent, the device shall prevent the elevator from restarting after a normal stop at a landing.
 - d. Upon initial inspection, the readings from the monitoring device shall be documented and submitted to Cal/OSHA.
 - e. A successful test of the monitoring device’s functionality shall be conducted at least once a year (the record of the annual test of the monitoring device shall be a maintenance

record subject to ASME A17.1-2004, section 8.6.1.4).

- f. The coated steel belts used shall be accepted by Cal/OSHA.
2. With respect to each elevator subject to this variance, the applicant shall comply with Cal/OSHA Circular Letter E-10-04, the substance of which is attached hereto as Addendum 1 and incorporated herein by this reference.
3. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection, and testing of the belts and monitoring device and criteria for belt replacement, and the applicant shall make those procedures and criteria available to Cal/OSHA upon request.
4. The flat coated steel belts shall be provided with a metal data tag that is securely attached to one of those belts. This data tag shall bear the following flat steel coated belt data:
 - a. The width and thickness in millimeters or inches;
 - b. The manufacturer's rated breaking strength in (kN) or (lbf);
 - c. The name of the person or organization that installed the flat coated steel belts;
 - d. The month and year the flat coated steel belts were installed;
 - e. The month and year the flat coated steel belts were first shortened;
 - f. The name or trademark of the manufacturer of the flat coated steel belts; and
 - g. Lubrication information.
5. There shall be a crosshead data plate of the sort required by section 2.20.2.1, and that plate shall bear the following flat steel coated belt data:
 - a. The number of belts;
 - b. The belt width and thickness in millimeters or inches; and
 - c. The manufacturer's rated breaking strength per belt in (kN) or (lbf).
6. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of elevator equipment in the hoistway is required. If service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
7. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on railings to perform adjustment, maintenance, repairs or inspections. The applicant shall not permit anyone to stand on or climb over the car top railing.
 - b. The distance that the car top railing may be inset shall be limited to no more than 6 inches.
 - c. All exposed areas outside the car top railing shall preclude standing or placing objects or persons which may fall and shall be beveled from the mid- or top rail to the outside of the car top.

- d. The top of the beveled area and/or car top outside the railing, shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
- e. The applicant shall provide durable signs with lettering not less than ½ inch on a contrasting background on each inset railing; each sign shall state:

CAUTION
DO NOT STAND ON OR CLIMB OVER RAILING

- f. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing shall be measured from the car top and not from the required bevel).
-
- 8. If the seismic reset switch does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
 - 9. If the inspection transfer switch required by ASME A17.1, rule 2.26.1.4.4(a) does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
 - 10. When the inspection and testing panel is located in the hoistway door jamb, the inspection and test control panel shall be openable only by use of a Security Group I restricted key.
 - 11. The governor speed-reducing switch function shall comply with the following:
 - a. It shall be used only with direct drive machines; i.e., no gear reduction is permitted between the drive motor and the suspension means.
 - b. The velocity encoder shall be coupled to the driving machine motor shaft. The “C” channel of the encoder shall be utilized for velocity measurements required by the speed reducing system. The signal from “C” channel of the encoder shall be verified with the “A” and “B” channels for failure. If a failure is detected then an emergency stop shall be initiated.
 - c. Control system parameters utilized in the speed-reducing system shall be held in non-volatile memory.
 - d. It shall be used in conjunction with approved car-mounted speed governors only.
 - e. It shall be used in conjunction with an effective traction monitoring system that detects a loss of traction between the driving sheave and the suspension means. If a loss of traction is detected, then an emergency stop shall be initiated.
 - f. A successful test of the speed-reducing switch system’s functionality shall be conducted at least once a year (the record of the annual test of the speed-reducing switch system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - g. A successful test of the traction monitoring system’s functionality shall be conducted at least once a year (the record of the annual test of the traction monitoring system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).

- h. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the maintenance, inspection, and testing of the speed-reducing switch and traction monitoring systems. The Applicant shall make the procedures available to Cal/OSHA upon request.

12. The speed governor rope and sheaves shall comply with the following:

- a. The governor shall be used in conjunction with a 6 mm (0.25 in.) diameter steel governor rope with 6-strand, regular lay construction.
- b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
- c. The governor sheaves shall have a pitch diameter of not less than 180 mm (7.1 in.).

13. All medical emergency service elevators shall comply with the following:

- a. The requirements of the 2019 California Building Code (CBC), section 3002.4.1a;

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5inch (127 mm) radius corners] in the horizontal, open position.

- b. All medical emergency service elevators shall be identified in the building construction documents in accordance with the 2019 CBC, section 3002.4a.
- c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).

- 14. The elevator shall be serviced, maintained, adjusted, tested, and inspected only by Certified Competent Conveyance Mechanics who have been trained to, and are competent to, perform those tasks on the Gen3 Edge/Gen2S/Gen3 Core elevator system in accordance with the written procedures and criteria required by Condition No. 3 and in accordance with the terms of this permanent variance.
- 15. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing, or testing of the elevators shall be provided a copy of this variance decision.
- 16. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and a Permit to Operate shall be issued before the elevator is placed in service.
- 17. The Applicant shall be subject to the Suspension Means – Replacement Reporting Condition stated in Addendum 2, as hereby incorporated by this reference.
- 18. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives

are to be notified of docketed permanent variance applications.

19. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in accordance with the Board's procedural regulations at section 426, subdivision (b).

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 29, 2026



Kelly Chau, Hearing Officer

ADDENDUM 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and, Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA-Elevator Unit HQS

ADDENDUM 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Otis Gen2S/Gen3Edge/Gen3 Core Elevator & Medical Emergency Car Dimensions

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-301	San Francisco Public Utilities Commission Wastewater Enterprise (SFPUC WWE)	750 Phelps St., SEP 914 San Francisco, CA	1

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Dan Leacox, with Leacox & Associates, and Wolter Geesink with Otis Elevator Company appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table

PD2	OSHSB Notice of Hearing
PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each Applicant intends to utilize Otis Gen3 Edge/Gen2S/Gen3 Core elevators at the locations and in the numbers stated in the above section A.1 table. Applicant may utilize the variance from minimum inside car platform dimensions for other elevators designated for emergency medical service at the same variance location.
2. The installation contracts for these elevators were or will be signed on or after May 1, 2008, making the elevators subject to the Group IV Elevator Safety Orders.
3. The Board incorporates by reference the relevant findings in previous Board decisions:
 - a. Items D.3 through D.9 of the Proposed Decision adopted by the Board on July 18, 2013 for Permanent Variance No. 12-V-093;
 - b. Item D.4 of the Proposed Decision adopted by the Board on September 25, 2014 for Permanent Variance No. 14-V-206;
 - c. Item B of the Proposed Decision adopted by the Board on September 15, 2022 for Permanent Variance No. 22-V-302 regarding medical emergency car dimensions; and
 - d. Items C and D of the Proposed Decision adopted by the Board on June 20, 2024 for Permanent Variance No. 24-V-193 regarding the Gen3 Core elevator equivalent safety.
4. Cal/OSHA, by way of written submissions to the record (Exhibit PD-3), and position stated at hearing, is of the well informed opinion that grant of requested permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment, and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the Elevator Safety Order requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A table shall have permanent variances from the

following sections of ASME A17.1-2004 that section 3141 makes applicable to the elevators the subject of those applications:

- **Car top railing:** sections 2.14.1.7.1 (to permit an inset car top railing, if, in fact, the car top railing is inset);
- **Speed governor over-speed switch:** 2.18.4.2.5(a) (to permit the use of the speed reducing system proposed by the Applicants, where the speed reducing switch resides in the controller algorithms, rather than on the governor, with the necessary speed input supplied by the main encoder signal from the motor);
- **Governor rope diameter:** 2.18.5.1 (to allow the use of reduced diameter governor rope);
- **Pitch diameter:** 2.18.7.4 (to permit the use of the speed-reducing system proposed by the Applicant, where the rope sheave pitch diameter is not less than 180 mm [7.1 in.]);
- **Suspension means:** 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4 and 2.20.9.5.4—the variances from these “suspension means” provisions to permit the use of Otis Gen2 flat coated steel suspension belts in lieu of conventional steel suspension ropes;
- **Inspection transfer switch:** 2.26.1.4.4(a) (to allow the inspection transfer switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room); and
- **Seismic reset switch:** 8.4.10.1.1(a)(2)(b) (to allow the seismic reset switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room).
- **Minimum Inside Car Platform Dimensions:** 3041(e)(1)(C) and 3141.7(b) (to comply with the performance-based requirements of the 2019 California Building Code section 3002.4.1a)

These variances apply to the locations and numbers of elevators stated in the section A table (so long as the elevators are Gen3 Edge/Gen2S Group and Gen3 Core & Medical Emergency Elevator Car Dimensions (Group IV) that are designed, equipped, and installed in accordance with, and are otherwise consistent with, and are subject to the following conditions:

1. The suspension system shall comply with the following:
 - a. The coated steel belt and connections shall have factors of safety equal to those permitted for use by section 3141 [ASME A17.1-2004, section 2.20.3] on wire rope suspended elevators.
 - b. Steel coated belts that have been installed and used on another installation shall not be reused.
 - c. The coated steel belt shall be fitted with a monitoring device which has been accepted by Cal/OSHA and which will automatically stop the car if the residual strength of any single belt drops below 60 percent. If the residual strength of any single belt drops below 60 percent, the device shall prevent the elevator from restarting after a normal stop at a landing.
 - d. Upon initial inspection, the readings from the monitoring device shall be documented and submitted to Cal/OSHA.
 - e. A successful test of the monitoring device’s functionality shall be conducted at least once

a year (the record of the annual test of the monitoring device shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).

- f. The coated steel belts used shall be accepted by Cal/OSHA.
2. With respect to each elevator subject to this variance, the applicant shall comply with Cal/OSHA Circular Letter E-10-04, the substance of which is attached hereto as Addendum 1 and incorporated herein by this reference.
3. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection, and testing of the belts and monitoring device and criteria for belt replacement, and the applicant shall make those procedures and criteria available to Cal/OSHA upon request.
4. The flat coated steel belts shall be provided with a metal data tag that is securely attached to one of those belts. This data tag shall bear the following flat steel coated belt data:
 - a. The width and thickness in millimeters or inches;
 - b. The manufacturer's rated breaking strength in (kN) or (lbf);
 - c. The name of the person or organization that installed the flat coated steel belts;
 - d. The month and year the flat coated steel belts were installed;
 - e. The month and year the flat coated steel belts were first shortened;
 - f. The name or trademark of the manufacturer of the flat coated steel belts; and
 - g. Lubrication information.
5. There shall be a crosshead data plate of the sort required by section 2.20.2.1, and that plate shall bear the following flat steel coated belt data:
 - a. The number of belts;
 - b. The belt width and thickness in millimeters or inches; and
 - c. The manufacturer's rated breaking strength per belt in (kN) or (lbf).
6. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of elevator equipment in the hoistway is required. If service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
7. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on railings to perform adjustment, maintenance, repairs or inspections. The applicant shall not permit anyone to stand on or climb over the car top railing.
 - b. The distance that the car top railing may be inset shall be limited to no more than 6 inches.
 - c. All exposed areas outside the car top railing shall preclude standing or placing objects or persons which may fall and shall be beveled from the mid- or top rail to the outside of the car top.

- d. The top of the beveled area and/or car top outside the railing, shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
- e. The applicant shall provide durable signs with lettering not less than ½ inch on a contrasting background on each inset railing; each sign shall state:

CAUTION
DO NOT STAND ON OR CLIMB OVER RAILING

- f. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing shall be measured from the car top and not from the required bevel).
-
- 8. If the seismic reset switch does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
 - 9. If the inspection transfer switch required by ASME A17.1, rule 2.26.1.4.4(a) does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
 - 10. When the inspection and testing panel is located in the hoistway door jamb, the inspection and test control panel shall be openable only by use of a Security Group I restricted key.
 - 11. The governor speed-reducing switch function shall comply with the following:
 - a. It shall be used only with direct drive machines; i.e., no gear reduction is permitted between the drive motor and the suspension means.
 - b. The velocity encoder shall be coupled to the driving machine motor shaft. The “C” channel of the encoder shall be utilized for velocity measurements required by the speed reducing system. The signal from “C” channel of the encoder shall be verified with the “A” and “B” channels for failure. If a failure is detected then an emergency stop shall be initiated.
 - c. Control system parameters utilized in the speed-reducing system shall be held in non-volatile memory.
 - d. It shall be used in conjunction with approved car-mounted speed governors only.
 - e. It shall be used in conjunction with an effective traction monitoring system that detects a loss of traction between the driving sheave and the suspension means. If a loss of traction is detected, then an emergency stop shall be initiated.
 - f. A successful test of the speed-reducing switch system’s functionality shall be conducted at least once a year (the record of the annual test of the speed-reducing switch system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - g. A successful test of the traction monitoring system’s functionality shall be conducted at least once a year (the record of the annual test of the traction monitoring system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).

- h. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the maintenance, inspection, and testing of the speed-reducing switch and traction monitoring systems. The Applicant shall make the procedures available to Cal/OSHA upon request.

12. The speed governor rope and sheaves shall comply with the following:

- a. The governor shall be used in conjunction with a 6 mm (0.25 in.) diameter steel governor rope with 6-strand, regular lay construction.
- b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
- c. The governor sheaves shall have a pitch diameter of not less than 180 mm (7.1 in.).

13. All medical emergency service elevators shall comply with the following:

- a. The requirements of the 2019 California Building Code (CBC), section 3002.4.1a;

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5inch (127 mm) radius corners] in the horizontal, open position.

- b. All medical emergency service elevators shall be identified in the building construction documents in accordance with the 2019 CBC, section 3002.4a.
- c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).


- 14. The elevator shall be serviced, maintained, adjusted, tested, and inspected only by Certified Competent Conveyance Mechanics who have been trained to, and are competent to, perform those tasks on the Gen3 Edge/Gen2S/Gen3 Core elevator system in accordance with the written procedures and criteria required by Condition No. 3 and in accordance with the terms of this permanent variance.
- 15. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing, or testing of the elevators shall be provided a copy of this variance decision.
- 16. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and a Permit to Operate shall be issued before the elevator is placed in service.
- 17. The Applicant shall be subject to the Suspension Means – Replacement Reporting Condition stated in Addendum 2, as hereby incorporated by this reference.
- 18. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives

are to be notified of docketed permanent variance applications.

19. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in accordance with the Board's procedural regulations at section 426, subdivision (b).

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 29, 2026

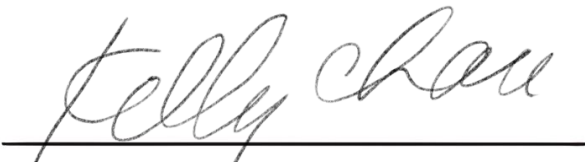

Kelly Chau, Hearing Officer

ADDENDUM 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and, Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA-Elevator Unit HQS

ADDENDUM 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Otis Gen2S/Gen3Edge/Gen3 Core Elevator & Medical Emergency Car Dimensions

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-302	Truly Redlands, LLC	425 West Colton Ave. Redlands, CA	2

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Dan Leacox, with Leacox & Associates, and Wolter Geesink with Otis Elevator Company appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each Applicant intends to utilize Otis Gen3 Edge/Gen2S/Gen3 Core elevators at the locations and in the numbers stated in the above section A.1 table. Applicant may utilize the variance from minimum inside car platform dimensions for other elevators designated for emergency medical service at the same variance location.
2. The installation contracts for these elevators were or will be signed on or after May 1, 2008, making the elevators subject to the Group IV Elevator Safety Orders.
3. The Board incorporates by reference the relevant findings in previous Board decisions:
 - a. Items D.3 through D.9 of the Proposed Decision adopted by the Board on July 18, 2013 for Permanent Variance No. 12-V-093;
 - b. Item D.4 of the Proposed Decision adopted by the Board on September 25, 2014 for Permanent Variance No. 14-V-206;
 - c. Item B of the Proposed Decision adopted by the Board on September 15, 2022 for Permanent Variance No. 22-V-302 regarding medical emergency car dimensions; and
 - d. Items C and D of the Proposed Decision adopted by the Board on June 20, 2024 for Permanent Variance No. 24-V-193 regarding the Gen3 Core elevator equivalent safety.
4. Cal/OSHA, by way of written submissions to the record (Exhibit PD-3), and position stated at hearing, is of the well informed opinion that grant of requested permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment, and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the Elevator Safety Order requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A table shall have permanent variances from the following sections of ASME A17.1-2004 that section 3141 makes applicable to the elevators the subject of those applications:

- **Car top railing:** sections 2.14.1.7.1 (to permit an inset car top railing, if, in fact, the car top railing is inset);
- **Speed governor over-speed switch:** 2.18.4.2.5(a) (to permit the use of the speed reducing system proposed by the Applicants, where the speed reducing switch resides in the controller algorithms, rather than on the governor, with the necessary speed input supplied by the main encoder signal from the motor);
- **Governor rope diameter:** 2.18.5.1 (to allow the use of reduced diameter governor rope);
- **Pitch diameter:** 2.18.7.4 (to permit the use of the speed-reducing system proposed by the Applicant, where the rope sheave pitch diameter is not less than 180 mm [7.1 in.]);
- **Suspension means:** 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4 and 2.20.9.5.4—the variances from these “suspension means” provisions to permit the use of Otis Gen2 flat coated steel suspension belts in lieu of conventional steel suspension ropes;
- **Inspection transfer switch:** 2.26.1.4.4(a) (to allow the inspection transfer switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room); and
- **Seismic reset switch:** 8.4.10.1.1(a)(2)(b) (to allow the seismic reset switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room).
- **Minimum Inside Car Platform Dimensions:** 3041(e)(1)(C) and 3141.7(b) (to comply with the performance-based requirements of the 2019 California Building Code section 3002.4.1a)

These variances apply to the locations and numbers of elevators stated in the section A table (so long as the elevators are Gen3 Edge/Gen2S Group and Gen3 Core & Medical Emergency Elevator Car Dimensions (Group IV) that are designed, equipped, and installed in accordance with, and are otherwise consistent with, and are subject to the following conditions:

1. The suspension system shall comply with the following:
 - a. The coated steel belt and connections shall have factors of safety equal to those permitted for use by section 3141 [ASME A17.1-2004, section 2.20.3] on wire rope suspended elevators.
 - b. Steel coated belts that have been installed and used on another installation shall not be reused.
 - c. The coated steel belt shall be fitted with a monitoring device which has been accepted by Cal/OSHA and which will automatically stop the car if the residual strength of any single belt drops below 60 percent. If the residual strength of any single belt drops below 60 percent, the device shall prevent the elevator from restarting after a normal stop at a landing.
 - d. Upon initial inspection, the readings from the monitoring device shall be documented and submitted to Cal/OSHA.
 - e. A successful test of the monitoring device’s functionality shall be conducted at least once a year (the record of the annual test of the monitoring device shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - f. The coated steel belts used shall be accepted by Cal/OSHA.

2. With respect to each elevator subject to this variance, the applicant shall comply with Cal/OSHA Circular Letter E-10-04, the substance of which is attached hereto as Addendum 1 and incorporated herein by this reference.
3. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection, and testing of the belts and monitoring device and criteria for belt replacement, and the applicant shall make those procedures and criteria available to Cal/OSHA upon request.
4. The flat coated steel belts shall be provided with a metal data tag that is securely attached to one of those belts. This data tag shall bear the following flat steel coated belt data:
 - a. The width and thickness in millimeters or inches;
 - b. The manufacturer's rated breaking strength in (kN) or (lbf);
 - c. The name of the person or organization that installed the flat coated steel belts;
 - d. The month and year the flat coated steel belts were installed;
 - e. The month and year the flat coated steel belts were first shortened;
 - f. The name or trademark of the manufacturer of the flat coated steel belts; and
 - g. Lubrication information.
5. There shall be a crosshead data plate of the sort required by section 2.20.2.1, and that plate shall bear the following flat steel coated belt data:
 - a. The number of belts;
 - b. The belt width and thickness in millimeters or inches; and
 - c. The manufacturer's rated breaking strength per belt in (kN) or (lbf).
6. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of elevator equipment in the hoistway is required. If service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
7. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on railings to perform adjustment, maintenance, repairs or inspections. The applicant shall not permit anyone to stand on or climb over the car top railing.
 - b. The distance that the car top railing may be inset shall be limited to no more than 6 inches.
 - c. All exposed areas outside the car top railing shall preclude standing or placing objects or persons which may fall and shall be beveled from the mid- or top rail to the outside of the car top.
 - d. The top of the beveled area and/or car top outside the railing, shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
 - e. The applicant shall provide durable signs with lettering not less than ½ inch on a

contrasting background on each inset railing; each sign shall state:

**CAUTION
DO NOT STAND ON OR CLIMB OVER RAILING**

- f. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing shall be measured from the car top and not from the required bevel).
- 8. If the seismic reset switch does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
- 9. If the inspection transfer switch required by ASME A17.1, rule 2.26.1.4.4(a) does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
- 10. When the inspection and testing panel is located in the hoistway door jamb, the inspection and test control panel shall be openable only by use of a Security Group I restricted key.
- 11. The governor speed-reducing switch function shall comply with the following:
 - a. It shall be used only with direct drive machines; i.e., no gear reduction is permitted between the drive motor and the suspension means.
 - b. The velocity encoder shall be coupled to the driving machine motor shaft. The “C” channel of the encoder shall be utilized for velocity measurements required by the speed reducing system. The signal from “C” channel of the encoder shall be verified with the “A” and “B” channels for failure. If a failure is detected then an emergency stop shall be initiated.
 - c. Control system parameters utilized in the speed-reducing system shall be held in non-volatile memory.
 - d. It shall be used in conjunction with approved car-mounted speed governors only.
 - e. It shall be used in conjunction with an effective traction monitoring system that detects a loss of traction between the driving sheave and the suspension means. If a loss of traction is detected, then an emergency stop shall be initiated.
 - f. A successful test of the speed-reducing switch system’s functionality shall be conducted at least once a year (the record of the annual test of the speed-reducing switch system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - g. A successful test of the traction monitoring system’s functionality shall be conducted at least once a year (the record of the annual test of the traction monitoring system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - h. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the maintenance, inspection, and testing of the speed-reducing switch and traction monitoring systems. The Applicant shall make the procedures available to Cal/OSHA upon

request.

12. The speed governor rope and sheaves shall comply with the following:

- a. The governor shall be used in conjunction with a 6 mm (0.25 in.) diameter steel governor rope with 6-strand, regular lay construction.
- b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
- c. The governor sheaves shall have a pitch diameter of not less than 180 mm (7.1 in.).

13. All medical emergency service elevators shall comply with the following:

- a. The requirements of the 2019 California Building Code (CBC), section 3002.4.1a;

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5inch (127 mm) radius corners] in the horizontal, open position.

- b. All medical emergency service elevators shall be identified in the building construction documents in accordance with the 2019 CBC, section 3002.4a.
- c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).

- 14. The elevator shall be serviced, maintained, adjusted, tested, and inspected only by Certified Competent Conveyance Mechanics who have been trained to, and are competent to, perform those tasks on the Gen3 Edge/Gen2S/Gen3 Core elevator system in accordance with the written procedures and criteria required by Condition No. 3 and in accordance with the terms of this permanent variance.
- 15. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing, or testing of the elevators shall be provided a copy of this variance decision.
- 16. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and a Permit to Operate shall be issued before the elevator is placed in service.
- 17. The Applicant shall be subject to the Suspension Means – Replacement Reporting Condition stated in Addendum 2, as hereby incorporated by this reference.
- 18. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications.
- 19. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in

accordance with the Board's procedural regulations at section 426, subdivision (b).

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 29, 2026



Kelly Chau, Hearing Officer

ADDENDUM 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and, Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA-Elevator Unit HQS

ADDENDUM 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Schindler Model 3300 Elevators, w/variant Gov. Ropes and Sheaves (Group IV)

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-303	2270 Mckinnon LLC	2270 Mckinnon Ave San Francisco CA	2

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Pete Cuellar, with SCHINDLER ELEVATOR CORPORATION, appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each respective Applicant intends to utilize Schindler model 3300 MRL elevator cars, in the quantity, at the locations specified in Jurisdictional and Procedural Matters, section 1.
2. The installation contract for these elevators was or will be signed on or after May 1, 2008, thus making the elevator subject to the Group IV Elevator Safety Orders.
3. The Schindler model 3300 MRL elevator cars are not supported by circular steel wire ropes, as required by the Elevator Safety Orders. They utilize non circular elastomeric coated steel belts and specialized suspension means fastenings.
4. No machine room is provided, preventing the inspection transfer switch from being located in the elevator machine room. The lack of machine room also prevents the seismic reset switch from being located in the elevator machine room.
5. Applicant proposes to relocate the inspection transfer switch and seismic reset switch in an alternative enclosure.
6. Due to the use of a 6 mm (0.25 in.) governor rope with 6-strand construction, the provided governor sheave pitch diameter is less than that required by the Elevator Safety Orders.
7. The driving machine and governor are positioned in the hoistway and restrict the required overhead clearance to the elevator car top.
8. Applicant proposes to insert the car top railings at the perimeter of the car top.
9. Applicant intends to use an elevator control system, model CO NX100NA or CO NX300NA, with a standalone, solid state motor control drive system that includes devices and circuits having a Safety Integrity Level (SIL) rating to execute specific elevator safety functions.

D. Relevant Safety Order Provisions

Applicant seeks a permanent variance from section 3141 [ASME A17.1-2004, sections 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4, 2.20.9.5.4, 2.26.1.4.4(a), 8.4.10.1.1(a)(2)(b), 2.14.1.7.1, 2.18.7.4, and 2.26.9.6.1] of the Elevator Safety Orders, with respect to the suspension ropes and connections, inspection transfer switch relocation, seismic reset switch relocation, the location and construction of car-top railings, governor-sheave diameter, and means of removing power from the driving machine motor for one (1) Schindler model 3300 MRL elevator.

The relevant language of those sections are below.

1. Suspension Means

- Section 3141 [ASME A17.1-2004, section 2.20.1, Suspension Means] states in part:

- Elevator cars shall be suspended by steel wire ropes attached to the car frame or passing around sheaves attached to the car frame specified in 2.15.1. Ropes that have previously been installed and used on another installation shall not be reused. Only iron (low carbon steel) or steel wire ropes, having the commercial classification “Elevator Wire Rope,” or wire rope specifically constructed for elevator use, shall be used for the suspension of elevator cars and for the suspension of counterweights. The wire material for ropes shall be manufactured by the open hearth or electric furnace process, or their equivalent.
- Section 3141 [ASME A17.1-2004, section 2.20.2.1(b), On Crosshead Data Plate] states in part:
 - The crosshead data plate required by 2.16.3 shall bear the following wire rope data:
 - (b) the diameter in millimeters (mm) or inches (in.)
- Section 3141 [ASME A17.1-2004, section 2.20.2.2(a) and (f) On Rope Data Tag] states in part:
 - A metal data tag shall be securely attached to one of the wire rope fastenings. This data tag shall bear the following wire rope data:
 - (a) the diameter in millimeters (mm) or inches (in.)
 - [...]
 - (f) whether the ropes were non preformed or preformed
- Section 3141 [ASME A17.1-2004, section 2.20.3, Factor of Safety] states:
 - The factor of safety of the suspension wire ropes shall be not less than shown in Table 2.20.3. Figure 8.2.7 gives the minimum factor of safety for intermediate rope speeds. The factor of safety shall be based on the actual rope speed corresponding to the rated speed of the car.
 - The factor of safety shall be calculated by the following formula:

$$f = \frac{(S \times N)}{W}$$

- where:
 - N = number of runs of rope under load. For 2:1 roping, N shall be two times the number of ropes used, etc.
 - S = manufacturer's rated breaking strength of one rope
 - W = maximum static load imposed on all car ropes with the car and its rated load at any position in the hoistway

- Section 3141 [ASME A17.1-2004, section 2.20.4, Minimum Number and Diameter of Suspension Ropes] states:
 - The minimum number of hoisting ropes used shall be three for traction elevators and two for drum type elevators.
 - Where a car counterweight is used, the number of counterweight ropes used shall be not less than two.
 - The term “diameter,” where used in reference to ropes, shall refer to the nominal diameter as given by the rope manufacturer.
 - The minimum diameter of hoisting and counterweight ropes shall be 9.5 mm (0.375 in.). Outer wires of the ropes shall be not less than 0.56 mm (0.024 in.) in diameter.
- Section 3141 [ASME A17.1-2004, section 2.20.9.3.4] states:
 - Cast or forged steel rope sockets, shackle rods, and their connections shall be made of unwelded steel, having an elongation of not less than 20% in a gauge length of 50 mm (2 in.), when measured in accordance with ASTM E 8, and conforming to ASTM A 668, Class B for forged steel, and ASTM A 27, Grade 60/30 for cast steel, and shall be stress relieved. Steels of greater strength shall be permitted, provided they have an elongation of not less than 20% in a length of 50 mm (2 in.).
- Section 3141 [ASME A17.1-2004, section 2.20.9.5.4] states:
 - When the rope has been seated in the wedge socket by the load on the rope, the wedge shall be visible, and at least two wire rope retaining clips shall be provided to attach the termination side to the load carrying side of the rope (see Fig. 2.20.9.5). The first clip shall be placed a maximum of 4 times the rope diameter above the socket, and the second clip shall be located within 8 times the rope diameter above the first clip. The purpose of the two clips is to retain the wedge and prevent the rope from slipping in the socket should the load on the rope be removed for any reason. The clips shall be designed and installed so that they do not distort or damage the rope in any manner.

2. Requested Transfer Switch Placement Variance

- As it pertains to installation of the requisite transfer switch within a “machine room” location incompatible with machine-room-less design of the Schindler Model 3300 elevator, the Applicant presently seeks permanent variance from the following Elevator Safety Order incorporated ASME Code A17.1-2004, subsection:
 - Subsection 2.26.1.4.4(a)--Transfer Switch Placement in Machine Room
- Section 3141[ASME A17.1-2004, section 2.26.1.4.4(a), Machine Room Inspection Operation] states:
- When machine room inspection operation is provided, it shall conform to 2.26.1.4.1, and the transfer switch shall be
- (a) located in the machine room[.]

3. Requested Seismic Reset Switch Placement Variance

- As it pertains to installation of the requisite seismic reset switch within a “machine room” location incompatible with machine-room-less design of the Schindler Model 3300 elevator, the Applicant presently seeks permanent variance from the following Elevator Safety Order incorporated ASME Code subsection:
 - Subsection 8.4.10.1.1(a)(2)(b)--Seismic Reset Switch Placement in Machine Room
- Section 3141[ASME A17.1-2004, section 8.4.10.1.1(a)(2)(b), Earthquake Equipment] states:
 - (a) All traction elevators operating at a rated speed of 0.75 m/s (150 ft/min) or more and having counterweights located in the same hoistway shall be provided with the following:
 - (1) seismic zone 3 or greater: a minimum of one seismic switch per building
 - (2) seismic zone 2 or greater:
 - (a) a displacement switch for each elevator
 - (b) an identified momentary reset button or switch for each elevator, located in the control panel in the elevator machine room

4. Requested Car Top Railing Inset Variance

- As it pertains to top of car railing placement requiring space occupied by upper hoistway mounted elevator machinery characteristic of the Schindler Model 3300 elevator, the Applicant presently seeks permanent variance from the following Elevator Safety Order incorporated ASME Code A17.1-2004, section:
 - Section 2.14.1.7.1—Top of Car Perimeter Railing Placement
- Section 3141[ASME A17.1-2004, section 2.14.1.7.1] states:
 - A standard railing conforming to 2.10.2 shall be provided on the outside perimeter of the car top on all sides where the perpendicular distance between the edges of the car top and the adjacent hoistway enclosure exceeds 300 mm (12 in.) horizontal clearance.

5. Pitch Diameter of Governor Sheaves

- Section 3141 [ASME A17.1-2004, Section 2.18.7.4] states:
 - “The pitch diameter of governor sheaves and governor tension sheaves shall be not less than the product of the diameter of the rope and the applicable multiplier listed in Table 2.18.7.4, based on the rated speed and the number of strands in the rope.”

Table 2.18.7.4 Multiplier for Determining Governor Sheave Pitch Diameter
[from ASME A17.1-2004]

<u>Rated Speed m/s (ft./min)</u>	<u>Number of Strands</u>	<u>Multiplier</u>
1.00 or less (200 or less)	6	42
1.00 or less (200 or less)	8	30
Over 1.0 (over 200)	6	46
Over 1.0 (over 200)	8	32

6. SIL Rated System to Inhibit Current Flow to AC Drive Motor

- Section 3141[ASME A17.1-2004, section 2.26.9.6.1] states:
 - Two separate means shall be provided to independently inhibit the flow of alternating current through the solid state devices that connect the direct current power source to the alternating current driving motor. At least one of the means shall be an electromechanical relay.

E. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicant's proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Order from which variance is being sought.

F. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above table in Jurisdictional and Procedural Matters shall have permanent variances from sections 3041, subdivision (e)(1)(C) and 3141.7, subdivision (b) subject of the following conditions:

Elevator Safety Orders:

- Suspension Means: 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4, and 2.20.9.5.4 (Only to the extent necessary to permit the use of the Elastomeric coated Steel Belts proposed by the Applicant, in lieu of circular steel suspension ropes.);
- Inspection transfer switch: 2.26.1.4.4(a) (Only to the extent necessary to permit the inspection transfer switch to reside at a location other than the machine room);
- Seismic reset switch: 8.4.10.1.1(a)(2)(b) (Only to the extent necessary to permit the seismic reset switch to reside at a location other than the machine room. room);

- Car Top Railing: 2.14.1.7.1 (Only to the extent necessary to permit the use of the car top railing system proposed by the Applicant, where the railing system is located inset from the elevator car top perimeter);
- Governor Rope and Sheave: The Applicant shall conditionally hold permanent variance from certain requirements of section 3141, incorporated section of ASME A17.1-2004, to the limited extent variance is necessary to allow for the below specified governor rope and governor sheave parameters: section 2.18.7.4.
- Means of Removing Power: 2.26.9.6.1 (Only to the extent necessary to permit the use of SIL rated devices and circuits as a means to remove power from the AC driving motor, where the redundant monitoring of electrical protective devices is required by the Elevator Safety Orders).

Conditions:

1. The elevator suspension system shall comply to the following:
 - a. The suspension traction media (STM) members and their associated fastenings shall conform to the applicable requirements of ASME A17.1-2013, sections:
 - 2.20.4.3 - Minimum Number of Suspension Members
 - 2.20.3 - Factor of Safety
 - 2.20.9 - Suspension Member Fastening
 - b. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection and testing of the STM members, fastenings, related monitoring and detection systems, and criteria for STM replacement. The Applicant shall make those procedures and criteria available to the Certified Competent Conveyance Mechanic (CCCM) at the location of the elevator, and to the Cal/OSHA upon request.
 - STM member mandatory replacement criteria shall include:
 - i. Any exposed wire, strand or cord;
 - ii. Any wire, strand or cord breaks through the elastomeric coating;
 - iii. Any evidence of rouging (steel tension element corrosion) on any part of the elastomeric coated steel suspension member;
 - iv. Any deformation in the elastomeric suspension member such as, but not limited to, kinks or bends;
 - c. Traction drive sheaves must have a minimum diameter of 72 mm. The maximum speed of STM members running on 72 mm, 87 mm and 125 mm drive sheaves shall be no greater than 2.5 m/s, 6.0 m/s and 8.0 m/s respectively.
 - d. If any one STM member needs replacement, the complete set of suspension members on the elevator shall be replaced. Exception: if a new suspension member is damaged during installation, and prior to any contemporaneously installed STM having been placed into service, it is permissible to replace the individual damaged suspension member. STM members that have been installed on another installation shall not be re used.

- e. A traction loss detection means shall be provided that conforms to the requirements of ASME A17.1-2013, section 2.20.8.1. The means shall be tested for correct function annually in accordance with ASME A17.1-2013, section 8.6.4.19.12.
 - f. A broken suspension member detection means shall be provided that conforms to the requirements of ASME A17.1-2013, section 2.20.8.2. The means shall be tested for correct function annually in accordance with ASME A17.1-2013, section 8.6.4.19.13(a).
 - g. An elevator controller integrated bend cycle monitoring system shall monitor actual STM bend cycles, by means of continuously counting, and storing in nonvolatile memory, the number of trips that the STM makes traveling, and thereby being bent, over the elevator sheaves. The bend cycle limit monitoring means shall automatically stop the car normally at the next available landing before the bend cycle correlated residual strength of any single STM member drops below 80 percent of full rated strength. The monitoring means shall prevent the car from restarting. The bend cycle monitoring system shall be tested annually in accordance with the procedures required by condition 1b above.
 - h. The elevator shall be provided with a device to monitor the remaining residual strength of each STM member. The device shall conform to the requirements of Cal/OSHA Circular Letter E-10-04, a copy of which is attached hereto as Exhibit 1 and incorporated herein by reference.
 - i. The elevator crosshead data plate shall comply with the requirements of ASME A17.1 2013, section 2.20.2.1.
 - j. A suspension means data tag shall be provided that complies with the requirements of ASME A17.1 2013, section 2.20.2.2.
 - k. Comprehensive visual inspections of the entire length of each and all installed suspension members, to the criteria developed in condition 1b, shall be conducted and documented every six months by a CCCM.
 - l. The Applicant shall be subject to the requirements set out in Exhibit 2 of this Decision and Order, "Suspension Means Replacement Reporting Condition," Incorporated herein by this reference.
 - m. Records of all tests and inspections shall be maintenance records subject to ASME A17.1 2004, sections 8.6.1.2 and 8.6.1.4, respectively.
2. If the inspection transfer switch required by ASME A17.1-2004, section 2.26.1.4.4 does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the control/machinery room/space containing the elevator's control equipment in an enclosure secured by a lock openable by a Group 1 security key. The enclosure is to remain locked at all times when not in use.
 3. If the seismic reset switch does not reside in the machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the control/machinery room/space containing the elevator's control equipment in an enclosure secured by a lock openable by a Group 1 security key. The enclosure is to remain locked at all times when not in use.
 4. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on the railings to perform adjustments, maintenance, repairs or inspections. The

Applicant shall not permit anyone to stand or climb over the car top railing.

- b. The distance that the railing can be inset shall be limited to not more than 6 inches.
- c. All exposed areas of the car top outside the car top railing where the distance from the railing to the edge of the car top exceeds 2 inches, shall be beveled with metal, at an angle of not less than 75 degrees with the horizontal, from the mid or top rail to the outside of the car top, such that no person or object can stand, sit, kneel, rest, or be placed in the exposed areas.
- d. The top of the beveled area and/or car top outside the railing shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
- e. The applicant shall provide durable signs with lettering not less than 1/2 inch on a contrasting background on each inset railing. Each sign shall state:

**CAUTION
STAY INSIDE RAILING
NO LEANING BEYOND RAILING
NO STEPPING ON, OR BEYOND, RAILING**

- f. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing will be measured from the car top and not from the required bevel).

5. The speed governor rope and sheaves shall comply with the following:

- a. The governor shall be used in conjunction with a steel 6 mm (0.25 in.) diameter governor rope with 6 strand, regular lay construction.
- b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
- c. The governor sheaves shall have a pitch diameter of not less than 200 mm (7.87 in.).

6. The SIL rated devices and circuits used to inhibit electrical current flow in accordance with ASME A17.1-2004, section 2.26.9.6.1 shall comply with the following:

- a. The SIL-rated devices and circuits shall consist of a Variodyn SIL3 rated Regenerative, Variable Voltage Variable Frequency (VVVF) motor drive unit, model VAF013, VAF023, or VAF043 labeled or marked with the SIL rating (not less than SIL 3), the name or mark of the certifying organization, and the SIL certification number (968/FSP 1556.00), and followed by the applicable revision number (as in 968/FSP 1556.00/19).
- b. The devices and circuits shall be certified for compliance with the applicable requirements of ASME A17.1-2013, section 2.26.4.3.2.
- c. The access door or cover of the enclosures containing the SIL rated components shall be clearly labeled or tagged on their exterior with the statement:

Assembly contains SIL rated devices.

**Refer to Maintenance Control Program and
wiring diagrams prior to performing work.**

- d. Unique maintenance procedures or methods required for the inspection, testing, or replacement of the SIL rated circuits shall be developed and a copy maintained in the elevator machine/control room/space. The procedures or methods shall include clear color photographs of each SIL rated component, with notations identifying parts and locations.
 - e. Wiring diagrams that include part identification, SIL, and certification information shall be maintained in the elevator machine/control room/space.
 - f. A successful test of the SIL rated devices and circuits shall be conducted initially and not less than annually in accordance with the testing procedure. The test shall demonstrate that SIL rated devices, safety functions, and related circuits operate as intended.
 - g. Any alterations to the SIL rated devices and circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the alteration of SIL rated devices, the alterations shall be made in conformance with ASME A17.1-2013, section 8.7.1.9.
 - h. Any replacement of the SIL rated devices and circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the replacement of SIL rated devices, the replacement shall be made in conformance with ASME A17.1-2013, section 8.6.3.14.
 - i. Any repairs to the SIL rated devices and circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the repair of SIL rated devices, the repairs shall be made in conformance with ASME A17.1-2013, section 8.6.2.6.
 - j. Any space containing SIL rated devices and circuits shall be maintained within the temperature and humidity range specified by Schindler Elevator Corporation. The temperature and humidity range shall be posted on each enclosure containing SIL rated devices and circuits.
 - k. Field changes to the SIL rated system are not permitted. Any changes to the SIL rated system's devices and circuitry will require recertification and all necessary updates to the documentation and diagrams required by conditions d. and e. above.
7. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and all applicable requirements met, including conditions of this permanent variance, prior to a Permit to Operate the elevator being issued. The elevator shall not be placed in service prior to the Permit to Operate being issued by Cal/OSHA.
8. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way that the Applicant was required to notify them of the docketed application for permanent variance per sections 411.2 and 411.3.
9. This Decision and Order shall remain in effect unless duly modified or revoked upon application by Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in the procedural manner prescribed.

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 28, 2026



A handwritten signature in cursive script, reading "Kelly Chau", is positioned above a solid horizontal line. Below the line, the name "Kelly Chau, Hearing Officer" is printed in a standard sans-serif font.

Kelly Chau, Hearing Officer

EXHIBIT 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA Elevator Unit HQS

EXHIBIT 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings. Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future):
CAL/OSHA Elevator Unit, 2 MacArthur Pl., Suite 700, Santa Ana, CA 92707, Attn: Engineering Section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance file number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.

- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

KONE Monospace 300 Elevators & Medical Emergency Elevator Car Dimensions (Group IV)

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-305	Redwood Cafe at River Islands, LLC	1300 Riverfront Dr. Lathrop, CA	1

2. The safety order requirements are set out within section 3143 incorporated ASME A17.1-2004, sections 2.18.5.1 and 2.20.4.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference, by the Occupational Safety and Health Standards Board ("Board"), with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit in accordance with section 426.
2. At the hearing, Fuei Saetern, with KONE INC., appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing
PD3	Cal/OSHA Review of Variance Application

PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each respective Applicant intends to utilize the KONE, Inc. Monospace 300 type elevator, in the quantity, at the location, specified per the above section A.1 table.
2. The installation contract for this elevator was or will be signed on or after May 1, 2008, thus making the elevator subject to the Group IV Elevator Safety Orders.
3. Each Applicant proposes to use hoisting ropes that are 8 mm in diameter which also consist of 0.51 mm diameter outer wires, in variance from the express requirements of ASME A17.1-2004, section 2.20.4.
4. In relevant part, ASME A17.1-2004, section 2.20.4 states:

2.20.4 Minimum Number and Diameter of Suspension Ropes

...The minimum diameter of hoisting and counterweight ropes shall be 9.5 mm (0.375 in.). Outer wires of the ropes shall be not less than 0.56 mm (0.024 in.) in diameter.

5. An intent of ASME A17.1-2004, section 2.20.4, is to ensure that the number, diameter, and construction of suspension ropes are adequate to provide safely robust and durable suspension means over the course of the ropes' foreseen service life.
6. KONE has represented to Cal/OSHA, having established an engineering practice for purposes of Monospace 300 elevator design, of meeting or exceeding the minimum factor of safety of 12 for 8 mm suspension members, as required in ASME A17.1-2010 - under which, given that factor of safety, supplemental broken suspension member protection is not required.
7. Also, each Applicant proposes as a further means of maintaining safety equivalence, monitoring the rope in conformity with the criteria specified within the *Inspector's Guide to 6 mm Diameter Governor and 8 mm Diameter Suspension Ropes for KONE Elevators* (per Application attachment "B", or as thereafter revised by KONE subject Cal/OSHA approval).
8. In addition, each Applicant has proposed to utilize 6 mm diameter governor ropes in variance from Title 8, section 3141, incorporated ASME A17.1-2004, section 2.18.5.1.
9. ASME A17.1-2004, section 2.18.5.1, specifies, in relevant part:

2.18.5.1 Material and Factor of Safety.

... [Governor ropes] not less than 9.5 mm (0.375 in.) in diameter. The factor of safety of governor ropes shall be not less than 5...

10. The Board takes notice of section 3141.7, subpart (a)(10):

A reduced diameter governor rope of equivalent construction and material to that required by ASME A17.1-2004, is permissible if the factor of safety as related to the strength necessary to activate the safety is 5 or greater;

11. Applicants propose use of 6mm governor rope having a safety factor of 5 or greater, in conformity with section 3141.7(a)(10), the specific parameters of which, being expressly set out within the Elevator Safety Orders (ESO), take precedence over more generally referenced governor rope diameter requirements per ASME A17.1-2004, section 2.18.5.1. Accordingly, the governor rope specifications being presently proposed, inclusive of a factor of safety of 5 or greater, would comply with current requirements, and therefore not be subject to issuance of permanent variance.
12. Absent evident diminution in elevator safety, over the past decade the Board has issued numerous permanent variances for use in KONE (Ecospace) elevator systems of 8 mm diameter suspension rope materially similar to that presently proposed (e.g. Permanent Variance Nos. 06-V-203, 08-V-245, and 13-V-303).
13. As noted by the Board in permanent Variance Nos. 18-V-044, and 18-V-045, Decision and Order Findings, subpart B.17 (hereby incorporated by reference), the strength of wire rope operating as an elevator's suspension means does not remain constant over its years of projected service life. With increasing usage cycles, a reduction in the cross-sectional area of the wire rope normally occurs, resulting in decreased residual strength. This characteristic is of particular relevance to the present matter because, decreasing wire rope diameter is associated with a higher rate of residual strength loss. This foreseeable reduction in cross-sectional area primarily results from elongation under sheave rounding load, as well as from wear, and wire or strand breaks. However, these characteristics need not compromise elevator safety when properly accounted for in the engineering of elevator suspension means, and associated components.
14. The presently proposed wire rope is Wuxi Universal steel rope Co LTD. 8 mm 8x19S+8x7+PP, with a manufacturer rated breaking strength of 35.8 kN, and an outer wire diameter of less than 0.56 mm, but not less than 0.51 mm. Cal/OSHA's safety engineer has scrutinized the material and structural specifications, and performance testing data, of this particular proposed rope, and concluded it will provide for safety equivalent to ESO compliant 9.5 mm wire rope, with 0.56 mm outer wire (under conditions of use included within the below Decision and Order).
15. The applicant supplies tabulated data regarding the "Maximum Static Load on All Suspension Ropes." To obtain the tabulated data, the applicant uses the following formula derived from ASME A17.1 2004, section 2.20.3:

$$W = \frac{(S \times N)}{f} \quad \text{where:}$$

W = maximum static load imposed on all car ropes with the car and its rated load at any position in the hoistway

N = number of runs of rope under load. For 2:1 roping, N shall be two times the number of ropes used, etc.

S = manufacturer's rated breaking strength of one rope

f = the factor of safety from Table 2.20.3

16. ASME A17.1-2010 sections 2.20.3 and 2.20.4 utilize the same formula, but provide for use of suspension ropes having a diameter smaller than 9.5 mm, under specified conditions, key

among them being that use of ropes having a diameter of between 8 mm to 9.5 mm be engineered with a factor of safety of 12 or higher. This is a higher minimum factor of safety than that proposed by Applicant but a minimum recommended by Cal/OSHA as a condition of variance necessary to the achieving of safety equivalence to 9.5 mm rope.

17. Cal/OSHA is in accord with Applicant, in proposing as a condition of safety equivalence, that periodic physical examination of the wire ropes be performed to confirm the ropes continue to meet the criteria set out in the (Application attachment) *Inspector's Guide to 6 mm Diameter Governor and 8 mm Diameter Suspension Ropes for KONE Elevators*. Adherence to this condition will provide an additional assurance of safety equivalence, regarding smaller minimum diameter suspension rope outer wire performance over the course of its service life.

18. Applicant requests a permanent variance from section 3041, subdivision (e)(1)(C), which states:

(1) All buildings and structures constructed after the effective date of this order that are provided with one or more passenger elevators shall be provided with not less than one passenger elevator designed and designated to accommodate the loading and transport of an ambulance gurney or stretcher maximum size 22 ½ in. (572 mm) by 75 in. (1.90 m) in its horizontal position and arranged to serve all landings in conformance with the following:

...

(C) The elevator car shall have a minimum inside car platform of 80 in. (2.03 m) wide by 51 in. (1.30 m) deep.

The intent of this language is to ensure that there is enough space to accommodate the access and egress of a gurney and medical personnel inside of a medical service elevator.

This standard is made applicable to Group IV by section 3141.7, subdivision (b), which reads, "Elevators utilized to provide medical emergency service shall comply with Group II, section 3041(e)."

19. Applicant proposes to comply with the requirements of the 2019 California Building Code, section 3002.4.1a in the design of its medical emergency service elevator. That section requires:

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5-inch (127 mm) radius corners] in the horizontal, open position.

The purpose of this requirement is to ensure that an elevator designated for emergency medical service will accommodate a minimum of two emergency personnel with an ambulance gurney or stretcher.

20. Cal/OSHA, by way of written submission to the record (Exhibit PD3), and stated position at hearing, is of the well informed opinion that grant of permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment, and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each Application being the subject of this proceeding, per above section A.1 table, is conditionally GRANTED, to the extent that each such Applicant shall be issued permanent variance from section 3141 incorporated ASME A17.1-2004, section 2.20.4, in as much as it precludes use of suspension rope of between 8 mm and 9.5 mm, or outer wire of between 0.51 mm and 0.56 mm in diameter, at such locations and numbers of Group IV KONE Monospace 300 elevators identified in each respective Application, subject to the following conditions:

1. The diameter of the hoisting steel ropes shall be not less than 8 mm (0.315 in) diameter and the roping ratio shall be two to one (2:1).
2. The outer wires of the suspension ropes shall be not less than 0.51 mm (0.02 in.) in diameter.
3. The number of suspension ropes shall be not fewer than those specified per hereby incorporated Decision and Order Appendix 1 Table.
4. The ropes shall be inspected annually for wire damage (rouge, valley break etc.) in accordance with "KONE, Inc. Inspector's Guide to 6 mm diameter and 8 mm diameter steel ropes for KONE Elevators" (per Application Exhibit B, or as thereafter amended by KONE subject to Cal/OSHA approval).
5. A rope inspection log shall be maintained and available in the elevator controller room / space at all times.
6. The elevator rated speed shall not exceed those speeds specified per the Decision and Order Appendix 1 Table.
7. The maximum suspended load shall not exceed those weights (plus 5%) specified per the Decision and Order Appendix 1 Table.
8. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of the elevator equipment in the hoistway is required. If the service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
9. The installation shall meet the suspension wire rope factor of safety requirements of ASME A17.1-2013 section 2.20.3.
10. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing or testing the elevators shall be provided a copy of this variance decision.
11. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA and a "Permit to Operate" issued before the elevator is placed in service.
12. The Applicant shall comply with suspension means replacement reporting condition per hereby

incorporated Decision and Order Appendix 2.

13. All medical emergency service elevator(s) shall comply with the following:

a. The requirements of the 2019 California Building Code (CBC) section 3002.4.1a:

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5-inch (127 mm) radius corners] in the horizontal, open position.

b. All medical emergency service elevator(s) shall be identified in the building construction documents in accordance with the 2019 California Building Code, section 3002.4a.

c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).

14. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications pursuant to sections 411.2 and 411.3.

15. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in the procedural manner prescribed.

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 23, 2026



Kelly Chau, Hearing Officer

APPENDIX 1

File Number	Elevator ID	Minimum Suspension Ropes Per Elevator	Maximum Suspended Weight Per Elevator	Maximum Speed	Rated Capacity
26-V-305	1	7	12247	150	3500

APPENDIX 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Schindler Model 3300 Elevators, w/variant Gov. Ropes and Sheaves (Group IV)

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-306	Affordable Housing Group Ltd, LLC	2310 W Ocean View Ave., Los Angeles, CA	1

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Pete Cuellar, with SCHINDLER ELEVATOR CORPORATION, appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table

PD2	OSHSB Notice of Hearing
PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each respective Applicant intends to utilize Schindler model 3300 MRL elevator cars, in the quantity, at the locations specified in Jurisdictional and Procedural Matters, section 1.
2. The installation contract for these elevators was or will be signed on or after May 1, 2008, thus making the elevator subject to the Group IV Elevator Safety Orders.
3. The Schindler model 3300 MRL elevator cars are not supported by circular steel wire ropes, as required by the Elevator Safety Orders. They utilize non circular elastomeric coated steel belts and specialized suspension means fastenings.
4. No machine room is provided, preventing the inspection transfer switch from being located in the elevator machine room. The lack of machine room also prevents the seismic reset switch from being located in the elevator machine room.
5. Applicant proposes to relocate the inspection transfer switch and seismic reset switch in an alternative enclosure.
6. Due to the use of a 6 mm (0.25 in.) governor rope with 6-strand construction, the provided governor sheave pitch diameter is less than that required by the Elevator Safety Orders.
7. The driving machine and governor are positioned in the hoistway and restrict the required overhead clearance to the elevator car top.
8. Applicant proposes to insert the car top railings at the perimeter of the car top.
9. Applicant intends to use an elevator control system, model CO NX100NA or CO NX300NA, with a standalone, solid state motor control drive system that includes devices and circuits having a Safety Integrity Level (SIL) rating to execute specific elevator safety functions.

D. Relevant Safety Order Provisions

Applicant seeks a permanent variance from section 3141 [ASME A17.1-2004, sections 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4, 2.20.9.5.4, 2.26.1.4.4(a), 8.4.10.1.1(a)(2)(b), 2.14.1.7.1, 2.18.7.4, and 2.26.9.6.1] of the Elevator Safety Orders, with respect to the suspension ropes and connections, inspection transfer switch relocation, seismic reset switch relocation, the location and construction of car-top railings, governor-sheave diameter, and means of removing power from the driving machine motor for one (1) Schindler model 3300 MRL elevator.

The relevant language of those sections are below.

1. Suspension Means

- Section 3141 [ASME A17.1-2004, section 2.20.1, Suspension Means] states in part:
 - Elevator cars shall be suspended by steel wire ropes attached to the car frame or passing around sheaves attached to the car frame specified in 2.15.1. Ropes that have previously been installed and used on another installation shall not be reused. Only iron (low carbon steel) or steel wire ropes, having the commercial classification “Elevator Wire Rope,” or wire rope specifically constructed for elevator use, shall be used for the suspension of elevator cars and for the suspension of counterweights. The wire material for ropes shall be manufactured by the open hearth or electric furnace process, or their equivalent.
- Section 3141 [ASME A17.1-2004, section 2.20.2.1(b), On Crosshead Data Plate] states in part:
 - The crosshead data plate required by 2.16.3 shall bear the following wire rope data:
 - (b) the diameter in millimeters (mm) or inches (in.)
- Section 3141 [ASME A17.1-2004, section 2.20.2.2(a) and (f) On Rope Data Tag] states in part:
 - A metal data tag shall be securely attached to one of the wire rope fastenings. This data tag shall bear the following wire rope data:
 - (a) the diameter in millimeters (mm) or inches (in.)
 - [...]
 - (f) whether the ropes were non preformed or preformed
- Section 3141 [ASME A17.1-2004, section 2.20.3, Factor of Safety] states:
 - The factor of safety of the suspension wire ropes shall be not less than shown in Table 2.20.3. Figure 8.2.7 gives the minimum factor of safety for intermediate rope speeds. The factor of safety shall be based on the actual rope speed corresponding to the rated speed of the car.
 - The factor of safety shall be calculated by the following formula:

$$f = \frac{(S \times N)}{W}$$

- where:
 - N = number of runs of rope under load. For 2:1 roping, N shall be two times the number of ropes used, etc.
 - S = manufacturer's rated breaking strength of one rope
 - W = maximum static load imposed on all car ropes with the car and its rated load at

any position in the hoistway

- Section 3141 [ASME A17.1-2004, section 2.20.4, Minimum Number and Diameter of Suspension Ropes] states:
 - The minimum number of hoisting ropes used shall be three for traction elevators and two for drum type elevators.
 - Where a car counterweight is used, the number of counterweight ropes used shall be not less than two.
 - The term “diameter,” where used in reference to ropes, shall refer to the nominal diameter as given by the rope manufacturer.
 - The minimum diameter of hoisting and counterweight ropes shall be 9.5 mm (0.375 in.). Outer wires of the ropes shall be not less than 0.56 mm (0.024 in.) in diameter.
- Section 3141 [ASME A17.1-2004, section 2.20.9.3.4] states:
 - Cast or forged steel rope sockets, shackle rods, and their connections shall be made of unwelded steel, having an elongation of not less than 20% in a gauge length of 50 mm (2 in.), when measured in accordance with ASTM E 8, and conforming to ASTM A 668, Class B for forged steel, and ASTM A 27, Grade 60/30 for cast steel, and shall be stress relieved. Steels of greater strength shall be permitted, provided they have an elongation of not less than 20% in a length of 50 mm (2 in.).
- Section 3141 [ASME A17.1-2004, section 2.20.9.5.4] states:
 - When the rope has been seated in the wedge socket by the load on the rope, the wedge shall be visible, and at least two wire rope retaining clips shall be provided to attach the termination side to the load carrying side of the rope (see Fig. 2.20.9.5). The first clip shall be placed a maximum of 4 times the rope diameter above the socket, and the second clip shall be located within 8 times the rope diameter above the first clip. The purpose of the two clips is to retain the wedge and prevent the rope from slipping in the socket should the load on the rope be removed for any reason. The clips shall be designed and installed so that they do not distort or damage the rope in any manner.

2. Requested Transfer Switch Placement Variance

- As it pertains to installation of the requisite transfer switch within a “machine room” location incompatible with machine-room-less design of the Schindler Model 3300 elevator, the Applicant presently seeks permanent variance from the following Elevator Safety Order incorporated ASME Code A17.1-2004, subsection:
 - Subsection 2.26.1.4.4(a)--Transfer Switch Placement in Machine Room
- Section 3141[ASME A17.1-2004, section 2.26.1.4.4(a), Machine Room Inspection Operation] states:
- When machine room inspection operation is provided, it shall conform to 2.26.1.4.1, and the transfer switch shall be

- (a) located in the machine room[.]

3. Requested Seismic Reset Switch Placement Variance

- As it pertains to installation of the requisite seismic reset switch within a “machine room” location incompatible with machine-room-less design of the Schindler Model 3300 elevator, the Applicant presently seeks permanent variance from the following Elevator Safety Order incorporated ASME Code subsection:
 - Subsection 8.4.10.1.1(a)(2)(b)--Seismic Reset Switch Placement in Machine Room
- Section 3141[ASME A17.1-2004, section 8.4.10.1.1(a)(2)(b), Earthquake Equipment] states:
 - (a) All traction elevators operating at a rated speed of 0.75 m/s (150 ft/min) or more and having counterweights located in the same hoistway shall be provided with the following:
 - (1) seismic zone 3 or greater: a minimum of one seismic switch per building
 - (2) seismic zone 2 or greater:
 - (a) a displacement switch for each elevator
 - (b) an identified momentary reset button or switch for each elevator, located in the control panel in the elevator machine room

4. Requested Car Top Railing Inset Variance

- As it pertains to top of car railing placement requiring space occupied by upper hoistway mounted elevator machinery characteristic of the Schindler Model 3300 elevator, the Applicant presently seeks permanent variance from the following Elevator Safety Order incorporated ASME Code A17.1-2004, section:
 - Section 2.14.1.7.1—Top of Car Perimeter Railing Placement
- Section 3141[ASME A17.1-2004, section 2.14.1.7.1] states:
 - A standard railing conforming to 2.10.2 shall be provided on the outside perimeter of the car top on all sides where the perpendicular distance between the edges of the car top and the adjacent hoistway enclosure exceeds 300 mm (12 in.) horizontal clearance.

5. Pitch Diameter of Governor Sheaves

- Section 3141 [ASME A17.1-2004, Section 2.18.7.4] states:
 - “The pitch diameter of governor sheaves and governor tension sheaves shall be not less than the product of the diameter of the rope and the applicable multiplier listed in Table 2.18.7.4, based on the rated speed and the number of strands in the rope.”

Table 2.18.7.4 Multiplier for Determining Governor Sheave Pitch Diameter
[from ASME A17.1-2004]

<u>Rated Speed m/s (ft./min)</u>	<u>Number of Strands</u>	<u>Multiplier</u>
1.00 or less (200 or less)	6	42
1.00 or less (200 or less)	8	30
Over 1.0 (over 200)	6	46
Over 1.0 (over 200)	8	32

6. SIL Rated System to Inhibit Current Flow to AC Drive Motor

- Section 3141[ASME A17.1-2004, section 2.26.9.6.1] states:
 - Two separate means shall be provided to independently inhibit the flow of alternating current through the solid state devices that connect the direct current power source to the alternating current driving motor. At least one of the means shall be an electromechanical relay.

E. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicant's proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Order from which variance is being sought.

F. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above table in Jurisdictional and Procedural Matters shall have permanent variances from sections 3041, subdivision (e)(1)(C) and 3141.7, subdivision (b) subject of the following conditions:

Elevator Safety Orders:

- Suspension Means: 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4, and 2.20.9.5.4 (Only to the extent necessary to permit the use of the Elastomeric coated Steel Belts proposed by the Applicant, in lieu of circular steel suspension ropes.);
- Inspection transfer switch: 2.26.1.4.4(a) (Only to the extent necessary to permit the inspection transfer switch to reside at a location other than the machine room);

- Seismic reset switch: 8.4.10.1.1(a)(2)(b) (Only to the extent necessary to permit the seismic reset switch to reside at a location other than the machine room. room);
- Car Top Railing: 2.14.1.7.1 (Only to the extent necessary to permit the use of the car top railing system proposed by the Applicant, where the railing system is located inset from the elevator car top perimeter);
- Governor Rope and Sheave: The Applicant shall conditionally hold permanent variance from certain requirements of section 3141, incorporated section of ASME A17.1-2004, to the limited extent variance is necessary to allow for the below specified governor rope and governor sheave parameters: section 2.18.7.4.
- Means of Removing Power: 2.26.9.6.1 (Only to the extent necessary to permit the use of SIL rated devices and circuits as a means to remove power from the AC driving motor, where the redundant monitoring of electrical protective devices is required by the Elevator Safety Orders).

Conditions:

1. The elevator suspension system shall comply to the following:
 - a. The suspension traction media (STM) members and their associated fastenings shall conform to the applicable requirements of ASME A17.1-2013, sections:
 - 2.20.4.3 - Minimum Number of Suspension Members
 - 2.20.3 - Factor of Safety
 - 2.20.9 - Suspension Member Fastening
 - b. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection and testing of the STM members, fastenings, related monitoring and detection systems, and criteria for STM replacement. The Applicant shall make those procedures and criteria available to the Certified Competent Conveyance Mechanic (CCCM) at the location of the elevator, and to the Cal/OSHA upon request.
 - STM member mandatory replacement criteria shall include:
 - i. Any exposed wire, strand or cord;
 - ii. Any wire, strand or cord breaks through the elastomeric coating;
 - iii. Any evidence of rouging (steel tension element corrosion) on any part of the elastomeric coated steel suspension member;
 - iv. Any deformation in the elastomeric suspension member such as, but not limited to, kinks or bends;
 - c. Traction drive sheaves must have a minimum diameter of 72 mm. The maximum speed of STM members running on 72 mm, 87 mm and 125 mm drive sheaves shall be no greater than 2.5 m/s, 6.0 m/s and 8.0 m/s respectively.
 - d. If any one STM member needs replacement, the complete set of suspension members on the elevator shall be replaced. Exception: if a new suspension member is damaged during

installation, and prior to any contemporaneously installed STM having been placed into service, it is permissible to replace the individual damaged suspension member. STM members that have been installed on another installation shall not be re used.

- e. A traction loss detection means shall be provided that conforms to the requirements of ASME A17.1-2013, section 2.20.8.1. The means shall be tested for correct function annually in accordance with ASME A17.1-2013, section 8.6.4.19.12.
 - f. A broken suspension member detection means shall be provided that conforms to the requirements of ASME A17.1-2013, section 2.20.8.2. The means shall be tested for correct function annually in accordance with ASME A17.1-2013, section 8.6.4.19.13(a).
 - g. An elevator controller integrated bend cycle monitoring system shall monitor actual STM bend cycles, by means of continuously counting, and storing in nonvolatile memory, the number of trips that the STM makes traveling, and thereby being bent, over the elevator sheaves. The bend cycle limit monitoring means shall automatically stop the car normally at the next available landing before the bend cycle correlated residual strength of any single STM member drops below 80 percent of full rated strength. The monitoring means shall prevent the car from restarting. The bend cycle monitoring system shall be tested annually in accordance with the procedures required by condition 1b above.
 - h. The elevator shall be provided with a device to monitor the remaining residual strength of each STM member. The device shall conform to the requirements of Cal/OSHA Circular Letter E-10-04, a copy of which is attached hereto as Exhibit 1 and incorporated herein by reference.
 - i. The elevator crosshead data plate shall comply with the requirements of ASME A17.1 2013, section 2.20.2.1.
 - j. A suspension means data tag shall be provided that complies with the requirements of ASME A17.1 2013, section 2.20.2.2.
 - k. Comprehensive visual inspections of the entire length of each and all installed suspension members, to the criteria developed in condition 1b, shall be conducted and documented every six months by a CCCM.
 - l. The Applicant shall be subject to the requirements set out in Exhibit 2 of this Decision and Order, "Suspension Means Replacement Reporting Condition," Incorporated herein by this reference.
 - m. Records of all tests and inspections shall be maintenance records subject to ASME A17.1 2004, sections 8.6.1.2 and 8.6.1.4, respectively.
2. If the inspection transfer switch required by ASME A17.1-2004, section 2.26.1.4.4 does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the control/machinery room/space containing the elevator's control equipment in an enclosure secured by a lock openable by a Group 1 security key. The enclosure is to remain locked at all times when not in use.
3. If the seismic reset switch does not reside in the machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the control/machinery room/space containing the elevator's control equipment in an enclosure secured by a lock openable by a Group 1 security key. The enclosure is to remain locked at all times when not in use.

4. If there is an inset car top railing:

- a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on the railings to perform adjustments, maintenance, repairs or inspections. The Applicant shall not permit anyone to stand or climb over the car top railing.
- b. The distance that the railing can be inset shall be limited to not more than 6 inches.
- c. All exposed areas of the car top outside the car top railing where the distance from the railing to the edge of the car top exceeds 2 inches, shall be beveled with metal, at an angle of not less than 75 degrees with the horizontal, from the mid or top rail to the outside of the car top, such that no person or object can stand, sit, kneel, rest, or be placed in the exposed areas.
- d. The top of the beveled area and/or car top outside the railing shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
- e. The applicant shall provide durable signs with lettering not less than 1/2 inch on a contrasting background on each inset railing. Each sign shall state:

**CAUTION
STAY INSIDE RAILING
NO LEANING BEYOND RAILING
NO STEPPING ON, OR BEYOND, RAILING**

- f. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing will be measured from the car top and not from the required bevel).

5. The speed governor rope and sheaves shall comply with the following:

- a. The governor shall be used in conjunction with a steel 6 mm (0.25 in.) diameter governor rope with 6 strand, regular lay construction.
- b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
- c. The governor sheaves shall have a pitch diameter of not less than 200 mm (7.87 in.).

6. The SIL rated devices and circuits used to inhibit electrical current flow in accordance with ASME A17.1-2004, section 2.26.9.6.1 shall comply with the following:

- a. The SIL-rated devices and circuits shall consist of a Variodyn SIL3 rated Regenerative, Variable Voltage Variable Frequency (VVVF) motor drive unit, model VAF013, VAF023, or VAF043 labeled or marked with the SIL rating (not less than SIL 3), the name or mark of the certifying organization, and the SIL certification number (968/FSP 1556.00), and followed by the applicable revision number (as in 968/FSP 1556.00/19).
- b. The devices and circuits shall be certified for compliance with the applicable requirements of ASME A17.1-2013, section 2.26.4.3.2.
- c. The access door or cover of the enclosures containing the SIL rated components shall be

clearly labeled or tagged on their exterior with the statement:


**Assembly contains SIL rated devices.
Refer to Maintenance Control Program and
wiring diagrams prior to performing work.**

- d. Unique maintenance procedures or methods required for the inspection, testing, or replacement of the SIL rated circuits shall be developed and a copy maintained in the elevator machine/control room/space. The procedures or methods shall include clear color photographs of each SIL rated component, with notations identifying parts and locations.
 - e. Wiring diagrams that include part identification, SIL, and certification information shall be maintained in the elevator machine/control room/space.
 - f. A successful test of the SIL rated devices and circuits shall be conducted initially and not less than annually in accordance with the testing procedure. The test shall demonstrate that SIL rated devices, safety functions, and related circuits operate as intended.
 - g. Any alterations to the SIL rated devices and circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the alteration of SIL rated devices, the alterations shall be made in conformance with ASME A17.1-2013, section 8.7.1.9.
 - h. Any replacement of the SIL rated devices and circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the replacement of SIL rated devices, the replacement shall be made in conformance with ASME A17.1-2013, section 8.6.3.14.
 - i. Any repairs to the SIL rated devices and circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the repair of SIL rated devices, the repairs shall be made in conformance with ASME A17.1-2013, section 8.6.2.6.
 - j. Any space containing SIL rated devices and circuits shall be maintained within the temperature and humidity range specified by Schindler Elevator Corporation. The temperature and humidity range shall be posted on each enclosure containing SIL rated devices and circuits.
 - k. Field changes to the SIL rated system are not permitted. Any changes to the SIL rated system's devices and circuitry will require recertification and all necessary updates to the documentation and diagrams required by conditions d. and e. above.
7. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and all applicable requirements met, including conditions of this permanent variance, prior to a Permit to Operate the elevator being issued. The elevator shall not be placed in service prior to the Permit to Operate being issued by Cal/OSHA.
8. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way that the Applicant was required to notify them of the docketed application for permanent variance per sections 411.2 and 411.3.

9. This Decision and Order shall remain in effect unless duly modified or revoked upon application by Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in the procedural manner prescribed.

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 28, 2026

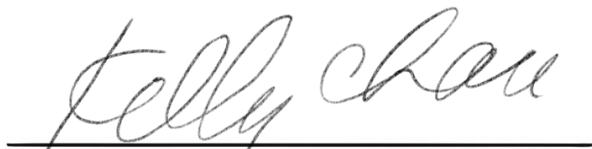

Kelly Chau, Hearing Officer

EXHIBIT 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA Elevator Unit HQS

EXHIBIT 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings. Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future):
CAL/OSHA Elevator Unit, 2 MacArthur Pl., Suite 700, Santa Ana, CA 92707, Attn: Engineering Section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance file number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.

- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Schindler Model S5000 MRL

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-307	Amazon.com LLC	1345 Doolittle Dr San Leandro, CA	1

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Pete Cuellar, with SCHINDLER ELEVATOR CORPORATION, appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each respective Applicant intends to utilize Schindler model S5000 MRL elevator cars, in the quantity, at the locations, specified per the above section A.1 table.
2. The installation contract for these elevators was or will be signed on or after May 1, 2008, thus making the elevator subject to the Group IV Elevator Safety Orders.
3. The Schindler model S5000 MRL elevator cars are not supported by circular steel wire ropes, as required by the Elevator Safety Orders. They utilize non-circular elastomeric-coated steel belts and specialized suspension means fastenings that are not in compliance with current ESO. This belt type suspension is similar to that found on other elevator products (e.g., Otis Gen2, Schindler 3300, and ThyssenKrupp EVO).
4. No machine room is provided, preventing the inspection transfer switch from being located in the elevator machine room. The lack of machine room also prevents the seismic reset switch from being located in the elevator machine room.
5. Applicant proposes to relocate the inspection transfer switch and seismic reset switch in an alternative enclosure.
6. The driving machine and governor are positioned in the hoistway and restrict the required overhead clearance to the elevator car top.
7. Applicant proposes to insert the car-top railings at the perimeter of the car top.
8. Due to the use of a 6 mm (0.25 in.) governor rope with 6 strand construction, the provided governor sheave pitch diameter is less than that required by the ESO.
9. The Applicant intends to install a governor rope that provides an increased factor of safety in order to compensate for the use of a governor sheave of reduced diameter.
10. Applicant intends to use an elevator control system, model CO NX100NA, with a standalone, solid-state motor control drive system that includes devices and circuits having a Safety Integrity Level (SIL) rating to execute specific elevator safety functions.

D. Relevant Safety Order Provisions

Applicant seeks a permanent variance from section 3141 [ASME A17.1-2004, sections 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4, 2.20.9.5.4, 2.26.1.4.4(a), 8.4.10.1.1(a)(2)(b), 2.14.1.7.1, 2.18.7.4, and 2.26.9.6.1]. The relevant language of those sections are below.

Suspension Means

Section 3141 [ASME A17.1-2004, section 2.20.1, Suspension Means] states in part:

Elevator cars shall be suspended by steel wire ropes attached to the car frame or passing around sheaves attached to the car frame specified in 2.15.1. Ropes that have previously been installed and used on another installation shall not be reused. Only iron (low carbon steel) or steel wire ropes, having the commercial classification “Elevator Wire Rope,” or wire rope specifically constructed for elevator use, shall be used for the suspension of elevator cars and for the suspension of counterweights. The wire material for ropes shall be manufactured by the open hearth or electric furnace process, or their equivalent.

Section 3141 [ASME A17.1-2004, section 2.20.2.1(b), On Crosshead Data Plate] states in part:

The crosshead data plate required by 2.16.3 shall bear the following wire-rope data:

(b) the diameter in millimeters (mm) or inches (in.)

Section 3141 [ASME A17.1-2004, section 2.20.2.2(a) and (f) On Rope Data Tag] states in part:

A metal data tag shall be securely attached to one of the wire rope fastenings. This data tag shall bear the following wire rope data:

(a) the diameter in millimeters (mm) or inches (in.)

[...]

(f) whether the ropes were non preformed or preformed

Section 3141 [ASME A17.1-2004, section 2.20.3, Factor of Safety] states:

The factor of safety of the suspension wire ropes shall be not less than shown in Table 2.20.3. Figure 8.2.7 gives the minimum factor of safety for intermediate rope speeds. The factor of safety shall be based on the actual rope speed corresponding to the rated speed of the car.

The factor of safety shall be calculated by the following formula:

$$f = \frac{(S \times N)}{W}$$

where:

N = number of runs of rope under load. For 2:1 roping, N shall be two times the number of ropes used, etc.

S = manufacturer's rated breaking strength of one rope

W = maximum static load imposed on all car ropes with the car and its rated load at any position in the hoistway

Section 3141 [ASME A17.1-2004, section 2.20.4, Minimum Number and Diameter of Suspension Ropes] states:

The minimum number of hoisting ropes used shall be three for traction elevators and two for drum-type elevators.

Where a car counterweight is used, the number of counterweight ropes used shall be not less than two.

The term “diameter,” where used in reference to ropes, shall refer to the nominal diameter as given by the rope manufacturer.

The minimum diameter of hoisting and counterweight ropes shall be 9.5 mm (0.375 in.). Outer wires of the ropes shall be not less than 0.56 mm (0.024 in.) in diameter.

Section 3141 [ASME A17.1-2004, section 2.20.9.3.4] states:

Cast or forged steel rope sockets, shackle rods, and their connections shall be made of unwelded steel, having an elongation of not less than 20% in a gauge length of 50 mm (2 in.), when measured in accordance with ASTM E 8, and conforming to ASTM A 668, Class B for forged steel, and ASTM A 27, Grade 60/30 for cast steel, and shall be stress relieved. Steels of greater strength shall be permitted, provided they have an elongation of not less than 20% in a length of 50 mm (2 in.).

Section 3141 [ASME A17.1-2004, section 2.20.9.5.4] states:

When the rope has been seated in the wedge socket by the load on the rope, the wedge shall be visible, and at least two wire rope retaining clips shall be provided to attach the termination side to the load carrying side of the rope (see Fig. 2.20.9.5). The first clip shall be placed a maximum of 4 times the rope diameter above the socket, and the second clip shall be located within 8 times the rope diameter above the first clip. The purpose of the two clips is to retain the wedge and prevent the rope from slipping in the socket should the load on the rope be removed for any reason. The clips shall be designed and installed so that they do not distort or damage the rope in any manner.

The intent of these code requirements is to ensure that the material used for suspending an elevator car is steel wire rope. Steel wire rope has long been the only accepted method for suspending elevators due to its ability to be visually examined and its proven robust construction. The steel wire rope and attachment specifications contained in the current Elevator Safety Orders are not uniformly suitable for application to the proposed non-circular elastomeric coated steel belt suspension due to its dissimilar construction and fastening to that of wire rope.

Inspection Transfer Switch

Section 3141[ASME A17.1-2004, section 2.26.1.4.4(a), Machine Room Inspection Operation] states:

When machine room inspection operation is provided, it shall conform to 2.26.1.4.1, and the transfer switch shall be

(a) located in the machine room[.]

Seismic Reset Switch

Section 3141[ASME A17.1-2004, section 8.4.10.1.1(a)(2)(b), Earthquake Equipment] states:

(a) All traction elevators operating at a rated speed of 0.75 m/s (150 ft/min) or more and having counterweights located in the same hoistway shall be provided with the following:

(1) seismic zone 3 or greater: a minimum of one seismic switch per building

(2) seismic zone 2 or greater:

(a) a displacement switch for each elevator

(b) an identified momentary reset button or switch for each elevator, located in the control panel in the elevator machine room

Car-Top Railings

Section 3141[ASME A17.1-2004, section 2.14.1.7.1] states:

A standard railing conforming to 2.10.2 shall be provided on the outside perimeter of the car top on all sides where the perpendicular distance between the edges of the car top and the adjacent hoistway enclosure exceeds 300 mm (12 in.) horizontal clearance.

Governor Sheave Diameter

Section 3141 [ASME A17.1-2004, Section 2.18.7.4] states:

“The pitch diameter of governor sheaves and governor tension sheaves shall be not less than the product of the diameter of the rope and the applicable multiplier listed in Table 2.18.7.4, based on the rated speed and the number of strands in the rope.”

Table 2.18.7.4 Multiplier for Determining Governor Sheave Pitch Diameter
[from ASME A17.1-2004]

<u>Rated Speed m/s (ft./min)</u>	<u>Number of Strands</u>	<u>Multiplier</u>
1.00 or less (200 or less)	6	42

1.00 or less (200 or less)	8	30
Over 1.0 (over 200)	6	46
Over 1.0 (over 200)	8	32

The intent of this code section is to prevent the bending of the governor rope around a sheave of insufficient diameter, which could reduce its life expectancy and working strength.

ASME A17.1-2022, Sections 2.18.5.1 states in part:

"Governor rope shall be made of iron, steel, monel metal, phosphor bronze, or stainless steel. They shall be of a regular-lay construction and not less than 6 mm (0.25 in.) in diameter.

The factor of safety of governor ropes shall be not less than 5. Where provided, ropes of a diameter less than 9.5 mm (0.375 in.) shall have a factor of safety not less than 8 and shall be a six-, eight-, or nine-strand construction. Tiller-rope construction shall not be used."

ASME A17.1-2022, Sections 2.18.7.4 states:

"Where governor ropes of a diameter of 9.5 mm (0.375 in.) or greater are used, the pitch diameter of governor sheaves and governor tension sheaves shall be not less than the product of the diameter of the rope and the applicable multiplier listed in Table 2.18.7.4, based on the rated speed and the number of strands in the rope. Where governor ropes of a diameter less than 9.5 mm (0.375 in.) are used, the governor sheave shall have a pitch diameter not less than the product of the diameter of the rope and a multiplier of 30."

SIL-Rated System to Inhibit Current Flow to AC Drive Motor

Section 3141[ASME A17.1-2004, section 2.26.9.6.1] states:

Two separate means shall be provided to independently inhibit the flow of alternating current through the solid state devices that connect the direct current power source to the alternating current driving motor. At least one of the means shall be an electromechanical relay.

E. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Order from which variance is being sought.

F. Decision and Order:

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A.1 shall have permanent variances from sections 3041,

subdivision (e)(1)(C) and 3141.7, subdivision (b) subject of the following conditions:

Elevator Safety Orders:

- Suspension Means: 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4, and 2.20.9.5.4 (Only to the extent necessary to permit the use of the Elastomeric coated Steel Belts proposed by the Applicant, in lieu of circular steel suspension ropes.);
- Inspection transfer switch: 2.26.1.4.4(a) (Only to the extent necessary to permit the inspection transfer switch to reside at a location other than the machine room);
- Seismic reset switch: 8.4.10.1.1(a)(2)(b) (Only to the extent necessary to permit the seismic reset switch to reside at a location other than the machine room. room);
- Car Top Railing: 2.14.1.7.1 (Only to the extent necessary to permit the use of the car top railing system proposed by the Applicant, where the railing system is located inset from the elevator car top perimeter);
- Pitch Diameter: 2.18.7.4 (Only to the extent necessary to permit the use of the speed governor system proposed by the Applicant, where the rope sheave pitch diameter is reduced to 200 mm [7.87 in.]); and
- Means of Removing Power: 2.26.9.6.1 (Only to the extent necessary to permit the use of SIL rated devices and circuits as a means to remove power from the AC driving motor, where the redundant monitoring of electrical protective devices is required by the Elevator Safety Orders).

Conditions:

1. The elevator suspension system shall comply to the following:
 - a. The suspension traction media (STM) members and their associated fastenings shall conform to the applicable requirements of ASME A17.1-2013, sections:
 - 2.20.4.3 - Minimum Number of Suspension Members
 - 2.20.3 - Factor of Safety
 - 2.20.9 - Suspension Member Fastening
 - b. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection and testing of the STM members, fastenings, related monitoring and detection systems, and criteria for STM replacement. The Applicant shall make those procedures and criteria available to the Certified Competent Conveyance Mechanic (CCCM) at the location of the elevator, and to the Cal/OSHA upon request.

STM member mandatory replacement criteria shall include:

- i. Any exposed wire, strand or cord;
- ii. Any wire, strand or cord breaks through the elastomeric coating;
- iii. Any evidence of rouging (steel tension element corrosion) on any part of the elastomeric coated steel suspension member;
- iv. Any deformation in the elastomeric suspension member such as, but not limited to,

kinks or bends;

- c. Traction drive sheaves must have a minimum diameter of 72 mm. The maximum speed of STM members running on 72 mm, 87 mm and 125 mm drive sheaves shall be no greater than 2.5 m/s, 6.0 m/s and 8.0 m/s respectively.
 - d. If any one STM member needs replacement, the complete set of suspension members on the elevator shall be replaced. Exception: if a new suspension member is damaged during installation, and prior to any contemporaneously installed STM having been placed into service, it is permissible to replace the individual damaged suspension member. STM members that have been installed on another installation shall not be re-used.
 - e. A traction loss detection means shall be provided that conforms to the requirements of ASME A17.1-2013, section 2.20.8.1. The means shall be tested for correct function annually in accordance with ASME A17.1 2013, section 8.6.4.19.12.
 - f. A broken suspension member detection means shall be provided that conforms to the requirements of ASME A17.1-2013, section 2.20.8.2. The means shall be tested for correct function annually in accordance with ASME A17.1-2013, section 8.6.4.19.13(a).
 - g. An elevator controller integrated bend cycle monitoring system shall monitor actual STM bend cycles, by means of continuously counting, and storing in nonvolatile memory, the number of trips that the STM makes traveling, and thereby being bent, over the elevator sheaves. The bend cycle limit monitoring means shall automatically stop the car normally at the next available landing before the bend cycle correlated residual strength of any single STM member drops below 80 percent of full rated strength. The monitoring means shall prevent the car from restarting. The bend cycle monitoring system shall be tested annually in accordance with the procedures required by condition 1b above.
 - h. The elevator shall be provided with a device to monitor the remaining residual strength of each STM member. The device shall conform to the requirements of Cal/OSHA Circular Letter E-10-04, a copy of which is attached hereto as Exhibit 1 and incorporated herein by reference.
 - i. The elevator crosshead data plate shall comply with the requirements of ASME A17.1-2013, section 2.20.2.1.
 - j. A suspension means data tag shall be provided that complies with the requirements of ASME A17.1-2013, section 2.20.2.2.
 - k. Comprehensive visual inspections of the entire length of each and all installed suspension members, to the criteria developed in condition 1b, shall be conducted and documented every six months by a CCCM.
 - l. The Applicant shall be subject to the requirements set out in Exhibit 2 of this Decision and Order, "Suspension Means Replacement Reporting Condition," Incorporated herein by this reference.
 - m. Records of all tests and inspections shall be maintenance records subject to ASME A17.1-2004, sections 8.6.1.2 and 8.6.1.4, respectively.
2. If the inspection transfer switch required by ASME A17.1-2004, section 2.26.1.4.4 does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in

the control/machinery room/space containing the elevator's control equipment in an enclosure secured by a lock openable by a Group 1 security key. The enclosure is to remain locked at all times when not in use.

3. If the seismic reset switch does not reside in the machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the control/machinery room/space containing the elevator's control equipment in an enclosure secured by a lock openable by a Group 1 security key. The enclosure is to remain locked at all times when not in use.
4. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on the railings to perform adjustments, maintenance, repairs or inspections. The Applicant shall not permit anyone to stand or climb over the car-top railing.
 - b. The distance that the railing can be inset shall be limited to not more than 6 inches.
 - c. All exposed areas of the car top outside the car top railing where the distance from the railing to the edge of the car-top exceeds 2 inches, shall be beveled with metal, at an angle of not less than 75 degrees with the horizontal, from the mid or top rail to the outside of the car top, such that no person or object can stand, sit, kneel, rest, or be placed in the exposed areas.
 - d. The top of the beveled area and/or car top outside the railing shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
 - e. The applicant shall provide durable signs with lettering not less than 1/2 inch on a contrasting background on each inset railing. Each sign shall state:

**CAUTION
STAY INSIDE RAILING
NO LEANING BEYOND RAILING
NO STEPPING ON, OR BEYOND, RAILING**

- f. The Group IV requirements for car-top clearances shall be maintained (car-top clearances outside the railing will be measured from the car top and not from the required bevel).
5. The speed governor rope and sheaves shall comply with the following:
 - a. The governor shall be used in conjunction with a steel 6 mm (0.25 in.) diameter governor rope with 6 strand, regular lay construction.
 - b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
 - c. The governor sheaves shall have a pitch diameter of not less than 200 mm (7.87 in.).
6. The SIL-rated devices and circuits used to inhibit electrical current flow in accordance with ASME A17.1-2004, section 2.26.9.6.1 shall comply with the following:
 - a. The SIL-rated devices and circuits shall consist of a Variodyn SIL-3 rated Regenerative, Variable Voltage Variable Frequency (VVVF) motor drive unit, model VAF023, VAF043, or VAF050, labeled or marked with the SIL rating (not less than SIL 3), the name or mark of the certifying organization, and the SIL certification number (968/FSP 1556.00), and followed by the

applicable revision number (as in 968/FSP 1556.02/18).

- b. The devices and circuits shall be certified for compliance with the applicable requirements of ASME A17.1-2013, section 2.26.4.3.2.
- c. The access door or cover of the enclosures containing the SIL rated components shall be clearly labeled or tagged on their exterior with the statement:

**Assembly contains SIL-rated devices
Refer to Maintenance Control Program and
wiring diagrams prior to performing work**

- d. Unique maintenance procedures or methods required for the inspection, testing, or replacement of the SIL-rated circuits shall be developed and a copy maintained in the elevator machine/control room/space. The procedures or methods shall include clear color photographs of each SIL-rated component, with notations identifying parts and locations.
 - e. Wiring diagrams that include part identification, SIL, and certification information shall be maintained in the elevator machine/control room/space.
 - f. A successful test of the SIL-rated devices and circuits shall be conducted initially and not less than annually in accordance with the testing procedure. The test shall demonstrate that SIL-rated devices, safety functions, and related circuits operate as intended.
 - g. Any alterations to the SIL-rated devices and circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the alteration of SIL-rated devices, the alterations shall be made in conformance with ASME A17.1-2022, section 8.7.1.9.
 - h. Any replacement of the SIL-rated devices and circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the replacement of SIL-rated devices, the replacement shall be made in conformance with ASME A17.1-2022, section 8.6.3.14.
 - i. Any repairs to the SIL-rated devices and circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the repair of SIL-rated devices, the repairs shall be made in conformance with ASME A17.1-2022, section 8.6.2.6.
 - j. Any space containing SIL-rated devices and circuits shall be maintained within the temperature and humidity range specified by Schindler Elevator Corporation. The temperature and humidity range shall be posted on each enclosure containing SIL-rated devices and circuits.
 - k. Field changes to the SIL-rated system are not permitted. Any changes to the SIL-rated system's devices and circuitry will require recertification and all necessary updates to the documentation and diagrams required by conditions d. and e. above.
7. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and all applicable requirements met, including conditions of this permanent variance, prior to a Permit to Operate the elevator being issued. The elevator shall not be placed in service prior to the Permit to Operate being issued by Cal/OSHA.
8. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way that the Applicant was required to notify them of the docketed application for

permanent variance per California Code of Regulations, sections 411.2 and 411.3.

9. This Decision and Order shall remain in effect unless duly modified or revoked upon application by Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in the procedural manner prescribed.

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 28, 2026



Kelly Chau, Hearing Officer

EXHIBIT 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA Elevator Unit HQS

EXHIBIT 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings. Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future):
CAL/OSHA Elevator Unit, 2 MacArthur Pl., Suite 700, Santa Ana, CA 92707, Attn: Engineering Section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance file number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.

- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

KONE Monospace 300 Elevators & Medical Emergency Elevator Car Dimensions (Group IV)

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-308	Sacramento City Unified School District	4140 Cuny Ave. Sacramento, CA	2

2. The safety order requirements are set out within section 3143 incorporated ASME A17.1-2004, sections 2.18.5.1 and 2.20.4.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference, by the Occupational Safety and Health Standards Board ("Board"), with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit in accordance with section 426.
2. At the hearing, Fuei Saetern, with KONE INC., appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing
PD3	Cal/OSHA Review of Variance Application

PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each respective Applicant intends to utilize the KONE, Inc. Monospace 300 type elevator, in the quantity, at the location, specified per the above section A.1 table.
2. The installation contract for this elevator was or will be signed on or after May 1, 2008, thus making the elevator subject to the Group IV Elevator Safety Orders.
3. Each Applicant proposes to use hoisting ropes that are 8 mm in diameter which also consist of 0.51 mm diameter outer wires, in variance from the express requirements of ASME A17.1-2004, section 2.20.4.
4. In relevant part, ASME A17.1-2004, section 2.20.4 states:

2.20.4 Minimum Number and Diameter of Suspension Ropes

...The minimum diameter of hoisting and counterweight ropes shall be 9.5 mm (0.375 in.). Outer wires of the ropes shall be not less than 0.56 mm (0.024 in.) in diameter.

5. An intent of ASME A17.1-2004, section 2.20.4, is to ensure that the number, diameter, and construction of suspension ropes are adequate to provide safely robust and durable suspension means over the course of the ropes' foreseen service life.
6. KONE has represented to Cal/OSHA, having established an engineering practice for purposes of Monospace 300 elevator design, of meeting or exceeding the minimum factor of safety of 12 for 8 mm suspension members, as required in ASME A17.1-2010 - under which, given that factor of safety, supplemental broken suspension member protection is not required.
7. Also, each Applicant proposes as a further means of maintaining safety equivalence, monitoring the rope in conformity with the criteria specified within the *Inspector's Guide to 6 mm Diameter Governor and 8 mm Diameter Suspension Ropes for KONE Elevators* (per Application attachment "B", or as thereafter revised by KONE subject Cal/OSHA approval).
8. In addition, each Applicant has proposed to utilize 6 mm diameter governor ropes in variance from Title 8, section 3141, incorporated ASME A17.1-2004, section 2.18.5.1.
9. ASME A17.1-2004, section 2.18.5.1, specifies, in relevant part:

2.18.5.1 Material and Factor of Safety.

... [Governor ropes] not less than 9.5 mm (0.375 in.) in diameter. The factor of safety of governor ropes shall be not less than 5...

10. The Board takes notice of section 3141.7, subpart (a)(10):

A reduced diameter governor rope of equivalent construction and material to that required by ASME A17.1-2004, is permissible if the factor of safety as related to the strength necessary to activate the safety is 5 or greater;

11. Applicants propose use of 6mm governor rope having a safety factor of 5 or greater, in conformity with section 3141.7(a)(10), the specific parameters of which, being expressly set out within the Elevator Safety Orders (ESO), take precedence over more generally referenced governor rope diameter requirements per ASME A17.1-2004, section 2.18.5.1. Accordingly, the governor rope specifications being presently proposed, inclusive of a factor of safety of 5 or greater, would comply with current requirements, and therefore not be subject to issuance of permanent variance.
12. Absent evident diminution in elevator safety, over the past decade the Board has issued numerous permanent variances for use in KONE (Ecospace) elevator systems of 8 mm diameter suspension rope materially similar to that presently proposed (e.g. Permanent Variance Nos. 06-V-203, 08-V-245, and 13-V-303).
13. As noted by the Board in permanent Variance Nos. 18-V-044, and 18-V-045, Decision and Order Findings, subpart B.17 (hereby incorporated by reference), the strength of wire rope operating as an elevator's suspension means does not remain constant over its years of projected service life. With increasing usage cycles, a reduction in the cross-sectional area of the wire rope normally occurs, resulting in decreased residual strength. This characteristic is of particular relevance to the present matter because, decreasing wire rope diameter is associated with a higher rate of residual strength loss. This foreseeable reduction in cross-sectional area primarily results from elongation under sheave rounding load, as well as from wear, and wire or strand breaks. However, these characteristics need not compromise elevator safety when properly accounted for in the engineering of elevator suspension means, and associated components.
14. The presently proposed wire rope is Wuxi Universal steel rope Co LTD. 8 mm 8x19S+8x7+PP, with a manufacturer rated breaking strength of 35.8 kN, and an outer wire diameter of less than 0.56 mm, but not less than 0.51 mm. Cal/OSHA's safety engineer has scrutinized the material and structural specifications, and performance testing data, of this particular proposed rope, and concluded it will provide for safety equivalent to ESO compliant 9.5 mm wire rope, with 0.56 mm outer wire (under conditions of use included within the below Decision and Order).
15. The applicant supplies tabulated data regarding the "Maximum Static Load on All Suspension Ropes." To obtain the tabulated data, the applicant uses the following formula derived from ASME A17.1 2004, section 2.20.3:

$$W = \frac{(S \times N)}{f} \quad \text{where:}$$

W = maximum static load imposed on all car ropes with the car and its rated load at any position in the hoistway

N = number of runs of rope under load. For 2:1 roping, N shall be two times the number of ropes used, etc.

S = manufacturer's rated breaking strength of one rope

f = the factor of safety from Table 2.20.3

16. ASME A17.1-2010 sections 2.20.3 and 2.20.4 utilize the same formula, but provide for use of suspension ropes having a diameter smaller than 9.5 mm, under specified conditions, key

among them being that use of ropes having a diameter of between 8 mm to 9.5 mm be engineered with a factor of safety of 12 or higher. This is a higher minimum factor of safety than that proposed by Applicant but a minimum recommended by Cal/OSHA as a condition of variance necessary to the achieving of safety equivalence to 9.5 mm rope.

17. Cal/OSHA is in accord with Applicant, in proposing as a condition of safety equivalence, that periodic physical examination of the wire ropes be performed to confirm the ropes continue to meet the criteria set out in the (Application attachment) *Inspector's Guide to 6 mm Diameter Governor and 8 mm Diameter Suspension Ropes for KONE Elevators*. Adherence to this condition will provide an additional assurance of safety equivalence, regarding smaller minimum diameter suspension rope outer wire performance over the course of its service life.

18. Applicant requests a permanent variance from section 3041, subdivision (e)(1)(C), which states:

(1) All buildings and structures constructed after the effective date of this order that are provided with one or more passenger elevators shall be provided with not less than one passenger elevator designed and designated to accommodate the loading and transport of an ambulance gurney or stretcher maximum size 22 ½ in. (572 mm) by 75 in. (1.90 m) in its horizontal position and arranged to serve all landings in conformance with the following:

...

(C) The elevator car shall have a minimum inside car platform of 80 in. (2.03 m) wide by 51 in. (1.30 m) deep.

The intent of this language is to ensure that there is enough space to accommodate the access and egress of a gurney and medical personnel inside of a medical service elevator.

This standard is made applicable to Group IV by section 3141.7, subdivision (b), which reads, "Elevators utilized to provide medical emergency service shall comply with Group II, section 3041(e)."

19. Applicant proposes to comply with the requirements of the 2019 California Building Code, section 3002.4.1a in the design of its medical emergency service elevator. That section requires:

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5-inch (127 mm) radius corners] in the horizontal, open position.

The purpose of this requirement is to ensure that an elevator designated for emergency medical service will accommodate a minimum of two emergency personnel with an ambulance gurney or stretcher.

20. Cal/OSHA, by way of written submission to the record (Exhibit PD3), and stated position at hearing, is of the well informed opinion that grant of permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment, and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each Application being the subject of this proceeding, per above section A.1 table, is conditionally GRANTED, to the extent that each such Applicant shall be issued permanent variance from section 3141 incorporated ASME A17.1-2004, section 2.20.4, in as much as it precludes use of suspension rope of between 8 mm and 9.5 mm, or outer wire of between 0.51 mm and 0.56 mm in diameter, at such locations and numbers of Group IV KONE Monospace 300 elevators identified in each respective Application, subject to the following conditions:

1. The diameter of the hoisting steel ropes shall be not less than 8 mm (0.315 in) diameter and the roping ratio shall be two to one (2:1).
2. The outer wires of the suspension ropes shall be not less than 0.51 mm (0.02 in.) in diameter.
3. The number of suspension ropes shall be not fewer than those specified per hereby incorporated Decision and Order Appendix 1 Table.
4. The ropes shall be inspected annually for wire damage (rouge, valley break etc.) in accordance with "KONE, Inc. Inspector's Guide to 6 mm diameter and 8 mm diameter steel ropes for KONE Elevators" (per Application Exhibit B, or as thereafter amended by KONE subject to Cal/OSHA approval).
5. A rope inspection log shall be maintained and available in the elevator controller room / space at all times.
6. The elevator rated speed shall not exceed those speeds specified per the Decision and Order Appendix 1 Table.
7. The maximum suspended load shall not exceed those weights (plus 5%) specified per the Decision and Order Appendix 1 Table.
8. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of the elevator equipment in the hoistway is required. If the service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
9. The installation shall meet the suspension wire rope factor of safety requirements of ASME A17.1-2013 section 2.20.3.
10. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing or testing the elevators shall be provided a copy of this variance decision.
11. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA and a "Permit to Operate" issued before the elevator is placed in service.
12. The Applicant shall comply with suspension means replacement reporting condition per hereby

incorporated Decision and Order Appendix 2.

13. All medical emergency service elevator(s) shall comply with the following:

a. The requirements of the 2019 California Building Code (CBC) section 3002.4.1a:

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5-inch (127 mm) radius corners] in the horizontal, open position.

b. All medical emergency service elevator(s) shall be identified in the building construction documents in accordance with the 2019 California Building Code, section 3002.4a.

c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).

14. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications pursuant to sections 411.2 and 411.3.

15. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in the procedural manner prescribed.

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 23, 2026



Kelly Chau, Hearing Officer

APPENDIX 1

File Number	Elevator ID	Minimum Suspension Ropes Per Elevator	Maximum Suspended Weight Per Elevator	Maximum Speed	Rated Capacity
26-V-308	1	7	12247	150	3500
26-V-308	2	7	12247	150	3500

APPENDIX 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Schindler Model 3300 Elevators, w/variant Gov. Ropes and Sheaves (Group IV)

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-309	Barbara Terrace, LLC	3949 Ohio St. San Diego, CA	2

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Pete Cuellar, with SCHINDLER ELEVATOR CORPORATION, appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each respective Applicant intends to utilize Schindler model 3300 MRL elevator cars, in the quantity, at the locations specified in Jurisdictional and Procedural Matters, section 1.
2. The installation contract for these elevators was or will be signed on or after May 1, 2008, thus making the elevator subject to the Group IV Elevator Safety Orders.
3. The Schindler model 3300 MRL elevator cars are not supported by circular steel wire ropes, as required by the Elevator Safety Orders. They utilize non circular elastomeric coated steel belts and specialized suspension means fastenings.
4. No machine room is provided, preventing the inspection transfer switch from being located in the elevator machine room. The lack of machine room also prevents the seismic reset switch from being located in the elevator machine room.
5. Applicant proposes to relocate the inspection transfer switch and seismic reset switch in an alternative enclosure.
6. Due to the use of a 6 mm (0.25 in.) governor rope with 6-strand construction, the provided governor sheave pitch diameter is less than that required by the Elevator Safety Orders.
7. The driving machine and governor are positioned in the hoistway and restrict the required overhead clearance to the elevator car top.
8. Applicant proposes to insert the car top railings at the perimeter of the car top.
9. Applicant intends to use an elevator control system, model CO NX100NA or CO NX300NA, with a standalone, solid state motor control drive system that includes devices and circuits having a Safety Integrity Level (SIL) rating to execute specific elevator safety functions.

D. Relevant Safety Order Provisions

Applicant seeks a permanent variance from section 3141 [ASME A17.1-2004, sections 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4, 2.20.9.5.4, 2.26.1.4.4(a), 8.4.10.1.1(a)(2)(b), 2.14.1.7.1, 2.18.7.4, and 2.26.9.6.1] of the Elevator Safety Orders, with respect to the suspension ropes and connections, inspection transfer switch relocation, seismic reset switch relocation, the location and construction of car-top railings, governor-sheave diameter, and means of removing power from the driving machine motor for one (1) Schindler model 3300 MRL elevator.

The relevant language of those sections are below.

1. Suspension Means

- Section 3141 [ASME A17.1-2004, section 2.20.1, Suspension Means] states in part:

- Elevator cars shall be suspended by steel wire ropes attached to the car frame or passing around sheaves attached to the car frame specified in 2.15.1. Ropes that have previously been installed and used on another installation shall not be reused. Only iron (low carbon steel) or steel wire ropes, having the commercial classification “Elevator Wire Rope,” or wire rope specifically constructed for elevator use, shall be used for the suspension of elevator cars and for the suspension of counterweights. The wire material for ropes shall be manufactured by the open hearth or electric furnace process, or their equivalent.
- Section 3141 [ASME A17.1-2004, section 2.20.2.1(b), On Crosshead Data Plate] states in part:
 - The crosshead data plate required by 2.16.3 shall bear the following wire rope data:
 - (b) the diameter in millimeters (mm) or inches (in.)
- Section 3141 [ASME A17.1-2004, section 2.20.2.2(a) and (f) On Rope Data Tag] states in part:
 - A metal data tag shall be securely attached to one of the wire rope fastenings. This data tag shall bear the following wire rope data:
 - (a) the diameter in millimeters (mm) or inches (in.)
 - [...]
 - (f) whether the ropes were non preformed or preformed
- Section 3141 [ASME A17.1-2004, section 2.20.3, Factor of Safety] states:
 - The factor of safety of the suspension wire ropes shall be not less than shown in Table 2.20.3. Figure 8.2.7 gives the minimum factor of safety for intermediate rope speeds. The factor of safety shall be based on the actual rope speed corresponding to the rated speed of the car.
 - The factor of safety shall be calculated by the following formula:

$$f = \frac{(S \times N)}{W}$$

- where:
 - N = number of runs of rope under load. For 2:1 roping, N shall be two times the number of ropes used, etc.
 - S = manufacturer's rated breaking strength of one rope
 - W = maximum static load imposed on all car ropes with the car and its rated load at any position in the hoistway

- Section 3141 [ASME A17.1-2004, section 2.20.4, Minimum Number and Diameter of Suspension Ropes] states:
 - The minimum number of hoisting ropes used shall be three for traction elevators and two for drum type elevators.
 - Where a car counterweight is used, the number of counterweight ropes used shall be not less than two.
 - The term “diameter,” where used in reference to ropes, shall refer to the nominal diameter as given by the rope manufacturer.
 - The minimum diameter of hoisting and counterweight ropes shall be 9.5 mm (0.375 in.). Outer wires of the ropes shall be not less than 0.56 mm (0.024 in.) in diameter.
- Section 3141 [ASME A17.1-2004, section 2.20.9.3.4] states:
 - Cast or forged steel rope sockets, shackle rods, and their connections shall be made of unwelded steel, having an elongation of not less than 20% in a gauge length of 50 mm (2 in.), when measured in accordance with ASTM E 8, and conforming to ASTM A 668, Class B for forged steel, and ASTM A 27, Grade 60/30 for cast steel, and shall be stress relieved. Steels of greater strength shall be permitted, provided they have an elongation of not less than 20% in a length of 50 mm (2 in.).
- Section 3141 [ASME A17.1-2004, section 2.20.9.5.4] states:
 - When the rope has been seated in the wedge socket by the load on the rope, the wedge shall be visible, and at least two wire rope retaining clips shall be provided to attach the termination side to the load carrying side of the rope (see Fig. 2.20.9.5). The first clip shall be placed a maximum of 4 times the rope diameter above the socket, and the second clip shall be located within 8 times the rope diameter above the first clip. The purpose of the two clips is to retain the wedge and prevent the rope from slipping in the socket should the load on the rope be removed for any reason. The clips shall be designed and installed so that they do not distort or damage the rope in any manner.

2. Requested Transfer Switch Placement Variance

- As it pertains to installation of the requisite transfer switch within a “machine room” location incompatible with machine-room-less design of the Schindler Model 3300 elevator, the Applicant presently seeks permanent variance from the following Elevator Safety Order incorporated ASME Code A17.1-2004, subsection:
 - Subsection 2.26.1.4.4(a)--Transfer Switch Placement in Machine Room
- Section 3141[ASME A17.1-2004, section 2.26.1.4.4(a), Machine Room Inspection Operation] states:
- When machine room inspection operation is provided, it shall conform to 2.26.1.4.1, and the transfer switch shall be
- (a) located in the machine room[.]

3. Requested Seismic Reset Switch Placement Variance

- As it pertains to installation of the requisite seismic reset switch within a “machine room” location incompatible with machine-room-less design of the Schindler Model 3300 elevator, the Applicant presently seeks permanent variance from the following Elevator Safety Order incorporated ASME Code subsection:
 - Subsection 8.4.10.1.1(a)(2)(b)--Seismic Reset Switch Placement in Machine Room
- Section 3141[ASME A17.1-2004, section 8.4.10.1.1(a)(2)(b), Earthquake Equipment] states:
 - (a) All traction elevators operating at a rated speed of 0.75 m/s (150 ft/min) or more and having counterweights located in the same hoistway shall be provided with the following:
 - (1) seismic zone 3 or greater: a minimum of one seismic switch per building
 - (2) seismic zone 2 or greater:
 - (a) a displacement switch for each elevator
 - (b) an identified momentary reset button or switch for each elevator, located in the control panel in the elevator machine room

4. Requested Car Top Railing Inset Variance

- As it pertains to top of car railing placement requiring space occupied by upper hoistway mounted elevator machinery characteristic of the Schindler Model 3300 elevator, the Applicant presently seeks permanent variance from the following Elevator Safety Order incorporated ASME Code A17.1-2004, section:
 - Section 2.14.1.7.1—Top of Car Perimeter Railing Placement
- Section 3141[ASME A17.1-2004, section 2.14.1.7.1] states:
 - A standard railing conforming to 2.10.2 shall be provided on the outside perimeter of the car top on all sides where the perpendicular distance between the edges of the car top and the adjacent hoistway enclosure exceeds 300 mm (12 in.) horizontal clearance.

5. Pitch Diameter of Governor Sheaves

- Section 3141 [ASME A17.1-2004, Section 2.18.7.4] states:
 - “The pitch diameter of governor sheaves and governor tension sheaves shall be not less than the product of the diameter of the rope and the applicable multiplier listed in Table 2.18.7.4, based on the rated speed and the number of strands in the rope.”

Table 2.18.7.4 Multiplier for Determining Governor Sheave Pitch Diameter
[from ASME A17.1-2004]

<u>Rated Speed m/s (ft./min)</u>	<u>Number of Strands</u>	<u>Multiplier</u>
1.00 or less (200 or less)	6	42
1.00 or less (200 or less)	8	30
Over 1.0 (over 200)	6	46
Over 1.0 (over 200)	8	32

6. SIL Rated System to Inhibit Current Flow to AC Drive Motor

- Section 3141[ASME A17.1-2004, section 2.26.9.6.1] states:
 - Two separate means shall be provided to independently inhibit the flow of alternating current through the solid state devices that connect the direct current power source to the alternating current driving motor. At least one of the means shall be an electromechanical relay.

E. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicant's proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Order from which variance is being sought.

F. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above table in Jurisdictional and Procedural Matters shall have permanent variances from sections 3041, subdivision (e)(1)(C) and 3141.7, subdivision (b) subject of the following conditions:

Elevator Safety Orders:

- Suspension Means: 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4, and 2.20.9.5.4 (Only to the extent necessary to permit the use of the Elastomeric coated Steel Belts proposed by the Applicant, in lieu of circular steel suspension ropes.);
- Inspection transfer switch: 2.26.1.4.4(a) (Only to the extent necessary to permit the inspection transfer switch to reside at a location other than the machine room);
- Seismic reset switch: 8.4.10.1.1(a)(2)(b) (Only to the extent necessary to permit the seismic reset switch to reside at a location other than the machine room. room);

- Car Top Railing: 2.14.1.7.1 (Only to the extent necessary to permit the use of the car top railing system proposed by the Applicant, where the railing system is located inset from the elevator car top perimeter);
- Governor Rope and Sheave: The Applicant shall conditionally hold permanent variance from certain requirements of section 3141, incorporated section of ASME A17.1-2004, to the limited extent variance is necessary to allow for the below specified governor rope and governor sheave parameters: section 2.18.7.4.
- Means of Removing Power: 2.26.9.6.1 (Only to the extent necessary to permit the use of SIL rated devices and circuits as a means to remove power from the AC driving motor, where the redundant monitoring of electrical protective devices is required by the Elevator Safety Orders).

Conditions:

1. The elevator suspension system shall comply to the following:
 - a. The suspension traction media (STM) members and their associated fastenings shall conform to the applicable requirements of ASME A17.1-2013, sections:
 - 2.20.4.3 - Minimum Number of Suspension Members
 - 2.20.3 - Factor of Safety
 - 2.20.9 - Suspension Member Fastening
 - b. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection and testing of the STM members, fastenings, related monitoring and detection systems, and criteria for STM replacement. The Applicant shall make those procedures and criteria available to the Certified Competent Conveyance Mechanic (CCCM) at the location of the elevator, and to the Cal/OSHA upon request.
 - STM member mandatory replacement criteria shall include:
 - i. Any exposed wire, strand or cord;
 - ii. Any wire, strand or cord breaks through the elastomeric coating;
 - iii. Any evidence of rouging (steel tension element corrosion) on any part of the elastomeric coated steel suspension member;
 - iv. Any deformation in the elastomeric suspension member such as, but not limited to, kinks or bends;
 - c. Traction drive sheaves must have a minimum diameter of 72 mm. The maximum speed of STM members running on 72 mm, 87 mm and 125 mm drive sheaves shall be no greater than 2.5 m/s, 6.0 m/s and 8.0 m/s respectively.
 - d. If any one STM member needs replacement, the complete set of suspension members on the elevator shall be replaced. Exception: if a new suspension member is damaged during installation, and prior to any contemporaneously installed STM having been placed into service, it is permissible to replace the individual damaged suspension member. STM members that have been installed on another installation shall not be re used.

- e. A traction loss detection means shall be provided that conforms to the requirements of ASME A17.1-2013, section 2.20.8.1. The means shall be tested for correct function annually in accordance with ASME A17.1-2013, section 8.6.4.19.12.
 - f. A broken suspension member detection means shall be provided that conforms to the requirements of ASME A17.1-2013, section 2.20.8.2. The means shall be tested for correct function annually in accordance with ASME A17.1-2013, section 8.6.4.19.13(a).
 - g. An elevator controller integrated bend cycle monitoring system shall monitor actual STM bend cycles, by means of continuously counting, and storing in nonvolatile memory, the number of trips that the STM makes traveling, and thereby being bent, over the elevator sheaves. The bend cycle limit monitoring means shall automatically stop the car normally at the next available landing before the bend cycle correlated residual strength of any single STM member drops below 80 percent of full rated strength. The monitoring means shall prevent the car from restarting. The bend cycle monitoring system shall be tested annually in accordance with the procedures required by condition 1b above.
 - h. The elevator shall be provided with a device to monitor the remaining residual strength of each STM member. The device shall conform to the requirements of Cal/OSHA Circular Letter E-10-04, a copy of which is attached hereto as Exhibit 1 and incorporated herein by reference.
 - i. The elevator crosshead data plate shall comply with the requirements of ASME A17.1 2013, section 2.20.2.1.
 - j. A suspension means data tag shall be provided that complies with the requirements of ASME A17.1 2013, section 2.20.2.2.
 - k. Comprehensive visual inspections of the entire length of each and all installed suspension members, to the criteria developed in condition 1b, shall be conducted and documented every six months by a CCCM.
 - l. The Applicant shall be subject to the requirements set out in Exhibit 2 of this Decision and Order, "Suspension Means Replacement Reporting Condition," Incorporated herein by this reference.
 - m. Records of all tests and inspections shall be maintenance records subject to ASME A17.1 2004, sections 8.6.1.2 and 8.6.1.4, respectively.
2. If the inspection transfer switch required by ASME A17.1-2004, section 2.26.1.4.4 does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the control/machinery room/space containing the elevator's control equipment in an enclosure secured by a lock openable by a Group 1 security key. The enclosure is to remain locked at all times when not in use.
 3. If the seismic reset switch does not reside in the machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the control/machinery room/space containing the elevator's control equipment in an enclosure secured by a lock openable by a Group 1 security key. The enclosure is to remain locked at all times when not in use.
 4. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on the railings to perform adjustments, maintenance, repairs or inspections. The

Applicant shall not permit anyone to stand or climb over the car top railing.

- b. The distance that the railing can be inset shall be limited to not more than 6 inches.
- c. All exposed areas of the car top outside the car top railing where the distance from the railing to the edge of the car top exceeds 2 inches, shall be beveled with metal, at an angle of not less than 75 degrees with the horizontal, from the mid or top rail to the outside of the car top, such that no person or object can stand, sit, kneel, rest, or be placed in the exposed areas.
- d. The top of the beveled area and/or car top outside the railing shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
- e. The applicant shall provide durable signs with lettering not less than 1/2 inch on a contrasting background on each inset railing. Each sign shall state:

**CAUTION
STAY INSIDE RAILING
NO LEANING BEYOND RAILING
NO STEPPING ON, OR BEYOND, RAILING**

- f. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing will be measured from the car top and not from the required bevel).

5. The speed governor rope and sheaves shall comply with the following:

- a. The governor shall be used in conjunction with a steel 6 mm (0.25 in.) diameter governor rope with 6 strand, regular lay construction.
- b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
- c. The governor sheaves shall have a pitch diameter of not less than 200 mm (7.87 in.).

6. The SIL rated devices and circuits used to inhibit electrical current flow in accordance with ASME A17.1-2004, section 2.26.9.6.1 shall comply with the following:

- a. The SIL-rated devices and circuits shall consist of a Variodyn SIL3 rated Regenerative, Variable Voltage Variable Frequency (VVVF) motor drive unit, model VAF013, VAF023, or VAF043 labeled or marked with the SIL rating (not less than SIL 3), the name or mark of the certifying organization, and the SIL certification number (968/FSP 1556.00), and followed by the applicable revision number (as in 968/FSP 1556.00/19).
- b. The devices and circuits shall be certified for compliance with the applicable requirements of ASME A17.1-2013, section 2.26.4.3.2.
- c. The access door or cover of the enclosures containing the SIL rated components shall be clearly labeled or tagged on their exterior with the statement:

Assembly contains SIL rated devices.

**Refer to Maintenance Control Program and
wiring diagrams prior to performing work.**

- d. Unique maintenance procedures or methods required for the inspection, testing, or replacement of the SIL rated circuits shall be developed and a copy maintained in the elevator machine/control room/space. The procedures or methods shall include clear color photographs of each SIL rated component, with notations identifying parts and locations.
 - e. Wiring diagrams that include part identification, SIL, and certification information shall be maintained in the elevator machine/control room/space.
 - f. A successful test of the SIL rated devices and circuits shall be conducted initially and not less than annually in accordance with the testing procedure. The test shall demonstrate that SIL rated devices, safety functions, and related circuits operate as intended.
 - g. Any alterations to the SIL rated devices and circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the alteration of SIL rated devices, the alterations shall be made in conformance with ASME A17.1-2013, section 8.7.1.9.
 - h. Any replacement of the SIL rated devices and circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the replacement of SIL rated devices, the replacement shall be made in conformance with ASME A17.1-2013, section 8.6.3.14.
 - i. Any repairs to the SIL rated devices and circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the repair of SIL rated devices, the repairs shall be made in conformance with ASME A17.1-2013, section 8.6.2.6.
 - j. Any space containing SIL rated devices and circuits shall be maintained within the temperature and humidity range specified by Schindler Elevator Corporation. The temperature and humidity range shall be posted on each enclosure containing SIL rated devices and circuits.
 - k. Field changes to the SIL rated system are not permitted. Any changes to the SIL rated system's devices and circuitry will require recertification and all necessary updates to the documentation and diagrams required by conditions d. and e. above.
7. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and all applicable requirements met, including conditions of this permanent variance, prior to a Permit to Operate the elevator being issued. The elevator shall not be placed in service prior to the Permit to Operate being issued by Cal/OSHA.
8. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way that the Applicant was required to notify them of the docketed application for permanent variance per sections 411.2 and 411.3.
9. This Decision and Order shall remain in effect unless duly modified or revoked upon application by Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in the procedural manner prescribed.

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 28, 2026



Kelly Chau, Hearing Officer

EXHIBIT 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA Elevator Unit HQS

EXHIBIT 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings. Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future):
CAL/OSHA Elevator Unit, 2 MacArthur Pl., Suite 700, Santa Ana, CA 92707, Attn: Engineering Section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance file number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.

- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

KONE Monospace 500 Elevators & Medical Emergency Elevator Car Dimensions (Group IV)

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-310	Chaffey Joint Union High School District	1245 N. Euclid Ave. Ontario, CA	1

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Fuei Saetern, with KONE INC., appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each respective Applicant intends to utilize the KONE, Inc. Monospace 500 type elevator, in the quantity, at the location, specified per the above section A.1 table.
2. The installation contract for this elevator was or will be signed on or after May 1, 2008, thus making the elevator subject to the Group IV Elevator Safety Orders.
3. Each Applicant proposes to use hoisting ropes that are 8 mm in diameter which also consist of 0.51 mm diameter outer wires, in variance from the express requirements of ASME A17.1-2004, section 2.20.4.
4. In relevant part, ASME A17.1-2004, section 2.20.4 states:

2.20.4 Minimum Number and Diameter of Suspension Ropes

...The minimum diameter of hoisting and counterweight ropes shall be 9.5 mm (0.375 in.). Outer wires of the ropes shall be not less than 0.56 mm (0.024 in.) in diameter.

5. An intent of ASME A17.1-2004, section 2.20.4, is to ensure that the number, diameter, and construction of suspension ropes are adequate to provided safely robust and durable suspension means over the course of the ropes' foreseen service life.
6. KONE has represented to Cal/OSHA, having established an engineering practice for purposes of Monospace 500 elevator design, of meeting or exceeding the minimum factor of safety of 12 for 8 mm suspension members, as required in ASME A17.1-2010 - under which, given that factor of safety, supplemental broken suspension member protection is not required.
7. Also, each Applicant proposes as a further means of maintaining safety equivalence, monitoring the rope in conformity with the criteria specified within the *Inspector's Guide to 6 mm Diameter Governor and 8 mm Diameter Suspension Ropes for KONE Elevators* (per Application attachment "B", or as thereafter revised by KONE subject Cal/OSHA approval).
8. In addition, each Applicant has proposed to utilize 6 mm diameter governor ropes in variance from Title 8, section 3141, incorporated ASME A17.1-2004, section 2.18.5.1.
9. ASME A17.1-2004, section 2.18.5.1, specifies, in relevant part:

2.18.5.1 Material and Factor of Safety.

... [Governor ropes] not less than 9.5 mm (0.375 in.) in diameter. The factor of safety of governor ropes shall be not less than 5...

10. The Board takes notice of section 3141.7, subpart (a)(10):

A reduced diameter governor rope of equivalent construction and material to that required by ASME A17.1-2004, is permissible if the factor of safety as related to the strength necessary to

activate the safety is 5 or greater;

11. Applicants propose use of 6mm governor rope having a safety factor of 5 or greater, in conformity with section 3141.7(a)(10), the specific parameters of which, being expressly set out within the Elevator Safety Orders (ESO), take precedence over more generally referenced governor rope diameter requirements per ASME A17.1-2004, section 2.18.5.1. Accordingly, the governor rope specifications being presently proposed, inclusive of a factor of safety of 5 or greater, would comply with current requirements, and therefore not be subject to issuance of permanent variance.
12. Absent evident diminution in elevator safety, over the past decade the Board has issued numerous permanent variances for use in KONE (Ecospace) elevator systems of 8 mm diameter suspension rope materially similar to that presently proposed (e.g. Permanent Variance Nos. 06-V-203, 08-V-245, and 13-V-303).
13. As noted by the Board in permanent Variance Nos. 18-V-044, and 18-V-045, Decision and Order Findings, subpart B.17 (hereby incorporated by reference), the strength of wire rope operating as an elevator's suspension means does not remain constant over its years of projected service life. With increasing usage cycles, a reduction in the cross-sectional area of the wire rope normally occurs, resulting in decreased residual strength. This characteristic is of particular relevance to the present matter because, decreasing wire rope diameter is associated with a higher rate of residual strength loss. This foreseeable reduction in cross-sectional area primarily results from elongation under sheave rounding load, as well as from wear, and wire or strand breaks. However, these characteristics need not compromise elevator safety when properly accounted for in the engineering of elevator suspension means, and associated components.
14. The presently proposed wire rope is Wuxi Universal steel rope Co LTD. 8 mm 8x19S+8x7+PP, with a manufacturer rated breaking strength of 35.8 kN, and an outer wire diameter of less than 0.56 mm, but not less than 0.51 mm. Cal/OSHA's safety engineer has scrutinized the material and structural specifications, and performance testing data, of this particular proposed rope, and concluded it will provide for safety equivalent to ESO compliant 9.5 mm wire rope, with 0.56 mm outer wire (under conditions of use included within the below Decision and Order).
15. The applicant supplies tabulated data regarding the "Maximum Static Load on All Suspension Ropes." To obtain the tabulated data, the applicant uses the following formula derived from ASME A17.1-2004, section 2.20.3:

$$W = \frac{(S \times N)}{f} \quad \text{where:}$$

W = maximum static load imposed on all car ropes with the car and its rated load at any position in the hoistway

N = number of runs of rope under load. For 2:1 roping, N shall be two times the number of ropes used, etc.

S = manufacturer's rated breaking strength of one rope

f = the factor of safety from Table 2.20.3

16. ASME A17.1-2010 sections 2.20.3 and 2.20.4 utilize the same formula, but provide for use of suspension ropes having a diameter smaller than 9.5 mm, under specified conditions, key among them being that use of ropes having a diameter of between 8 mm to 9.5 mm be engineered with a factor of safety of 12 or higher. This is a higher minimum factor of safety than that proposed by Applicant but a minimum recommended by Cal/OSHA as a condition of variance necessary to the achieving of safety equivalence to 9.5 mm rope.
17. Cal/OSHA is in accord with Applicant, in proposing as a condition of safety equivalence, that periodic physical examination of the wire ropes be performed to confirm the ropes continue to meet the criteria set out in the (Application attachment) *Inspector's Guide to 6 mm Diameter Governor and 8 mm Diameter Suspension Ropes for KONE Elevators*. Adherence to this condition will provide an additional assurance of safety equivalence, regarding smaller minimum diameter suspension rope outer wire performance over the course of its service life.
18. Applicant requests a permanent variance from section 3041, subdivision (e)(1)(C), which states:
- (1) All buildings and structures constructed after the effective date of this order that are provided with one or more passenger elevators shall be provided with not less than one passenger elevator designed and designated to accommodate the loading and transport of an ambulance gurney or stretcher maximum size 22 ½ in. (572 mm) by 75 in. (1.90 m) in its horizontal position and arranged to serve all landings in conformance with the following:
- ...
- (C) The elevator car shall have a minimum inside car platform of 80 in. (2.03 m) wide by 51 in. (1.30 m) deep.
- The intent of this language is to ensure that there is enough space to accommodate the access and egress of a gurney and medical personnel inside of a medical service elevator.
- This standard is made applicable to Group IV by section 3141.7, subdivision (b), which reads, "Elevators utilized to provide medical emergency service shall comply with Group II, section 3041(e)."
19. Applicant proposes to comply with the requirements of the 2019 California Building Code, section 3002.4.1a in the design of its medical emergency service elevator. That section requires:
- The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5-inch (127 mm) radius corners] in the horizontal, open position.
- The purpose of this requirement is to ensure that an elevator designated for emergency medical service will accommodate a minimum of two emergency personnel with an ambulance gurney or stretcher.
20. Cal/OSHA, by way of written submission to the record (Exhibit PD3), and stated position at hearing, is of the well informed opinion that grant of permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment, and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each Application being the subject of this proceeding, per above section A.1 table, is conditionally GRANTED, to the extent that each such Applicant shall be issued permanent variance from section 3141 incorporated ASME A17.1-2004, section 2.20.4, in as much as it precludes use of suspension rope of between 8 mm and 9.5 mm, or outer wire of between 0.51 mm and 0.56 mm in diameter, at such locations and numbers of Group IV KONE Monospace 500 elevators identified in each respective Application, subject to the following conditions:

1. The diameter of the hoisting steel ropes shall be not less than 8 mm (0.315 in) diameter and the roping ratio shall be two to one (2:1).
2. The outer wires of the suspension ropes shall be not less than 0.51 mm (0.02 in.) in diameter.
3. The number of suspension ropes shall be not fewer than those specified per hereby incorporated Decision and Order Appendix 1 Table.
4. The ropes shall be inspected annually for wire damage (rouge, valley break etc.) in accordance with "KONE, Inc. Inspector's Guide to 6 mm diameter and 8 mm diameter steel ropes for KONE Elevators" (per Application Exhibit B, or as thereafter amended by KONE subject to Cal/OSHA approval).
5. A rope inspection log shall be maintained and available in the elevator controller room/space at all times.
6. The elevator rated speed shall not exceed those speeds specified per the Decision and Order Appendix 1 Table.
7. The maximum suspended load shall not exceed those weights (plus 5%) specified per the Decision and Order Appendix 1 Table.
8. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of the elevator equipment in the hoistway is required. If the service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
9. The installation shall meet the suspension wire rope factor of safety requirements of ASME A17.1-2013 section 2.20.3.
10. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing or testing the elevators shall be provided a copy of this variance decision.
11. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA and a "Permit to Operate" issued before the elevator is placed in service.
12. The Applicant shall comply with suspension means replacement reporting condition per hereby

incorporated Decision and Order Appendix 2.

13. All medical emergency service elevator(s) shall comply with the following:

a. The requirements of the 2019 California Building Code (CBC) section 3002.4.1a:

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5-inch (127 mm) radius corners] in the horizontal, open position.

b. All medical emergency service elevator(s) shall be identified in the building construction documents in accordance with the 2019 California Building Code, section 3002.4a.

c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).

14. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications pursuant to sections 411.2 and 411.3.

15. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in the procedural manner prescribed.

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 23, 2026



Kelly Chau, Hearing Officer

APPENDIX 1

File Number	Elevator ID	Minimum Suspension Ropes Per Elevator	Maximum Suspended Weight Per Elevator	Maximum Speed	Rated Capacity
26-V-310	1	5	8748	150	2500

APPENDIX 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Schindler Model S5000 MRL

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-311	Commune VTA III, LLC	148 S Garden St. Ventura, CA	1

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Pete Cuellar, with SCHINDLER ELEVATOR CORPORATION, appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each respective Applicant intends to utilize Schindler model S5000 MRL elevator cars, in the quantity, at the locations, specified per the above section A.1 table.
2. The installation contract for these elevators was or will be signed on or after May 1, 2008, thus making the elevator subject to the Group IV Elevator Safety Orders.
3. The Schindler model S5000 MRL elevator cars are not supported by circular steel wire ropes, as required by the Elevator Safety Orders. They utilize non-circular elastomeric-coated steel belts and specialized suspension means fastenings that are not in compliance with current ESO. This belt type suspension is similar to that found on other elevator products (e.g., Otis Gen2, Schindler 3300, and ThyssenKrupp EVO).
4. No machine room is provided, preventing the inspection transfer switch from being located in the elevator machine room. The lack of machine room also prevents the seismic reset switch from being located in the elevator machine room.
5. Applicant proposes to relocate the inspection transfer switch and seismic reset switch in an alternative enclosure.
6. The driving machine and governor are positioned in the hoistway and restrict the required overhead clearance to the elevator car top.
7. Applicant proposes to insert the car-top railings at the perimeter of the car top.
8. Due to the use of a 6 mm (0.25 in.) governor rope with 6 strand construction, the provided governor sheave pitch diameter is less than that required by the ESO.
9. The Applicant intends to install a governor rope that provides an increased factor of safety in order to compensate for the use of a governor sheave of reduced diameter.
10. Applicant intends to use an elevator control system, model CO NX100NA, with a standalone, solid-state motor control drive system that includes devices and circuits having a Safety Integrity Level (SIL) rating to execute specific elevator safety functions.

D. Relevant Safety Order Provisions

Applicant seeks a permanent variance from section 3141 [ASME A17.1-2004, sections 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4, 2.20.9.5.4, 2.26.1.4.4(a), 8.4.10.1.1(a)(2)(b), 2.14.1.7.1, 2.18.7.4, and 2.26.9.6.1]. The relevant language of those sections are below.

Suspension Means

Section 3141 [ASME A17.1-2004, section 2.20.1, Suspension Means] states in part:

Elevator cars shall be suspended by steel wire ropes attached to the car frame or passing around sheaves attached to the car frame specified in 2.15.1. Ropes that have previously been installed and used on another installation shall not be reused. Only iron (low carbon steel) or steel wire ropes, having the commercial classification "Elevator Wire Rope," or wire rope specifically constructed for elevator use, shall be used for the suspension of elevator cars and for the suspension of counterweights. The wire material for ropes shall be manufactured by the open hearth or electric furnace process, or their equivalent.

Section 3141 [ASME A17.1-2004, section 2.20.2.1(b), On Crosshead Data Plate] states in part:

The crosshead data plate required by 2.16.3 shall bear the following wire-rope data:

(b) the diameter in millimeters (mm) or inches (in.)

Section 3141 [ASME A17.1-2004, section 2.20.2.2(a) and (f) On Rope Data Tag] states in part:

A metal data tag shall be securely attached to one of the wire rope fastenings. This data tag shall bear the following wire rope data:

(a) the diameter in millimeters (mm) or inches (in.)

[...]

(f) whether the ropes were non preformed or preformed

Section 3141 [ASME A17.1-2004, section 2.20.3, Factor of Safety] states:

The factor of safety of the suspension wire ropes shall be not less than shown in Table 2.20.3. Figure 8.2.7 gives the minimum factor of safety for intermediate rope speeds. The factor of safety shall be based on the actual rope speed corresponding to the rated speed of the car.

The factor of safety shall be calculated by the following formula:

$$f = \frac{(S \times N)}{W}$$

where:

N = number of runs of rope under load. For 2:1 roping, N shall be two times the number of ropes used, etc.

S = manufacturer's rated breaking strength of one rope

W = maximum static load imposed on all car ropes with the car and its rated load at any position in the hoistway

Section 3141 [ASME A17.1-2004, section 2.20.4, Minimum Number and Diameter of Suspension Ropes] states:

The minimum number of hoisting ropes used shall be three for traction elevators and two for drum-type elevators.

Where a car counterweight is used, the number of counterweight ropes used shall be not less than two.

The term “diameter,” where used in reference to ropes, shall refer to the nominal diameter as given by the rope manufacturer.

The minimum diameter of hoisting and counterweight ropes shall be 9.5 mm (0.375 in.). Outer wires of the ropes shall be not less than 0.56 mm (0.024 in.) in diameter.

Section 3141 [ASME A17.1-2004, section 2.20.9.3.4] states:

Cast or forged steel rope sockets, shackle rods, and their connections shall be made of unwelded steel, having an elongation of not less than 20% in a gauge length of 50 mm (2 in.), when measured in accordance with ASTM E 8, and conforming to ASTM A 668, Class B for forged steel, and ASTM A 27, Grade 60/30 for cast steel, and shall be stress relieved. Steels of greater strength shall be permitted, provided they have an elongation of not less than 20% in a length of 50 mm (2 in.).

Section 3141 [ASME A17.1-2004, section 2.20.9.5.4] states:

When the rope has been seated in the wedge socket by the load on the rope, the wedge shall be visible, and at least two wire rope retaining clips shall be provided to attach the termination side to the load carrying side of the rope (see Fig. 2.20.9.5). The first clip shall be placed a maximum of 4 times the rope diameter above the socket, and the second clip shall be located within 8 times the rope diameter above the first clip. The purpose of the two clips is to retain the wedge and prevent the rope from slipping in the socket should the load on the rope be removed for any reason. The clips shall be designed and installed so that they do not distort or damage the rope in any manner.

The intent of these code requirements is to ensure that the material used for suspending an elevator car is steel wire rope. Steel wire rope has long been the only accepted method for suspending elevators due to its ability to be visually examined and its proven robust construction. The steel wire rope and attachment specifications contained in the current Elevator Safety Orders are not uniformly suitable for application to the proposed non-circular elastomeric coated steel belt suspension due to its dissimilar construction and fastening to that of wire rope.

Inspection Transfer Switch

Section 3141[ASME A17.1-2004, section 2.26.1.4.4(a), Machine Room Inspection Operation] states:

When machine room inspection operation is provided, it shall conform to 2.26.1.4.1, and the transfer switch shall be

(a) located in the machine room[.]

Seismic Reset Switch

Section 3141[ASME A17.1-2004, section 8.4.10.1.1(a)(2)(b), Earthquake Equipment] states:

(a) All traction elevators operating at a rated speed of 0.75 m/s (150 ft/min) or more and having counterweights located in the same hoistway shall be provided with the following:

(1) seismic zone 3 or greater: a minimum of one seismic switch per building

(2) seismic zone 2 or greater:

(a) a displacement switch for each elevator

(b) an identified momentary reset button or switch for each elevator, located in the control panel in the elevator machine room

Car-Top Railings

Section 3141[ASME A17.1-2004, section 2.14.1.7.1] states:

A standard railing conforming to 2.10.2 shall be provided on the outside perimeter of the car top on all sides where the perpendicular distance between the edges of the car top and the adjacent hoistway enclosure exceeds 300 mm (12 in.) horizontal clearance.

Governor Sheave Diameter

Section 3141 [ASME A17.1-2004, Section 2.18.7.4] states:

“The pitch diameter of governor sheaves and governor tension sheaves shall be not less than the product of the diameter of the rope and the applicable multiplier listed in Table 2.18.7.4, based on the rated speed and the number of strands in the rope.”

Table 2.18.7.4 Multiplier for Determining Governor Sheave Pitch Diameter
[from ASME A17.1-2004]

<u>Rated Speed m/s (ft./min)</u>	<u>Number of Strands</u>	<u>Multiplier</u>
1.00 or less (200 or less)	6	42

1.00 or less (200 or less)	8	30
Over 1.0 (over 200)	6	46
Over 1.0 (over 200)	8	32

The intent of this code section is to prevent the bending of the governor rope around a sheave of insufficient diameter, which could reduce its life expectancy and working strength.

ASME A17.1-2022, Sections 2.18.5.1 states in part:

"Governor rope shall be made of iron, steel, monel metal, phosphor bronze, or stainless steel. They shall be of a regular-lay construction and not less than 6 mm (0.25 in.) in diameter.

The factor of safety of governor ropes shall be not less than 5. Where provided, ropes of a diameter less than 9.5 mm (0.375 in.) shall have a factor of safety not less than 8 and shall be a six-, eight-, or nine-strand construction. Tiller-rope construction shall not be used."

ASME A17.1-2022, Sections 2.18.7.4 states:

"Where governor ropes of a diameter of 9.5 mm (0.375 in.) or greater are used, the pitch diameter of governor sheaves and governor tension sheaves shall be not less than the product of the diameter of the rope and the applicable multiplier listed in Table 2.18.7.4, based on the rated speed and the number of strands in the rope. Where governor ropes of a diameter less than 9.5 mm (0.375 in.) are used, the governor sheave shall have a pitch diameter not less than the product of the diameter of the rope and a multiplier of 30."

SIL-Rated System to Inhibit Current Flow to AC Drive Motor

Section 3141[ASME A17.1-2004, section 2.26.9.6.1] states:

Two separate means shall be provided to independently inhibit the flow of alternating current through the solid state devices that connect the direct current power source to the alternating current driving motor. At least one of the means shall be an electromechanical relay.

E. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Order from which variance is being sought.

F. Decision and Order:

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A.1 shall have permanent variances from sections 3041,

subdivision (e)(1)(C) and 3141.7, subdivision (b) subject of the following conditions:

Elevator Safety Orders:

- Suspension Means: 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4, and 2.20.9.5.4 (Only to the extent necessary to permit the use of the Elastomeric coated Steel Belts proposed by the Applicant, in lieu of circular steel suspension ropes.);
- Inspection transfer switch: 2.26.1.4.4(a) (Only to the extent necessary to permit the inspection transfer switch to reside at a location other than the machine room);
- Seismic reset switch: 8.4.10.1.1(a)(2)(b) (Only to the extent necessary to permit the seismic reset switch to reside at a location other than the machine room. room);
- Car Top Railing: 2.14.1.7.1 (Only to the extent necessary to permit the use of the car top railing system proposed by the Applicant, where the railing system is located inset from the elevator car top perimeter);
- Pitch Diameter: 2.18.7.4 (Only to the extent necessary to permit the use of the speed governor system proposed by the Applicant, where the rope sheave pitch diameter is reduced to 200 mm [7.87 in.]); and
- Means of Removing Power: 2.26.9.6.1 (Only to the extent necessary to permit the use of SIL rated devices and circuits as a means to remove power from the AC driving motor, where the redundant monitoring of electrical protective devices is required by the Elevator Safety Orders).

Conditions:

1. The elevator suspension system shall comply to the following:
 - a. The suspension traction media (STM) members and their associated fastenings shall conform to the applicable requirements of ASME A17.1-2013, sections:
 - 2.20.4.3 - Minimum Number of Suspension Members
 - 2.20.3 - Factor of Safety
 - 2.20.9 - Suspension Member Fastening
 - b. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection and testing of the STM members, fastenings, related monitoring and detection systems, and criteria for STM replacement. The Applicant shall make those procedures and criteria available to the Certified Competent Conveyance Mechanic (CCCM) at the location of the elevator, and to the Cal/OSHA upon request.

STM member mandatory replacement criteria shall include:

- i. Any exposed wire, strand or cord;
- ii. Any wire, strand or cord breaks through the elastomeric coating;
- iii. Any evidence of rouging (steel tension element corrosion) on any part of the elastomeric coated steel suspension member;
- iv. Any deformation in the elastomeric suspension member such as, but not limited to,

kinks or bends;

- c. Traction drive sheaves must have a minimum diameter of 72 mm. The maximum speed of STM members running on 72 mm, 87 mm and 125 mm drive sheaves shall be no greater than 2.5 m/s, 6.0 m/s and 8.0 m/s respectively.
 - d. If any one STM member needs replacement, the complete set of suspension members on the elevator shall be replaced. Exception: if a new suspension member is damaged during installation, and prior to any contemporaneously installed STM having been placed into service, it is permissible to replace the individual damaged suspension member. STM members that have been installed on another installation shall not be re-used.
 - e. A traction loss detection means shall be provided that conforms to the requirements of ASME A17.1-2013, section 2.20.8.1. The means shall be tested for correct function annually in accordance with ASME A17.1 2013, section 8.6.4.19.12.
 - f. A broken suspension member detection means shall be provided that conforms to the requirements of ASME A17.1-2013, section 2.20.8.2. The means shall be tested for correct function annually in accordance with ASME A17.1-2013, section 8.6.4.19.13(a).
 - g. An elevator controller integrated bend cycle monitoring system shall monitor actual STM bend cycles, by means of continuously counting, and storing in nonvolatile memory, the number of trips that the STM makes traveling, and thereby being bent, over the elevator sheaves. The bend cycle limit monitoring means shall automatically stop the car normally at the next available landing before the bend cycle correlated residual strength of any single STM member drops below 80 percent of full rated strength. The monitoring means shall prevent the car from restarting. The bend cycle monitoring system shall be tested annually in accordance with the procedures required by condition 1b above.
 - h. The elevator shall be provided with a device to monitor the remaining residual strength of each STM member. The device shall conform to the requirements of Cal/OSHA Circular Letter E-10-04, a copy of which is attached hereto as Exhibit 1 and incorporated herein by reference.
 - i. The elevator crosshead data plate shall comply with the requirements of ASME A17.1-2013, section 2.20.2.1.
 - j. A suspension means data tag shall be provided that complies with the requirements of ASME A17.1-2013, section 2.20.2.2.
 - k. Comprehensive visual inspections of the entire length of each and all installed suspension members, to the criteria developed in condition 1b, shall be conducted and documented every six months by a CCCM.
 - l. The Applicant shall be subject to the requirements set out in Exhibit 2 of this Decision and Order, "Suspension Means Replacement Reporting Condition," Incorporated herein by this reference.
 - m. Records of all tests and inspections shall be maintenance records subject to ASME A17.1-2004, sections 8.6.1.2 and 8.6.1.4, respectively.
2. If the inspection transfer switch required by ASME A17.1-2004, section 2.26.1.4.4 does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in

the control/machinery room/space containing the elevator's control equipment in an enclosure secured by a lock openable by a Group 1 security key. The enclosure is to remain locked at all times when not in use.

3. If the seismic reset switch does not reside in the machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the control/machinery room/space containing the elevator's control equipment in an enclosure secured by a lock openable by a Group 1 security key. The enclosure is to remain locked at all times when not in use.
4. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on the railings to perform adjustments, maintenance, repairs or inspections. The Applicant shall not permit anyone to stand or climb over the car-top railing.
 - b. The distance that the railing can be inset shall be limited to not more than 6 inches.
 - c. All exposed areas of the car top outside the car top railing where the distance from the railing to the edge of the car-top exceeds 2 inches, shall be beveled with metal, at an angle of not less than 75 degrees with the horizontal, from the mid or top rail to the outside of the car top, such that no person or object can stand, sit, kneel, rest, or be placed in the exposed areas.
 - d. The top of the beveled area and/or car top outside the railing shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
 - e. The applicant shall provide durable signs with lettering not less than 1/2 inch on a contrasting background on each inset railing. Each sign shall state:

**CAUTION
STAY INSIDE RAILING
NO LEANING BEYOND RAILING
NO STEPPING ON, OR BEYOND, RAILING**

- f. The Group IV requirements for car-top clearances shall be maintained (car-top clearances outside the railing will be measured from the car top and not from the required bevel).
5. The speed governor rope and sheaves shall comply with the following:
 - a. The governor shall be used in conjunction with a steel 6 mm (0.25 in.) diameter governor rope with 6 strand, regular lay construction.
 - b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
 - c. The governor sheaves shall have a pitch diameter of not less than 200 mm (7.87 in.).
6. The SIL-rated devices and circuits used to inhibit electrical current flow in accordance with ASME A17.1-2004, section 2.26.9.6.1 shall comply with the following:
 - a. The SIL-rated devices and circuits shall consist of a Variodyn SIL-3 rated Regenerative, Variable Voltage Variable Frequency (VVVF) motor drive unit, model VAF023, VAF043, or VAF050, labeled or marked with the SIL rating (not less than SIL 3), the name or mark of the certifying organization, and the SIL certification number (968/FSP 1556.00), and followed by the

applicable revision number (as in 968/FSP 1556.02/18).

- b. The devices and circuits shall be certified for compliance with the applicable requirements of ASME A17.1-2013, section 2.26.4.3.2.
- c. The access door or cover of the enclosures containing the SIL rated components shall be clearly labeled or tagged on their exterior with the statement:

**Assembly contains SIL-rated devices
Refer to Maintenance Control Program and
wiring diagrams prior to performing work**

- d. Unique maintenance procedures or methods required for the inspection, testing, or replacement of the SIL-rated circuits shall be developed and a copy maintained in the elevator machine/control room/space. The procedures or methods shall include clear color photographs of each SIL-rated component, with notations identifying parts and locations.
 - e. Wiring diagrams that include part identification, SIL, and certification information shall be maintained in the elevator machine/control room/space.
 - f. A successful test of the SIL-rated devices and circuits shall be conducted initially and not less than annually in accordance with the testing procedure. The test shall demonstrate that SIL-rated devices, safety functions, and related circuits operate as intended.
 - g. Any alterations to the SIL-rated devices and circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the alteration of SIL-rated devices, the alterations shall be made in conformance with ASME A17.1-2022, section 8.7.1.9.
 - h. Any replacement of the SIL-rated devices and circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the replacement of SIL-rated devices, the replacement shall be made in conformance with ASME A17.1-2022, section 8.6.3.14.
 - i. Any repairs to the SIL-rated devices and circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the repair of SIL-rated devices, the repairs shall be made in conformance with ASME A17.1-2022, section 8.6.2.6.
 - j. Any space containing SIL-rated devices and circuits shall be maintained within the temperature and humidity range specified by Schindler Elevator Corporation. The temperature and humidity range shall be posted on each enclosure containing SIL-rated devices and circuits.
 - k. Field changes to the SIL-rated system are not permitted. Any changes to the SIL-rated system's devices and circuitry will require recertification and all necessary updates to the documentation and diagrams required by conditions d. and e. above.
7. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and all applicable requirements met, including conditions of this permanent variance, prior to a Permit to Operate the elevator being issued. The elevator shall not be placed in service prior to the Permit to Operate being issued by Cal/OSHA.
8. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way that the Applicant was required to notify them of the docketed application for

permanent variance per California Code of Regulations, sections 411.2 and 411.3.

9. This Decision and Order shall remain in effect unless duly modified or revoked upon application by Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in the procedural manner prescribed.

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 28, 2026



Kelly Chau, Hearing Officer

EXHIBIT 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA Elevator Unit HQS

EXHIBIT 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings. Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future):
CAL/OSHA Elevator Unit, 2 MacArthur Pl., Suite 700, Santa Ana, CA 92707, Attn: Engineering Section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance file number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.

- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Schindler Model S5000 MRL

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-312	LA RE Development Holdings, LLC	2011-2021 Rosecrans Ave. El Segundo, CA	1

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Pete Cuellar, with SCHINDLER ELEVATOR CORPORATION, appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table

PD2	OSHSB Notice of Hearing
PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each respective Applicant intends to utilize Schindler model S5000 MRL elevator cars, in the quantity, at the locations, specified per the above section A.1 table.
2. The installation contract for these elevators was or will be signed on or after May 1, 2008, thus making the elevator subject to the Group IV Elevator Safety Orders.
3. The Schindler model S5000 MRL elevator cars are not supported by circular steel wire ropes, as required by the Elevator Safety Orders. They utilize non-circular elastomeric-coated steel belts and specialized suspension means fastenings that are not in compliance with current ESO. This belt type suspension is similar to that found on other elevator products (e.g., Otis Gen2, Schindler 3300, and ThyssenKrupp EVO).
4. No machine room is provided, preventing the inspection transfer switch from being located in the elevator machine room. The lack of machine room also prevents the seismic reset switch from being located in the elevator machine room.
5. Applicant proposes to relocate the inspection transfer switch and seismic reset switch in an alternative enclosure.
6. The driving machine and governor are positioned in the hoistway and restrict the required overhead clearance to the elevator car top.
7. Applicant proposes to insert the car-top railings at the perimeter of the car top.
8. Due to the use of a 6 mm (0.25 in.) governor rope with 6 strand construction, the provided governor sheave pitch diameter is less than that required by the ESO.
9. The Applicant intends to install a governor rope that provides an increased factor of safety in order to compensate for the use of a governor sheave of reduced diameter.
10. Applicant intends to use an elevator control system, model CO NX100NA, with a standalone, solid-state motor control drive system that includes devices and circuits having a Safety Integrity Level (SIL) rating to execute specific elevator safety functions.

D. Relevant Safety Order Provisions

Applicant seeks a permanent variance from section 3141 [ASME A17.1-2004, sections 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4, 2.20.9.5.4, 2.26.1.4.4(a), 8.4.10.1.1(a)(2)(b), 2.14.1.7.1, 2.18.7.4, and 2.26.9.6.1]. The relevant language of those sections are below.

Suspension Means

Section 3141 [ASME A17.1-2004, section 2.20.1, Suspension Means] states in part:

Elevator cars shall be suspended by steel wire ropes attached to the car frame or passing around sheaves attached to the car frame specified in 2.15.1. Ropes that have previously been installed and used on another installation shall not be reused. Only iron (low carbon steel) or steel wire ropes, having the commercial classification "Elevator Wire Rope," or wire rope specifically constructed for elevator use, shall be used for the suspension of elevator cars and for the suspension of counterweights. The wire material for ropes shall be manufactured by the open hearth or electric furnace process, or their equivalent.

Section 3141 [ASME A17.1-2004, section 2.20.2.1(b), On Crosshead Data Plate] states in part:

The crosshead data plate required by 2.16.3 shall bear the following wire-rope data:

(b) the diameter in millimeters (mm) or inches (in.)

Section 3141 [ASME A17.1-2004, section 2.20.2.2(a) and (f) On Rope Data Tag] states in part:

A metal data tag shall be securely attached to one of the wire rope fastenings. This data tag shall bear the following wire rope data:

(a) the diameter in millimeters (mm) or inches (in.)

[...]

(f) whether the ropes were non preformed or preformed

Section 3141 [ASME A17.1-2004, section 2.20.3, Factor of Safety] states:

The factor of safety of the suspension wire ropes shall be not less than shown in Table 2.20.3. Figure 8.2.7 gives the minimum factor of safety for intermediate rope speeds. The factor of safety shall be based on the actual rope speed corresponding to the rated speed of the car.

The factor of safety shall be calculated by the following formula:

$$f = \frac{(S \times N)}{W}$$

where:

N = number of runs of rope under load. For 2:1 roping, N shall be two times the number of ropes used, etc.

S = manufacturer's rated breaking strength of one rope

W = maximum static load imposed on all car ropes with the car and its rated load at any position in the hoistway

Section 3141 [ASME A17.1-2004, section 2.20.4, Minimum Number and Diameter of Suspension Ropes] states:

The minimum number of hoisting ropes used shall be three for traction elevators and two for drum-type elevators.

Where a car counterweight is used, the number of counterweight ropes used shall be not less than two.

The term “diameter,” where used in reference to ropes, shall refer to the nominal diameter as given by the rope manufacturer.

The minimum diameter of hoisting and counterweight ropes shall be 9.5 mm (0.375 in.). Outer wires of the ropes shall be not less than 0.56 mm (0.024 in.) in diameter.

Section 3141 [ASME A17.1-2004, section 2.20.9.3.4] states:

Cast or forged steel rope sockets, shackle rods, and their connections shall be made of unwelded steel, having an elongation of not less than 20% in a gauge length of 50 mm (2 in.), when measured in accordance with ASTM E 8, and conforming to ASTM A 668, Class B for forged steel, and ASTM A 27, Grade 60/30 for cast steel, and shall be stress relieved. Steels of greater strength shall be permitted, provided they have an elongation of not less than 20% in a length of 50 mm (2 in.).

Section 3141 [ASME A17.1-2004, section 2.20.9.5.4] states:

When the rope has been seated in the wedge socket by the load on the rope, the wedge shall be visible, and at least two wire rope retaining clips shall be provided to attach the termination side to the load carrying side of the rope (see Fig. 2.20.9.5). The first clip shall be placed a maximum of 4 times the rope diameter above the socket, and the second clip shall be located within 8 times the rope diameter above the first clip. The purpose of the two clips is to retain the wedge and prevent the rope from slipping in the socket should the load on the rope be removed for any reason. The clips shall be designed and installed so that they do not distort or damage the rope in any manner.

The intent of these code requirements is to ensure that the material used for suspending an elevator car is steel wire rope. Steel wire rope has long been the only accepted method for suspending elevators due to its ability to be visually examined and its proven robust construction. The steel wire rope and attachment specifications contained in the current Elevator Safety Orders are not uniformly suitable for application to the proposed non-circular elastomeric coated steel belt suspension due to its dissimilar construction and fastening to that of wire rope.

Section 3141[ASME A17.1-2004, section 2.26.1.4.4(a), Machine Room Inspection Operation] states:

When machine room inspection operation is provided, it shall conform to 2.26.1.4.1, and the transfer switch shall be

(a) located in the machine room[.]

Seismic Reset Switch

Section 3141[ASME A17.1-2004, section 8.4.10.1.1(a)(2)(b), Earthquake Equipment] states:

(a) All traction elevators operating at a rated speed of 0.75 m/s (150 ft/min) or more and having counterweights located in the same hoistway shall be provided with the following:

(1) seismic zone 3 or greater: a minimum of one seismic switch per building

(2) seismic zone 2 or greater:

(a) a displacement switch for each elevator

(b) an identified momentary reset button or switch for each elevator, located in the control panel in the elevator machine room

Car-Top Railings

Section 3141[ASME A17.1-2004, section 2.14.1.7.1] states:

A standard railing conforming to 2.10.2 shall be provided on the outside perimeter of the car top on all sides where the perpendicular distance between the edges of the car top and the adjacent hoistway enclosure exceeds 300 mm (12 in.) horizontal clearance.

Governor Sheave Diameter

Section 3141 [ASME A17.1-2004, Section 2.18.7.4] states:

“The pitch diameter of governor sheaves and governor tension sheaves shall be not less than the product of the diameter of the rope and the applicable multiplier listed in Table 2.18.7.4, based on the rated speed and the number of strands in the rope.”

Table 2.18.7.4 Multiplier for Determining Governor Sheave Pitch Diameter
[from ASME A17.1-2004]

Rated Speed m/s (ft./min)	Number of Strands	Multiplier
1.00 or less	6	42

(200 or less)		
1.00 or less (200 or less)	8	30
Over 1.0 (over 200)	6	46
Over 1.0 (over 200)	8	32

The intent of this code section is to prevent the bending of the governor rope around a sheave of insufficient diameter, which could reduce its life expectancy and working strength.

ASME A17.1-2022, Sections 2.18.5.1 states in part:

"Governor rope shall be made of iron, steel, monel metal, phosphor bronze, or stainless steel. They shall be of a regular-lay construction and not less than 6 mm (0.25 in.) in diameter.

The factor of safety of governor ropes shall be not less than 5. Where provided, ropes of a diameter less than 9.5 mm (0.375 in.) shall have a factor of safety not less than 8 and shall be a six-, eight-, or nine-strand construction. Tiller-rope construction shall not be used."

ASME A17.1-2022, Sections 2.18.7.4 states:

"Where governor ropes of a diameter of 9.5 mm (0.375 in.) or greater are used, the pitch diameter of governor sheaves and governor tension sheaves shall be not less than the product of the diameter of the rope and the applicable multiplier listed in Table 2.18.7.4, based on the rated speed and the number of strands in the rope. Where governor ropes of a diameter less than 9.5 mm (0.375 in.) are used, the governor sheave shall have a pitch diameter not less than the product of the diameter of the rope and a multiplier of 30."

SIL-Rated System to Inhibit Current Flow to AC Drive Motor

Section 3141[ASME A17.1-2004, section 2.26.9.6.1] states:

Two separate means shall be provided to independently inhibit the flow of alternating current through the solid state devices that connect the direct current power source to the alternating current driving motor. At least one of the means shall be an electromechanical relay.

E. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Order from which variance is being sought.

F. Decision and Order:

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each

Applicant listed in the above section A.1 shall have permanent variances from sections 3041, subdivision (e)(1)(C) and 3141.7, subdivision (b) subject of the following conditions:

Elevator Safety Orders:

- Suspension Means: 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4, and 2.20.9.5.4 (Only to the extent necessary to permit the use of the Elastomeric coated Steel Belts proposed by the Applicant, in lieu of circular steel suspension ropes.);
- Inspection transfer switch: 2.26.1.4.4(a) (Only to the extent necessary to permit the inspection transfer switch to reside at a location other than the machine room);
- Seismic reset switch: 8.4.10.1.1(a)(2)(b) (Only to the extent necessary to permit the seismic reset switch to reside at a location other than the machine room. room);
- Car Top Railing: 2.14.1.7.1 (Only to the extent necessary to permit the use of the car top railing system proposed by the Applicant, where the railing system is located inset from the elevator car top perimeter);
- Pitch Diameter: 2.18.7.4 (Only to the extent necessary to permit the use of the speed governor system proposed by the Applicant, where the rope sheave pitch diameter is reduced to 200 mm [7.87 in.]); and
- Means of Removing Power: 2.26.9.6.1 (Only to the extent necessary to permit the use of SIL rated devices and circuits as a means to remove power from the AC driving motor, where the redundant monitoring of electrical protective devices is required by the Elevator Safety Orders).

Conditions:

1. The elevator suspension system shall comply to the following:
 - a. The suspension traction media (STM) members and their associated fastenings shall conform to the applicable requirements of ASME A17.1-2013, sections:
 - 2.20.4.3 - Minimum Number of Suspension Members
 - 2.20.3 - Factor of Safety
 - 2.20.9 - Suspension Member Fastening
 - b. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection and testing of the STM members, fastenings, related monitoring and detection systems, and criteria for STM replacement. The Applicant shall make those procedures and criteria available to the Certified Competent Conveyance Mechanic (CCCM) at the location of the elevator, and to the Cal/OSHA upon request.

STM member mandatory replacement criteria shall include:

- i. Any exposed wire, strand or cord;
- ii. Any wire, strand or cord breaks through the elastomeric coating;
- iii. Any evidence of rouging (steel tension element corrosion) on any part of the elastomeric coated steel suspension member;

- iv. Any deformation in the elastomeric suspension member such as, but not limited to, kinks or bends;
- c. Traction drive sheaves must have a minimum diameter of 72 mm. The maximum speed of STM members running on 72 mm, 87 mm and 125 mm drive sheaves shall be no greater than 2.5 m/s, 6.0 m/s and 8.0 m/s respectively.
- d. If any one STM member needs replacement, the complete set of suspension members on the elevator shall be replaced. Exception: if a new suspension member is damaged during installation, and prior to any contemporaneously installed STM having been placed into service, it is permissible to replace the individual damaged suspension member. STM members that have been installed on another installation shall not be re-used.
- e. A traction loss detection means shall be provided that conforms to the requirements of ASME A17.1-2013, section 2.20.8.1. The means shall be tested for correct function annually in accordance with ASME A17.1 2013, section 8.6.4.19.12.
- f. A broken suspension member detection means shall be provided that conforms to the requirements of ASME A17.1-2013, section 2.20.8.2. The means shall be tested for correct function annually in accordance with ASME A17.1-2013, section 8.6.4.19.13(a).
- g. An elevator controller integrated bend cycle monitoring system shall monitor actual STM bend cycles, by means of continuously counting, and storing in nonvolatile memory, the number of trips that the STM makes traveling, and thereby being bent, over the elevator sheaves. The bend cycle limit monitoring means shall automatically stop the car normally at the next available landing before the bend cycle correlated residual strength of any single STM member drops below 80 percent of full rated strength. The monitoring means shall prevent the car from restarting. The bend cycle monitoring system shall be tested annually in accordance with the procedures required by condition 1b above.
- h. The elevator shall be provided with a device to monitor the remaining residual strength of each STM member. The device shall conform to the requirements of Cal/OSHA Circular Letter E-10-04, a copy of which is attached hereto as Exhibit 1 and incorporated herein by reference.
- i. The elevator crosshead data plate shall comply with the requirements of ASME A17.1-2013, section 2.20.2.1.
- j. A suspension means data tag shall be provided that complies with the requirements of ASME A17.1-2013, section 2.20.2.2.
- k. Comprehensive visual inspections of the entire length of each and all installed suspension members, to the criteria developed in condition 1b, shall be conducted and documented every six months by a CCCM.
- l. The Applicant shall be subject to the requirements set out in Exhibit 2 of this Decision and Order, "Suspension Means Replacement Reporting Condition," Incorporated herein by this reference.
- m. Records of all tests and inspections shall be maintenance records subject to ASME A17.1-2004, sections 8.6.1.2 and 8.6.1.4, respectively.

2. If the inspection transfer switch required by ASME A17.1-2004, section 2.26.1.4.4 does not reside

in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the control/machinery room/space containing the elevator's control equipment in an enclosure secured by a lock openable by a Group 1 security key. The enclosure is to remain locked at all times when not in use.

3. If the seismic reset switch does not reside in the machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the control/machinery room/space containing the elevator's control equipment in an enclosure secured by a lock openable by a Group 1 security key. The enclosure is to remain locked at all times when not in use.
4. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on the railings to perform adjustments, maintenance, repairs or inspections. The Applicant shall not permit anyone to stand or climb over the car-top railing.
 - b. The distance that the railing can be inset shall be limited to not more than 6 inches.
 - c. All exposed areas of the car top outside the car top railing where the distance from the railing to the edge of the car-top exceeds 2 inches, shall be beveled with metal, at an angle of not less than 75 degrees with the horizontal, from the mid or top rail to the outside of the car top, such that no person or object can stand, sit, kneel, rest, or be placed in the exposed areas.
 - d. The top of the beveled area and/or car top outside the railing shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
 - e. The applicant shall provide durable signs with lettering not less than 1/2 inch on a contrasting background on each inset railing. Each sign shall state:

**CAUTION
STAY INSIDE RAILING
NO LEANING BEYOND RAILING
NO STEPPING ON, OR BEYOND, RAILING**

- f. The Group IV requirements for car-top clearances shall be maintained (car-top clearances outside the railing will be measured from the car top and not from the required bevel).
5. The speed governor rope and sheaves shall comply with the following:
 - a. The governor shall be used in conjunction with a steel 6 mm (0.25 in.) diameter governor rope with 6 strand, regular lay construction.
 - b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
 - c. The governor sheaves shall have a pitch diameter of not less than 200 mm (7.87 in.).
6. The SIL-rated devices and circuits used to inhibit electrical current flow in accordance with ASME A17.1-2004, section 2.26.9.6.1 shall comply with the following:
 - a. The SIL-rated devices and circuits shall consist of a Variodyn SIL-3 rated Regenerative, Variable Voltage Variable Frequency (VVVF) motor drive unit, model VAF023, VAF043, or VAF050, labeled or marked with the SIL rating (not less than SIL 3), the name or mark of the

certifying organization, and the SIL certification number (968/FSP 1556.00), and followed by the applicable revision number (as in 968/FSP 1556.02/18).

- b. The devices and circuits shall be certified for compliance with the applicable requirements of ASME A17.1-2013, section 2.26.4.3.2.
- c. The access door or cover of the enclosures containing the SIL rated components shall be clearly labeled or tagged on their exterior with the statement:

**Assembly contains SIL-rated devices
Refer to Maintenance Control Program and
wiring diagrams prior to performing work**

- d. Unique maintenance procedures or methods required for the inspection, testing, or replacement of the SIL-rated circuits shall be developed and a copy maintained in the elevator machine/control room/space. The procedures or methods shall include clear color photographs of each SIL-rated component, with notations identifying parts and locations.
 - e. Wiring diagrams that include part identification, SIL, and certification information shall be maintained in the elevator machine/control room/space.
 - f. A successful test of the SIL-rated devices and circuits shall be conducted initially and not less than annually in accordance with the testing procedure. The test shall demonstrate that SIL-rated devices, safety functions, and related circuits operate as intended.
 - g. Any alterations to the SIL-rated devices and circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the alteration of SIL-rated devices, the alterations shall be made in conformance with ASME A17.1-2022, section 8.7.1.9.
 - h. Any replacement of the SIL-rated devices and circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the replacement of SIL-rated devices, the replacement shall be made in conformance with ASME A17.1-2022, section 8.6.3.14.
 - i. Any repairs to the SIL-rated devices and circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the repair of SIL-rated devices, the repairs shall be made in conformance with ASME A17.1-2022, section 8.6.2.6.
 - j. Any space containing SIL-rated devices and circuits shall be maintained within the temperature and humidity range specified by Schindler Elevator Corporation. The temperature and humidity range shall be posted on each enclosure containing SIL-rated devices and circuits.
 - k. Field changes to the SIL-rated system are not permitted. Any changes to the SIL-rated system's devices and circuitry will require recertification and all necessary updates to the documentation and diagrams required by conditions d. and e. above.
7. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and all applicable requirements met, including conditions of this permanent variance, prior to a Permit to Operate the elevator being issued. The elevator shall not be placed in service prior to the Permit to Operate being issued by Cal/OSHA.
8. The Applicant shall notify its employees or their authorized representative(s), or both, of this order

in the same way that the Applicant was required to notify them of the docketed application for permanent variance per California Code of Regulations, sections 411.2 and 411.3.

9. This Decision and Order shall remain in effect unless duly modified or revoked upon application by Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in the procedural manner prescribed.

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 28, 2026



Kelly Chau, Hearing Officer

EXHIBIT 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA Elevator Unit HQS

EXHIBIT 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings. Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future):
CAL/OSHA Elevator Unit, 2 MacArthur Pl., Suite 700, Santa Ana, CA 92707, Attn: Engineering Section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance file number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.

- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Schindler Model S5000 MRL

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-313	Commune VTA, LLC	921 E Front St. Ventura, CA	1

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Pete Cuellar, with SCHINDLER ELEVATOR CORPORATION, appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each respective Applicant intends to utilize Schindler model S5000 MRL elevator cars, in the quantity, at the locations, specified per the above section A.1 table.
2. The installation contract for these elevators was or will be signed on or after May 1, 2008, thus making the elevator subject to the Group IV Elevator Safety Orders.
3. The Schindler model S5000 MRL elevator cars are not supported by circular steel wire ropes, as required by the Elevator Safety Orders. They utilize non-circular elastomeric-coated steel belts and specialized suspension means fastenings that are not in compliance with current ESO. This belt type suspension is similar to that found on other elevator products (e.g., Otis Gen2, Schindler 3300, and ThyssenKrupp EVO).
4. No machine room is provided, preventing the inspection transfer switch from being located in the elevator machine room. The lack of machine room also prevents the seismic reset switch from being located in the elevator machine room.
5. Applicant proposes to relocate the inspection transfer switch and seismic reset switch in an alternative enclosure.
6. The driving machine and governor are positioned in the hoistway and restrict the required overhead clearance to the elevator car top.
7. Applicant proposes to insert the car-top railings at the perimeter of the car top.
8. Due to the use of a 6 mm (0.25 in.) governor rope with 6 strand construction, the provided governor sheave pitch diameter is less than that required by the ESO.
9. The Applicant intends to install a governor rope that provides an increased factor of safety in order to compensate for the use of a governor sheave of reduced diameter.
10. Applicant intends to use an elevator control system, model CO NX100NA, with a standalone, solid-state motor control drive system that includes devices and circuits having a Safety Integrity Level (SIL) rating to execute specific elevator safety functions.

D. Relevant Safety Order Provisions

Applicant seeks a permanent variance from section 3141 [ASME A17.1-2004, sections 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4, 2.20.9.5.4, 2.26.1.4.4(a), 8.4.10.1.1(a)(2)(b), 2.14.1.7.1, 2.18.7.4, and 2.26.9.6.1]. The relevant language of those sections are below.

Suspension Means

Section 3141 [ASME A17.1-2004, section 2.20.1, Suspension Means] states in part:

Elevator cars shall be suspended by steel wire ropes attached to the car frame or passing around sheaves attached to the car frame specified in 2.15.1. Ropes that have previously been installed and used on another installation shall not be reused. Only iron (low carbon steel) or steel wire ropes, having the commercial classification "Elevator Wire Rope," or wire rope specifically constructed for elevator use, shall be used for the suspension of elevator cars and for the suspension of counterweights. The wire material for ropes shall be manufactured by the open hearth or electric furnace process, or their equivalent.

Section 3141 [ASME A17.1-2004, section 2.20.2.1(b), On Crosshead Data Plate] states in part:

The crosshead data plate required by 2.16.3 shall bear the following wire-rope data:

(b) the diameter in millimeters (mm) or inches (in.)

Section 3141 [ASME A17.1-2004, section 2.20.2.2(a) and (f) On Rope Data Tag] states in part:

A metal data tag shall be securely attached to one of the wire rope fastenings. This data tag shall bear the following wire rope data:

(a) the diameter in millimeters (mm) or inches (in.)

[...]

(f) whether the ropes were non preformed or preformed

Section 3141 [ASME A17.1-2004, section 2.20.3, Factor of Safety] states:

The factor of safety of the suspension wire ropes shall be not less than shown in Table 2.20.3. Figure 8.2.7 gives the minimum factor of safety for intermediate rope speeds. The factor of safety shall be based on the actual rope speed corresponding to the rated speed of the car.

The factor of safety shall be calculated by the following formula:

$$f = \frac{(S \times N)}{W}$$

where:

N = number of runs of rope under load. For 2:1 roping, N shall be two times the number of ropes used, etc.

S = manufacturer's rated breaking strength of one rope

W = maximum static load imposed on all car ropes with the car and its rated load at any position in the hoistway

Section 3141 [ASME A17.1-2004, section 2.20.4, Minimum Number and Diameter of Suspension Ropes] states:

The minimum number of hoisting ropes used shall be three for traction elevators and two for drum-type elevators.

Where a car counterweight is used, the number of counterweight ropes used shall be not less than two.

The term “diameter,” where used in reference to ropes, shall refer to the nominal diameter as given by the rope manufacturer.

The minimum diameter of hoisting and counterweight ropes shall be 9.5 mm (0.375 in.). Outer wires of the ropes shall be not less than 0.56 mm (0.024 in.) in diameter.

Section 3141 [ASME A17.1-2004, section 2.20.9.3.4] states:

Cast or forged steel rope sockets, shackle rods, and their connections shall be made of unwelded steel, having an elongation of not less than 20% in a gauge length of 50 mm (2 in.), when measured in accordance with ASTM E 8, and conforming to ASTM A 668, Class B for forged steel, and ASTM A 27, Grade 60/30 for cast steel, and shall be stress relieved. Steels of greater strength shall be permitted, provided they have an elongation of not less than 20% in a length of 50 mm (2 in.).

Section 3141 [ASME A17.1-2004, section 2.20.9.5.4] states:

When the rope has been seated in the wedge socket by the load on the rope, the wedge shall be visible, and at least two wire rope retaining clips shall be provided to attach the termination side to the load carrying side of the rope (see Fig. 2.20.9.5). The first clip shall be placed a maximum of 4 times the rope diameter above the socket, and the second clip shall be located within 8 times the rope diameter above the first clip. The purpose of the two clips is to retain the wedge and prevent the rope from slipping in the socket should the load on the rope be removed for any reason. The clips shall be designed and installed so that they do not distort or damage the rope in any manner.

The intent of these code requirements is to ensure that the material used for suspending an elevator car is steel wire rope. Steel wire rope has long been the only accepted method for suspending elevators due to its ability to be visually examined and its proven robust construction. The steel wire rope and attachment specifications contained in the current Elevator Safety Orders are not uniformly suitable for application to the proposed non-circular elastomeric coated steel belt suspension due to its dissimilar construction and fastening to that of wire rope.

Inspection Transfer Switch

Section 3141[ASME A17.1-2004, section 2.26.1.4.4(a), Machine Room Inspection Operation] states:

When machine room inspection operation is provided, it shall conform to 2.26.1.4.1, and the transfer switch shall be

(a) located in the machine room[.]

Seismic Reset Switch

Section 3141[ASME A17.1-2004, section 8.4.10.1.1(a)(2)(b), Earthquake Equipment] states:

(a) All traction elevators operating at a rated speed of 0.75 m/s (150 ft/min) or more and having counterweights located in the same hoistway shall be provided with the following:

(1) seismic zone 3 or greater: a minimum of one seismic switch per building

(2) seismic zone 2 or greater:

(a) a displacement switch for each elevator

(b) an identified momentary reset button or switch for each elevator, located in the control panel in the elevator machine room

Car-Top Railings

Section 3141[ASME A17.1-2004, section 2.14.1.7.1] states:

A standard railing conforming to 2.10.2 shall be provided on the outside perimeter of the car top on all sides where the perpendicular distance between the edges of the car top and the adjacent hoistway enclosure exceeds 300 mm (12 in.) horizontal clearance.

Governor Sheave Diameter

Section 3141 [ASME A17.1-2004, Section 2.18.7.4] states:

“The pitch diameter of governor sheaves and governor tension sheaves shall be not less than the product of the diameter of the rope and the applicable multiplier listed in Table 2.18.7.4, based on the rated speed and the number of strands in the rope.”

Table 2.18.7.4 Multiplier for Determining Governor Sheave Pitch Diameter
[from ASME A17.1-2004]

<u>Rated Speed m/s (ft./min)</u>	<u>Number of Strands</u>	<u>Multiplier</u>
1.00 or less (200 or less)	6	42

1.00 or less (200 or less)	8	30
Over 1.0 (over 200)	6	46
Over 1.0 (over 200)	8	32

The intent of this code section is to prevent the bending of the governor rope around a sheave of insufficient diameter, which could reduce its life expectancy and working strength.

ASME A17.1-2022, Sections 2.18.5.1 states in part:

"Governor rope shall be made of iron, steel, monel metal, phosphor bronze, or stainless steel. They shall be of a regular-lay construction and not less than 6 mm (0.25 in.) in diameter.

The factor of safety of governor ropes shall be not less than 5. Where provided, ropes of a diameter less than 9.5 mm (0.375 in.) shall have a factor of safety not less than 8 and shall be a six-, eight-, or nine-strand construction. Tiller-rope construction shall not be used."

ASME A17.1-2022, Sections 2.18.7.4 states:

"Where governor ropes of a diameter of 9.5 mm (0.375 in.) or greater are used, the pitch diameter of governor sheaves and governor tension sheaves shall be not less than the product of the diameter of the rope and the applicable multiplier listed in Table 2.18.7.4, based on the rated speed and the number of strands in the rope. Where governor ropes of a diameter less than 9.5 mm (0.375 in.) are used, the governor sheave shall have a pitch diameter not less than the product of the diameter of the rope and a multiplier of 30."

SIL-Rated System to Inhibit Current Flow to AC Drive Motor

Section 3141[ASME A17.1-2004, section 2.26.9.6.1] states:

Two separate means shall be provided to independently inhibit the flow of alternating current through the solid state devices that connect the direct current power source to the alternating current driving motor. At least one of the means shall be an electromechanical relay.

E. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Order from which variance is being sought.

F. Decision and Order:

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A.1 shall have permanent variances from sections 3041,

subdivision (e)(1)(C) and 3141.7, subdivision (b) subject of the following conditions:

Elevator Safety Orders:

- Suspension Means: 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4, and 2.20.9.5.4 (Only to the extent necessary to permit the use of the Elastomeric coated Steel Belts proposed by the Applicant, in lieu of circular steel suspension ropes.);
- Inspection transfer switch: 2.26.1.4.4(a) (Only to the extent necessary to permit the inspection transfer switch to reside at a location other than the machine room);
- Seismic reset switch: 8.4.10.1.1(a)(2)(b) (Only to the extent necessary to permit the seismic reset switch to reside at a location other than the machine room. room);
- Car Top Railing: 2.14.1.7.1 (Only to the extent necessary to permit the use of the car top railing system proposed by the Applicant, where the railing system is located inset from the elevator car top perimeter);
- Pitch Diameter: 2.18.7.4 (Only to the extent necessary to permit the use of the speed governor system proposed by the Applicant, where the rope sheave pitch diameter is reduced to 200 mm [7.87 in.]); and
- Means of Removing Power: 2.26.9.6.1 (Only to the extent necessary to permit the use of SIL rated devices and circuits as a means to remove power from the AC driving motor, where the redundant monitoring of electrical protective devices is required by the Elevator Safety Orders).

Conditions:

1. The elevator suspension system shall comply to the following:
 - a. The suspension traction media (STM) members and their associated fastenings shall conform to the applicable requirements of ASME A17.1-2013, sections:
 - 2.20.4.3 - Minimum Number of Suspension Members
 - 2.20.3 - Factor of Safety
 - 2.20.9 - Suspension Member Fastening
 - b. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection and testing of the STM members, fastenings, related monitoring and detection systems, and criteria for STM replacement. The Applicant shall make those procedures and criteria available to the Certified Competent Conveyance Mechanic (CCCM) at the location of the elevator, and to the Cal/OSHA upon request.

STM member mandatory replacement criteria shall include:

- i. Any exposed wire, strand or cord;
- ii. Any wire, strand or cord breaks through the elastomeric coating;
- iii. Any evidence of rouging (steel tension element corrosion) on any part of the elastomeric coated steel suspension member;
- iv. Any deformation in the elastomeric suspension member such as, but not limited to,

kinks or bends;

- c. Traction drive sheaves must have a minimum diameter of 72 mm. The maximum speed of STM members running on 72 mm, 87 mm and 125 mm drive sheaves shall be no greater than 2.5 m/s, 6.0 m/s and 8.0 m/s respectively.
 - d. If any one STM member needs replacement, the complete set of suspension members on the elevator shall be replaced. Exception: if a new suspension member is damaged during installation, and prior to any contemporaneously installed STM having been placed into service, it is permissible to replace the individual damaged suspension member. STM members that have been installed on another installation shall not be re-used.
 - e. A traction loss detection means shall be provided that conforms to the requirements of ASME A17.1-2013, section 2.20.8.1. The means shall be tested for correct function annually in accordance with ASME A17.1 2013, section 8.6.4.19.12.
 - f. A broken suspension member detection means shall be provided that conforms to the requirements of ASME A17.1-2013, section 2.20.8.2. The means shall be tested for correct function annually in accordance with ASME A17.1-2013, section 8.6.4.19.13(a).
 - g. An elevator controller integrated bend cycle monitoring system shall monitor actual STM bend cycles, by means of continuously counting, and storing in nonvolatile memory, the number of trips that the STM makes traveling, and thereby being bent, over the elevator sheaves. The bend cycle limit monitoring means shall automatically stop the car normally at the next available landing before the bend cycle correlated residual strength of any single STM member drops below 80 percent of full rated strength. The monitoring means shall prevent the car from restarting. The bend cycle monitoring system shall be tested annually in accordance with the procedures required by condition 1b above.
 - h. The elevator shall be provided with a device to monitor the remaining residual strength of each STM member. The device shall conform to the requirements of Cal/OSHA Circular Letter E-10-04, a copy of which is attached hereto as Exhibit 1 and incorporated herein by reference.
 - i. The elevator crosshead data plate shall comply with the requirements of ASME A17.1-2013, section 2.20.2.1.
 - j. A suspension means data tag shall be provided that complies with the requirements of ASME A17.1-2013, section 2.20.2.2.
 - k. Comprehensive visual inspections of the entire length of each and all installed suspension members, to the criteria developed in condition 1b, shall be conducted and documented every six months by a CCCM.
 - l. The Applicant shall be subject to the requirements set out in Exhibit 2 of this Decision and Order, "Suspension Means Replacement Reporting Condition," Incorporated herein by this reference.
 - m. Records of all tests and inspections shall be maintenance records subject to ASME A17.1-2004, sections 8.6.1.2 and 8.6.1.4, respectively.
2. If the inspection transfer switch required by ASME A17.1-2004, section 2.26.1.4.4 does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in

the control/machinery room/space containing the elevator's control equipment in an enclosure secured by a lock openable by a Group 1 security key. The enclosure is to remain locked at all times when not in use.

3. If the seismic reset switch does not reside in the machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the control/machinery room/space containing the elevator's control equipment in an enclosure secured by a lock openable by a Group 1 security key. The enclosure is to remain locked at all times when not in use.
4. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on the railings to perform adjustments, maintenance, repairs or inspections. The Applicant shall not permit anyone to stand or climb over the car-top railing.
 - b. The distance that the railing can be inset shall be limited to not more than 6 inches.
 - c. All exposed areas of the car top outside the car top railing where the distance from the railing to the edge of the car-top exceeds 2 inches, shall be beveled with metal, at an angle of not less than 75 degrees with the horizontal, from the mid or top rail to the outside of the car top, such that no person or object can stand, sit, kneel, rest, or be placed in the exposed areas.
 - d. The top of the beveled area and/or car top outside the railing shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
 - e. The applicant shall provide durable signs with lettering not less than 1/2 inch on a contrasting background on each inset railing. Each sign shall state:

**CAUTION
STAY INSIDE RAILING
NO LEANING BEYOND RAILING
NO STEPPING ON, OR BEYOND, RAILING**

- f. The Group IV requirements for car-top clearances shall be maintained (car-top clearances outside the railing will be measured from the car top and not from the required bevel).
5. The speed governor rope and sheaves shall comply with the following:
 - a. The governor shall be used in conjunction with a steel 6 mm (0.25 in.) diameter governor rope with 6 strand, regular lay construction.
 - b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
 - c. The governor sheaves shall have a pitch diameter of not less than 200 mm (7.87 in.).
6. The SIL-rated devices and circuits used to inhibit electrical current flow in accordance with ASME A17.1-2004, section 2.26.9.6.1 shall comply with the following:
 - a. The SIL-rated devices and circuits shall consist of a Variodyn SIL-3 rated Regenerative, Variable Voltage Variable Frequency (VVVF) motor drive unit, model VAF023, VAF043, or VAF050, labeled or marked with the SIL rating (not less than SIL 3), the name or mark of the certifying organization, and the SIL certification number (968/FSP 1556.00), and followed by the

applicable revision number (as in 968/FSP 1556.02/18).

- b. The devices and circuits shall be certified for compliance with the applicable requirements of ASME A17.1-2013, section 2.26.4.3.2.
- c. The access door or cover of the enclosures containing the SIL rated components shall be clearly labeled or tagged on their exterior with the statement:

**Assembly contains SIL-rated devices
Refer to Maintenance Control Program and
wiring diagrams prior to performing work**

- d. Unique maintenance procedures or methods required for the inspection, testing, or replacement of the SIL-rated circuits shall be developed and a copy maintained in the elevator machine/control room/space. The procedures or methods shall include clear color photographs of each SIL-rated component, with notations identifying parts and locations.
 - e. Wiring diagrams that include part identification, SIL, and certification information shall be maintained in the elevator machine/control room/space.
 - f. A successful test of the SIL-rated devices and circuits shall be conducted initially and not less than annually in accordance with the testing procedure. The test shall demonstrate that SIL-rated devices, safety functions, and related circuits operate as intended.
 - g. Any alterations to the SIL-rated devices and circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the alteration of SIL-rated devices, the alterations shall be made in conformance with ASME A17.1-2022, section 8.7.1.9.
 - h. Any replacement of the SIL-rated devices and circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the replacement of SIL-rated devices, the replacement shall be made in conformance with ASME A17.1-2022, section 8.6.3.14.
 - i. Any repairs to the SIL-rated devices and circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the repair of SIL-rated devices, the repairs shall be made in conformance with ASME A17.1-2022, section 8.6.2.6.
 - j. Any space containing SIL-rated devices and circuits shall be maintained within the temperature and humidity range specified by Schindler Elevator Corporation. The temperature and humidity range shall be posted on each enclosure containing SIL-rated devices and circuits.
 - k. Field changes to the SIL-rated system are not permitted. Any changes to the SIL-rated system's devices and circuitry will require recertification and all necessary updates to the documentation and diagrams required by conditions d. and e. above.
7. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and all applicable requirements met, including conditions of this permanent variance, prior to a Permit to Operate the elevator being issued. The elevator shall not be placed in service prior to the Permit to Operate being issued by Cal/OSHA.
8. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way that the Applicant was required to notify them of the docketed application for

permanent variance per California Code of Regulations, sections 411.2 and 411.3.

9. This Decision and Order shall remain in effect unless duly modified or revoked upon application by Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in the procedural manner prescribed.

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 28, 2026



Kelly Chau, Hearing Officer

EXHIBIT 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA Elevator Unit HQS

EXHIBIT 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings. Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future):
CAL/OSHA Elevator Unit, 2 MacArthur Pl., Suite 700, Santa Ana, CA 92707, Attn: Engineering Section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance file number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.

- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Schindler Model 3300 Elevators, w/variant Gov. Ropes and Sheaves (Group IV)

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-314	LA RE Development Holdings, LLC	2011-2021 Rosecrans Ave. El Segundo, CA	2

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Pete Cuellar, with SCHINDLER ELEVATOR CORPORATION, appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table

PD2	OSHSB Notice of Hearing
PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each respective Applicant intends to utilize Schindler model 3300 MRL elevator cars, in the quantity, at the locations specified in Jurisdictional and Procedural Matters, section 1.
2. The installation contract for these elevators was or will be signed on or after May 1, 2008, thus making the elevator subject to the Group IV Elevator Safety Orders.
3. The Schindler model 3300 MRL elevator cars are not supported by circular steel wire ropes, as required by the Elevator Safety Orders. They utilize non circular elastomeric coated steel belts and specialized suspension means fastenings.
4. No machine room is provided, preventing the inspection transfer switch from being located in the elevator machine room. The lack of machine room also prevents the seismic reset switch from being located in the elevator machine room.
5. Applicant proposes to relocate the inspection transfer switch and seismic reset switch in an alternative enclosure.
6. Due to the use of a 6 mm (0.25 in.) governor rope with 6-strand construction, the provided governor sheave pitch diameter is less than that required by the Elevator Safety Orders.
7. The driving machine and governor are positioned in the hoistway and restrict the required overhead clearance to the elevator car top.
8. Applicant proposes to insert the car top railings at the perimeter of the car top.
9. Applicant intends to use an elevator control system, model CO NX100NA or CO NX300NA, with a standalone, solid state motor control drive system that includes devices and circuits having a Safety Integrity Level (SIL) rating to execute specific elevator safety functions.

D. Relevant Safety Order Provisions

Applicant seeks a permanent variance from section 3141 [ASME A17.1-2004, sections 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4, 2.20.9.5.4, 2.26.1.4.4(a), 8.4.10.1.1(a)(2)(b), 2.14.1.7.1, 2.18.7.4, and 2.26.9.6.1] of the Elevator Safety Orders, with respect to the suspension ropes and connections, inspection transfer switch relocation, seismic reset switch relocation, the location and construction of car-top railings, governor-sheave diameter, and means of removing power from the driving machine motor for one (1) Schindler model 3300 MRL elevator.

The relevant language of those sections are below.

1. Suspension Means

- Section 3141 [ASME A17.1-2004, section 2.20.1, Suspension Means] states in part:
 - Elevator cars shall be suspended by steel wire ropes attached to the car frame or passing around sheaves attached to the car frame specified in 2.15.1. Ropes that have previously been installed and used on another installation shall not be reused. Only iron (low carbon steel) or steel wire ropes, having the commercial classification “Elevator Wire Rope,” or wire rope specifically constructed for elevator use, shall be used for the suspension of elevator cars and for the suspension of counterweights. The wire material for ropes shall be manufactured by the open hearth or electric furnace process, or their equivalent.
- Section 3141 [ASME A17.1-2004, section 2.20.2.1(b), On Crosshead Data Plate] states in part:
 - The crosshead data plate required by 2.16.3 shall bear the following wire rope data:
 - (b) the diameter in millimeters (mm) or inches (in.)
- Section 3141 [ASME A17.1-2004, section 2.20.2.2(a) and (f) On Rope Data Tag] states in part:
 - A metal data tag shall be securely attached to one of the wire rope fastenings. This data tag shall bear the following wire rope data:
 - (a) the diameter in millimeters (mm) or inches (in.)
 - [...]
 - (f) whether the ropes were non preformed or preformed
- Section 3141 [ASME A17.1-2004, section 2.20.3, Factor of Safety] states:
 - The factor of safety of the suspension wire ropes shall be not less than shown in Table 2.20.3. Figure 8.2.7 gives the minimum factor of safety for intermediate rope speeds. The factor of safety shall be based on the actual rope speed corresponding to the rated speed of the car.
 - The factor of safety shall be calculated by the following formula:

$$f = \frac{(S \times N)}{W}$$

- where:
 - N = number of runs of rope under load. For 2:1 roping, N shall be two times the number of ropes used, etc.
 - S = manufacturer's rated breaking strength of one rope
 - W = maximum static load imposed on all car ropes with the car and its rated load at

any position in the hoistway

- Section 3141 [ASME A17.1-2004, section 2.20.4, Minimum Number and Diameter of Suspension Ropes] states:
 - The minimum number of hoisting ropes used shall be three for traction elevators and two for drum type elevators.
 - Where a car counterweight is used, the number of counterweight ropes used shall be not less than two.
 - The term “diameter,” where used in reference to ropes, shall refer to the nominal diameter as given by the rope manufacturer.
 - The minimum diameter of hoisting and counterweight ropes shall be 9.5 mm (0.375 in.). Outer wires of the ropes shall be not less than 0.56 mm (0.024 in.) in diameter.
- Section 3141 [ASME A17.1-2004, section 2.20.9.3.4] states:
 - Cast or forged steel rope sockets, shackle rods, and their connections shall be made of unwelded steel, having an elongation of not less than 20% in a gauge length of 50 mm (2 in.), when measured in accordance with ASTM E 8, and conforming to ASTM A 668, Class B for forged steel, and ASTM A 27, Grade 60/30 for cast steel, and shall be stress relieved. Steels of greater strength shall be permitted, provided they have an elongation of not less than 20% in a length of 50 mm (2 in.).
- Section 3141 [ASME A17.1-2004, section 2.20.9.5.4] states:
 - When the rope has been seated in the wedge socket by the load on the rope, the wedge shall be visible, and at least two wire rope retaining clips shall be provided to attach the termination side to the load carrying side of the rope (see Fig. 2.20.9.5). The first clip shall be placed a maximum of 4 times the rope diameter above the socket, and the second clip shall be located within 8 times the rope diameter above the first clip. The purpose of the two clips is to retain the wedge and prevent the rope from slipping in the socket should the load on the rope be removed for any reason. The clips shall be designed and installed so that they do not distort or damage the rope in any manner.

2. Requested Transfer Switch Placement Variance

- As it pertains to installation of the requisite transfer switch within a “machine room” location incompatible with machine-room-less design of the Schindler Model 3300 elevator, the Applicant presently seeks permanent variance from the following Elevator Safety Order incorporated ASME Code A17.1-2004, subsection:
 - Subsection 2.26.1.4.4(a)--Transfer Switch Placement in Machine Room
- Section 3141[ASME A17.1-2004, section 2.26.1.4.4(a), Machine Room Inspection Operation] states:
- When machine room inspection operation is provided, it shall conform to 2.26.1.4.1, and the transfer switch shall be

- (a) located in the machine room[.]

3. Requested Seismic Reset Switch Placement Variance

- As it pertains to installation of the requisite seismic reset switch within a “machine room” location incompatible with machine-room-less design of the Schindler Model 3300 elevator, the Applicant presently seeks permanent variance from the following Elevator Safety Order incorporated ASME Code subsection:
 - Subsection 8.4.10.1.1(a)(2)(b)--Seismic Reset Switch Placement in Machine Room
- Section 3141[ASME A17.1-2004, section 8.4.10.1.1(a)(2)(b), Earthquake Equipment] states:
 - (a) All traction elevators operating at a rated speed of 0.75 m/s (150 ft/min) or more and having counterweights located in the same hoistway shall be provided with the following:
 - (1) seismic zone 3 or greater: a minimum of one seismic switch per building
 - (2) seismic zone 2 or greater:
 - (a) a displacement switch for each elevator
 - (b) an identified momentary reset button or switch for each elevator, located in the control panel in the elevator machine room

4. Requested Car Top Railing Inset Variance

- As it pertains to top of car railing placement requiring space occupied by upper hoistway mounted elevator machinery characteristic of the Schindler Model 3300 elevator, the Applicant presently seeks permanent variance from the following Elevator Safety Order incorporated ASME Code A17.1-2004, section:
 - Section 2.14.1.7.1—Top of Car Perimeter Railing Placement
- Section 3141[ASME A17.1-2004, section 2.14.1.7.1] states:
 - A standard railing conforming to 2.10.2 shall be provided on the outside perimeter of the car top on all sides where the perpendicular distance between the edges of the car top and the adjacent hoistway enclosure exceeds 300 mm (12 in.) horizontal clearance.

5. Pitch Diameter of Governor Sheaves

- Section 3141 [ASME A17.1-2004, Section 2.18.7.4] states:
 - “The pitch diameter of governor sheaves and governor tension sheaves shall be not less than the product of the diameter of the rope and the applicable multiplier listed in Table 2.18.7.4, based on the rated speed and the number of strands in the rope.”

Table 2.18.7.4 Multiplier for Determining Governor Sheave Pitch Diameter
[from ASME A17.1-2004]

<u>Rated Speed m/s (ft./min)</u>	<u>Number of Strands</u>	<u>Multiplier</u>
1.00 or less (200 or less)	6	42
1.00 or less (200 or less)	8	30
Over 1.0 (over 200)	6	46
Over 1.0 (over 200)	8	32

6. SIL Rated System to Inhibit Current Flow to AC Drive Motor

- Section 3141[ASME A17.1-2004, section 2.26.9.6.1] states:
 - Two separate means shall be provided to independently inhibit the flow of alternating current through the solid state devices that connect the direct current power source to the alternating current driving motor. At least one of the means shall be an electromechanical relay.

E. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicant's proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Order from which variance is being sought.

F. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above table in Jurisdictional and Procedural Matters shall have permanent variances from sections 3041, subdivision (e)(1)(C) and 3141.7, subdivision (b) subject of the following conditions:

Elevator Safety Orders:

- Suspension Means: 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4, and 2.20.9.5.4 (Only to the extent necessary to permit the use of the Elastomeric coated Steel Belts proposed by the Applicant, in lieu of circular steel suspension ropes.);
- Inspection transfer switch: 2.26.1.4.4(a) (Only to the extent necessary to permit the inspection transfer switch to reside at a location other than the machine room);

- Seismic reset switch: 8.4.10.1.1(a)(2)(b) (Only to the extent necessary to permit the seismic reset switch to reside at a location other than the machine room. room);
- Car Top Railing: 2.14.1.7.1 (Only to the extent necessary to permit the use of the car top railing system proposed by the Applicant, where the railing system is located inset from the elevator car top perimeter);
- Governor Rope and Sheave: The Applicant shall conditionally hold permanent variance from certain requirements of section 3141, incorporated section of ASME A17.1-2004, to the limited extent variance is necessary to allow for the below specified governor rope and governor sheave parameters: section 2.18.7.4.
- Means of Removing Power: 2.26.9.6.1 (Only to the extent necessary to permit the use of SIL rated devices and circuits as a means to remove power from the AC driving motor, where the redundant monitoring of electrical protective devices is required by the Elevator Safety Orders).

Conditions:

1. The elevator suspension system shall comply to the following:
 - a. The suspension traction media (STM) members and their associated fastenings shall conform to the applicable requirements of ASME A17.1-2013, sections:
 - 2.20.4.3 - Minimum Number of Suspension Members
 - 2.20.3 - Factor of Safety
 - 2.20.9 - Suspension Member Fastening
 - b. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection and testing of the STM members, fastenings, related monitoring and detection systems, and criteria for STM replacement. The Applicant shall make those procedures and criteria available to the Certified Competent Conveyance Mechanic (CCCM) at the location of the elevator, and to the Cal/OSHA upon request.
 - STM member mandatory replacement criteria shall include:
 - i. Any exposed wire, strand or cord;
 - ii. Any wire, strand or cord breaks through the elastomeric coating;
 - iii. Any evidence of rouging (steel tension element corrosion) on any part of the elastomeric coated steel suspension member;
 - iv. Any deformation in the elastomeric suspension member such as, but not limited to, kinks or bends;
 - c. Traction drive sheaves must have a minimum diameter of 72 mm. The maximum speed of STM members running on 72 mm, 87 mm and 125 mm drive sheaves shall be no greater than 2.5 m/s, 6.0 m/s and 8.0 m/s respectively.
 - d. If any one STM member needs replacement, the complete set of suspension members on the elevator shall be replaced. Exception: if a new suspension member is damaged during

installation, and prior to any contemporaneously installed STM having been placed into service, it is permissible to replace the individual damaged suspension member. STM members that have been installed on another installation shall not be re used.

- e. A traction loss detection means shall be provided that conforms to the requirements of ASME A17.1-2013, section 2.20.8.1. The means shall be tested for correct function annually in accordance with ASME A17.1-2013, section 8.6.4.19.12.
 - f. A broken suspension member detection means shall be provided that conforms to the requirements of ASME A17.1-2013, section 2.20.8.2. The means shall be tested for correct function annually in accordance with ASME A17.1-2013, section 8.6.4.19.13(a).
 - g. An elevator controller integrated bend cycle monitoring system shall monitor actual STM bend cycles, by means of continuously counting, and storing in nonvolatile memory, the number of trips that the STM makes traveling, and thereby being bent, over the elevator sheaves. The bend cycle limit monitoring means shall automatically stop the car normally at the next available landing before the bend cycle correlated residual strength of any single STM member drops below 80 percent of full rated strength. The monitoring means shall prevent the car from restarting. The bend cycle monitoring system shall be tested annually in accordance with the procedures required by condition 1b above.
 - h. The elevator shall be provided with a device to monitor the remaining residual strength of each STM member. The device shall conform to the requirements of Cal/OSHA Circular Letter E-10-04, a copy of which is attached hereto as Exhibit 1 and incorporated herein by reference.
 - i. The elevator crosshead data plate shall comply with the requirements of ASME A17.1 2013, section 2.20.2.1.
 - j. A suspension means data tag shall be provided that complies with the requirements of ASME A17.1 2013, section 2.20.2.2.
 - k. Comprehensive visual inspections of the entire length of each and all installed suspension members, to the criteria developed in condition 1b, shall be conducted and documented every six months by a CCM.
 - l. The Applicant shall be subject to the requirements set out in Exhibit 2 of this Decision and Order, "Suspension Means Replacement Reporting Condition," Incorporated herein by this reference.
 - m. Records of all tests and inspections shall be maintenance records subject to ASME A17.1 2004, sections 8.6.1.2 and 8.6.1.4, respectively.
2. If the inspection transfer switch required by ASME A17.1-2004, section 2.26.1.4.4 does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the control/machinery room/space containing the elevator's control equipment in an enclosure secured by a lock openable by a Group 1 security key. The enclosure is to remain locked at all times when not in use.
3. If the seismic reset switch does not reside in the machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the control/machinery room/space containing the elevator's control equipment in an enclosure secured by a lock openable by a Group 1 security key. The enclosure is to remain locked at all times when not in use.

4. If there is an inset car top railing:

- a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on the railings to perform adjustments, maintenance, repairs or inspections. The Applicant shall not permit anyone to stand or climb over the car top railing.
- b. The distance that the railing can be inset shall be limited to not more than 6 inches.
- c. All exposed areas of the car top outside the car top railing where the distance from the railing to the edge of the car top exceeds 2 inches, shall be beveled with metal, at an angle of not less than 75 degrees with the horizontal, from the mid or top rail to the outside of the car top, such that no person or object can stand, sit, kneel, rest, or be placed in the exposed areas.
- d. The top of the beveled area and/or car top outside the railing shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
- e. The applicant shall provide durable signs with lettering not less than 1/2 inch on a contrasting background on each inset railing. Each sign shall state:

**CAUTION
STAY INSIDE RAILING
NO LEANING BEYOND RAILING
NO STEPPING ON, OR BEYOND, RAILING**

- f. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing will be measured from the car top and not from the required bevel).

5. The speed governor rope and sheaves shall comply with the following:

- a. The governor shall be used in conjunction with a steel 6 mm (0.25 in.) diameter governor rope with 6 strand, regular lay construction.
- b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
- c. The governor sheaves shall have a pitch diameter of not less than 200 mm (7.87 in.).

6. The SIL rated devices and circuits used to inhibit electrical current flow in accordance with ASME A17.1-2004, section 2.26.9.6.1 shall comply with the following:

- a. The SIL-rated devices and circuits shall consist of a Variodyn SIL3 rated Regenerative, Variable Voltage Variable Frequency (VVVF) motor drive unit, model VAF013, VAF023, or VAF043 labeled or marked with the SIL rating (not less than SIL 3), the name or mark of the certifying organization, and the SIL certification number (968/FSP 1556.00), and followed by the applicable revision number (as in 968/FSP 1556.00/19).
- b. The devices and circuits shall be certified for compliance with the applicable requirements of ASME A17.1-2013, section 2.26.4.3.2.
- c. The access door or cover of the enclosures containing the SIL rated components shall be

clearly labeled or tagged on their exterior with the statement:


**Assembly contains SIL rated devices.
Refer to Maintenance Control Program and
wiring diagrams prior to performing work.**

- d. Unique maintenance procedures or methods required for the inspection, testing, or replacement of the SIL rated circuits shall be developed and a copy maintained in the elevator machine/control room/space. The procedures or methods shall include clear color photographs of each SIL rated component, with notations identifying parts and locations.
 - e. Wiring diagrams that include part identification, SIL, and certification information shall be maintained in the elevator machine/control room/space.
 - f. A successful test of the SIL rated devices and circuits shall be conducted initially and not less than annually in accordance with the testing procedure. The test shall demonstrate that SIL rated devices, safety functions, and related circuits operate as intended.
 - g. Any alterations to the SIL rated devices and circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the alteration of SIL rated devices, the alterations shall be made in conformance with ASME A17.1-2013, section 8.7.1.9.
 - h. Any replacement of the SIL rated devices and circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the replacement of SIL rated devices, the replacement shall be made in conformance with ASME A17.1-2013, section 8.6.3.14.
 - i. Any repairs to the SIL rated devices and circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the repair of SIL rated devices, the repairs shall be made in conformance with ASME A17.1-2013, section 8.6.2.6.
 - j. Any space containing SIL rated devices and circuits shall be maintained within the temperature and humidity range specified by Schindler Elevator Corporation. The temperature and humidity range shall be posted on each enclosure containing SIL rated devices and circuits.
 - k. Field changes to the SIL rated system are not permitted. Any changes to the SIL rated system's devices and circuitry will require recertification and all necessary updates to the documentation and diagrams required by conditions d. and e. above.
7. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and all applicable requirements met, including conditions of this permanent variance, prior to a Permit to Operate the elevator being issued. The elevator shall not be placed in service prior to the Permit to Operate being issued by Cal/OSHA.
8. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way that the Applicant was required to notify them of the docketed application for permanent variance per sections 411.2 and 411.3.

9. This Decision and Order shall remain in effect unless duly modified or revoked upon application by Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in the procedural manner prescribed.

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 28, 2026

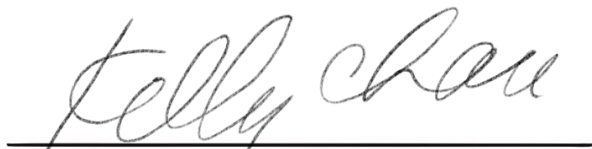

Kelly Chau, Hearing Officer

EXHIBIT 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA Elevator Unit HQS

EXHIBIT 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings. Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future):
CAL/OSHA Elevator Unit, 2 MacArthur Pl., Suite 700, Santa Ana, CA 92707, Attn: Engineering Section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance file number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.

- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

KONE Monospace 500 Elevators & Medical Emergency Elevator Car Dimensions (Group IV)

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-315	Yeshivath Torath Emeth Academy	555 N. La Brea Ave. Los Angeles, CA	1

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Fuei Saetern, with KONE INC., appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each respective Applicant intends to utilize the KONE, Inc. Monospace 500 type elevator, in the quantity, at the location, specified per the above section A.1 table.
2. The installation contract for this elevator was or will be signed on or after May 1, 2008, thus making the elevator subject to the Group IV Elevator Safety Orders.
3. Each Applicant proposes to use hoisting ropes that are 8 mm in diameter which also consist of 0.51 mm diameter outer wires, in variance from the express requirements of ASME A17.1-2004, section 2.20.4.
4. In relevant part, ASME A17.1-2004, section 2.20.4 states:

2.20.4 Minimum Number and Diameter of Suspension Ropes

...The minimum diameter of hoisting and counterweight ropes shall be 9.5 mm (0.375 in.). Outer wires of the ropes shall be not less than 0.56 mm (0.024 in.) in diameter.

5. An intent of ASME A17.1-2004, section 2.20.4, is to ensure that the number, diameter, and construction of suspension ropes are adequate to provided safely robust and durable suspension means over the course of the ropes' foreseen service life.
6. KONE has represented to Cal/OSHA, having established an engineering practice for purposes of Monospace 500 elevator design, of meeting or exceeding the minimum factor of safety of 12 for 8 mm suspension members, as required in ASME A17.1-2010 - under which, given that factor of safety, supplemental broken suspension member protection is not required.
7. Also, each Applicant proposes as a further means of maintaining safety equivalence, monitoring the rope in conformity with the criteria specified within the *Inspector's Guide to 6 mm Diameter Governor and 8 mm Diameter Suspension Ropes for KONE Elevators* (per Application attachment "B", or as thereafter revised by KONE subject Cal/OSHA approval).
8. In addition, each Applicant has proposed to utilize 6 mm diameter governor ropes in variance from Title 8, section 3141, incorporated ASME A17.1-2004, section 2.18.5.1.
9. ASME A17.1-2004, section 2.18.5.1, specifies, in relevant part:

2.18.5.1 Material and Factor of Safety.

... [Governor ropes] not less than 9.5 mm (0.375 in.) in diameter. The factor of safety of governor ropes shall be not less than 5...

10. The Board takes notice of section 3141.7, subpart (a)(10):

A reduced diameter governor rope of equivalent construction and material to that required by ASME A17.1-2004, is permissible if the factor of safety as related to the strength necessary to

activate the safety is 5 or greater;

11. Applicants propose use of 6mm governor rope having a safety factor of 5 or greater, in conformity with section 3141.7(a)(10), the specific parameters of which, being expressly set out within the Elevator Safety Orders (ESO), take precedence over more generally referenced governor rope diameter requirements per ASME A17.1-2004, section 2.18.5.1. Accordingly, the governor rope specifications being presently proposed, inclusive of a factor of safety of 5 or greater, would comply with current requirements, and therefore not be subject to issuance of permanent variance.
12. Absent evident diminution in elevator safety, over the past decade the Board has issued numerous permanent variances for use in KONE (Ecospace) elevator systems of 8 mm diameter suspension rope materially similar to that presently proposed (e.g. Permanent Variance Nos. 06-V-203, 08-V-245, and 13-V-303).
13. As noted by the Board in permanent Variance Nos. 18-V-044, and 18-V-045, Decision and Order Findings, subpart B.17 (hereby incorporated by reference), the strength of wire rope operating as an elevator's suspension means does not remain constant over its years of projected service life. With increasing usage cycles, a reduction in the cross-sectional area of the wire rope normally occurs, resulting in decreased residual strength. This characteristic is of particular relevance to the present matter because, decreasing wire rope diameter is associated with a higher rate of residual strength loss. This foreseeable reduction in cross-sectional area primarily results from elongation under sheave rounding load, as well as from wear, and wire or strand breaks. However, these characteristics need not compromise elevator safety when properly accounted for in the engineering of elevator suspension means, and associated components.
14. The presently proposed wire rope is Wuxi Universal steel rope Co LTD. 8 mm 8x19S+8x7+PP, with a manufacturer rated breaking strength of 35.8 kN, and an outer wire diameter of less than 0.56 mm, but not less than 0.51 mm. Cal/OSHA's safety engineer has scrutinized the material and structural specifications, and performance testing data, of this particular proposed rope, and concluded it will provide for safety equivalent to ESO compliant 9.5 mm wire rope, with 0.56 mm outer wire (under conditions of use included within the below Decision and Order).
15. The applicant supplies tabulated data regarding the "Maximum Static Load on All Suspension Ropes." To obtain the tabulated data, the applicant uses the following formula derived from ASME A17.1-2004, section 2.20.3:

$$W = \frac{(S \times N)}{f} \quad \text{where:}$$

W = maximum static load imposed on all car ropes with the car and its rated load at any position in the hoistway

N = number of runs of rope under load. For 2:1 roping, N shall be two times the number of ropes used, etc.

S = manufacturer's rated breaking strength of one rope

f = the factor of safety from Table 2.20.3

16. ASME A17.1-2010 sections 2.20.3 and 2.20.4 utilize the same formula, but provide for use of suspension ropes having a diameter smaller than 9.5 mm, under specified conditions, key among them being that use of ropes having a diameter of between 8 mm to 9.5 mm be engineered with a factor of safety of 12 or higher. This is a higher minimum factor of safety than that proposed by Applicant but a minimum recommended by Cal/OSHA as a condition of variance necessary to the achieving of safety equivalence to 9.5 mm rope.
17. Cal/OSHA is in accord with Applicant, in proposing as a condition of safety equivalence, that periodic physical examination of the wire ropes be performed to confirm the ropes continue to meet the criteria set out in the (Application attachment) *Inspector's Guide to 6 mm Diameter Governor and 8 mm Diameter Suspension Ropes for KONE Elevators*. Adherence to this condition will provide an additional assurance of safety equivalence, regarding smaller minimum diameter suspension rope outer wire performance over the course of its service life.
18. Applicant requests a permanent variance from section 3041, subdivision (e)(1)(C), which states:
- (1) All buildings and structures constructed after the effective date of this order that are provided with one or more passenger elevators shall be provided with not less than one passenger elevator designed and designated to accommodate the loading and transport of an ambulance gurney or stretcher maximum size 22 ½ in. (572 mm) by 75 in. (1.90 m) in its horizontal position and arranged to serve all landings in conformance with the following:
- ...
- (C) The elevator car shall have a minimum inside car platform of 80 in. (2.03 m) wide by 51 in. (1.30 m) deep.
- The intent of this language is to ensure that there is enough space to accommodate the access and egress of a gurney and medical personnel inside of a medical service elevator.
- This standard is made applicable to Group IV by section 3141.7, subdivision (b), which reads, "Elevators utilized to provide medical emergency service shall comply with Group II, section 3041(e)."
19. Applicant proposes to comply with the requirements of the 2019 California Building Code, section 3002.4.1a in the design of its medical emergency service elevator. That section requires:
- The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5-inch (127 mm) radius corners] in the horizontal, open position.
- The purpose of this requirement is to ensure that an elevator designated for emergency medical service will accommodate a minimum of two emergency personnel with an ambulance gurney or stretcher.
20. Cal/OSHA, by way of written submission to the record (Exhibit PD3), and stated position at hearing, is of the well informed opinion that grant of permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment, and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each Application being the subject of this proceeding, per above section A.1 table, is conditionally GRANTED, to the extent that each such Applicant shall be issued permanent variance from section 3141 incorporated ASME A17.1-2004, section 2.20.4, in as much as it precludes use of suspension rope of between 8 mm and 9.5 mm, or outer wire of between 0.51 mm and 0.56 mm in diameter, at such locations and numbers of Group IV KONE Monospace 500 elevators identified in each respective Application, subject to the following conditions:

1. The diameter of the hoisting steel ropes shall be not less than 8 mm (0.315 in) diameter and the roping ratio shall be two to one (2:1).
2. The outer wires of the suspension ropes shall be not less than 0.51 mm (0.02 in.) in diameter.
3. The number of suspension ropes shall be not fewer than those specified per hereby incorporated Decision and Order Appendix 1 Table.
4. The ropes shall be inspected annually for wire damage (rouge, valley break etc.) in accordance with "KONE, Inc. Inspector's Guide to 6 mm diameter and 8 mm diameter steel ropes for KONE Elevators" (per Application Exhibit B, or as thereafter amended by KONE subject to Cal/OSHA approval).
5. A rope inspection log shall be maintained and available in the elevator controller room/space at all times.
6. The elevator rated speed shall not exceed those speeds specified per the Decision and Order Appendix 1 Table.
7. The maximum suspended load shall not exceed those weights (plus 5%) specified per the Decision and Order Appendix 1 Table.
8. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of the elevator equipment in the hoistway is required. If the service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
9. The installation shall meet the suspension wire rope factor of safety requirements of ASME A17.1-2013 section 2.20.3.
10. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing or testing the elevators shall be provided a copy of this variance decision.
11. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA and a "Permit to Operate" issued before the elevator is placed in service.
12. The Applicant shall comply with suspension means replacement reporting condition per hereby

incorporated Decision and Order Appendix 2.

13. All medical emergency service elevator(s) shall comply with the following:

a. The requirements of the 2019 California Building Code (CBC) section 3002.4.1a:

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5-inch (127 mm) radius corners] in the horizontal, open position.

b. All medical emergency service elevator(s) shall be identified in the building construction documents in accordance with the 2019 California Building Code, section 3002.4a.

c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).

14. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications pursuant to sections 411.2 and 411.3.

15. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in the procedural manner prescribed.

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 23, 2026



Kelly Chau, Hearing Officer

APPENDIX 1

File Number	Elevator ID	Minimum Suspension Ropes Per Elevator	Maximum Suspended Weight Per Elevator	Maximum Speed	Rated Capacity
26-V-315	1	7	12247	150	3500

APPENDIX 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

TK Elevator Evolution (Group IV)

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-317	San Joaquin County Office of Education	201 N. California St. Stockton, CA	1

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, James Day, with TK Elevator Corporation, appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Applicant proposes to utilize inset car top railings and guards in compliance with ASME 17.1-2013, section 2.14.1.7.1 and the Vivante Westside, LLC File No. 18-V-364 (Nov. 20, 2020) decision (Vivante). Applicant further claims that the request is consistent with the Vivante, the Mack Urban, LLC, Permanent Variance No. 15-V-349 (Nov. 17, 2016), and the Patton Equities, LLC Permanent Variance No. 20-V-128 (Nov. 12, 2020) decisions (Patton Equities).
2. Applicant proposes to utilize noncircular elastomeric-coated steel belts ("ECSBs") rather than steel ropes in a machine room-less ("MRL") elevator installation, with updated data plates, data tags, and wedge sockets designed for use with ECSBs, as well as the appropriate factor of safety criteria conforming to ASME 17.1-2013, with a continuous residual strength detection device ("RSDD") compliant with the San Francisco Public Works (Permanent Variance No. 21-V-061, et al.) decisions.
3. The installation shall utilize the TK Elevator Model 104DP001 RSDD, accepted by Cal/OSHA on May 4, 2021.
4. Applicant proposes to comply with ASME A17.1-2013 sections 2.26.9.3, "Protection Against Failures", rather than the requirements of 2.26.9.3 and 2.26.9.4 in the ASME 2004 code.
5. Applicant proposes to use TKE's control systems, using the TKE TAC32T Controller with SIL3 rated elements, to provide equivalent safety to ASME A17.1-2004, section 2.26.9.4 as a means to inhibit flow of Alternating Current to the Driving Motor in compliance with ASME A17.1-2013, section 2.26.9.6.
6. Applicant proposes to locate the Inspection Transfer Switch within the machinery/control room/space in the MRL installation, in compliance with ASME 17.1-2013, section 2.26.1.4.
7. Applicant proposes to locate the Seismic-Operation Reset Switch in the machinery/control room/space in the MRL installation.

D. Relevant Safety Orders

Variance Request No. 1 (ASME A17.1-2004, section 2.14.1.7.1)

2.14.1.7.1 A standard railing conforming to 2.10.2 shall be provided on the outside perimeter of the car top on all sides where the perpendicular distance between the edges of the car top and the adjacent hoistway enclosure exceeds 300 mm (12 in.) horizontal clearance.

Variance Request No. 2A (ASME A17.1-2004, section 2.20.1)

2.20.1 Suspension Means

Elevator cars shall be suspended by steel wire ropes attached to the car frame or passing around sheaves attached to the car frame specified in 2.15.1. Ropes that have previously been installed and used on another installation shall not be reused.

Only iron (low-carbon steel) or steel wire ropes, having the commercial classification "Elevator Wire Rope," or wire rope specifically constructed for elevator use, shall be used for the suspension of elevator cars and for the suspension of counterweights. The wire material for ropes shall be manufactured by the open-hearth or electric furnace process or their equivalent.

Variance Request No. 2B (ASME A17.1-2004, section 2.20.2[.1])

2.20.2.1 On Crosshead Data Plate.

The crosshead data plate required by 2.16.3 shall bear the following wire-rope data:

- (a) the number of ropes
- (b) the diameter in millimeters (mm) or inches (in.)
- (c) the manufacturer's rated breaking strength per rope in kilo Newton (kN) or pounds (lb)

Variance Request No. 2C (ASME A17.1-2004, section 2.20.2.2)

2.20.2.2 On Rope Data Tag.

A metal data tag shall be securely attached to one of the wire-rope fastenings. This data tag shall bear the following wire-rope data:

- (a) the diameter in millimeters (mm) or inches (in.)
- [...]
- (f) whether the ropes were nonpreformed or preformed
- [...]

Variance Request No. 2D. (ASME A17.1-2004, section 2.20.3)

2.20.3 Factor of Safety

The factor of safety of the suspension wire ropes shall be not less than shown in Table 2.20.3. Figure 8.2.7 gives the minimum factor of safety for intermediate rope speeds. The factor of safety shall be based on the actual rope speed corresponding to the rated speed of the car.

The factor of safety shall be calculated by the following formula:

$$f = \frac{(S \times N)}{W}$$

where:

N = number of runs of rope under load. For 2:1 roping, N shall be two times the number of ropes used, etc.

S = manufacturer's rated breaking strength of one rope

W = maximum static load imposed on all car ropes with the car and its rated load at any position in the hoistway

Variance Request No. 2E (ASME A17.1-2004, section 2.20.4)

2.20.4 Minimum Number and Diameter of Suspension Ropes

The minimum number of hoisting ropes used shall be three for traction elevators and two for drum-type elevators.

Where a car counterweight is used, the number of counterweight ropes used shall be not less than two.

The term "diameter," where used in reference to ropes, shall refer to the nominal diameter as given by the rope manufacturer.

The minimum diameter of hoisting and counterweight ropes shall be 9.5 mm (0.375 in.). Outer wires of the ropes shall be not less than 0.56 mm (0.024 in.) in diameter.

Variance Request No. 2F (ASME A17.1-2004, section 2.20.9[.1])

2.20.9 Suspension-Rope Fastening

2.20.9.1 Type of Rope Fastenings. The car and counterweight ends of suspension wire ropes, or the stationary hitch-ends where multiple roping is used, shall be fastened in such a manner that all portions of the rope, except the portion inside the rope sockets, shall be readily visible.

Fastening shall be

(a) by individual tapered rope sockets (see 2.20.9.4) or other types of rope fastenings that have undergone adequate tensile engineering tests, provided that

(1) such fastenings conform to 2.20.9.2 and 2.20.9.3;

(2) the rope socketing is such as to develop at least 80% of the ultimate breaking strength of the strongest rope to be used in such fastenings; or

(b) by individual wedge rope sockets (see 2.20.9.5); and

(c) U-bolt-type rope clamps or similar devices shall not be used for suspension rope fastenings.

Variance Request No. 3 (ASME A17.1-2004, section 2.26.9.4)

2.26.9.4 Redundant devices used to satisfy 2.26.9.3 in the determination of the occurrence of a single ground, or the failure of any single magnetically operated switch, contactor or relay, or of any single solid state device, or any single device that limits the leveling or truck zone, or a software system failure, shall be checked prior to each start of the elevator from a landing, when on automatic operation. When a single ground or failure, as specified in 2.26.9.3, occurs, the car shall not be permitted to restart. Implementation of redundancy by a software system is permitted, provided that the removal of power from the driving-machine motor and brake shall not be solely dependent on software-controlled means.

Variance Request No. 4 (ASME A17.1-2004, section 2.26.9.6.1)

2.26.9.6.1 Two separate means shall be provided to independently inhibit the flow of alternating-current through the solid state devices that connect the direct-current power source to the alternating-current driving motor. At least one of the means shall be an electromechanical relay.

Variance Request No. 5 (ASME A17.1-2004, section 2.26.1.4.4(a))

2.26.1.4.4 Machine Room Inspection Operation

(a) When machine room inspection operation is provided, it shall conform to 2.26.1.4.1, and the transfer switch shall be located in the machine room.

Variance Request No. 6 (ASME A17.1-2004, section 8.4.10.1.1(a)(2)(b))

8.4.10.1.1 Earthquake Equipment (See Also Fig. 8.4.10.1.1)

(a) All traction elevators operating at a rated speed of 0.75 m/s (150 ft/min) or more and having counterweights located in the same hoistway shall be provided with the following:

(1) seismic zone 3 or greater: a minimum of one seismic switch per building

(2) seismic zone 2 or greater:

(a) a displacement switch for each elevator

(b) an identified momentary reset button or switch for each elevator, located in the control panel in the elevator machine room [see 8.4.10.1.3(i)]

E. Decision and Order

Applicant is hereby conditionally GRANTED Permanent Variance as specified below, and to the limited extent, as of the date the Board adopts this Proposed Decision, with respect to the section A specified number of TKE EVO 200 elevator(s), at the specified location, each shall conditionally hold permanent variance from the following subparts of ASME A17.1-2004, currently incorporated by reference into section 3141 of the Elevator Safety Orders:

- Car-Top Railing: 2.14.1.7.1 (Limited to the extent necessary to permit the use of an inset car-top railing)
- Suspension Means: 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, and 2.20.9.1

(Limited to the extent necessary to permit the use of the elastomeric-coated steel belts in lieu of circular steel suspension ropes)

- Inspection transfer switch: 2.26.1.4.4(a) (Limited to the extent necessary to permit the inspection transfer switch to reside at a location other than the machine room)
- Software Reliant Means to Remove Power: 2.26.9.4 (Limited to the extent necessary to permit the exclusive use of SIL-rated software systems as a means to remove power from the driving machine motor and brake)
- SIL-Rated Circuitry to Inhibit Current Flow: 2.26.9.6.1 (Limited to the extent necessary to permit the use of SIL-rated circuitry in place of an electromechanical relay to inhibit current flow to the drive motor)
- Seismic reset switch: 8.4.10.1.1(a)(2)(b) (Limited to the extent necessary to permit the seismic reset switch to reside at a location other than the machine room)

Inset Car Top Railing (Variance Request No. 1):

1.0 Any and all inset car top railings shall comply with the following:

1.1 Serviceable equipment shall be positioned so that mechanics and inspectors do not have to stand on or climb over the railings to perform adjustments, maintenance, repairs or inspections. The Applicant shall not permit trained elevator mechanics or elevator service personnel to stand or climb over the car top railing.

1.2 The distance that the railing can be inset shall be limited to not more than six inches (6").

1.3 All exposed areas of the car top outside the car top railing where the distance from the railing to the edge of the car top exceeds two inches (2"), shall be beveled with metal, at an angle of not less than 75 degrees with the horizontal, from the mid or top rail to the outside of the car top, such that no person or object can stand, sit, kneel, rest, or be placed in the exposed areas.

1.4 The top surface of the beveled area and/or car top outside the railing, shall be clearly marked. The markings shall consist of alternating 4" diagonal red and white stripes.

1.5 The Applicant shall provide durable signs with lettering not less than 1/2 inch on a contrasting background on each inset railing; each sign shall state:

**CAUTION
STAY INSIDE RAILING
NO LEANING BEYOND RAILING
NO STEPPING ON, OR BEYOND, RAILING**

1.6 The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing will be measured from the car top and not from the required bevel).

Suspension Means (Variance Request No. 2):

2.0 The elevator suspension system shall comply with the following:

2.1 The elastomeric coated steel belts (ECSBs) and their associated fastenings shall conform to the applicable requirements of ASME A17.1-2013, sections:

2.20.4.3 – Minimum Number of Suspension Members

2.20.3 – Factor of Safety

2.20.9 – Suspension Member Fastening

2.2 Additionally, ECSBs shall meet or exceed all requirements of ASME A17.6-2010, Standard for Elevator Suspension, Compensation, and Governor Systems, Part 3 Noncircular Elastomeric Coated Steel Suspension Members for Elevators.

2.3 The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection and testing of the ECSBs and fastenings and related monitoring and detection systems and criteria for ECSB replacement, and the Applicant shall make those procedures and criteria available to the Certified Competent Conveyance Mechanic (CCCM) at the location of the elevator, and to Cal/OSHA upon request.

2.4 ECSB mandatory replacement criteria shall include:

2.4.1. Any exposed wire, strand or cord;

2.4.2. Any wire, strand or cord breaks through the elastomeric coating;

2.4.3. Any evidence of rouging (steel tension element corrosion) on any part of the elastomeric coated steel suspension member;

2.4.4. Any deformation in the elastomeric suspension member such as, but not limited to, kinks or bends.

2.5 Traction drive sheaves must have a minimum diameter of 112 mm. The maximum speed of ECSBs running on 112 mm drive sheaves shall be no greater than 6.1 m/s.

2.6 If any one (1) ECSB needs replacement, the complete set of suspension members on the elevator shall be replaced. Exception: If a new suspension member is damaged during installation, and prior to any contemporaneously installed ECSB having been placed into service, it is permissible to replace the individual damaged suspension member. ECSBs that have been installed on another installation shall not be re used.

2.7 A traction loss detection means shall be provided that conforms to the requirements of ASME A17.1-2013, section 2.20.8.1. The means shall be tested for correct function annually in accordance with ASME A17.1-2013, section 8.6.4.19.12.

2.8 A broken suspension member detection means shall be provided that conforms to the requirements of ASME A17.1-2013, section 2.20.8.2. The means shall be tested for correct function annually in accordance with ASME A17.1-2013, section 8.6.4.19.13(a).

2.9 An elevator controller integrated bend cycle monitoring system shall monitor actual ECSB bend cycles, by means of continuously counting, and storing in nonvolatile memory, the number of trips that

the ECSB makes traveling, and thereby being bent, over the elevator sheaves. The bend cycle limit monitoring means shall automatically stop the car normally at the next available landing before the bend cycle correlated residual strength of any single ECSB member drops below (60%) sixty percent of full rated strength. The monitoring means shall prevent the car from restarting. Notwithstanding any less frequent periodic testing requirement per Addendum 2 (Cal/OSHA Circular Letter), the bend cycle monitoring system shall be tested semiannually in accordance with the procedures required per above Conditions 2.3 and 2.4.

2.10 The elevator crosshead data plate shall comply with the requirements of ASME A17.1-2013, section 2.20.2.1.

2.11 A suspension means data tag shall be provided that complies with the requirements of ASME A17.1-2013, section 2.20.2.2.

2.12 Comprehensive visual inspections of the entire length of each and all installed suspension members, in conformity with above Conditions 2.3 and 2.4 specified criteria, shall be conducted and documented every six (6) months by a CCCM.

2.13 The Applicant shall be subject to the requirements per hereto attached, and inhere incorporated, Addendum 1, "Suspension Means Replacement Reporting Condition."

2.14 Records of all tests and inspections shall be maintenance records subject to ASME A17.1-2004, sections 8.6.1.2, and 8.6.1.4, respectively.

2.15 The subject elevators(s) shall be equipped with a TK Elevator Model 104DP001 Residual Strength Detection Device accepted by Cal/OSHA on May 4, 2021 or Cal/OSHA accepted equivalent device.

Control and Operating Circuits

Combined Software Redundant Devices with Software Removal of Power from Driving Motor and Brake (Variance Request No. 3)

Removal of Power from Driving Motor Without Electro-mechanical Switches (Variance Request No. 4)

3.0 The SIL rated circuitry used to provide device/circuit redundancy and to inhibit electrical current flow in accordance with ASME A17.1-2004, sections 2.26.9.4 and 2.26.9.6.1 shall comply with the following:

3.1 The SIL rated systems and related circuits shall consist of:

3.1.1. ELGO LIMAX33 RED, (aka LIMAX3R-03-050-0500-CNXTG-RJU), Safe Magnetic Absolute Shaft Information System, labeled or marked with the SIL rating (not less than SIL 3), the name or mark of the certifying organization, and the SIL certification number (968/A 163), followed by the applicable revision number (as in 968/A 163.07/19).

3.1.2 Printed circuit board assembly SSOA (6300 AHE001), labeled or marked with the SIL rating (not less than SIL 3), the name or mark of the certifying organization, and the SIL certification number (968/FSP 1347), followed by the applicable revision number (as in 968/FSP 1347.00/16).

3.1.3 Two circuit board components (Serializer S3I and S3O), each labeled or marked with the SIL rating (not less than SIL 3), the name or mark of the certifying organization and the SIL certification number (968/A 162), followed by the applicable revision number (as in 968/A 162.04/18)

3.2 The software system and related circuits shall be certified for compliance with the applicable requirements of ASME A17.1-2013, section 2.26.4.3.2.

3.3 The access door or cover of the enclosures containing the SIL rated components shall be clearly labeled or tagged on their exterior with the statement:

**Assembly contains SIL rated devices.
Refer to maintenance Control Program and wiring diagrams
prior to performing work.**

3.4 Unique maintenance procedures or methods required for the inspection, testing, or replacement of the SIL rated circuits shall be developed and a copy maintained in the elevator machine/control room/space. The procedures or methods shall include clear color photographs of each SIL rated component, with notations identifying parts and locations.

3.5 Wiring diagrams that include part identification, SIL, and certification information shall be maintained in the elevator machine/control room/space.

3.6 A successful test of the SIL rated circuits shall be conducted initially and not less than annually in accordance with the testing procedure. The test shall demonstrate that SIL rated devices, safety functions, and related circuits operate as intended.

3.7 Any alterations to the SIL rated circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the alteration of SIL rated devices, the alterations shall be made in conformance with ASME A17.1-2013, section 8.7.1.9.

3.8 Any replacement of the SIL rated circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the replacement of SIL rated devices, the replacement shall be made in conformance with ASME A17.1-2013, section 8.6.3.14.

3.9 Any repairs to the SIL rated circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the repair of SIL rated devices, the repairs shall be made in conformance with ASME A17.1-2013, section 8.6.2.6.

3.10 Any space containing SIL rated circuits shall be maintained within the temperature and humidity range specified by TKE. The temperature and humidity range shall be posted on each enclosure containing SIL rated software or circuits.

3.11 Field software changes to the SIL rated system are not permitted. Any changes to the SIL rated system's circuitry will require recertification and all necessary updates to the documentation and diagrams required by Conditions 3.4 and 3.5 above.

Inspection Transfer Switch and Seismic Reset Switch (Variance Request Nos. 5 and 6):

4.0 Inspection Transfer switch and Seismic Reset switch placement and enclosure shall comply with the following:

4.1 If the inspection transfer switch required by ASME A17.1-2004, section 2.26.1.4.4, does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the control/machinery room/space containing the elevator's control equipment in an enclosure secured by a lock openable by a Group 1 security key. The enclosure is to remain locked at all times when not in use.

4.2 If the seismic reset switch does not reside in the machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the control/machinery room/space containing the elevator's control equipment in an enclosure secured by a lock openable by a Group 1 security key. The enclosure is to remain locked at all times when not in use.

5.0 The elevator shall be serviced, maintained, adjusted, tested, and inspected only by CCCM having been trained, and competent, to perform those tasks on the TKE EVO 200 elevator system in accordance with written procedures and criteria, including as required per above Conditions 2.3, and 2.4.

6.0 Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and all applicable requirements met, including conditions of this permanent variance, prior to a Permit to Operate the elevator being issued. The elevator shall not be placed in full service prior to the Permit to Operate being issued by Cal/OSHA.

7.0 The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications pursuant to sections 411.2, and 411.3.

8.0 This Decision and Order shall remain in effect unless duly modified or revoked upon application by Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in the procedural manner prescribed by the Board's regulations.

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 28, 2026



Kelly Chau, Hearing Officer

ADDENDUM 1

SUSPENSION MEANS REPLACEMENT REPORTING REQUIREMENTS

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future):
Cal/OSHA Elevator Unit, Attn: Engineering section, 2 MacArthur Place Suite 700, Santa Ana, CA 92707.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State issued conveyance number, complete address, and Permanent Variance file number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, and certification expiration date of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which

case, the information to be reported shall be the information required by the ASME provision as modified by the variance.

- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.

In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2(a) above.

ADDENDUM 2

CIRCULAR LETTER E-10-04, October 6, 2010

TO: Installers, Manufacturers of Conveyances and Related Equipment and, Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a nonfunctional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be nonfunctional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA Elevator Unit HQ

ADDENDUM 3

- A. A Residual Strength Detection Device (RSDD) shall continuously monitor all Elastomeric Coated Steel Belt suspension members (ECSB), automatically stopping the car if the residual strength of any belt drops below 60%. The RSDD shall prevent the elevator from restarting after a normal stop at a landing. The RSDD shall device shall apply a form of electrical current and/or signal through the entire length of the steel tension elements of the ECSB and measure the current and/or signal on its return. The values measured shall be continuously compared to values that have been correlated to the remaining residual strength of the ECSB through testing. The required RSDD shall not rely upon giant magnetoresistance technology, or other magnetic measurement means, for residual strength detection or monitoring.

The RSDD must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room or controller location. The removed RSDD must be replaced or returned to proper service within 30 days. If upon routine inspection, the RSDD device is found to be in a nonfunctional state, the date and findings are to be conspicuously documented in the elevator machine room or controller location.

If upon inspection by Cal/OSHA, the RSDD is found to be nonfunctional or removed, and the required documentation is not in place, the elevator will be removed from service. If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

- B. On or before November 21 2021, and thereafter, the above specified and documented RSDD shall be installed and operational on the subject elevator.
- C. A successful functionality test of each RSDD shall be conducted once a year, and a copy of completed testing documentation conspicuously located in the machine room or within proximity of the controller.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

KONE Monospace 500 Elevators & Medical Emergency Elevator Car Dimensions (Group IV)

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-318	Crystal Springs Uplands School	400 Uplands Dr. Hillsborough, CA	1

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Fuei Saetern, with KONE INC., appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each respective Applicant intends to utilize the KONE, Inc. Monospace 500 type elevator, in the quantity, at the location, specified per the above section A.1 table.
2. The installation contract for this elevator was or will be signed on or after May 1, 2008, thus making the elevator subject to the Group IV Elevator Safety Orders.
3. Each Applicant proposes to use hoisting ropes that are 8 mm in diameter which also consist of 0.51 mm diameter outer wires, in variance from the express requirements of ASME A17.1-2004, section 2.20.4.
4. In relevant part, ASME A17.1-2004, section 2.20.4 states:

2.20.4 Minimum Number and Diameter of Suspension Ropes

...The minimum diameter of hoisting and counterweight ropes shall be 9.5 mm (0.375 in.). Outer wires of the ropes shall be not less than 0.56 mm (0.024 in.) in diameter.

5. An intent of ASME A17.1-2004, section 2.20.4, is to ensure that the number, diameter, and construction of suspension ropes are adequate to provided safely robust and durable suspension means over the course of the ropes' foreseen service life.
6. KONE has represented to Cal/OSHA, having established an engineering practice for purposes of Monospace 500 elevator design, of meeting or exceeding the minimum factor of safety of 12 for 8 mm suspension members, as required in ASME A17.1-2010 - under which, given that factor of safety, supplemental broken suspension member protection is not required.
7. Also, each Applicant proposes as a further means of maintaining safety equivalence, monitoring the rope in conformity with the criteria specified within the *Inspector's Guide to 6 mm Diameter Governor and 8 mm Diameter Suspension Ropes for KONE Elevators* (per Application attachment "B", or as thereafter revised by KONE subject Cal/OSHA approval).
8. In addition, each Applicant has proposed to utilize 6 mm diameter governor ropes in variance from Title 8, section 3141, incorporated ASME A17.1-2004, section 2.18.5.1.
9. ASME A17.1-2004, section 2.18.5.1, specifies, in relevant part:

2.18.5.1 Material and Factor of Safety.

... [Governor ropes] not less than 9.5 mm (0.375 in.) in diameter. The factor of safety of governor ropes shall be not less than 5...

10. The Board takes notice of section 3141.7, subpart (a)(10):

A reduced diameter governor rope of equivalent construction and material to that required by ASME A17.1-2004, is permissible if the factor of safety as related to the strength necessary to

activate the safety is 5 or greater;

11. Applicants propose use of 6mm governor rope having a safety factor of 5 or greater, in conformity with section 3141.7(a)(10), the specific parameters of which, being expressly set out within the Elevator Safety Orders (ESO), take precedence over more generally referenced governor rope diameter requirements per ASME A17.1-2004, section 2.18.5.1. Accordingly, the governor rope specifications being presently proposed, inclusive of a factor of safety of 5 or greater, would comply with current requirements, and therefore not be subject to issuance of permanent variance.
12. Absent evident diminution in elevator safety, over the past decade the Board has issued numerous permanent variances for use in KONE (Ecospace) elevator systems of 8 mm diameter suspension rope materially similar to that presently proposed (e.g. Permanent Variance Nos. 06-V-203, 08-V-245, and 13-V-303).
13. As noted by the Board in permanent Variance Nos. 18-V-044, and 18-V-045, Decision and Order Findings, subpart B.17 (hereby incorporated by reference), the strength of wire rope operating as an elevator's suspension means does not remain constant over its years of projected service life. With increasing usage cycles, a reduction in the cross-sectional area of the wire rope normally occurs, resulting in decreased residual strength. This characteristic is of particular relevance to the present matter because, decreasing wire rope diameter is associated with a higher rate of residual strength loss. This foreseeable reduction in cross-sectional area primarily results from elongation under sheave rounding load, as well as from wear, and wire or strand breaks. However, these characteristics need not compromise elevator safety when properly accounted for in the engineering of elevator suspension means, and associated components.
14. The presently proposed wire rope is Wuxi Universal steel rope Co LTD. 8 mm 8x19S+8x7+PP, with a manufacturer rated breaking strength of 35.8 kN, and an outer wire diameter of less than 0.56 mm, but not less than 0.51 mm. Cal/OSHA's safety engineer has scrutinized the material and structural specifications, and performance testing data, of this particular proposed rope, and concluded it will provide for safety equivalent to ESO compliant 9.5 mm wire rope, with 0.56 mm outer wire (under conditions of use included within the below Decision and Order).
15. The applicant supplies tabulated data regarding the "Maximum Static Load on All Suspension Ropes." To obtain the tabulated data, the applicant uses the following formula derived from ASME A17.1-2004, section 2.20.3:

$$W = \frac{(S \times N)}{f} \quad \text{where:}$$

W = maximum static load imposed on all car ropes with the car and its rated load at any position in the hoistway

N = number of runs of rope under load. For 2:1 roping, N shall be two times the number of ropes used, etc.

S = manufacturer's rated breaking strength of one rope

f = the factor of safety from Table 2.20.3

16. ASME A17.1-2010 sections 2.20.3 and 2.20.4 utilize the same formula, but provide for use of suspension ropes having a diameter smaller than 9.5 mm, under specified conditions, key among them being that use of ropes having a diameter of between 8 mm to 9.5 mm be engineered with a factor of safety of 12 or higher. This is a higher minimum factor of safety than that proposed by Applicant but a minimum recommended by Cal/OSHA as a condition of variance necessary to the achieving of safety equivalence to 9.5 mm rope.
17. Cal/OSHA is in accord with Applicant, in proposing as a condition of safety equivalence, that periodic physical examination of the wire ropes be performed to confirm the ropes continue to meet the criteria set out in the (Application attachment) *Inspector's Guide to 6 mm Diameter Governor and 8 mm Diameter Suspension Ropes for KONE Elevators*. Adherence to this condition will provide an additional assurance of safety equivalence, regarding smaller minimum diameter suspension rope outer wire performance over the course of its service life.
18. Applicant requests a permanent variance from section 3041, subdivision (e)(1)(C), which states:
- (1) All buildings and structures constructed after the effective date of this order that are provided with one or more passenger elevators shall be provided with not less than one passenger elevator designed and designated to accommodate the loading and transport of an ambulance gurney or stretcher maximum size 22 ½ in. (572 mm) by 75 in. (1.90 m) in its horizontal position and arranged to serve all landings in conformance with the following:
- ...
- (C) The elevator car shall have a minimum inside car platform of 80 in. (2.03 m) wide by 51 in. (1.30 m) deep.
- The intent of this language is to ensure that there is enough space to accommodate the access and egress of a gurney and medical personnel inside of a medical service elevator.
- This standard is made applicable to Group IV by section 3141.7, subdivision (b), which reads, "Elevators utilized to provide medical emergency service shall comply with Group II, section 3041(e)."
19. Applicant proposes to comply with the requirements of the 2019 California Building Code, section 3002.4.1a in the design of its medical emergency service elevator. That section requires:
- The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5-inch (127 mm) radius corners] in the horizontal, open position.
- The purpose of this requirement is to ensure that an elevator designated for emergency medical service will accommodate a minimum of two emergency personnel with an ambulance gurney or stretcher.
20. Cal/OSHA, by way of written submission to the record (Exhibit PD3), and stated position at hearing, is of the well informed opinion that grant of permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment, and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each Application being the subject of this proceeding, per above section A.1 table, is conditionally GRANTED, to the extent that each such Applicant shall be issued permanent variance from section 3141 incorporated ASME A17.1-2004, section 2.20.4, in as much as it precludes use of suspension rope of between 8 mm and 9.5 mm, or outer wire of between 0.51 mm and 0.56 mm in diameter, at such locations and numbers of Group IV KONE Monospace 500 elevators identified in each respective Application, subject to the following conditions:

1. The diameter of the hoisting steel ropes shall be not less than 8 mm (0.315 in) diameter and the roping ratio shall be two to one (2:1).
2. The outer wires of the suspension ropes shall be not less than 0.51 mm (0.02 in.) in diameter.
3. The number of suspension ropes shall be not fewer than those specified per hereby incorporated Decision and Order Appendix 1 Table.
4. The ropes shall be inspected annually for wire damage (rouge, valley break etc.) in accordance with "KONE, Inc. Inspector's Guide to 6 mm diameter and 8 mm diameter steel ropes for KONE Elevators" (per Application Exhibit B, or as thereafter amended by KONE subject to Cal/OSHA approval).
5. A rope inspection log shall be maintained and available in the elevator controller room/space at all times.
6. The elevator rated speed shall not exceed those speeds specified per the Decision and Order Appendix 1 Table.
7. The maximum suspended load shall not exceed those weights (plus 5%) specified per the Decision and Order Appendix 1 Table.
8. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of the elevator equipment in the hoistway is required. If the service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
9. The installation shall meet the suspension wire rope factor of safety requirements of ASME A17.1-2013 section 2.20.3.
10. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing or testing the elevators shall be provided a copy of this variance decision.
11. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA and a "Permit to Operate" issued before the elevator is placed in service.
12. The Applicant shall comply with suspension means replacement reporting condition per hereby

incorporated Decision and Order Appendix 2.

13. All medical emergency service elevator(s) shall comply with the following:

a. The requirements of the 2019 California Building Code (CBC) section 3002.4.1a:

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5-inch (127 mm) radius corners] in the horizontal, open position.

b. All medical emergency service elevator(s) shall be identified in the building construction documents in accordance with the 2019 California Building Code, section 3002.4a.

c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).

14. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications pursuant to sections 411.2 and 411.3.

15. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in the procedural manner prescribed.

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 23, 2026



Kelly Chau, Hearing Officer

APPENDIX 1

File Number	Elevator ID	Minimum Suspension Ropes Per Elevator	Maximum Suspended Weight Per Elevator	Maximum Speed	Rated Capacity
26-V-318	1	8	13207	200	3500

APPENDIX 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Mitsubishi Elevators (Group IV)

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-323	Gilead Sciences, Inc.	335 Lakeside Dr. Foster City, CA	3

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Matt Jaskiewicz, with MITSUBISHI ELECTRIC US, INC., appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each section A table specified Applicant intends to utilize Mitsubishi elevators at the location and in the number stated in the table in Item A1. The installation contracts for these elevators were signed on or after May 1, 2008, thus making the elevators subject to the Group IV Elevator Safety Orders.
2. The Board takes official notice and incorporates herein, Subsections D.3 through D.5 of the February 20, 2014, Decision of the Board in Permanent Variance File No. 13-V-270.
3. As reflected in the record of this matter, including Cal/OSHA evaluation as PD-3, and testimony at hearing, it is the professionally informed opinion of Cal/OSHA, that grant of requested variance, subject to conditions and limitations in substantial conforming with those set out per below Decision and Order, will provide Occupational Safety and Health equivalent or superior to that provided by the safety order requirements from which variance is sought.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicant's proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A.1 table shall have permanent variances from sections 3041, subdivision (e)(1)(C) and 3141.7, subdivision (b) subject of the following conditions:

1. The car top railing may be inset only to the extent necessary to clear obstructions when the conveyance is located at the top landing to perform work on the machine and/or governor.
2. Serviceable equipment shall be positioned so that mechanics, inspectors, and others working on the car top can remain positioned on the car top within the confines of the railings and do not have to climb on or over railings to perform adjustment, maintenance, minor repairs, inspections, or similar tasks. Persons performing those tasks are not to stand on or climb over railing, and those persons shall not remove handrails unless the equipment has been secured from movement and approved personal fall protection is used.
3. All exposed areas outside the car top railing shall preclude standing or placing objects or persons which may fall, and shall be beveled from an intermediate or bottom rail to the outside of the car top.

4. The top surface of the beveled area shall be clearly marked. The markings shall consist of alternating 4-inch red and white diagonal stripes.
5. The Applicant shall provide a durable sign with lettering not less than ½-inch high on a contrasting background. The sign shall be located on the inset top railing; the sign shall be visible from the access side of the car top, and the sign shall state:

CAUTION
DO NOT STAND ON OR CLIMB OVER RAILING.
PERSONNEL ARE PROHIBITED FROM REMOVING HANDRAIL
UNLESS THE EQUIPMENT HAS BEEN SECURED FROM MOVEMENT AND APPROVED
PERSONAL FALL PROTECTION IS USED.

6. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing will be measured from the car top and not from the required bevel).
7. A mechanical means (e.g., locking bar mechanism) that will secure the car to the guide rail to prevent unintended movement shall be provided and used during machine and/or governor car-top work. The mechanical means (e.g., locking bar mechanism) shall have a safety factor of not less than 3.5 for the total unbalanced load.
8. An electrical switch or a lockout/tagout procedure shall be provided that will remove power from the driving machine and brake when the mechanical means (e.g., locking bar mechanism) is engaged.
9. In order to inhibit employees from working outside the car top railing, sections shall not be hinged and they shall be installed by means that will inhibit (but not necessarily completely preclude) removal. The Applicant shall ensure that all persons performing work that requires removal of any part of the car top railing are provided with fall protection that is appropriate and suitable for the assigned work. That fall protection shall consist of a personal fall arrest system or fall restraint system that complies with section 1670.
10. The bevel utilized by the Applicant in accordance with the variance granted from ASME A17.1-2004, section 2.10.2.4 shall slope at not less than 75 degrees from the horizontal to serve as the toe board; however, that slope may be reduced to a minimum of 40 degrees from the horizontal as may be required for sections where machine encroachment occurs.
11. If the Applicant directs or allows its employees to perform tasks on the car top, the Applicant shall develop, implement, and document a safety training program that shall provide training to Applicant employees. Components of the training shall include, but not necessarily be limited to, the following: car blocking procedures; how examination, inspection, adjustment, repair, removal and replacement of elevator components are to be performed safely, consistent with the requirements of the variance conditions; applicable provisions of the law and other sources of safety practices regarding the operation of the elevator. A copy of the training program shall be located in the control room of each elevator that is the subject of this variance, and a copy of the training program shall be attached to a copy of this variance that shall be retained in any building where an elevator subject to this variance is located. The Applicant shall not allow Certified Qualified Conveyance Company (CQCC) or other contractor personnel to work on the top of any elevator subject to this variance unless the Applicant first ascertains from the CQCC or other contractor that the personnel in question have received training equivalent to, or more extensive than, the training components referred to in this condition.
12. Any CQCC performing inspections, maintenance, servicing, or testing of the elevators shall be

provided a copy of this variance decision.

13. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and a Permit to Operate shall be issued before the elevator is placed in service.
14. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications pursuant to sections 411.2 and 411.3.
15. This Decision and Order shall remain in effect unless duly modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion.

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 28, 2026



Kelly Chau, Hearing Officer

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Otis Gen2S/Gen3Edge/Gen3 Core Elevator & Medical Emergency Car Dimensions

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-326	Auburn Lake Shore LLC	14118 W. Gilmore St. Van Nuys, CA	1

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Dan Leacox, with Leacox & Associates, and Wolter Geesink with Otis Elevator Company appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each Applicant intends to utilize Otis Gen3 Edge/Gen2S/Gen3 Core elevators at the locations and in the numbers stated in the above section A.1 table. Applicant may utilize the variance from minimum inside car platform dimensions for other elevators designated for emergency medical service at the same variance location.
2. The installation contracts for these elevators were or will be signed on or after May 1, 2008, making the elevators subject to the Group IV Elevator Safety Orders.
3. The Board incorporates by reference the relevant findings in previous Board decisions:
 - a. Items D.3 through D.9 of the Proposed Decision adopted by the Board on July 18, 2013 for Permanent Variance No. 12-V-093;
 - b. Item D.4 of the Proposed Decision adopted by the Board on September 25, 2014 for Permanent Variance No. 14-V-206;
 - c. Item B of the Proposed Decision adopted by the Board on September 15, 2022 for Permanent Variance No. 22-V-302 regarding medical emergency car dimensions; and
 - d. Items C and D of the Proposed Decision adopted by the Board on June 20, 2024 for Permanent Variance No. 24-V-193 regarding the Gen3 Core elevator equivalent safety.
4. Cal/OSHA, by way of written submissions to the record (Exhibit PD-3), and position stated at hearing, is of the well informed opinion that grant of requested permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment, and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the Elevator Safety Order requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A table shall have permanent variances from the following sections of ASME A17.1-2004 that section 3141 makes applicable to the elevators the subject of those applications:

- **Car top railing:** sections 2.14.1.7.1 (to permit an inset car top railing, if, in fact, the car top railing is inset);
- **Speed governor over-speed switch:** 2.18.4.2.5(a) (to permit the use of the speed reducing system proposed by the Applicants, where the speed reducing switch resides in the controller algorithms, rather than on the governor, with the necessary speed input supplied by the main encoder signal from the motor);
- **Governor rope diameter:** 2.18.5.1 (to allow the use of reduced diameter governor rope);
- **Pitch diameter:** 2.18.7.4 (to permit the use of the speed-reducing system proposed by the Applicant, where the rope sheave pitch diameter is not less than 180 mm [7.1 in.]);
- **Suspension means:** 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4 and 2.20.9.5.4—the variances from these “suspension means” provisions to permit the use of Otis Gen2 flat coated steel suspension belts in lieu of conventional steel suspension ropes;
- **Inspection transfer switch:** 2.26.1.4.4(a) (to allow the inspection transfer switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room); and
- **Seismic reset switch:** 8.4.10.1.1(a)(2)(b) (to allow the seismic reset switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room).
- **Minimum Inside Car Platform Dimensions:** 3041(e)(1)(C) and 3141.7(b) (to comply with the performance-based requirements of the 2019 California Building Code section 3002.4.1a)

These variances apply to the locations and numbers of elevators stated in the section A table (so long as the elevators are Gen3 Edge/Gen2S Group and Gen3 Core & Medical Emergency Elevator Car Dimensions (Group IV) that are designed, equipped, and installed in accordance with, and are otherwise consistent with, and are subject to the following conditions:

1. The suspension system shall comply with the following:
 - a. The coated steel belt and connections shall have factors of safety equal to those permitted for use by section 3141 [ASME A17.1-2004, section 2.20.3] on wire rope suspended elevators.
 - b. Steel coated belts that have been installed and used on another installation shall not be reused.
 - c. The coated steel belt shall be fitted with a monitoring device which has been accepted by Cal/OSHA and which will automatically stop the car if the residual strength of any single belt drops below 60 percent. If the residual strength of any single belt drops below 60 percent, the device shall prevent the elevator from restarting after a normal stop at a landing.
 - d. Upon initial inspection, the readings from the monitoring device shall be documented and submitted to Cal/OSHA.
 - e. A successful test of the monitoring device’s functionality shall be conducted at least once a year (the record of the annual test of the monitoring device shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - f. The coated steel belts used shall be accepted by Cal/OSHA.

2. With respect to each elevator subject to this variance, the applicant shall comply with Cal/OSHA Circular Letter E-10-04, the substance of which is attached hereto as Addendum 1 and incorporated herein by this reference.
3. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection, and testing of the belts and monitoring device and criteria for belt replacement, and the applicant shall make those procedures and criteria available to Cal/OSHA upon request.
4. The flat coated steel belts shall be provided with a metal data tag that is securely attached to one of those belts. This data tag shall bear the following flat steel coated belt data:
 - a. The width and thickness in millimeters or inches;
 - b. The manufacturer's rated breaking strength in (kN) or (lbf);
 - c. The name of the person or organization that installed the flat coated steel belts;
 - d. The month and year the flat coated steel belts were installed;
 - e. The month and year the flat coated steel belts were first shortened;
 - f. The name or trademark of the manufacturer of the flat coated steel belts; and
 - g. Lubrication information.
5. There shall be a crosshead data plate of the sort required by section 2.20.2.1, and that plate shall bear the following flat steel coated belt data:
 - a. The number of belts;
 - b. The belt width and thickness in millimeters or inches; and
 - c. The manufacturer's rated breaking strength per belt in (kN) or (lbf).
6. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of elevator equipment in the hoistway is required. If service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
7. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on railings to perform adjustment, maintenance, repairs or inspections. The applicant shall not permit anyone to stand on or climb over the car top railing.
 - b. The distance that the car top railing may be inset shall be limited to no more than 6 inches.
 - c. All exposed areas outside the car top railing shall preclude standing or placing objects or persons which may fall and shall be beveled from the mid- or top rail to the outside of the car top.
 - d. The top of the beveled area and/or car top outside the railing, shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
 - e. The applicant shall provide durable signs with lettering not less than ½ inch on a

contrasting background on each inset railing; each sign shall state:

CAUTION
DO NOT STAND ON OR CLIMB OVER RAILING

- f. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing shall be measured from the car top and not from the required bevel).
- 8. If the seismic reset switch does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
- 9. If the inspection transfer switch required by ASME A17.1, rule 2.26.1.4.4(a) does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
- 10. When the inspection and testing panel is located in the hoistway door jamb, the inspection and test control panel shall be openable only by use of a Security Group I restricted key.
- 11. The governor speed-reducing switch function shall comply with the following:
 - a. It shall be used only with direct drive machines; i.e., no gear reduction is permitted between the drive motor and the suspension means.
 - b. The velocity encoder shall be coupled to the driving machine motor shaft. The “C” channel of the encoder shall be utilized for velocity measurements required by the speed reducing system. The signal from “C” channel of the encoder shall be verified with the “A” and “B” channels for failure. If a failure is detected then an emergency stop shall be initiated.
 - c. Control system parameters utilized in the speed-reducing system shall be held in non-volatile memory.
 - d. It shall be used in conjunction with approved car-mounted speed governors only.
 - e. It shall be used in conjunction with an effective traction monitoring system that detects a loss of traction between the driving sheave and the suspension means. If a loss of traction is detected, then an emergency stop shall be initiated.
 - f. A successful test of the speed-reducing switch system’s functionality shall be conducted at least once a year (the record of the annual test of the speed-reducing switch system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - g. A successful test of the traction monitoring system’s functionality shall be conducted at least once a year (the record of the annual test of the traction monitoring system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - h. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the maintenance, inspection, and testing of the speed-reducing switch and traction monitoring systems. The Applicant shall make the procedures available to Cal/OSHA upon

request.

12. The speed governor rope and sheaves shall comply with the following:

- a. The governor shall be used in conjunction with a 6 mm (0.25 in.) diameter steel governor rope with 6-strand, regular lay construction.
- b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
- c. The governor sheaves shall have a pitch diameter of not less than 180 mm (7.1 in.).

13. All medical emergency service elevators shall comply with the following:

- a. The requirements of the 2019 California Building Code (CBC), section 3002.4.1a;

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5inch (127 mm) radius corners] in the horizontal, open position.

- b. All medical emergency service elevators shall be identified in the building construction documents in accordance with the 2019 CBC, section 3002.4a.
- c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).

- 14. The elevator shall be serviced, maintained, adjusted, tested, and inspected only by Certified Competent Conveyance Mechanics who have been trained to, and are competent to, perform those tasks on the Gen3 Edge/Gen2S/Gen3 Core elevator system in accordance with the written procedures and criteria required by Condition No. 3 and in accordance with the terms of this permanent variance.
- 15. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing, or testing of the elevators shall be provided a copy of this variance decision.
- 16. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and a Permit to Operate shall be issued before the elevator is placed in service.
- 17. The Applicant shall be subject to the Suspension Means – Replacement Reporting Condition stated in Addendum 2, as hereby incorporated by this reference.
- 18. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications.
- 19. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in

accordance with the Board's procedural regulations at section 426, subdivision (b).

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 29, 2026



Kelly Chau, Hearing Officer

ADDENDUM 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and, Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA-Elevator Unit HQS

ADDENDUM 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Schindler Model 3300 Elevators, w/variant Gov. Ropes and Sheaves (Group IV)

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-327	Fresno City Center Corporation	2111 E. Dakota Ave. Fresno, CA	1

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Pete Cuellar, with SCHINDLER ELEVATOR CORPORATION, appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each respective Applicant intends to utilize Schindler model 3300 MRL elevator cars, in the quantity, at the locations specified in Jurisdictional and Procedural Matters, section 1.
2. The installation contract for these elevators was or will be signed on or after May 1, 2008, thus making the elevator subject to the Group IV Elevator Safety Orders.
3. The Schindler model 3300 MRL elevator cars are not supported by circular steel wire ropes, as required by the Elevator Safety Orders. They utilize non circular elastomeric coated steel belts and specialized suspension means fastenings.
4. No machine room is provided, preventing the inspection transfer switch from being located in the elevator machine room. The lack of machine room also prevents the seismic reset switch from being located in the elevator machine room.
5. Applicant proposes to relocate the inspection transfer switch and seismic reset switch in an alternative enclosure.
6. Due to the use of a 6 mm (0.25 in.) governor rope with 6-strand construction, the provided governor sheave pitch diameter is less than that required by the Elevator Safety Orders.
7. The driving machine and governor are positioned in the hoistway and restrict the required overhead clearance to the elevator car top.
8. Applicant proposes to insert the car top railings at the perimeter of the car top.
9. Applicant intends to use an elevator control system, model CO NX100NA or CO NX300NA, with a standalone, solid state motor control drive system that includes devices and circuits having a Safety Integrity Level (SIL) rating to execute specific elevator safety functions.

D. Relevant Safety Order Provisions

Applicant seeks a permanent variance from section 3141 [ASME A17.1-2004, sections 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4, 2.20.9.5.4, 2.26.1.4.4(a), 8.4.10.1.1(a)(2)(b), 2.14.1.7.1, 2.18.7.4, and 2.26.9.6.1] of the Elevator Safety Orders, with respect to the suspension ropes and connections, inspection transfer switch relocation, seismic reset switch relocation, the location and construction of car-top railings, governor-sheave diameter, and means of removing power from the driving machine motor for one (1) Schindler model 3300 MRL elevator.

The relevant language of those sections are below.

1. Suspension Means

- Section 3141 [ASME A17.1-2004, section 2.20.1, Suspension Means] states in part:

- Elevator cars shall be suspended by steel wire ropes attached to the car frame or passing around sheaves attached to the car frame specified in 2.15.1. Ropes that have previously been installed and used on another installation shall not be reused. Only iron (low carbon steel) or steel wire ropes, having the commercial classification “Elevator Wire Rope,” or wire rope specifically constructed for elevator use, shall be used for the suspension of elevator cars and for the suspension of counterweights. The wire material for ropes shall be manufactured by the open hearth or electric furnace process, or their equivalent.
- Section 3141 [ASME A17.1-2004, section 2.20.2.1(b), On Crosshead Data Plate] states in part:
 - The crosshead data plate required by 2.16.3 shall bear the following wire rope data:
 - (b) the diameter in millimeters (mm) or inches (in.)
- Section 3141 [ASME A17.1-2004, section 2.20.2.2(a) and (f) On Rope Data Tag] states in part:
 - A metal data tag shall be securely attached to one of the wire rope fastenings. This data tag shall bear the following wire rope data:
 - (a) the diameter in millimeters (mm) or inches (in.)
 - [...]
 - (f) whether the ropes were non preformed or preformed
- Section 3141 [ASME A17.1-2004, section 2.20.3, Factor of Safety] states:
 - The factor of safety of the suspension wire ropes shall be not less than shown in Table 2.20.3. Figure 8.2.7 gives the minimum factor of safety for intermediate rope speeds. The factor of safety shall be based on the actual rope speed corresponding to the rated speed of the car.
 - The factor of safety shall be calculated by the following formula:

$$f = \frac{(S \times N)}{W}$$

- where:
 - N = number of runs of rope under load. For 2:1 roping, N shall be two times the number of ropes used, etc.
 - S = manufacturer's rated breaking strength of one rope
 - W = maximum static load imposed on all car ropes with the car and its rated load at any position in the hoistway

- Section 3141 [ASME A17.1-2004, section 2.20.4, Minimum Number and Diameter of Suspension Ropes] states:
 - The minimum number of hoisting ropes used shall be three for traction elevators and two for drum type elevators.
 - Where a car counterweight is used, the number of counterweight ropes used shall be not less than two.
 - The term “diameter,” where used in reference to ropes, shall refer to the nominal diameter as given by the rope manufacturer.
 - The minimum diameter of hoisting and counterweight ropes shall be 9.5 mm (0.375 in.). Outer wires of the ropes shall be not less than 0.56 mm (0.024 in.) in diameter.
- Section 3141 [ASME A17.1-2004, section 2.20.9.3.4] states:
 - Cast or forged steel rope sockets, shackle rods, and their connections shall be made of unwelded steel, having an elongation of not less than 20% in a gauge length of 50 mm (2 in.), when measured in accordance with ASTM E 8, and conforming to ASTM A 668, Class B for forged steel, and ASTM A 27, Grade 60/30 for cast steel, and shall be stress relieved. Steels of greater strength shall be permitted, provided they have an elongation of not less than 20% in a length of 50 mm (2 in.).
- Section 3141 [ASME A17.1-2004, section 2.20.9.5.4] states:
 - When the rope has been seated in the wedge socket by the load on the rope, the wedge shall be visible, and at least two wire rope retaining clips shall be provided to attach the termination side to the load carrying side of the rope (see Fig. 2.20.9.5). The first clip shall be placed a maximum of 4 times the rope diameter above the socket, and the second clip shall be located within 8 times the rope diameter above the first clip. The purpose of the two clips is to retain the wedge and prevent the rope from slipping in the socket should the load on the rope be removed for any reason. The clips shall be designed and installed so that they do not distort or damage the rope in any manner.

2. Requested Transfer Switch Placement Variance

- As it pertains to installation of the requisite transfer switch within a “machine room” location incompatible with machine-room-less design of the Schindler Model 3300 elevator, the Applicant presently seeks permanent variance from the following Elevator Safety Order incorporated ASME Code A17.1-2004, subsection:
 - Subsection 2.26.1.4.4(a)--Transfer Switch Placement in Machine Room
- Section 3141[ASME A17.1-2004, section 2.26.1.4.4(a), Machine Room Inspection Operation] states:
- When machine room inspection operation is provided, it shall conform to 2.26.1.4.1, and the transfer switch shall be
- (a) located in the machine room[.]

3. Requested Seismic Reset Switch Placement Variance

- As it pertains to installation of the requisite seismic reset switch within a “machine room” location incompatible with machine-room-less design of the Schindler Model 3300 elevator, the Applicant presently seeks permanent variance from the following Elevator Safety Order incorporated ASME Code subsection:
 - Subsection 8.4.10.1.1(a)(2)(b)--Seismic Reset Switch Placement in Machine Room
- Section 3141[ASME A17.1-2004, section 8.4.10.1.1(a)(2)(b), Earthquake Equipment] states:
 - (a) All traction elevators operating at a rated speed of 0.75 m/s (150 ft/min) or more and having counterweights located in the same hoistway shall be provided with the following:
 - (1) seismic zone 3 or greater: a minimum of one seismic switch per building
 - (2) seismic zone 2 or greater:
 - (a) a displacement switch for each elevator
 - (b) an identified momentary reset button or switch for each elevator, located in the control panel in the elevator machine room

4. Requested Car Top Railing Inset Variance

- As it pertains to top of car railing placement requiring space occupied by upper hoistway mounted elevator machinery characteristic of the Schindler Model 3300 elevator, the Applicant presently seeks permanent variance from the following Elevator Safety Order incorporated ASME Code A17.1-2004, section:
 - Section 2.14.1.7.1—Top of Car Perimeter Railing Placement
- Section 3141[ASME A17.1-2004, section 2.14.1.7.1] states:
 - A standard railing conforming to 2.10.2 shall be provided on the outside perimeter of the car top on all sides where the perpendicular distance between the edges of the car top and the adjacent hoistway enclosure exceeds 300 mm (12 in.) horizontal clearance.

5. Pitch Diameter of Governor Sheaves

- Section 3141 [ASME A17.1-2004, Section 2.18.7.4] states:
 - “The pitch diameter of governor sheaves and governor tension sheaves shall be not less than the product of the diameter of the rope and the applicable multiplier listed in Table 2.18.7.4, based on the rated speed and the number of strands in the rope.”

Table 2.18.7.4 Multiplier for Determining Governor Sheave Pitch Diameter
[from ASME A17.1-2004]

<u>Rated Speed m/s (ft./min)</u>	<u>Number of Strands</u>	<u>Multiplier</u>
1.00 or less (200 or less)	6	42
1.00 or less (200 or less)	8	30
Over 1.0 (over 200)	6	46
Over 1.0 (over 200)	8	32

6. SIL Rated System to Inhibit Current Flow to AC Drive Motor

- Section 3141[ASME A17.1-2004, section 2.26.9.6.1] states:
 - Two separate means shall be provided to independently inhibit the flow of alternating current through the solid state devices that connect the direct current power source to the alternating current driving motor. At least one of the means shall be an electromechanical relay.

E. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicant's proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Order from which variance is being sought.

F. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above table in Jurisdictional and Procedural Matters shall have permanent variances from sections 3041, subdivision (e)(1)(C) and 3141.7, subdivision (b) subject of the following conditions:

Elevator Safety Orders:

- Suspension Means: 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4, and 2.20.9.5.4 (Only to the extent necessary to permit the use of the Elastomeric coated Steel Belts proposed by the Applicant, in lieu of circular steel suspension ropes.);
- Inspection transfer switch: 2.26.1.4.4(a) (Only to the extent necessary to permit the inspection transfer switch to reside at a location other than the machine room);
- Seismic reset switch: 8.4.10.1.1(a)(2)(b) (Only to the extent necessary to permit the seismic reset switch to reside at a location other than the machine room. room);

- Car Top Railing: 2.14.1.7.1 (Only to the extent necessary to permit the use of the car top railing system proposed by the Applicant, where the railing system is located inset from the elevator car top perimeter);
- Governor Rope and Sheave: The Applicant shall conditionally hold permanent variance from certain requirements of section 3141, incorporated section of ASME A17.1-2004, to the limited extent variance is necessary to allow for the below specified governor rope and governor sheave parameters: section 2.18.7.4.
- Means of Removing Power: 2.26.9.6.1 (Only to the extent necessary to permit the use of SIL rated devices and circuits as a means to remove power from the AC driving motor, where the redundant monitoring of electrical protective devices is required by the Elevator Safety Orders).

Conditions:

1. The elevator suspension system shall comply to the following:
 - a. The suspension traction media (STM) members and their associated fastenings shall conform to the applicable requirements of ASME A17.1-2013, sections:
 - 2.20.4.3 - Minimum Number of Suspension Members
 - 2.20.3 - Factor of Safety
 - 2.20.9 - Suspension Member Fastening
 - b. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection and testing of the STM members, fastenings, related monitoring and detection systems, and criteria for STM replacement. The Applicant shall make those procedures and criteria available to the Certified Competent Conveyance Mechanic (CCCM) at the location of the elevator, and to the Cal/OSHA upon request.
 - STM member mandatory replacement criteria shall include:
 - i. Any exposed wire, strand or cord;
 - ii. Any wire, strand or cord breaks through the elastomeric coating;
 - iii. Any evidence of rouging (steel tension element corrosion) on any part of the elastomeric coated steel suspension member;
 - iv. Any deformation in the elastomeric suspension member such as, but not limited to, kinks or bends;
 - c. Traction drive sheaves must have a minimum diameter of 72 mm. The maximum speed of STM members running on 72 mm, 87 mm and 125 mm drive sheaves shall be no greater than 2.5 m/s, 6.0 m/s and 8.0 m/s respectively.
 - d. If any one STM member needs replacement, the complete set of suspension members on the elevator shall be replaced. Exception: if a new suspension member is damaged during installation, and prior to any contemporaneously installed STM having been placed into service, it is permissible to replace the individual damaged suspension member. STM members that have been installed on another installation shall not be re used.

- e. A traction loss detection means shall be provided that conforms to the requirements of ASME A17.1-2013, section 2.20.8.1. The means shall be tested for correct function annually in accordance with ASME A17.1-2013, section 8.6.4.19.12.
 - f. A broken suspension member detection means shall be provided that conforms to the requirements of ASME A17.1-2013, section 2.20.8.2. The means shall be tested for correct function annually in accordance with ASME A17.1-2013, section 8.6.4.19.13(a).
 - g. An elevator controller integrated bend cycle monitoring system shall monitor actual STM bend cycles, by means of continuously counting, and storing in nonvolatile memory, the number of trips that the STM makes traveling, and thereby being bent, over the elevator sheaves. The bend cycle limit monitoring means shall automatically stop the car normally at the next available landing before the bend cycle correlated residual strength of any single STM member drops below 80 percent of full rated strength. The monitoring means shall prevent the car from restarting. The bend cycle monitoring system shall be tested annually in accordance with the procedures required by condition 1b above.
 - h. The elevator shall be provided with a device to monitor the remaining residual strength of each STM member. The device shall conform to the requirements of Cal/OSHA Circular Letter E-10-04, a copy of which is attached hereto as Exhibit 1 and incorporated herein by reference.
 - i. The elevator crosshead data plate shall comply with the requirements of ASME A17.1 2013, section 2.20.2.1.
 - j. A suspension means data tag shall be provided that complies with the requirements of ASME A17.1 2013, section 2.20.2.2.
 - k. Comprehensive visual inspections of the entire length of each and all installed suspension members, to the criteria developed in condition 1b, shall be conducted and documented every six months by a CCCM.
 - l. The Applicant shall be subject to the requirements set out in Exhibit 2 of this Decision and Order, "Suspension Means Replacement Reporting Condition," Incorporated herein by this reference.
 - m. Records of all tests and inspections shall be maintenance records subject to ASME A17.1 2004, sections 8.6.1.2 and 8.6.1.4, respectively.
2. If the inspection transfer switch required by ASME A17.1-2004, section 2.26.1.4.4 does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the control/machinery room/space containing the elevator's control equipment in an enclosure secured by a lock openable by a Group 1 security key. The enclosure is to remain locked at all times when not in use.
 3. If the seismic reset switch does not reside in the machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the control/machinery room/space containing the elevator's control equipment in an enclosure secured by a lock openable by a Group 1 security key. The enclosure is to remain locked at all times when not in use.
 4. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on the railings to perform adjustments, maintenance, repairs or inspections. The

Applicant shall not permit anyone to stand or climb over the car top railing.

- b. The distance that the railing can be inset shall be limited to not more than 6 inches.
- c. All exposed areas of the car top outside the car top railing where the distance from the railing to the edge of the car top exceeds 2 inches, shall be beveled with metal, at an angle of not less than 75 degrees with the horizontal, from the mid or top rail to the outside of the car top, such that no person or object can stand, sit, kneel, rest, or be placed in the exposed areas.
- d. The top of the beveled area and/or car top outside the railing shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
- e. The applicant shall provide durable signs with lettering not less than 1/2 inch on a contrasting background on each inset railing. Each sign shall state:

**CAUTION
STAY INSIDE RAILING
NO LEANING BEYOND RAILING
NO STEPPING ON, OR BEYOND, RAILING**

- f. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing will be measured from the car top and not from the required bevel).

5. The speed governor rope and sheaves shall comply with the following:

- a. The governor shall be used in conjunction with a steel 6 mm (0.25 in.) diameter governor rope with 6 strand, regular lay construction.
- b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
- c. The governor sheaves shall have a pitch diameter of not less than 200 mm (7.87 in.).

6. The SIL rated devices and circuits used to inhibit electrical current flow in accordance with ASME A17.1-2004, section 2.26.9.6.1 shall comply with the following:

- a. The SIL-rated devices and circuits shall consist of a Variodyn SIL3 rated Regenerative, Variable Voltage Variable Frequency (VVVF) motor drive unit, model VAF013, VAF023, or VAF043 labeled or marked with the SIL rating (not less than SIL 3), the name or mark of the certifying organization, and the SIL certification number (968/FSP 1556.00), and followed by the applicable revision number (as in 968/FSP 1556.00/19).
- b. The devices and circuits shall be certified for compliance with the applicable requirements of ASME A17.1-2013, section 2.26.4.3.2.
- c. The access door or cover of the enclosures containing the SIL rated components shall be clearly labeled or tagged on their exterior with the statement:

Assembly contains SIL rated devices.

**Refer to Maintenance Control Program and
wiring diagrams prior to performing work.**

- d. Unique maintenance procedures or methods required for the inspection, testing, or replacement of the SIL rated circuits shall be developed and a copy maintained in the elevator machine/control room/space. The procedures or methods shall include clear color photographs of each SIL rated component, with notations identifying parts and locations.
 - e. Wiring diagrams that include part identification, SIL, and certification information shall be maintained in the elevator machine/control room/space.
 - f. A successful test of the SIL rated devices and circuits shall be conducted initially and not less than annually in accordance with the testing procedure. The test shall demonstrate that SIL rated devices, safety functions, and related circuits operate as intended.
 - g. Any alterations to the SIL rated devices and circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the alteration of SIL rated devices, the alterations shall be made in conformance with ASME A17.1-2013, section 8.7.1.9.
 - h. Any replacement of the SIL rated devices and circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the replacement of SIL rated devices, the replacement shall be made in conformance with ASME A17.1-2013, section 8.6.3.14.
 - i. Any repairs to the SIL rated devices and circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the repair of SIL rated devices, the repairs shall be made in conformance with ASME A17.1-2013, section 8.6.2.6.
 - j. Any space containing SIL rated devices and circuits shall be maintained within the temperature and humidity range specified by Schindler Elevator Corporation. The temperature and humidity range shall be posted on each enclosure containing SIL rated devices and circuits.
 - k. Field changes to the SIL rated system are not permitted. Any changes to the SIL rated system's devices and circuitry will require recertification and all necessary updates to the documentation and diagrams required by conditions d. and e. above.
7. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and all applicable requirements met, including conditions of this permanent variance, prior to a Permit to Operate the elevator being issued. The elevator shall not be placed in service prior to the Permit to Operate being issued by Cal/OSHA.
8. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way that the Applicant was required to notify them of the docketed application for permanent variance per sections 411.2 and 411.3.
9. This Decision and Order shall remain in effect unless duly modified or revoked upon application by Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in the procedural manner prescribed.

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 28, 2026



Kelly Chau, Hearing Officer

EXHIBIT 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA Elevator Unit HQS

EXHIBIT 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings. Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future):
CAL/OSHA Elevator Unit, 2 MacArthur Pl., Suite 700, Santa Ana, CA 92707, Attn: Engineering Section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance file number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.

- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding: KONE Medical Emergency Elevator Car Dimensions	Permanent Variance No: See section A.1 table below PROPOSED DECISION Hearing Date: July 22, 2026 Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-328	Sweetwater Union High School District	1395 Hilltop Dr. Chula Vista, CA	N/A

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026, via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Fuei Saetern, with KONE Inc., appeared on behalf of each Applicant; and Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").

3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing
PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings, and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact and Applicable Regulations

1. Applicant requests a permanent variance from section 3041, subdivision (e)(1)(C), which states:

(1) All buildings and structures constructed after the effective date of this order that are provided with one or more passenger elevators shall be provided with not less than one passenger elevator designed and designated to accommodate the loading and transport of an ambulance gurney or stretcher maximum size 22 ½ in. (572 mm) by 75 in. (1.90 m) in its horizontal position and arranged to serve all landings in conformance with the following:

...

(C) The elevator car shall have a minimum inside car platform of 80 in. (2.03 m) wide by 51 in. (1.30 m) deep.

The intent of this language is to ensure that there is enough space to accommodate the access and egress of a gurney and medical personnel inside of a medical service elevator.

This standard is made applicable to Group IV by section 3141.7, subdivision (b), which reads, "Elevators utilized to provide medical emergency service shall comply with Group II, section 3041(e)."

2. Applicant proposes to comply with the requirements of the 2019 California Building Code, section 3002.4.1a in the design of its medical emergency service elevator. That section requires:

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5-inch (127 mm) radius corners] in the horizontal, open position.

The purpose of this requirement is to ensure that an elevator designated for emergency medical service will accommodate a minimum of two emergency personnel with an ambulance gurney or stretcher.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A.1 table shall have permanent variances from sections 3041, subdivision (e)(1)(C) and 3141.7, subdivision (b) subject of the following conditions:

1. All medical emergency service elevator(s) shall comply with the requirements of the 2019 California Building Code section 3002.4.1a:

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5-inch (127 mm) radius corners] in the horizontal, open position.

2. All medical emergency service elevator(s) shall be identified in the building construction documents in accordance with the 2019 California Building Code, section 3002.4a.
3. Dimensional drawings and other information necessary to demonstrate compliance with the conditions of this permanent variance decision shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).
4. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing, or testing the elevators shall be provided a copy of this variance decision.
5. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and all applicable requirements met, including conditions of this permanent variance, prior to a Permit to Operate the elevator being issued. The elevator shall not be placed in service prior to the Permit to Operate being issued by Cal/OSHA.
6. Applicant shall notify its employees and their authorized representative, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications pursuant to sections 411.2 and 411.3.
7. This Decision and Order shall remain in effect unless duly modified or revoked upon application by Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in accordance with then in effect administrative procedures of the Board.

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 15, 2026



Kelly Chau, Hearing Officer

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Otis Gen2S/Gen3Edge/Gen3 Core Elevator & Medical Emergency Car Dimensions

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-329	6122 Victoria Partners LLC	6122 S. Victoria Ave. Los Angeles, CA	1

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Dan Leacox, with Leacox & Associates, and Wolter Geesink with Otis Elevator Company appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each Applicant intends to utilize Otis Gen3 Edge/Gen2S/Gen3 Core elevators at the locations and in the numbers stated in the above section A.1 table. Applicant may utilize the variance from minimum inside car platform dimensions for other elevators designated for emergency medical service at the same variance location.
2. The installation contracts for these elevators were or will be signed on or after May 1, 2008, making the elevators subject to the Group IV Elevator Safety Orders.
3. The Board incorporates by reference the relevant findings in previous Board decisions:
 - a. Items D.3 through D.9 of the Proposed Decision adopted by the Board on July 18, 2013 for Permanent Variance No. 12-V-093;
 - b. Item D.4 of the Proposed Decision adopted by the Board on September 25, 2014 for Permanent Variance No. 14-V-206;
 - c. Item B of the Proposed Decision adopted by the Board on September 15, 2022 for Permanent Variance No. 22-V-302 regarding medical emergency car dimensions; and
 - d. Items C and D of the Proposed Decision adopted by the Board on June 20, 2024 for Permanent Variance No. 24-V-193 regarding the Gen3 Core elevator equivalent safety.
4. Cal/OSHA, by way of written submissions to the record (Exhibit PD-3), and position stated at hearing, is of the well informed opinion that grant of requested permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment, and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the Elevator Safety Order requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A table shall have permanent variances from the following sections of ASME A17.1-2004 that section 3141 makes applicable to the elevators the subject of those applications:

- **Car top railing:** sections 2.14.1.7.1 (to permit an inset car top railing, if, in fact, the car top railing is inset);
- **Speed governor over-speed switch:** 2.18.4.2.5(a) (to permit the use of the speed reducing system proposed by the Applicants, where the speed reducing switch resides in the controller algorithms, rather than on the governor, with the necessary speed input supplied by the main encoder signal from the motor);
- **Governor rope diameter:** 2.18.5.1 (to allow the use of reduced diameter governor rope);
- **Pitch diameter:** 2.18.7.4 (to permit the use of the speed-reducing system proposed by the Applicant, where the rope sheave pitch diameter is not less than 180 mm [7.1 in.]);
- **Suspension means:** 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4 and 2.20.9.5.4—the variances from these “suspension means” provisions to permit the use of Otis Gen2 flat coated steel suspension belts in lieu of conventional steel suspension ropes;
- **Inspection transfer switch:** 2.26.1.4.4(a) (to allow the inspection transfer switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room); and
- **Seismic reset switch:** 8.4.10.1.1(a)(2)(b) (to allow the seismic reset switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room).
- **Minimum Inside Car Platform Dimensions:** 3041(e)(1)(C) and 3141.7(b) (to comply with the performance-based requirements of the 2019 California Building Code section 3002.4.1a)

These variances apply to the locations and numbers of elevators stated in the section A table (so long as the elevators are Gen3 Edge/Gen2S Group and Gen3 Core & Medical Emergency Elevator Car Dimensions (Group IV) that are designed, equipped, and installed in accordance with, and are otherwise consistent with, and are subject to the following conditions:

1. The suspension system shall comply with the following:
 - a. The coated steel belt and connections shall have factors of safety equal to those permitted for use by section 3141 [ASME A17.1-2004, section 2.20.3] on wire rope suspended elevators.
 - b. Steel coated belts that have been installed and used on another installation shall not be reused.
 - c. The coated steel belt shall be fitted with a monitoring device which has been accepted by Cal/OSHA and which will automatically stop the car if the residual strength of any single belt drops below 60 percent. If the residual strength of any single belt drops below 60 percent, the device shall prevent the elevator from restarting after a normal stop at a landing.
 - d. Upon initial inspection, the readings from the monitoring device shall be documented and submitted to Cal/OSHA.
 - e. A successful test of the monitoring device’s functionality shall be conducted at least once a year (the record of the annual test of the monitoring device shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - f. The coated steel belts used shall be accepted by Cal/OSHA.

2. With respect to each elevator subject to this variance, the applicant shall comply with Cal/OSHA Circular Letter E-10-04, the substance of which is attached hereto as Addendum 1 and incorporated herein by this reference.
3. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection, and testing of the belts and monitoring device and criteria for belt replacement, and the applicant shall make those procedures and criteria available to Cal/OSHA upon request.
4. The flat coated steel belts shall be provided with a metal data tag that is securely attached to one of those belts. This data tag shall bear the following flat steel coated belt data:
 - a. The width and thickness in millimeters or inches;
 - b. The manufacturer's rated breaking strength in (kN) or (lbf);
 - c. The name of the person or organization that installed the flat coated steel belts;
 - d. The month and year the flat coated steel belts were installed;
 - e. The month and year the flat coated steel belts were first shortened;
 - f. The name or trademark of the manufacturer of the flat coated steel belts; and
 - g. Lubrication information.
5. There shall be a crosshead data plate of the sort required by section 2.20.2.1, and that plate shall bear the following flat steel coated belt data:
 - a. The number of belts;
 - b. The belt width and thickness in millimeters or inches; and
 - c. The manufacturer's rated breaking strength per belt in (kN) or (lbf).
6. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of elevator equipment in the hoistway is required. If service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
7. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on railings to perform adjustment, maintenance, repairs or inspections. The applicant shall not permit anyone to stand on or climb over the car top railing.
 - b. The distance that the car top railing may be inset shall be limited to no more than 6 inches.
 - c. All exposed areas outside the car top railing shall preclude standing or placing objects or persons which may fall and shall be beveled from the mid- or top rail to the outside of the car top.
 - d. The top of the beveled area and/or car top outside the railing, shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
 - e. The applicant shall provide durable signs with lettering not less than ½ inch on a

contrasting background on each inset railing; each sign shall state:

**CAUTION
DO NOT STAND ON OR CLIMB OVER RAILING**

- f. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing shall be measured from the car top and not from the required bevel).
8. If the seismic reset switch does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
9. If the inspection transfer switch required by ASME A17.1, rule 2.26.1.4.4(a) does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
10. When the inspection and testing panel is located in the hoistway door jamb, the inspection and test control panel shall be openable only by use of a Security Group I restricted key.
11. The governor speed-reducing switch function shall comply with the following:
 - a. It shall be used only with direct drive machines; i.e., no gear reduction is permitted between the drive motor and the suspension means.
 - b. The velocity encoder shall be coupled to the driving machine motor shaft. The “C” channel of the encoder shall be utilized for velocity measurements required by the speed reducing system. The signal from “C” channel of the encoder shall be verified with the “A” and “B” channels for failure. If a failure is detected then an emergency stop shall be initiated.
 - c. Control system parameters utilized in the speed-reducing system shall be held in non-volatile memory.
 - d. It shall be used in conjunction with approved car-mounted speed governors only.
 - e. It shall be used in conjunction with an effective traction monitoring system that detects a loss of traction between the driving sheave and the suspension means. If a loss of traction is detected, then an emergency stop shall be initiated.
 - f. A successful test of the speed-reducing switch system’s functionality shall be conducted at least once a year (the record of the annual test of the speed-reducing switch system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - g. A successful test of the traction monitoring system’s functionality shall be conducted at least once a year (the record of the annual test of the traction monitoring system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - h. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the maintenance, inspection, and testing of the speed-reducing switch and traction monitoring systems. The Applicant shall make the procedures available to Cal/OSHA upon

request.

12. The speed governor rope and sheaves shall comply with the following:

- a. The governor shall be used in conjunction with a 6 mm (0.25 in.) diameter steel governor rope with 6-strand, regular lay construction.
- b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
- c. The governor sheaves shall have a pitch diameter of not less than 180 mm (7.1 in.).

13. All medical emergency service elevators shall comply with the following:

- a. The requirements of the 2019 California Building Code (CBC), section 3002.4.1a;

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5inch (127 mm) radius corners] in the horizontal, open position.

- b. All medical emergency service elevators shall be identified in the building construction documents in accordance with the 2019 CBC, section 3002.4a.
- c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).

- 14. The elevator shall be serviced, maintained, adjusted, tested, and inspected only by Certified Competent Conveyance Mechanics who have been trained to, and are competent to, perform those tasks on the Gen3 Edge/Gen2S/Gen3 Core elevator system in accordance with the written procedures and criteria required by Condition No. 3 and in accordance with the terms of this permanent variance.
- 15. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing, or testing of the elevators shall be provided a copy of this variance decision.
- 16. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and a Permit to Operate shall be issued before the elevator is placed in service.
- 17. The Applicant shall be subject to the Suspension Means – Replacement Reporting Condition stated in Addendum 2, as hereby incorporated by this reference.
- 18. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications.
- 19. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in

accordance with the Board's procedural regulations at section 426, subdivision (b).

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 29, 2026



Kelly Chau, Hearing Officer

ADDENDUM 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and, Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA-Elevator Unit HQS

ADDENDUM 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Otis Gen2S/Gen3Edge/Gen3 Core Elevator & Medical Emergency Car Dimensions

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-330	Elad Investment LLC	3990 S. Wade St. Los Angeles, CA	1

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Dan Leacox, with Leacox & Associates, and Wolter Geesink with Otis Elevator Company appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each Applicant intends to utilize Otis Gen3 Edge/Gen2S/Gen3 Core elevators at the locations and in the numbers stated in the above section A.1 table. Applicant may utilize the variance from minimum inside car platform dimensions for other elevators designated for emergency medical service at the same variance location.
2. The installation contracts for these elevators were or will be signed on or after May 1, 2008, making the elevators subject to the Group IV Elevator Safety Orders.
3. The Board incorporates by reference the relevant findings in previous Board decisions:
 - a. Items D.3 through D.9 of the Proposed Decision adopted by the Board on July 18, 2013 for Permanent Variance No. 12-V-093;
 - b. Item D.4 of the Proposed Decision adopted by the Board on September 25, 2014 for Permanent Variance No. 14-V-206;
 - c. Item B of the Proposed Decision adopted by the Board on September 15, 2022 for Permanent Variance No. 22-V-302 regarding medical emergency car dimensions; and
 - d. Items C and D of the Proposed Decision adopted by the Board on June 20, 2024 for Permanent Variance No. 24-V-193 regarding the Gen3 Core elevator equivalent safety.
4. Cal/OSHA, by way of written submissions to the record (Exhibit PD-3), and position stated at hearing, is of the well informed opinion that grant of requested permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment, and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the Elevator Safety Order requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A table shall have permanent variances from the following sections of ASME A17.1-2004 that section 3141 makes applicable to the elevators the subject of those applications:

- **Car top railing:** sections 2.14.1.7.1 (to permit an inset car top railing, if, in fact, the car top railing is inset);
- **Speed governor over-speed switch:** 2.18.4.2.5(a) (to permit the use of the speed reducing system proposed by the Applicants, where the speed reducing switch resides in the controller algorithms, rather than on the governor, with the necessary speed input supplied by the main encoder signal from the motor);
- **Governor rope diameter:** 2.18.5.1 (to allow the use of reduced diameter governor rope);
- **Pitch diameter:** 2.18.7.4 (to permit the use of the speed-reducing system proposed by the Applicant, where the rope sheave pitch diameter is not less than 180 mm [7.1 in.]);
- **Suspension means:** 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4 and 2.20.9.5.4—the variances from these “suspension means” provisions to permit the use of Otis Gen2 flat coated steel suspension belts in lieu of conventional steel suspension ropes;
- **Inspection transfer switch:** 2.26.1.4.4(a) (to allow the inspection transfer switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room); and
- **Seismic reset switch:** 8.4.10.1.1(a)(2)(b) (to allow the seismic reset switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room).
- **Minimum Inside Car Platform Dimensions:** 3041(e)(1)(C) and 3141.7(b) (to comply with the performance-based requirements of the 2019 California Building Code section 3002.4.1a)

These variances apply to the locations and numbers of elevators stated in the section A table (so long as the elevators are Gen3 Edge/Gen2S Group and Gen3 Core & Medical Emergency Elevator Car Dimensions (Group IV) that are designed, equipped, and installed in accordance with, and are otherwise consistent with, and are subject to the following conditions:

1. The suspension system shall comply with the following:
 - a. The coated steel belt and connections shall have factors of safety equal to those permitted for use by section 3141 [ASME A17.1-2004, section 2.20.3] on wire rope suspended elevators.
 - b. Steel coated belts that have been installed and used on another installation shall not be reused.
 - c. The coated steel belt shall be fitted with a monitoring device which has been accepted by Cal/OSHA and which will automatically stop the car if the residual strength of any single belt drops below 60 percent. If the residual strength of any single belt drops below 60 percent, the device shall prevent the elevator from restarting after a normal stop at a landing.
 - d. Upon initial inspection, the readings from the monitoring device shall be documented and submitted to Cal/OSHA.
 - e. A successful test of the monitoring device’s functionality shall be conducted at least once a year (the record of the annual test of the monitoring device shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - f. The coated steel belts used shall be accepted by Cal/OSHA.

2. With respect to each elevator subject to this variance, the applicant shall comply with Cal/OSHA Circular Letter E-10-04, the substance of which is attached hereto as Addendum 1 and incorporated herein by this reference.
3. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection, and testing of the belts and monitoring device and criteria for belt replacement, and the applicant shall make those procedures and criteria available to Cal/OSHA upon request.
4. The flat coated steel belts shall be provided with a metal data tag that is securely attached to one of those belts. This data tag shall bear the following flat steel coated belt data:
 - a. The width and thickness in millimeters or inches;
 - b. The manufacturer's rated breaking strength in (kN) or (lbf);
 - c. The name of the person or organization that installed the flat coated steel belts;
 - d. The month and year the flat coated steel belts were installed;
 - e. The month and year the flat coated steel belts were first shortened;
 - f. The name or trademark of the manufacturer of the flat coated steel belts; and
 - g. Lubrication information.
5. There shall be a crosshead data plate of the sort required by section 2.20.2.1, and that plate shall bear the following flat steel coated belt data:
 - a. The number of belts;
 - b. The belt width and thickness in millimeters or inches; and
 - c. The manufacturer's rated breaking strength per belt in (kN) or (lbf).
6. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of elevator equipment in the hoistway is required. If service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
7. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on railings to perform adjustment, maintenance, repairs or inspections. The applicant shall not permit anyone to stand on or climb over the car top railing.
 - b. The distance that the car top railing may be inset shall be limited to no more than 6 inches.
 - c. All exposed areas outside the car top railing shall preclude standing or placing objects or persons which may fall and shall be beveled from the mid- or top rail to the outside of the car top.
 - d. The top of the beveled area and/or car top outside the railing, shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
 - e. The applicant shall provide durable signs with lettering not less than ½ inch on a

contrasting background on each inset railing; each sign shall state:

**CAUTION
DO NOT STAND ON OR CLIMB OVER RAILING**

- f. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing shall be measured from the car top and not from the required bevel).
- 8. If the seismic reset switch does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
- 9. If the inspection transfer switch required by ASME A17.1, rule 2.26.1.4.4(a) does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
- 10. When the inspection and testing panel is located in the hoistway door jamb, the inspection and test control panel shall be openable only by use of a Security Group I restricted key.
- 11. The governor speed-reducing switch function shall comply with the following:
 - a. It shall be used only with direct drive machines; i.e., no gear reduction is permitted between the drive motor and the suspension means.
 - b. The velocity encoder shall be coupled to the driving machine motor shaft. The “C” channel of the encoder shall be utilized for velocity measurements required by the speed reducing system. The signal from “C” channel of the encoder shall be verified with the “A” and “B” channels for failure. If a failure is detected then an emergency stop shall be initiated.
 - c. Control system parameters utilized in the speed-reducing system shall be held in non-volatile memory.
 - d. It shall be used in conjunction with approved car-mounted speed governors only.
 - e. It shall be used in conjunction with an effective traction monitoring system that detects a loss of traction between the driving sheave and the suspension means. If a loss of traction is detected, then an emergency stop shall be initiated.
 - f. A successful test of the speed-reducing switch system’s functionality shall be conducted at least once a year (the record of the annual test of the speed-reducing switch system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - g. A successful test of the traction monitoring system’s functionality shall be conducted at least once a year (the record of the annual test of the traction monitoring system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - h. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the maintenance, inspection, and testing of the speed-reducing switch and traction monitoring systems. The Applicant shall make the procedures available to Cal/OSHA upon

request.

12. The speed governor rope and sheaves shall comply with the following:

- a. The governor shall be used in conjunction with a 6 mm (0.25 in.) diameter steel governor rope with 6-strand, regular lay construction.
- b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
- c. The governor sheaves shall have a pitch diameter of not less than 180 mm (7.1 in.).

13. All medical emergency service elevators shall comply with the following:

- a. The requirements of the 2019 California Building Code (CBC), section 3002.4.1a;

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5inch (127 mm) radius corners] in the horizontal, open position.

- b. All medical emergency service elevators shall be identified in the building construction documents in accordance with the 2019 CBC, section 3002.4a.
- c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).

- 14. The elevator shall be serviced, maintained, adjusted, tested, and inspected only by Certified Competent Conveyance Mechanics who have been trained to, and are competent to, perform those tasks on the Gen3 Edge/Gen2S/Gen3 Core elevator system in accordance with the written procedures and criteria required by Condition No. 3 and in accordance with the terms of this permanent variance.
- 15. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing, or testing of the elevators shall be provided a copy of this variance decision.
- 16. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and a Permit to Operate shall be issued before the elevator is placed in service.
- 17. The Applicant shall be subject to the Suspension Means – Replacement Reporting Condition stated in Addendum 2, as hereby incorporated by this reference.
- 18. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications.
- 19. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in

accordance with the Board's procedural regulations at section 426, subdivision (b).

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 29, 2026



Kelly Chau, Hearing Officer

ADDENDUM 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and, Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA-Elevator Unit HQS

ADDENDUM 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Otis Gen2S/Gen3Edge/Gen3 Core Elevator & Medical Emergency Car Dimensions

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-331	Burlington Capital LP	255 S. Burlington Ave. Los Angeles, CA	3

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Dan Leacox, with Leacox & Associates, and Wolter Geesink with Otis Elevator Company appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each Applicant intends to utilize Otis Gen3 Edge/Gen2S/Gen3 Core elevators at the locations and in the numbers stated in the above section A.1 table. Applicant may utilize the variance from minimum inside car platform dimensions for other elevators designated for emergency medical service at the same variance location.
2. The installation contracts for these elevators were or will be signed on or after May 1, 2008, making the elevators subject to the Group IV Elevator Safety Orders.
3. The Board incorporates by reference the relevant findings in previous Board decisions:
 - a. Items D.3 through D.9 of the Proposed Decision adopted by the Board on July 18, 2013 for Permanent Variance No. 12-V-093;
 - b. Item D.4 of the Proposed Decision adopted by the Board on September 25, 2014 for Permanent Variance No. 14-V-206;
 - c. Item B of the Proposed Decision adopted by the Board on September 15, 2022 for Permanent Variance No. 22-V-302 regarding medical emergency car dimensions; and
 - d. Items C and D of the Proposed Decision adopted by the Board on June 20, 2024 for Permanent Variance No. 24-V-193 regarding the Gen3 Core elevator equivalent safety.
4. Cal/OSHA, by way of written submissions to the record (Exhibit PD-3), and position stated at hearing, is of the well informed opinion that grant of requested permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment, and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the Elevator Safety Order requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A table shall have permanent variances from the following sections of ASME A17.1-2004 that section 3141 makes applicable to the elevators the subject of those applications:

- **Car top railing:** sections 2.14.1.7.1 (to permit an inset car top railing, if, in fact, the car top railing is inset);
- **Speed governor over-speed switch:** 2.18.4.2.5(a) (to permit the use of the speed reducing system proposed by the Applicants, where the speed reducing switch resides in the controller algorithms, rather than on the governor, with the necessary speed input supplied by the main encoder signal from the motor);
- **Governor rope diameter:** 2.18.5.1 (to allow the use of reduced diameter governor rope);
- **Pitch diameter:** 2.18.7.4 (to permit the use of the speed-reducing system proposed by the Applicant, where the rope sheave pitch diameter is not less than 180 mm [7.1 in.]);
- **Suspension means:** 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4 and 2.20.9.5.4—the variances from these “suspension means” provisions to permit the use of Otis Gen2 flat coated steel suspension belts in lieu of conventional steel suspension ropes;
- **Inspection transfer switch:** 2.26.1.4.4(a) (to allow the inspection transfer switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room); and
- **Seismic reset switch:** 8.4.10.1.1(a)(2)(b) (to allow the seismic reset switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room).
- **Minimum Inside Car Platform Dimensions:** 3041(e)(1)(C) and 3141.7(b) (to comply with the performance-based requirements of the 2019 California Building Code section 3002.4.1a)

These variances apply to the locations and numbers of elevators stated in the section A table (so long as the elevators are Gen3 Edge/Gen2S Group and Gen3 Core & Medical Emergency Elevator Car Dimensions (Group IV) that are designed, equipped, and installed in accordance with, and are otherwise consistent with, and are subject to the following conditions:

1. The suspension system shall comply with the following:
 - a. The coated steel belt and connections shall have factors of safety equal to those permitted for use by section 3141 [ASME A17.1-2004, section 2.20.3] on wire rope suspended elevators.
 - b. Steel coated belts that have been installed and used on another installation shall not be reused.
 - c. The coated steel belt shall be fitted with a monitoring device which has been accepted by Cal/OSHA and which will automatically stop the car if the residual strength of any single belt drops below 60 percent. If the residual strength of any single belt drops below 60 percent, the device shall prevent the elevator from restarting after a normal stop at a landing.
 - d. Upon initial inspection, the readings from the monitoring device shall be documented and submitted to Cal/OSHA.
 - e. A successful test of the monitoring device’s functionality shall be conducted at least once a year (the record of the annual test of the monitoring device shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - f. The coated steel belts used shall be accepted by Cal/OSHA.

2. With respect to each elevator subject to this variance, the applicant shall comply with Cal/OSHA Circular Letter E-10-04, the substance of which is attached hereto as Addendum 1 and incorporated herein by this reference.
3. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection, and testing of the belts and monitoring device and criteria for belt replacement, and the applicant shall make those procedures and criteria available to Cal/OSHA upon request.
4. The flat coated steel belts shall be provided with a metal data tag that is securely attached to one of those belts. This data tag shall bear the following flat steel coated belt data:
 - a. The width and thickness in millimeters or inches;
 - b. The manufacturer's rated breaking strength in (kN) or (lbf);
 - c. The name of the person or organization that installed the flat coated steel belts;
 - d. The month and year the flat coated steel belts were installed;
 - e. The month and year the flat coated steel belts were first shortened;
 - f. The name or trademark of the manufacturer of the flat coated steel belts; and
 - g. Lubrication information.
5. There shall be a crosshead data plate of the sort required by section 2.20.2.1, and that plate shall bear the following flat steel coated belt data:
 - a. The number of belts;
 - b. The belt width and thickness in millimeters or inches; and
 - c. The manufacturer's rated breaking strength per belt in (kN) or (lbf).
6. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of elevator equipment in the hoistway is required. If service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
7. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on railings to perform adjustment, maintenance, repairs or inspections. The applicant shall not permit anyone to stand on or climb over the car top railing.
 - b. The distance that the car top railing may be inset shall be limited to no more than 6 inches.
 - c. All exposed areas outside the car top railing shall preclude standing or placing objects or persons which may fall and shall be beveled from the mid- or top rail to the outside of the car top.
 - d. The top of the beveled area and/or car top outside the railing, shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
 - e. The applicant shall provide durable signs with lettering not less than ½ inch on a

contrasting background on each inset railing; each sign shall state:

**CAUTION
DO NOT STAND ON OR CLIMB OVER RAILING**

- f. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing shall be measured from the car top and not from the required bevel).
- 8. If the seismic reset switch does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
- 9. If the inspection transfer switch required by ASME A17.1, rule 2.26.1.4.4(a) does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
- 10. When the inspection and testing panel is located in the hoistway door jamb, the inspection and test control panel shall be openable only by use of a Security Group I restricted key.
- 11. The governor speed-reducing switch function shall comply with the following:
 - a. It shall be used only with direct drive machines; i.e., no gear reduction is permitted between the drive motor and the suspension means.
 - b. The velocity encoder shall be coupled to the driving machine motor shaft. The “C” channel of the encoder shall be utilized for velocity measurements required by the speed reducing system. The signal from “C” channel of the encoder shall be verified with the “A” and “B” channels for failure. If a failure is detected then an emergency stop shall be initiated.
 - c. Control system parameters utilized in the speed-reducing system shall be held in non-volatile memory.
 - d. It shall be used in conjunction with approved car-mounted speed governors only.
 - e. It shall be used in conjunction with an effective traction monitoring system that detects a loss of traction between the driving sheave and the suspension means. If a loss of traction is detected, then an emergency stop shall be initiated.
 - f. A successful test of the speed-reducing switch system’s functionality shall be conducted at least once a year (the record of the annual test of the speed-reducing switch system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - g. A successful test of the traction monitoring system’s functionality shall be conducted at least once a year (the record of the annual test of the traction monitoring system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - h. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the maintenance, inspection, and testing of the speed-reducing switch and traction monitoring systems. The Applicant shall make the procedures available to Cal/OSHA upon

request.

12. The speed governor rope and sheaves shall comply with the following:

- a. The governor shall be used in conjunction with a 6 mm (0.25 in.) diameter steel governor rope with 6-strand, regular lay construction.
- b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
- c. The governor sheaves shall have a pitch diameter of not less than 180 mm (7.1 in.).

13. All medical emergency service elevators shall comply with the following:

- a. The requirements of the 2019 California Building Code (CBC), section 3002.4.1a;

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5inch (127 mm) radius corners] in the horizontal, open position.

- b. All medical emergency service elevators shall be identified in the building construction documents in accordance with the 2019 CBC, section 3002.4a.
- c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).

- 14. The elevator shall be serviced, maintained, adjusted, tested, and inspected only by Certified Competent Conveyance Mechanics who have been trained to, and are competent to, perform those tasks on the Gen3 Edge/Gen2S/Gen3 Core elevator system in accordance with the written procedures and criteria required by Condition No. 3 and in accordance with the terms of this permanent variance.
- 15. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing, or testing of the elevators shall be provided a copy of this variance decision.
- 16. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and a Permit to Operate shall be issued before the elevator is placed in service.
- 17. The Applicant shall be subject to the Suspension Means – Replacement Reporting Condition stated in Addendum 2, as hereby incorporated by this reference.
- 18. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications.
- 19. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in

accordance with the Board's procedural regulations at section 426, subdivision (b).

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 29, 2026



Kelly Chau, Hearing Officer

ADDENDUM 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and, Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA-Elevator Unit HQS

ADDENDUM 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Otis Gen2S/Gen3Edge/Gen3 Core Elevator & Medical Emergency Car Dimensions

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-332	City of Eastvale	Eastvale Civic Center - City Hall 6065 Premier Place Eastvale, CA	2

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Dan Leacox, with Leacox & Associates, and Wolter Geesink with Otis Elevator Company appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table

PD2	OSHSB Notice of Hearing
PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each Applicant intends to utilize Otis Gen3 Edge/Gen2S/Gen3 Core elevators at the locations and in the numbers stated in the above section A.1 table. Applicant may utilize the variance from minimum inside car platform dimensions for other elevators designated for emergency medical service at the same variance location.
2. The installation contracts for these elevators were or will be signed on or after May 1, 2008, making the elevators subject to the Group IV Elevator Safety Orders.
3. The Board incorporates by reference the relevant findings in previous Board decisions:
 - a. Items D.3 through D.9 of the Proposed Decision adopted by the Board on July 18, 2013 for Permanent Variance No. 12-V-093;
 - b. Item D.4 of the Proposed Decision adopted by the Board on September 25, 2014 for Permanent Variance No. 14-V-206;
 - c. Item B of the Proposed Decision adopted by the Board on September 15, 2022 for Permanent Variance No. 22-V-302 regarding medical emergency car dimensions; and
 - d. Items C and D of the Proposed Decision adopted by the Board on June 20, 2024 for Permanent Variance No. 24-V-193 regarding the Gen3 Core elevator equivalent safety.
4. Cal/OSHA, by way of written submissions to the record (Exhibit PD-3), and position stated at hearing, is of the well informed opinion that grant of requested permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment, and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the Elevator Safety Order requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A table shall have permanent variances from the

following sections of ASME A17.1-2004 that section 3141 makes applicable to the elevators the subject of those applications:

- **Car top railing:** sections 2.14.1.7.1 (to permit an inset car top railing, if, in fact, the car top railing is inset);
- **Speed governor over-speed switch:** 2.18.4.2.5(a) (to permit the use of the speed reducing system proposed by the Applicants, where the speed reducing switch resides in the controller algorithms, rather than on the governor, with the necessary speed input supplied by the main encoder signal from the motor);
- **Governor rope diameter:** 2.18.5.1 (to allow the use of reduced diameter governor rope);
- **Pitch diameter:** 2.18.7.4 (to permit the use of the speed-reducing system proposed by the Applicant, where the rope sheave pitch diameter is not less than 180 mm [7.1 in.]);
- **Suspension means:** 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4 and 2.20.9.5.4—the variances from these “suspension means” provisions to permit the use of Otis Gen2 flat coated steel suspension belts in lieu of conventional steel suspension ropes;
- **Inspection transfer switch:** 2.26.1.4.4(a) (to allow the inspection transfer switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room); and
- **Seismic reset switch:** 8.4.10.1.1(a)(2)(b) (to allow the seismic reset switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room).
- **Minimum Inside Car Platform Dimensions:** 3041(e)(1)(C) and 3141.7(b) (to comply with the performance-based requirements of the 2019 California Building Code section 3002.4.1a)

These variances apply to the locations and numbers of elevators stated in the section A table (so long as the elevators are Gen3 Edge/Gen2S Group and Gen3 Core & Medical Emergency Elevator Car Dimensions (Group IV) that are designed, equipped, and installed in accordance with, and are otherwise consistent with, and are subject to the following conditions:

1. The suspension system shall comply with the following:
 - a. The coated steel belt and connections shall have factors of safety equal to those permitted for use by section 3141 [ASME A17.1-2004, section 2.20.3] on wire rope suspended elevators.
 - b. Steel coated belts that have been installed and used on another installation shall not be reused.
 - c. The coated steel belt shall be fitted with a monitoring device which has been accepted by Cal/OSHA and which will automatically stop the car if the residual strength of any single belt drops below 60 percent. If the residual strength of any single belt drops below 60 percent, the device shall prevent the elevator from restarting after a normal stop at a landing.
 - d. Upon initial inspection, the readings from the monitoring device shall be documented and submitted to Cal/OSHA.
 - e. A successful test of the monitoring device’s functionality shall be conducted at least once

a year (the record of the annual test of the monitoring device shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).

- f. The coated steel belts used shall be accepted by Cal/OSHA.
2. With respect to each elevator subject to this variance, the applicant shall comply with Cal/OSHA Circular Letter E-10-04, the substance of which is attached hereto as Addendum 1 and incorporated herein by this reference.
3. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection, and testing of the belts and monitoring device and criteria for belt replacement, and the applicant shall make those procedures and criteria available to Cal/OSHA upon request.
4. The flat coated steel belts shall be provided with a metal data tag that is securely attached to one of those belts. This data tag shall bear the following flat steel coated belt data:
 - a. The width and thickness in millimeters or inches;
 - b. The manufacturer's rated breaking strength in (kN) or (lbf);
 - c. The name of the person or organization that installed the flat coated steel belts;
 - d. The month and year the flat coated steel belts were installed;
 - e. The month and year the flat coated steel belts were first shortened;
 - f. The name or trademark of the manufacturer of the flat coated steel belts; and
 - g. Lubrication information.
5. There shall be a crosshead data plate of the sort required by section 2.20.2.1, and that plate shall bear the following flat steel coated belt data:
 - a. The number of belts;
 - b. The belt width and thickness in millimeters or inches; and
 - c. The manufacturer's rated breaking strength per belt in (kN) or (lbf).
6. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of elevator equipment in the hoistway is required. If service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
7. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on railings to perform adjustment, maintenance, repairs or inspections. The applicant shall not permit anyone to stand on or climb over the car top railing.
 - b. The distance that the car top railing may be inset shall be limited to no more than 6 inches.
 - c. All exposed areas outside the car top railing shall preclude standing or placing objects or persons which may fall and shall be beveled from the mid- or top rail to the outside of the car top.

- d. The top of the beveled area and/or car top outside the railing, shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
- e. The applicant shall provide durable signs with lettering not less than ½ inch on a contrasting background on each inset railing; each sign shall state:

CAUTION
DO NOT STAND ON OR CLIMB OVER RAILING

- f. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing shall be measured from the car top and not from the required bevel).
-
- 8. If the seismic reset switch does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
 - 9. If the inspection transfer switch required by ASME A17.1, rule 2.26.1.4.4(a) does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
 - 10. When the inspection and testing panel is located in the hoistway door jamb, the inspection and test control panel shall be openable only by use of a Security Group I restricted key.
 - 11. The governor speed-reducing switch function shall comply with the following:
 - a. It shall be used only with direct drive machines; i.e., no gear reduction is permitted between the drive motor and the suspension means.
 - b. The velocity encoder shall be coupled to the driving machine motor shaft. The “C” channel of the encoder shall be utilized for velocity measurements required by the speed reducing system. The signal from “C” channel of the encoder shall be verified with the “A” and “B” channels for failure. If a failure is detected then an emergency stop shall be initiated.
 - c. Control system parameters utilized in the speed-reducing system shall be held in non-volatile memory.
 - d. It shall be used in conjunction with approved car-mounted speed governors only.
 - e. It shall be used in conjunction with an effective traction monitoring system that detects a loss of traction between the driving sheave and the suspension means. If a loss of traction is detected, then an emergency stop shall be initiated.
 - f. A successful test of the speed-reducing switch system’s functionality shall be conducted at least once a year (the record of the annual test of the speed-reducing switch system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - g. A successful test of the traction monitoring system’s functionality shall be conducted at least once a year (the record of the annual test of the traction monitoring system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).

- h. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the maintenance, inspection, and testing of the speed-reducing switch and traction monitoring systems. The Applicant shall make the procedures available to Cal/OSHA upon request.

12. The speed governor rope and sheaves shall comply with the following:

- a. The governor shall be used in conjunction with a 6 mm (0.25 in.) diameter steel governor rope with 6-strand, regular lay construction.
- b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
- c. The governor sheaves shall have a pitch diameter of not less than 180 mm (7.1 in.).

13. All medical emergency service elevators shall comply with the following:

- a. The requirements of the 2019 California Building Code (CBC), section 3002.4.1a;

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5inch (127 mm) radius corners] in the horizontal, open position.

- b. All medical emergency service elevators shall be identified in the building construction documents in accordance with the 2019 CBC, section 3002.4a.
- c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).

- 14. The elevator shall be serviced, maintained, adjusted, tested, and inspected only by Certified Competent Conveyance Mechanics who have been trained to, and are competent to, perform those tasks on the Gen3 Edge/Gen2S/Gen3 Core elevator system in accordance with the written procedures and criteria required by Condition No. 3 and in accordance with the terms of this permanent variance.
- 15. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing, or testing of the elevators shall be provided a copy of this variance decision.
- 16. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and a Permit to Operate shall be issued before the elevator is placed in service.
- 17. The Applicant shall be subject to the Suspension Means – Replacement Reporting Condition stated in Addendum 2, as hereby incorporated by this reference.
- 18. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives

are to be notified of docketed permanent variance applications.

19. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in accordance with the Board's procedural regulations at section 426, subdivision (b).

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 29, 2026



Kelly Chau, Hearing Officer

ADDENDUM 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and, Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA-Elevator Unit HQS

ADDENDUM 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Otis Gen2S/Gen3Edge/Gen3 Core Elevator & Medical Emergency Car Dimensions

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-333	City of Eastvale	Eastvale Civic Center - Library 6060 Bootsma Blvd. Eastvale, CA	1

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Dan Leacox, with Leacox & Associates, and Wolter Geesink with Otis Elevator Company appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table

PD2	OSHSB Notice of Hearing
PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each Applicant intends to utilize Otis Gen3 Edge/Gen2S/Gen3 Core elevators at the locations and in the numbers stated in the above section A.1 table. Applicant may utilize the variance from minimum inside car platform dimensions for other elevators designated for emergency medical service at the same variance location.
2. The installation contracts for these elevators were or will be signed on or after May 1, 2008, making the elevators subject to the Group IV Elevator Safety Orders.
3. The Board incorporates by reference the relevant findings in previous Board decisions:
 - a. Items D.3 through D.9 of the Proposed Decision adopted by the Board on July 18, 2013 for Permanent Variance No. 12-V-093;
 - b. Item D.4 of the Proposed Decision adopted by the Board on September 25, 2014 for Permanent Variance No. 14-V-206;
 - c. Item B of the Proposed Decision adopted by the Board on September 15, 2022 for Permanent Variance No. 22-V-302 regarding medical emergency car dimensions; and
 - d. Items C and D of the Proposed Decision adopted by the Board on June 20, 2024 for Permanent Variance No. 24-V-193 regarding the Gen3 Core elevator equivalent safety.
4. Cal/OSHA, by way of written submissions to the record (Exhibit PD-3), and position stated at hearing, is of the well informed opinion that grant of requested permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment, and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the Elevator Safety Order requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A table shall have permanent variances from the

following sections of ASME A17.1-2004 that section 3141 makes applicable to the elevators the subject of those applications:

- **Car top railing:** sections 2.14.1.7.1 (to permit an inset car top railing, if, in fact, the car top railing is inset);
- **Speed governor over-speed switch:** 2.18.4.2.5(a) (to permit the use of the speed reducing system proposed by the Applicants, where the speed reducing switch resides in the controller algorithms, rather than on the governor, with the necessary speed input supplied by the main encoder signal from the motor);
- **Governor rope diameter:** 2.18.5.1 (to allow the use of reduced diameter governor rope);
- **Pitch diameter:** 2.18.7.4 (to permit the use of the speed-reducing system proposed by the Applicant, where the rope sheave pitch diameter is not less than 180 mm [7.1 in.]);
- **Suspension means:** 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4 and 2.20.9.5.4—the variances from these “suspension means” provisions to permit the use of Otis Gen2 flat coated steel suspension belts in lieu of conventional steel suspension ropes;
- **Inspection transfer switch:** 2.26.1.4.4(a) (to allow the inspection transfer switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room); and
- **Seismic reset switch:** 8.4.10.1.1(a)(2)(b) (to allow the seismic reset switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room).
- **Minimum Inside Car Platform Dimensions:** 3041(e)(1)(C) and 3141.7(b) (to comply with the performance-based requirements of the 2019 California Building Code section 3002.4.1a)

These variances apply to the locations and numbers of elevators stated in the section A table (so long as the elevators are Gen3 Edge/Gen2S Group and Gen3 Core & Medical Emergency Elevator Car Dimensions (Group IV) that are designed, equipped, and installed in accordance with, and are otherwise consistent with, and are subject to the following conditions:

1. The suspension system shall comply with the following:
 - a. The coated steel belt and connections shall have factors of safety equal to those permitted for use by section 3141 [ASME A17.1-2004, section 2.20.3] on wire rope suspended elevators.
 - b. Steel coated belts that have been installed and used on another installation shall not be reused.
 - c. The coated steel belt shall be fitted with a monitoring device which has been accepted by Cal/OSHA and which will automatically stop the car if the residual strength of any single belt drops below 60 percent. If the residual strength of any single belt drops below 60 percent, the device shall prevent the elevator from restarting after a normal stop at a landing.
 - d. Upon initial inspection, the readings from the monitoring device shall be documented and submitted to Cal/OSHA.
 - e. A successful test of the monitoring device’s functionality shall be conducted at least once

a year (the record of the annual test of the monitoring device shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).

- f. The coated steel belts used shall be accepted by Cal/OSHA.
2. With respect to each elevator subject to this variance, the applicant shall comply with Cal/OSHA Circular Letter E-10-04, the substance of which is attached hereto as Addendum 1 and incorporated herein by this reference.
3. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection, and testing of the belts and monitoring device and criteria for belt replacement, and the applicant shall make those procedures and criteria available to Cal/OSHA upon request.
4. The flat coated steel belts shall be provided with a metal data tag that is securely attached to one of those belts. This data tag shall bear the following flat steel coated belt data:
 - a. The width and thickness in millimeters or inches;
 - b. The manufacturer's rated breaking strength in (kN) or (lbf);
 - c. The name of the person or organization that installed the flat coated steel belts;
 - d. The month and year the flat coated steel belts were installed;
 - e. The month and year the flat coated steel belts were first shortened;
 - f. The name or trademark of the manufacturer of the flat coated steel belts; and
 - g. Lubrication information.
5. There shall be a crosshead data plate of the sort required by section 2.20.2.1, and that plate shall bear the following flat steel coated belt data:
 - a. The number of belts;
 - b. The belt width and thickness in millimeters or inches; and
 - c. The manufacturer's rated breaking strength per belt in (kN) or (lbf).
6. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of elevator equipment in the hoistway is required. If service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
7. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on railings to perform adjustment, maintenance, repairs or inspections. The applicant shall not permit anyone to stand on or climb over the car top railing.
 - b. The distance that the car top railing may be inset shall be limited to no more than 6 inches.
 - c. All exposed areas outside the car top railing shall preclude standing or placing objects or persons which may fall and shall be beveled from the mid- or top rail to the outside of the car top.

- d. The top of the beveled area and/or car top outside the railing, shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
- e. The applicant shall provide durable signs with lettering not less than ½ inch on a contrasting background on each inset railing; each sign shall state:

CAUTION
DO NOT STAND ON OR CLIMB OVER RAILING

- f. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing shall be measured from the car top and not from the required bevel).
-
- 8. If the seismic reset switch does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
 - 9. If the inspection transfer switch required by ASME A17.1, rule 2.26.1.4.4(a) does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
 - 10. When the inspection and testing panel is located in the hoistway door jamb, the inspection and test control panel shall be openable only by use of a Security Group I restricted key.
 - 11. The governor speed-reducing switch function shall comply with the following:
 - a. It shall be used only with direct drive machines; i.e., no gear reduction is permitted between the drive motor and the suspension means.
 - b. The velocity encoder shall be coupled to the driving machine motor shaft. The “C” channel of the encoder shall be utilized for velocity measurements required by the speed reducing system. The signal from “C” channel of the encoder shall be verified with the “A” and “B” channels for failure. If a failure is detected then an emergency stop shall be initiated.
 - c. Control system parameters utilized in the speed-reducing system shall be held in non-volatile memory.
 - d. It shall be used in conjunction with approved car-mounted speed governors only.
 - e. It shall be used in conjunction with an effective traction monitoring system that detects a loss of traction between the driving sheave and the suspension means. If a loss of traction is detected, then an emergency stop shall be initiated.
 - f. A successful test of the speed-reducing switch system’s functionality shall be conducted at least once a year (the record of the annual test of the speed-reducing switch system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - g. A successful test of the traction monitoring system’s functionality shall be conducted at least once a year (the record of the annual test of the traction monitoring system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).

- h. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the maintenance, inspection, and testing of the speed-reducing switch and traction monitoring systems. The Applicant shall make the procedures available to Cal/OSHA upon request.

12. The speed governor rope and sheaves shall comply with the following:

- a. The governor shall be used in conjunction with a 6 mm (0.25 in.) diameter steel governor rope with 6-strand, regular lay construction.
- b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
- c. The governor sheaves shall have a pitch diameter of not less than 180 mm (7.1 in.).

13. All medical emergency service elevators shall comply with the following:

- a. The requirements of the 2019 California Building Code (CBC), section 3002.4.1a;

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5inch (127 mm) radius corners] in the horizontal, open position.

- b. All medical emergency service elevators shall be identified in the building construction documents in accordance with the 2019 CBC, section 3002.4a.
- c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).

- 14. The elevator shall be serviced, maintained, adjusted, tested, and inspected only by Certified Competent Conveyance Mechanics who have been trained to, and are competent to, perform those tasks on the Gen3 Edge/Gen2S/Gen3 Core elevator system in accordance with the written procedures and criteria required by Condition No. 3 and in accordance with the terms of this permanent variance.
- 15. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing, or testing of the elevators shall be provided a copy of this variance decision.
- 16. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and a Permit to Operate shall be issued before the elevator is placed in service.
- 17. The Applicant shall be subject to the Suspension Means – Replacement Reporting Condition stated in Addendum 2, as hereby incorporated by this reference.
- 18. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives

are to be notified of docketed permanent variance applications.

19. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in accordance with the Board's procedural regulations at section 426, subdivision (b).

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 29, 2026



Kelly Chau, Hearing Officer

ADDENDUM 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and, Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA-Elevator Unit HQS

ADDENDUM 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Otis Gen2S/Gen3Edge/Gen3 Core Elevator & Medical Emergency Car Dimensions

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-334	City of Eastvale	Eastvale Civic Center - Police Station 6075 Premier Place Eastvale, CA	2

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Dan Leacox, with Leacox & Associates, and Wolter Geesink with Otis Elevator Company appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table

PD2	OSHSB Notice of Hearing
PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each Applicant intends to utilize Otis Gen3 Edge/Gen2S/Gen3 Core elevators at the locations and in the numbers stated in the above section A.1 table. Applicant may utilize the variance from minimum inside car platform dimensions for other elevators designated for emergency medical service at the same variance location.
2. The installation contracts for these elevators were or will be signed on or after May 1, 2008, making the elevators subject to the Group IV Elevator Safety Orders.
3. The Board incorporates by reference the relevant findings in previous Board decisions:
 - a. Items D.3 through D.9 of the Proposed Decision adopted by the Board on July 18, 2013 for Permanent Variance No. 12-V-093;
 - b. Item D.4 of the Proposed Decision adopted by the Board on September 25, 2014 for Permanent Variance No. 14-V-206;
 - c. Item B of the Proposed Decision adopted by the Board on September 15, 2022 for Permanent Variance No. 22-V-302 regarding medical emergency car dimensions; and
 - d. Items C and D of the Proposed Decision adopted by the Board on June 20, 2024 for Permanent Variance No. 24-V-193 regarding the Gen3 Core elevator equivalent safety.
4. Cal/OSHA, by way of written submissions to the record (Exhibit PD-3), and position stated at hearing, is of the well informed opinion that grant of requested permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment, and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the Elevator Safety Order requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A table shall have permanent variances from the

following sections of ASME A17.1-2004 that section 3141 makes applicable to the elevators the subject of those applications:

- **Car top railing:** sections 2.14.1.7.1 (to permit an inset car top railing, if, in fact, the car top railing is inset);
- **Speed governor over-speed switch:** 2.18.4.2.5(a) (to permit the use of the speed reducing system proposed by the Applicants, where the speed reducing switch resides in the controller algorithms, rather than on the governor, with the necessary speed input supplied by the main encoder signal from the motor);
- **Governor rope diameter:** 2.18.5.1 (to allow the use of reduced diameter governor rope);
- **Pitch diameter:** 2.18.7.4 (to permit the use of the speed-reducing system proposed by the Applicant, where the rope sheave pitch diameter is not less than 180 mm [7.1 in.]);
- **Suspension means:** 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4 and 2.20.9.5.4—the variances from these “suspension means” provisions to permit the use of Otis Gen2 flat coated steel suspension belts in lieu of conventional steel suspension ropes;
- **Inspection transfer switch:** 2.26.1.4.4(a) (to allow the inspection transfer switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room); and
- **Seismic reset switch:** 8.4.10.1.1(a)(2)(b) (to allow the seismic reset switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room).
- **Minimum Inside Car Platform Dimensions:** 3041(e)(1)(C) and 3141.7(b) (to comply with the performance-based requirements of the 2019 California Building Code section 3002.4.1a)

These variances apply to the locations and numbers of elevators stated in the section A table (so long as the elevators are Gen3 Edge/Gen2S Group and Gen3 Core & Medical Emergency Elevator Car Dimensions (Group IV) that are designed, equipped, and installed in accordance with, and are otherwise consistent with, and are subject to the following conditions:

1. The suspension system shall comply with the following:
 - a. The coated steel belt and connections shall have factors of safety equal to those permitted for use by section 3141 [ASME A17.1-2004, section 2.20.3] on wire rope suspended elevators.
 - b. Steel coated belts that have been installed and used on another installation shall not be reused.
 - c. The coated steel belt shall be fitted with a monitoring device which has been accepted by Cal/OSHA and which will automatically stop the car if the residual strength of any single belt drops below 60 percent. If the residual strength of any single belt drops below 60 percent, the device shall prevent the elevator from restarting after a normal stop at a landing.
 - d. Upon initial inspection, the readings from the monitoring device shall be documented and submitted to Cal/OSHA.
 - e. A successful test of the monitoring device’s functionality shall be conducted at least once

a year (the record of the annual test of the monitoring device shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).

- f. The coated steel belts used shall be accepted by Cal/OSHA.
2. With respect to each elevator subject to this variance, the applicant shall comply with Cal/OSHA Circular Letter E-10-04, the substance of which is attached hereto as Addendum 1 and incorporated herein by this reference.
3. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection, and testing of the belts and monitoring device and criteria for belt replacement, and the applicant shall make those procedures and criteria available to Cal/OSHA upon request.
4. The flat coated steel belts shall be provided with a metal data tag that is securely attached to one of those belts. This data tag shall bear the following flat steel coated belt data:
 - a. The width and thickness in millimeters or inches;
 - b. The manufacturer's rated breaking strength in (kN) or (lbf);
 - c. The name of the person or organization that installed the flat coated steel belts;
 - d. The month and year the flat coated steel belts were installed;
 - e. The month and year the flat coated steel belts were first shortened;
 - f. The name or trademark of the manufacturer of the flat coated steel belts; and
 - g. Lubrication information.
5. There shall be a crosshead data plate of the sort required by section 2.20.2.1, and that plate shall bear the following flat steel coated belt data:
 - a. The number of belts;
 - b. The belt width and thickness in millimeters or inches; and
 - c. The manufacturer's rated breaking strength per belt in (kN) or (lbf).
6. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of elevator equipment in the hoistway is required. If service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
7. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on railings to perform adjustment, maintenance, repairs or inspections. The applicant shall not permit anyone to stand on or climb over the car top railing.
 - b. The distance that the car top railing may be inset shall be limited to no more than 6 inches.
 - c. All exposed areas outside the car top railing shall preclude standing or placing objects or persons which may fall and shall be beveled from the mid- or top rail to the outside of the car top.

- d. The top of the beveled area and/or car top outside the railing, shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
- e. The applicant shall provide durable signs with lettering not less than ½ inch on a contrasting background on each inset railing; each sign shall state:

CAUTION
DO NOT STAND ON OR CLIMB OVER RAILING

- f. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing shall be measured from the car top and not from the required bevel).
-
- 8. If the seismic reset switch does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
 - 9. If the inspection transfer switch required by ASME A17.1, rule 2.26.1.4.4(a) does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
 - 10. When the inspection and testing panel is located in the hoistway door jamb, the inspection and test control panel shall be openable only by use of a Security Group I restricted key.
 - 11. The governor speed-reducing switch function shall comply with the following:
 - a. It shall be used only with direct drive machines; i.e., no gear reduction is permitted between the drive motor and the suspension means.
 - b. The velocity encoder shall be coupled to the driving machine motor shaft. The “C” channel of the encoder shall be utilized for velocity measurements required by the speed reducing system. The signal from “C” channel of the encoder shall be verified with the “A” and “B” channels for failure. If a failure is detected then an emergency stop shall be initiated.
 - c. Control system parameters utilized in the speed-reducing system shall be held in non-volatile memory.
 - d. It shall be used in conjunction with approved car-mounted speed governors only.
 - e. It shall be used in conjunction with an effective traction monitoring system that detects a loss of traction between the driving sheave and the suspension means. If a loss of traction is detected, then an emergency stop shall be initiated.
 - f. A successful test of the speed-reducing switch system’s functionality shall be conducted at least once a year (the record of the annual test of the speed-reducing switch system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - g. A successful test of the traction monitoring system’s functionality shall be conducted at least once a year (the record of the annual test of the traction monitoring system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).

- h. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the maintenance, inspection, and testing of the speed-reducing switch and traction monitoring systems. The Applicant shall make the procedures available to Cal/OSHA upon request.

12. The speed governor rope and sheaves shall comply with the following:

- a. The governor shall be used in conjunction with a 6 mm (0.25 in.) diameter steel governor rope with 6-strand, regular lay construction.
- b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
- c. The governor sheaves shall have a pitch diameter of not less than 180 mm (7.1 in.).

13. All medical emergency service elevators shall comply with the following:

- a. The requirements of the 2019 California Building Code (CBC), section 3002.4.1a;

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5inch (127 mm) radius corners] in the horizontal, open position.

- b. All medical emergency service elevators shall be identified in the building construction documents in accordance with the 2019 CBC, section 3002.4a.
- c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).

- 14. The elevator shall be serviced, maintained, adjusted, tested, and inspected only by Certified Competent Conveyance Mechanics who have been trained to, and are competent to, perform those tasks on the Gen3 Edge/Gen2S/Gen3 Core elevator system in accordance with the written procedures and criteria required by Condition No. 3 and in accordance with the terms of this permanent variance.
- 15. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing, or testing of the elevators shall be provided a copy of this variance decision.
- 16. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and a Permit to Operate shall be issued before the elevator is placed in service.
- 17. The Applicant shall be subject to the Suspension Means – Replacement Reporting Condition stated in Addendum 2, as hereby incorporated by this reference.
- 18. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives

are to be notified of docketed permanent variance applications.

19. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in accordance with the Board's procedural regulations at section 426, subdivision (b).

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 29, 2026



Kelly Chau, Hearing Officer

ADDENDUM 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and, Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA-Elevator Unit HQS

ADDENDUM 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Otis Gen2S/Gen3Edge/Gen3 Core Elevator & Medical Emergency Car Dimensions

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-335	Sutter Bay Hospitals	3501 Cesar Chavez St. San Francisco, CA	6

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Dan Leacox, with Leacox & Associates, and Wolter Geesink with Otis Elevator Company appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each Applicant intends to utilize Otis Gen3 Edge/Gen2S/Gen3 Core elevators at the locations and in the numbers stated in the above section A.1 table. Applicant may utilize the variance from minimum inside car platform dimensions for other elevators designated for emergency medical service at the same variance location.
2. The installation contracts for these elevators were or will be signed on or after May 1, 2008, making the elevators subject to the Group IV Elevator Safety Orders.
3. The Board incorporates by reference the relevant findings in previous Board decisions:
 - a. Items D.3 through D.9 of the Proposed Decision adopted by the Board on July 18, 2013 for Permanent Variance No. 12-V-093;
 - b. Item D.4 of the Proposed Decision adopted by the Board on September 25, 2014 for Permanent Variance No. 14-V-206;
 - c. Item B of the Proposed Decision adopted by the Board on September 15, 2022 for Permanent Variance No. 22-V-302 regarding medical emergency car dimensions; and
 - d. Items C and D of the Proposed Decision adopted by the Board on June 20, 2024 for Permanent Variance No. 24-V-193 regarding the Gen3 Core elevator equivalent safety.
4. Cal/OSHA, by way of written submissions to the record (Exhibit PD-3), and position stated at hearing, is of the well informed opinion that grant of requested permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment, and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the Elevator Safety Order requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A table shall have permanent variances from the following sections of ASME A17.1-2004 that section 3141 makes applicable to the elevators the subject of those applications:

- **Car top railing:** sections 2.14.1.7.1 (to permit an inset car top railing, if, in fact, the car top railing is inset);
- **Speed governor over-speed switch:** 2.18.4.2.5(a) (to permit the use of the speed reducing system proposed by the Applicants, where the speed reducing switch resides in the controller algorithms, rather than on the governor, with the necessary speed input supplied by the main encoder signal from the motor);
- **Governor rope diameter:** 2.18.5.1 (to allow the use of reduced diameter governor rope);
- **Pitch diameter:** 2.18.7.4 (to permit the use of the speed-reducing system proposed by the Applicant, where the rope sheave pitch diameter is not less than 180 mm [7.1 in.]);
- **Suspension means:** 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4 and 2.20.9.5.4—the variances from these “suspension means” provisions to permit the use of Otis Gen2 flat coated steel suspension belts in lieu of conventional steel suspension ropes;
- **Inspection transfer switch:** 2.26.1.4.4(a) (to allow the inspection transfer switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room); and
- **Seismic reset switch:** 8.4.10.1.1(a)(2)(b) (to allow the seismic reset switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room).
- **Minimum Inside Car Platform Dimensions:** 3041(e)(1)(C) and 3141.7(b) (to comply with the performance-based requirements of the 2019 California Building Code section 3002.4.1a)

These variances apply to the locations and numbers of elevators stated in the section A table (so long as the elevators are Gen3 Edge/Gen2S Group and Gen3 Core & Medical Emergency Elevator Car Dimensions (Group IV) that are designed, equipped, and installed in accordance with, and are otherwise consistent with, and are subject to the following conditions:

1. The suspension system shall comply with the following:
 - a. The coated steel belt and connections shall have factors of safety equal to those permitted for use by section 3141 [ASME A17.1-2004, section 2.20.3] on wire rope suspended elevators.
 - b. Steel coated belts that have been installed and used on another installation shall not be reused.
 - c. The coated steel belt shall be fitted with a monitoring device which has been accepted by Cal/OSHA and which will automatically stop the car if the residual strength of any single belt drops below 60 percent. If the residual strength of any single belt drops below 60 percent, the device shall prevent the elevator from restarting after a normal stop at a landing.
 - d. Upon initial inspection, the readings from the monitoring device shall be documented and submitted to Cal/OSHA.
 - e. A successful test of the monitoring device’s functionality shall be conducted at least once a year (the record of the annual test of the monitoring device shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - f. The coated steel belts used shall be accepted by Cal/OSHA.

2. With respect to each elevator subject to this variance, the applicant shall comply with Cal/OSHA Circular Letter E-10-04, the substance of which is attached hereto as Addendum 1 and incorporated herein by this reference.
3. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection, and testing of the belts and monitoring device and criteria for belt replacement, and the applicant shall make those procedures and criteria available to Cal/OSHA upon request.
4. The flat coated steel belts shall be provided with a metal data tag that is securely attached to one of those belts. This data tag shall bear the following flat steel coated belt data:
 - a. The width and thickness in millimeters or inches;
 - b. The manufacturer's rated breaking strength in (kN) or (lbf);
 - c. The name of the person or organization that installed the flat coated steel belts;
 - d. The month and year the flat coated steel belts were installed;
 - e. The month and year the flat coated steel belts were first shortened;
 - f. The name or trademark of the manufacturer of the flat coated steel belts; and
 - g. Lubrication information.
5. There shall be a crosshead data plate of the sort required by section 2.20.2.1, and that plate shall bear the following flat steel coated belt data:
 - a. The number of belts;
 - b. The belt width and thickness in millimeters or inches; and
 - c. The manufacturer's rated breaking strength per belt in (kN) or (lbf).
6. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of elevator equipment in the hoistway is required. If service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
7. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on railings to perform adjustment, maintenance, repairs or inspections. The applicant shall not permit anyone to stand on or climb over the car top railing.
 - b. The distance that the car top railing may be inset shall be limited to no more than 6 inches.
 - c. All exposed areas outside the car top railing shall preclude standing or placing objects or persons which may fall and shall be beveled from the mid- or top rail to the outside of the car top.
 - d. The top of the beveled area and/or car top outside the railing, shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
 - e. The applicant shall provide durable signs with lettering not less than ½ inch on a

contrasting background on each inset railing; each sign shall state:

**CAUTION
DO NOT STAND ON OR CLIMB OVER RAILING**

- f. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing shall be measured from the car top and not from the required bevel).
- 8. If the seismic reset switch does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
- 9. If the inspection transfer switch required by ASME A17.1, rule 2.26.1.4.4(a) does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
- 10. When the inspection and testing panel is located in the hoistway door jamb, the inspection and test control panel shall be openable only by use of a Security Group I restricted key.
- 11. The governor speed-reducing switch function shall comply with the following:
 - a. It shall be used only with direct drive machines; i.e., no gear reduction is permitted between the drive motor and the suspension means.
 - b. The velocity encoder shall be coupled to the driving machine motor shaft. The “C” channel of the encoder shall be utilized for velocity measurements required by the speed reducing system. The signal from “C” channel of the encoder shall be verified with the “A” and “B” channels for failure. If a failure is detected then an emergency stop shall be initiated.
 - c. Control system parameters utilized in the speed-reducing system shall be held in non-volatile memory.
 - d. It shall be used in conjunction with approved car-mounted speed governors only.
 - e. It shall be used in conjunction with an effective traction monitoring system that detects a loss of traction between the driving sheave and the suspension means. If a loss of traction is detected, then an emergency stop shall be initiated.
 - f. A successful test of the speed-reducing switch system’s functionality shall be conducted at least once a year (the record of the annual test of the speed-reducing switch system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - g. A successful test of the traction monitoring system’s functionality shall be conducted at least once a year (the record of the annual test of the traction monitoring system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - h. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the maintenance, inspection, and testing of the speed-reducing switch and traction monitoring systems. The Applicant shall make the procedures available to Cal/OSHA upon

request.

12. The speed governor rope and sheaves shall comply with the following:

- a. The governor shall be used in conjunction with a 6 mm (0.25 in.) diameter steel governor rope with 6-strand, regular lay construction.
- b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
- c. The governor sheaves shall have a pitch diameter of not less than 180 mm (7.1 in.).

13. All medical emergency service elevators shall comply with the following:

- a. The requirements of the 2019 California Building Code (CBC), section 3002.4.1a;

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5inch (127 mm) radius corners] in the horizontal, open position.

- b. All medical emergency service elevators shall be identified in the building construction documents in accordance with the 2019 CBC, section 3002.4a.
- c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).

- 14. The elevator shall be serviced, maintained, adjusted, tested, and inspected only by Certified Competent Conveyance Mechanics who have been trained to, and are competent to, perform those tasks on the Gen3 Edge/Gen2S/Gen3 Core elevator system in accordance with the written procedures and criteria required by Condition No. 3 and in accordance with the terms of this permanent variance.
- 15. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing, or testing of the elevators shall be provided a copy of this variance decision.
- 16. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and a Permit to Operate shall be issued before the elevator is placed in service.
- 17. The Applicant shall be subject to the Suspension Means – Replacement Reporting Condition stated in Addendum 2, as hereby incorporated by this reference.
- 18. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications.
- 19. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in

accordance with the Board's procedural regulations at section 426, subdivision (b).

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 29, 2026



Kelly Chau, Hearing Officer

ADDENDUM 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and, Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA-Elevator Unit HQS

ADDENDUM 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Otis Gen2S/Gen3Edge/Gen3 Core Elevator & Medical Emergency Car Dimensions

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-336	Regents of the University of California	Recreation Replacement Bldg 111 Easton Circle Los Angeles, CA	1

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Dan Leacox, with Leacox & Associates, and Wolter Geesink with Otis Elevator Company appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table

PD2	OSHSB Notice of Hearing
PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each Applicant intends to utilize Otis Gen3 Edge/Gen2S/Gen3 Core elevators at the locations and in the numbers stated in the above section A.1 table. Applicant may utilize the variance from minimum inside car platform dimensions for other elevators designated for emergency medical service at the same variance location.
2. The installation contracts for these elevators were or will be signed on or after May 1, 2008, making the elevators subject to the Group IV Elevator Safety Orders.
3. The Board incorporates by reference the relevant findings in previous Board decisions:
 - a. Items D.3 through D.9 of the Proposed Decision adopted by the Board on July 18, 2013 for Permanent Variance No. 12-V-093;
 - b. Item D.4 of the Proposed Decision adopted by the Board on September 25, 2014 for Permanent Variance No. 14-V-206;
 - c. Item B of the Proposed Decision adopted by the Board on September 15, 2022 for Permanent Variance No. 22-V-302 regarding medical emergency car dimensions; and
 - d. Items C and D of the Proposed Decision adopted by the Board on June 20, 2024 for Permanent Variance No. 24-V-193 regarding the Gen3 Core elevator equivalent safety.
4. Cal/OSHA, by way of written submissions to the record (Exhibit PD-3), and position stated at hearing, is of the well informed opinion that grant of requested permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment, and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the Elevator Safety Order requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A table shall have permanent variances from the

following sections of ASME A17.1-2004 that section 3141 makes applicable to the elevators the subject of those applications:

- **Car top railing:** sections 2.14.1.7.1 (to permit an inset car top railing, if, in fact, the car top railing is inset);
- **Speed governor over-speed switch:** 2.18.4.2.5(a) (to permit the use of the speed reducing system proposed by the Applicants, where the speed reducing switch resides in the controller algorithms, rather than on the governor, with the necessary speed input supplied by the main encoder signal from the motor);
- **Governor rope diameter:** 2.18.5.1 (to allow the use of reduced diameter governor rope);
- **Pitch diameter:** 2.18.7.4 (to permit the use of the speed-reducing system proposed by the Applicant, where the rope sheave pitch diameter is not less than 180 mm [7.1 in.]);
- **Suspension means:** 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4 and 2.20.9.5.4—the variances from these “suspension means” provisions to permit the use of Otis Gen2 flat coated steel suspension belts in lieu of conventional steel suspension ropes;
- **Inspection transfer switch:** 2.26.1.4.4(a) (to allow the inspection transfer switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room); and
- **Seismic reset switch:** 8.4.10.1.1(a)(2)(b) (to allow the seismic reset switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room).
- **Minimum Inside Car Platform Dimensions:** 3041(e)(1)(C) and 3141.7(b) (to comply with the performance-based requirements of the 2019 California Building Code section 3002.4.1a)

These variances apply to the locations and numbers of elevators stated in the section A table (so long as the elevators are Gen3 Edge/Gen2S Group and Gen3 Core & Medical Emergency Elevator Car Dimensions (Group IV) that are designed, equipped, and installed in accordance with, and are otherwise consistent with, and are subject to the following conditions:

1. The suspension system shall comply with the following:
 - a. The coated steel belt and connections shall have factors of safety equal to those permitted for use by section 3141 [ASME A17.1-2004, section 2.20.3] on wire rope suspended elevators.
 - b. Steel coated belts that have been installed and used on another installation shall not be reused.
 - c. The coated steel belt shall be fitted with a monitoring device which has been accepted by Cal/OSHA and which will automatically stop the car if the residual strength of any single belt drops below 60 percent. If the residual strength of any single belt drops below 60 percent, the device shall prevent the elevator from restarting after a normal stop at a landing.
 - d. Upon initial inspection, the readings from the monitoring device shall be documented and submitted to Cal/OSHA.
 - e. A successful test of the monitoring device’s functionality shall be conducted at least once

a year (the record of the annual test of the monitoring device shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).

- f. The coated steel belts used shall be accepted by Cal/OSHA.
2. With respect to each elevator subject to this variance, the applicant shall comply with Cal/OSHA Circular Letter E-10-04, the substance of which is attached hereto as Addendum 1 and incorporated herein by this reference.
3. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection, and testing of the belts and monitoring device and criteria for belt replacement, and the applicant shall make those procedures and criteria available to Cal/OSHA upon request.
4. The flat coated steel belts shall be provided with a metal data tag that is securely attached to one of those belts. This data tag shall bear the following flat steel coated belt data:
 - a. The width and thickness in millimeters or inches;
 - b. The manufacturer's rated breaking strength in (kN) or (lbf);
 - c. The name of the person or organization that installed the flat coated steel belts;
 - d. The month and year the flat coated steel belts were installed;
 - e. The month and year the flat coated steel belts were first shortened;
 - f. The name or trademark of the manufacturer of the flat coated steel belts; and
 - g. Lubrication information.
5. There shall be a crosshead data plate of the sort required by section 2.20.2.1, and that plate shall bear the following flat steel coated belt data:
 - a. The number of belts;
 - b. The belt width and thickness in millimeters or inches; and
 - c. The manufacturer's rated breaking strength per belt in (kN) or (lbf).
6. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of elevator equipment in the hoistway is required. If service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
7. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on railings to perform adjustment, maintenance, repairs or inspections. The applicant shall not permit anyone to stand on or climb over the car top railing.
 - b. The distance that the car top railing may be inset shall be limited to no more than 6 inches.
 - c. All exposed areas outside the car top railing shall preclude standing or placing objects or persons which may fall and shall be beveled from the mid- or top rail to the outside of the car top.

- d. The top of the beveled area and/or car top outside the railing, shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
- e. The applicant shall provide durable signs with lettering not less than ½ inch on a contrasting background on each inset railing; each sign shall state:

CAUTION
DO NOT STAND ON OR CLIMB OVER RAILING

- f. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing shall be measured from the car top and not from the required bevel).
-
- 8. If the seismic reset switch does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
 - 9. If the inspection transfer switch required by ASME A17.1, rule 2.26.1.4.4(a) does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
 - 10. When the inspection and testing panel is located in the hoistway door jamb, the inspection and test control panel shall be openable only by use of a Security Group I restricted key.
 - 11. The governor speed-reducing switch function shall comply with the following:
 - a. It shall be used only with direct drive machines; i.e., no gear reduction is permitted between the drive motor and the suspension means.
 - b. The velocity encoder shall be coupled to the driving machine motor shaft. The “C” channel of the encoder shall be utilized for velocity measurements required by the speed reducing system. The signal from “C” channel of the encoder shall be verified with the “A” and “B” channels for failure. If a failure is detected then an emergency stop shall be initiated.
 - c. Control system parameters utilized in the speed-reducing system shall be held in non-volatile memory.
 - d. It shall be used in conjunction with approved car-mounted speed governors only.
 - e. It shall be used in conjunction with an effective traction monitoring system that detects a loss of traction between the driving sheave and the suspension means. If a loss of traction is detected, then an emergency stop shall be initiated.
 - f. A successful test of the speed-reducing switch system’s functionality shall be conducted at least once a year (the record of the annual test of the speed-reducing switch system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - g. A successful test of the traction monitoring system’s functionality shall be conducted at least once a year (the record of the annual test of the traction monitoring system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).

h. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the maintenance, inspection, and testing of the speed-reducing switch and traction monitoring systems. The Applicant shall make the procedures available to Cal/OSHA upon request.

12. The speed governor rope and sheaves shall comply with the following:

- a. The governor shall be used in conjunction with a 6 mm (0.25 in.) diameter steel governor rope with 6-strand, regular lay construction.
- b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
- c. The governor sheaves shall have a pitch diameter of not less than 180 mm (7.1 in.).

13. All medical emergency service elevators shall comply with the following:

- a. The requirements of the 2019 California Building Code (CBC), section 3002.4.1a;

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5inch (127 mm) radius corners] in the horizontal, open position.

- b. All medical emergency service elevators shall be identified in the building construction documents in accordance with the 2019 CBC, section 3002.4a.
- c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).

14. The elevator shall be serviced, maintained, adjusted, tested, and inspected only by Certified Competent Conveyance Mechanics who have been trained to, and are competent to, perform those tasks on the Gen3 Edge/Gen2S/Gen3 Core elevator system in accordance with the written procedures and criteria required by Condition No. 3 and in accordance with the terms of this permanent variance.

15. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing, or testing of the elevators shall be provided a copy of this variance decision.

16. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and a Permit to Operate shall be issued before the elevator is placed in service.

17. The Applicant shall be subject to the Suspension Means – Replacement Reporting Condition stated in Addendum 2, as hereby incorporated by this reference.

18. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives

are to be notified of docketed permanent variance applications.

19. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in accordance with the Board's procedural regulations at section 426, subdivision (b).

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 29, 2026



Kelly Chau, Hearing Officer

ADDENDUM 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and, Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA-Elevator Unit HQS

ADDENDUM 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Otis Gen2S/Gen3Edge/Gen3 Core Elevator & Medical Emergency Car Dimensions

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-337	Vista Point SPE LLC	305 Academic Way Irvine, CA	6

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Dan Leacox, with Leacox & Associates, and Wolter Geesink with Otis Elevator Company appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each Applicant intends to utilize Otis Gen3 Edge/Gen2S/Gen3 Core elevators at the locations and in the numbers stated in the above section A.1 table. Applicant may utilize the variance from minimum inside car platform dimensions for other elevators designated for emergency medical service at the same variance location.
2. The installation contracts for these elevators were or will be signed on or after May 1, 2008, making the elevators subject to the Group IV Elevator Safety Orders.
3. The Board incorporates by reference the relevant findings in previous Board decisions:
 - a. Items D.3 through D.9 of the Proposed Decision adopted by the Board on July 18, 2013 for Permanent Variance No. 12-V-093;
 - b. Item D.4 of the Proposed Decision adopted by the Board on September 25, 2014 for Permanent Variance No. 14-V-206;
 - c. Item B of the Proposed Decision adopted by the Board on September 15, 2022 for Permanent Variance No. 22-V-302 regarding medical emergency car dimensions; and
 - d. Items C and D of the Proposed Decision adopted by the Board on June 20, 2024 for Permanent Variance No. 24-V-193 regarding the Gen3 Core elevator equivalent safety.
4. Cal/OSHA, by way of written submissions to the record (Exhibit PD-3), and position stated at hearing, is of the well informed opinion that grant of requested permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment, and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the Elevator Safety Order requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A table shall have permanent variances from the following sections of ASME A17.1-2004 that section 3141 makes applicable to the elevators the subject of those applications:

- **Car top railing:** sections 2.14.1.7.1 (to permit an inset car top railing, if, in fact, the car top railing is inset);
- **Speed governor over-speed switch:** 2.18.4.2.5(a) (to permit the use of the speed reducing system proposed by the Applicants, where the speed reducing switch resides in the controller algorithms, rather than on the governor, with the necessary speed input supplied by the main encoder signal from the motor);
- **Governor rope diameter:** 2.18.5.1 (to allow the use of reduced diameter governor rope);
- **Pitch diameter:** 2.18.7.4 (to permit the use of the speed-reducing system proposed by the Applicant, where the rope sheave pitch diameter is not less than 180 mm [7.1 in.]);
- **Suspension means:** 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4 and 2.20.9.5.4—the variances from these “suspension means” provisions to permit the use of Otis Gen2 flat coated steel suspension belts in lieu of conventional steel suspension ropes;
- **Inspection transfer switch:** 2.26.1.4.4(a) (to allow the inspection transfer switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room); and
- **Seismic reset switch:** 8.4.10.1.1(a)(2)(b) (to allow the seismic reset switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room).
- **Minimum Inside Car Platform Dimensions:** 3041(e)(1)(C) and 3141.7(b) (to comply with the performance-based requirements of the 2019 California Building Code section 3002.4.1a)

These variances apply to the locations and numbers of elevators stated in the section A table (so long as the elevators are Gen3 Edge/Gen2S Group and Gen3 Core & Medical Emergency Elevator Car Dimensions (Group IV) that are designed, equipped, and installed in accordance with, and are otherwise consistent with, and are subject to the following conditions:

1. The suspension system shall comply with the following:
 - a. The coated steel belt and connections shall have factors of safety equal to those permitted for use by section 3141 [ASME A17.1-2004, section 2.20.3] on wire rope suspended elevators.
 - b. Steel coated belts that have been installed and used on another installation shall not be reused.
 - c. The coated steel belt shall be fitted with a monitoring device which has been accepted by Cal/OSHA and which will automatically stop the car if the residual strength of any single belt drops below 60 percent. If the residual strength of any single belt drops below 60 percent, the device shall prevent the elevator from restarting after a normal stop at a landing.
 - d. Upon initial inspection, the readings from the monitoring device shall be documented and submitted to Cal/OSHA.
 - e. A successful test of the monitoring device’s functionality shall be conducted at least once a year (the record of the annual test of the monitoring device shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - f. The coated steel belts used shall be accepted by Cal/OSHA.

2. With respect to each elevator subject to this variance, the applicant shall comply with Cal/OSHA Circular Letter E-10-04, the substance of which is attached hereto as Addendum 1 and incorporated herein by this reference.
3. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection, and testing of the belts and monitoring device and criteria for belt replacement, and the applicant shall make those procedures and criteria available to Cal/OSHA upon request.
4. The flat coated steel belts shall be provided with a metal data tag that is securely attached to one of those belts. This data tag shall bear the following flat steel coated belt data:
 - a. The width and thickness in millimeters or inches;
 - b. The manufacturer's rated breaking strength in (kN) or (lbf);
 - c. The name of the person or organization that installed the flat coated steel belts;
 - d. The month and year the flat coated steel belts were installed;
 - e. The month and year the flat coated steel belts were first shortened;
 - f. The name or trademark of the manufacturer of the flat coated steel belts; and
 - g. Lubrication information.
5. There shall be a crosshead data plate of the sort required by section 2.20.2.1, and that plate shall bear the following flat steel coated belt data:
 - a. The number of belts;
 - b. The belt width and thickness in millimeters or inches; and
 - c. The manufacturer's rated breaking strength per belt in (kN) or (lbf).
6. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of elevator equipment in the hoistway is required. If service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
7. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on railings to perform adjustment, maintenance, repairs or inspections. The applicant shall not permit anyone to stand on or climb over the car top railing.
 - b. The distance that the car top railing may be inset shall be limited to no more than 6 inches.
 - c. All exposed areas outside the car top railing shall preclude standing or placing objects or persons which may fall and shall be beveled from the mid- or top rail to the outside of the car top.
 - d. The top of the beveled area and/or car top outside the railing, shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
 - e. The applicant shall provide durable signs with lettering not less than ½ inch on a

contrasting background on each inset railing; each sign shall state:

**CAUTION
DO NOT STAND ON OR CLIMB OVER RAILING**

- f. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing shall be measured from the car top and not from the required bevel).
- 8. If the seismic reset switch does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
- 9. If the inspection transfer switch required by ASME A17.1, rule 2.26.1.4.4(a) does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
- 10. When the inspection and testing panel is located in the hoistway door jamb, the inspection and test control panel shall be openable only by use of a Security Group I restricted key.
- 11. The governor speed-reducing switch function shall comply with the following:
 - a. It shall be used only with direct drive machines; i.e., no gear reduction is permitted between the drive motor and the suspension means.
 - b. The velocity encoder shall be coupled to the driving machine motor shaft. The “C” channel of the encoder shall be utilized for velocity measurements required by the speed reducing system. The signal from “C” channel of the encoder shall be verified with the “A” and “B” channels for failure. If a failure is detected then an emergency stop shall be initiated.
 - c. Control system parameters utilized in the speed-reducing system shall be held in non-volatile memory.
 - d. It shall be used in conjunction with approved car-mounted speed governors only.
 - e. It shall be used in conjunction with an effective traction monitoring system that detects a loss of traction between the driving sheave and the suspension means. If a loss of traction is detected, then an emergency stop shall be initiated.
 - f. A successful test of the speed-reducing switch system’s functionality shall be conducted at least once a year (the record of the annual test of the speed-reducing switch system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - g. A successful test of the traction monitoring system’s functionality shall be conducted at least once a year (the record of the annual test of the traction monitoring system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - h. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the maintenance, inspection, and testing of the speed-reducing switch and traction monitoring systems. The Applicant shall make the procedures available to Cal/OSHA upon

request.

12. The speed governor rope and sheaves shall comply with the following:

- a. The governor shall be used in conjunction with a 6 mm (0.25 in.) diameter steel governor rope with 6-strand, regular lay construction.
- b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
- c. The governor sheaves shall have a pitch diameter of not less than 180 mm (7.1 in.).

13. All medical emergency service elevators shall comply with the following:

- a. The requirements of the 2019 California Building Code (CBC), section 3002.4.1a;

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5inch (127 mm) radius corners] in the horizontal, open position.

- b. All medical emergency service elevators shall be identified in the building construction documents in accordance with the 2019 CBC, section 3002.4a.
- c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).

- 14. The elevator shall be serviced, maintained, adjusted, tested, and inspected only by Certified Competent Conveyance Mechanics who have been trained to, and are competent to, perform those tasks on the Gen3 Edge/Gen2S/Gen3 Core elevator system in accordance with the written procedures and criteria required by Condition No. 3 and in accordance with the terms of this permanent variance.
- 15. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing, or testing of the elevators shall be provided a copy of this variance decision.
- 16. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and a Permit to Operate shall be issued before the elevator is placed in service.
- 17. The Applicant shall be subject to the Suspension Means – Replacement Reporting Condition stated in Addendum 2, as hereby incorporated by this reference.
- 18. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications.
- 19. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in

accordance with the Board's procedural regulations at section 426, subdivision (b).

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 29, 2026



Kelly Chau, Hearing Officer

ADDENDUM 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and, Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA-Elevator Unit HQS

ADDENDUM 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Otis Gen2S/Gen3Edge/Gen3 Core Elevator & Medical Emergency Car Dimensions

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-338	5637 Broadway, LLC	5637 S. Broadway Los Angeles, CA	1

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Dan Leacox, with Leacox & Associates, and Wolter Geesink with Otis Elevator Company appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each Applicant intends to utilize Otis Gen3 Edge/Gen2S/Gen3 Core elevators at the locations and in the numbers stated in the above section A.1 table. Applicant may utilize the variance from minimum inside car platform dimensions for other elevators designated for emergency medical service at the same variance location.
2. The installation contracts for these elevators were or will be signed on or after May 1, 2008, making the elevators subject to the Group IV Elevator Safety Orders.
3. The Board incorporates by reference the relevant findings in previous Board decisions:
 - a. Items D.3 through D.9 of the Proposed Decision adopted by the Board on July 18, 2013 for Permanent Variance No. 12-V-093;
 - b. Item D.4 of the Proposed Decision adopted by the Board on September 25, 2014 for Permanent Variance No. 14-V-206;
 - c. Item B of the Proposed Decision adopted by the Board on September 15, 2022 for Permanent Variance No. 22-V-302 regarding medical emergency car dimensions; and
 - d. Items C and D of the Proposed Decision adopted by the Board on June 20, 2024 for Permanent Variance No. 24-V-193 regarding the Gen3 Core elevator equivalent safety.
4. Cal/OSHA, by way of written submissions to the record (Exhibit PD-3), and position stated at hearing, is of the well informed opinion that grant of requested permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment, and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the Elevator Safety Order requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A table shall have permanent variances from the following sections of ASME A17.1-2004 that section 3141 makes applicable to the elevators the subject of those applications:

- **Car top railing:** sections 2.14.1.7.1 (to permit an inset car top railing, if, in fact, the car top railing is inset);
- **Speed governor over-speed switch:** 2.18.4.2.5(a) (to permit the use of the speed reducing system proposed by the Applicants, where the speed reducing switch resides in the controller algorithms, rather than on the governor, with the necessary speed input supplied by the main encoder signal from the motor);
- **Governor rope diameter:** 2.18.5.1 (to allow the use of reduced diameter governor rope);
- **Pitch diameter:** 2.18.7.4 (to permit the use of the speed-reducing system proposed by the Applicant, where the rope sheave pitch diameter is not less than 180 mm [7.1 in.]);
- **Suspension means:** 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4 and 2.20.9.5.4—the variances from these “suspension means” provisions to permit the use of Otis Gen2 flat coated steel suspension belts in lieu of conventional steel suspension ropes;
- **Inspection transfer switch:** 2.26.1.4.4(a) (to allow the inspection transfer switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room); and
- **Seismic reset switch:** 8.4.10.1.1(a)(2)(b) (to allow the seismic reset switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room).
- **Minimum Inside Car Platform Dimensions:** 3041(e)(1)(C) and 3141.7(b) (to comply with the performance-based requirements of the 2019 California Building Code section 3002.4.1a)

These variances apply to the locations and numbers of elevators stated in the section A table (so long as the elevators are Gen3 Edge/Gen2S Group and Gen3 Core & Medical Emergency Elevator Car Dimensions (Group IV) that are designed, equipped, and installed in accordance with, and are otherwise consistent with, and are subject to the following conditions:

1. The suspension system shall comply with the following:
 - a. The coated steel belt and connections shall have factors of safety equal to those permitted for use by section 3141 [ASME A17.1-2004, section 2.20.3] on wire rope suspended elevators.
 - b. Steel coated belts that have been installed and used on another installation shall not be reused.
 - c. The coated steel belt shall be fitted with a monitoring device which has been accepted by Cal/OSHA and which will automatically stop the car if the residual strength of any single belt drops below 60 percent. If the residual strength of any single belt drops below 60 percent, the device shall prevent the elevator from restarting after a normal stop at a landing.
 - d. Upon initial inspection, the readings from the monitoring device shall be documented and submitted to Cal/OSHA.
 - e. A successful test of the monitoring device’s functionality shall be conducted at least once a year (the record of the annual test of the monitoring device shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - f. The coated steel belts used shall be accepted by Cal/OSHA.

2. With respect to each elevator subject to this variance, the applicant shall comply with Cal/OSHA Circular Letter E-10-04, the substance of which is attached hereto as Addendum 1 and incorporated herein by this reference.
3. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection, and testing of the belts and monitoring device and criteria for belt replacement, and the applicant shall make those procedures and criteria available to Cal/OSHA upon request.
4. The flat coated steel belts shall be provided with a metal data tag that is securely attached to one of those belts. This data tag shall bear the following flat steel coated belt data:
 - a. The width and thickness in millimeters or inches;
 - b. The manufacturer's rated breaking strength in (kN) or (lbf);
 - c. The name of the person or organization that installed the flat coated steel belts;
 - d. The month and year the flat coated steel belts were installed;
 - e. The month and year the flat coated steel belts were first shortened;
 - f. The name or trademark of the manufacturer of the flat coated steel belts; and
 - g. Lubrication information.
5. There shall be a crosshead data plate of the sort required by section 2.20.2.1, and that plate shall bear the following flat steel coated belt data:
 - a. The number of belts;
 - b. The belt width and thickness in millimeters or inches; and
 - c. The manufacturer's rated breaking strength per belt in (kN) or (lbf).
6. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of elevator equipment in the hoistway is required. If service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
7. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on railings to perform adjustment, maintenance, repairs or inspections. The applicant shall not permit anyone to stand on or climb over the car top railing.
 - b. The distance that the car top railing may be inset shall be limited to no more than 6 inches.
 - c. All exposed areas outside the car top railing shall preclude standing or placing objects or persons which may fall and shall be beveled from the mid- or top rail to the outside of the car top.
 - d. The top of the beveled area and/or car top outside the railing, shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
 - e. The applicant shall provide durable signs with lettering not less than ½ inch on a

contrasting background on each inset railing; each sign shall state:

**CAUTION
DO NOT STAND ON OR CLIMB OVER RAILING**

- f. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing shall be measured from the car top and not from the required bevel).
- 8. If the seismic reset switch does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
- 9. If the inspection transfer switch required by ASME A17.1, rule 2.26.1.4.4(a) does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
- 10. When the inspection and testing panel is located in the hoistway door jamb, the inspection and test control panel shall be openable only by use of a Security Group I restricted key.
- 11. The governor speed-reducing switch function shall comply with the following:
 - a. It shall be used only with direct drive machines; i.e., no gear reduction is permitted between the drive motor and the suspension means.
 - b. The velocity encoder shall be coupled to the driving machine motor shaft. The “C” channel of the encoder shall be utilized for velocity measurements required by the speed reducing system. The signal from “C” channel of the encoder shall be verified with the “A” and “B” channels for failure. If a failure is detected then an emergency stop shall be initiated.
 - c. Control system parameters utilized in the speed-reducing system shall be held in non-volatile memory.
 - d. It shall be used in conjunction with approved car-mounted speed governors only.
 - e. It shall be used in conjunction with an effective traction monitoring system that detects a loss of traction between the driving sheave and the suspension means. If a loss of traction is detected, then an emergency stop shall be initiated.
 - f. A successful test of the speed-reducing switch system’s functionality shall be conducted at least once a year (the record of the annual test of the speed-reducing switch system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - g. A successful test of the traction monitoring system’s functionality shall be conducted at least once a year (the record of the annual test of the traction monitoring system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - h. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the maintenance, inspection, and testing of the speed-reducing switch and traction monitoring systems. The Applicant shall make the procedures available to Cal/OSHA upon

request.

12. The speed governor rope and sheaves shall comply with the following:

- a. The governor shall be used in conjunction with a 6 mm (0.25 in.) diameter steel governor rope with 6-strand, regular lay construction.
- b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
- c. The governor sheaves shall have a pitch diameter of not less than 180 mm (7.1 in.).

13. All medical emergency service elevators shall comply with the following:

- a. The requirements of the 2019 California Building Code (CBC), section 3002.4.1a;

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5inch (127 mm) radius corners] in the horizontal, open position.

- b. All medical emergency service elevators shall be identified in the building construction documents in accordance with the 2019 CBC, section 3002.4a.
- c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).

- 14. The elevator shall be serviced, maintained, adjusted, tested, and inspected only by Certified Competent Conveyance Mechanics who have been trained to, and are competent to, perform those tasks on the Gen3 Edge/Gen2S/Gen3 Core elevator system in accordance with the written procedures and criteria required by Condition No. 3 and in accordance with the terms of this permanent variance.
- 15. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing, or testing of the elevators shall be provided a copy of this variance decision.
- 16. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and a Permit to Operate shall be issued before the elevator is placed in service.
- 17. The Applicant shall be subject to the Suspension Means – Replacement Reporting Condition stated in Addendum 2, as hereby incorporated by this reference.
- 18. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications.
- 19. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in

accordance with the Board's procedural regulations at section 426, subdivision (b).

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 29, 2026



Kelly Chau, Hearing Officer

ADDENDUM 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and, Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA-Elevator Unit HQS

ADDENDUM 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Otis Medical Emergency Elevator Car Dimensions

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-339	TR Costa Mesa Courtyards, LLC	555 West 19th St. Costa Mesa, CA	

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Dan Leacox, with Leacox & Associates, and Wolter Geesink with Otis Elevator Company appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact and Applicable Regulations

1. Applicant requests a permanent variance from section 3041, subdivision (e)(1)(C), which states:

(1) All buildings and structures constructed after the effective date of this order that are provided with one or more passenger elevators shall be provided with not less than one passenger elevator designed and designated to accommodate the loading and transport of an ambulance gurney or stretcher maximum size 22 ½ in. (572 mm) by 75 in. (1.90 m) in its horizontal position and arranged to serve all landings in conformance with the following:

...

(C) The elevator car shall have a minimum inside car platform of 80 in. (2.03 m) wide by 51 in. (1.30 m) deep.

The intent of this language is to ensure that there is enough space to accommodate the access and egress of a gurney and medical personnel inside of a medical service elevator.

This standard is made applicable to Group IV by section 3141.7, subdivision (b), which reads, "Elevators utilized to provide medical emergency service shall comply with Group II, section 3041(e)."

2. Applicant proposes to comply with the requirements of the 2019 California Building Code, section 3002.4.1a in the design of its medical emergency service elevator. That section requires:

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5-inch (127 mm) radius corners] in the horizontal, open position.

The purpose of this requirement is to ensure that an elevator designated for emergency medical service will accommodate a minimum of two emergency personnel with an ambulance gurney or stretcher.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A.1 table shall have permanent variances from sections 3041, subdivision (e)(1)(C) and 3141.7, subdivision (b) subject of the following conditions:


1. All medical emergency service elevator(s) shall comply with the requirements of the 2019 California Building Code section 3002.4.1a:

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5-inch (127 mm) radius corners] in the horizontal, open position.

2. All medical emergency service elevator(s) shall be identified in the building construction documents in accordance with the 2019 California Building Code, section 3002.4a.
3. Dimensional drawings and other information necessary to demonstrate compliance with the conditions of this permanent variance decision shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).
4. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing, or testing the elevators shall be provided a copy of this variance decision.
5. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and all applicable requirements met, including conditions of this permanent variance, prior to a Permit to Operate the elevator being issued. The elevator shall not be placed in service prior to the Permit to Operate being issued by Cal/OSHA.
6. Applicant shall notify its employees and their authorized representative, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications pursuant to sections 411.2 and 411.3.
7. This Decision and Order shall remain in effect unless duly modified or revoked upon application by Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in accordance with then in effect administrative procedures of the Board.

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 29, 2026

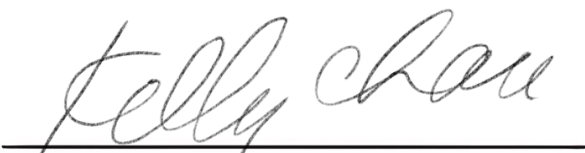

Kelly Chau, Hearing Officer

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Otis Gen2S/Gen3Edge/Gen3 Core Elevator & Medical Emergency Car Dimensions

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-340	San Francisco Community College District	CCSF Diego Rivera Theatre 57 Frida Kahlo Way San Francisco, CA	1

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Dan Leacox, with Leacox & Associates, and Wolter Geesink with Otis Elevator Company appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table

PD2	OSHSB Notice of Hearing
PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each Applicant intends to utilize Otis Gen3 Edge/Gen2S/Gen3 Core elevators at the locations and in the numbers stated in the above section A.1 table. Applicant may utilize the variance from minimum inside car platform dimensions for other elevators designated for emergency medical service at the same variance location.
2. The installation contracts for these elevators were or will be signed on or after May 1, 2008, making the elevators subject to the Group IV Elevator Safety Orders.
3. The Board incorporates by reference the relevant findings in previous Board decisions:
 - a. Items D.3 through D.9 of the Proposed Decision adopted by the Board on July 18, 2013 for Permanent Variance No. 12-V-093;
 - b. Item D.4 of the Proposed Decision adopted by the Board on September 25, 2014 for Permanent Variance No. 14-V-206;
 - c. Item B of the Proposed Decision adopted by the Board on September 15, 2022 for Permanent Variance No. 22-V-302 regarding medical emergency car dimensions; and
 - d. Items C and D of the Proposed Decision adopted by the Board on June 20, 2024 for Permanent Variance No. 24-V-193 regarding the Gen3 Core elevator equivalent safety.
4. Cal/OSHA, by way of written submissions to the record (Exhibit PD-3), and position stated at hearing, is of the well informed opinion that grant of requested permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment, and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the Elevator Safety Order requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A table shall have permanent variances from the

following sections of ASME A17.1-2004 that section 3141 makes applicable to the elevators the subject of those applications:

- **Car top railing:** sections 2.14.1.7.1 (to permit an inset car top railing, if, in fact, the car top railing is inset);
- **Speed governor over-speed switch:** 2.18.4.2.5(a) (to permit the use of the speed reducing system proposed by the Applicants, where the speed reducing switch resides in the controller algorithms, rather than on the governor, with the necessary speed input supplied by the main encoder signal from the motor);
- **Governor rope diameter:** 2.18.5.1 (to allow the use of reduced diameter governor rope);
- **Pitch diameter:** 2.18.7.4 (to permit the use of the speed-reducing system proposed by the Applicant, where the rope sheave pitch diameter is not less than 180 mm [7.1 in.]);
- **Suspension means:** 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4 and 2.20.9.5.4—the variances from these “suspension means” provisions to permit the use of Otis Gen2 flat coated steel suspension belts in lieu of conventional steel suspension ropes;
- **Inspection transfer switch:** 2.26.1.4.4(a) (to allow the inspection transfer switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room); and
- **Seismic reset switch:** 8.4.10.1.1(a)(2)(b) (to allow the seismic reset switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room).
- **Minimum Inside Car Platform Dimensions:** 3041(e)(1)(C) and 3141.7(b) (to comply with the performance-based requirements of the 2019 California Building Code section 3002.4.1a)

These variances apply to the locations and numbers of elevators stated in the section A table (so long as the elevators are Gen3 Edge/Gen2S Group and Gen3 Core & Medical Emergency Elevator Car Dimensions (Group IV) that are designed, equipped, and installed in accordance with, and are otherwise consistent with, and are subject to the following conditions:

1. The suspension system shall comply with the following:
 - a. The coated steel belt and connections shall have factors of safety equal to those permitted for use by section 3141 [ASME A17.1-2004, section 2.20.3] on wire rope suspended elevators.
 - b. Steel coated belts that have been installed and used on another installation shall not be reused.
 - c. The coated steel belt shall be fitted with a monitoring device which has been accepted by Cal/OSHA and which will automatically stop the car if the residual strength of any single belt drops below 60 percent. If the residual strength of any single belt drops below 60 percent, the device shall prevent the elevator from restarting after a normal stop at a landing.
 - d. Upon initial inspection, the readings from the monitoring device shall be documented and submitted to Cal/OSHA.
 - e. A successful test of the monitoring device’s functionality shall be conducted at least once

a year (the record of the annual test of the monitoring device shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).

f. The coated steel belts used shall be accepted by Cal/OSHA.

2. With respect to each elevator subject to this variance, the applicant shall comply with Cal/OSHA Circular Letter E-10-04, the substance of which is attached hereto as Addendum 1 and incorporated herein by this reference.
3. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection, and testing of the belts and monitoring device and criteria for belt replacement, and the applicant shall make those procedures and criteria available to Cal/OSHA upon request.
4. The flat coated steel belts shall be provided with a metal data tag that is securely attached to one of those belts. This data tag shall bear the following flat steel coated belt data:
 - a. The width and thickness in millimeters or inches;
 - b. The manufacturer's rated breaking strength in (kN) or (lbf);
 - c. The name of the person or organization that installed the flat coated steel belts;
 - d. The month and year the flat coated steel belts were installed;
 - e. The month and year the flat coated steel belts were first shortened;
 - f. The name or trademark of the manufacturer of the flat coated steel belts; and
 - g. Lubrication information.
5. There shall be a crosshead data plate of the sort required by section 2.20.2.1, and that plate shall bear the following flat steel coated belt data:
 - a. The number of belts;
 - b. The belt width and thickness in millimeters or inches; and
 - c. The manufacturer's rated breaking strength per belt in (kN) or (lbf).
6. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of elevator equipment in the hoistway is required. If service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
7. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on railings to perform adjustment, maintenance, repairs or inspections. The applicant shall not permit anyone to stand on or climb over the car top railing.
 - b. The distance that the car top railing may be inset shall be limited to no more than 6 inches.
 - c. All exposed areas outside the car top railing shall preclude standing or placing objects or persons which may fall and shall be beveled from the mid- or top rail to the outside of the car top.

- d. The top of the beveled area and/or car top outside the railing, shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
- e. The applicant shall provide durable signs with lettering not less than ½ inch on a contrasting background on each inset railing; each sign shall state:

CAUTION
DO NOT STAND ON OR CLIMB OVER RAILING

- f. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing shall be measured from the car top and not from the required bevel).
-
- 8. If the seismic reset switch does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
 - 9. If the inspection transfer switch required by ASME A17.1, rule 2.26.1.4.4(a) does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
 - 10. When the inspection and testing panel is located in the hoistway door jamb, the inspection and test control panel shall be openable only by use of a Security Group I restricted key.
 - 11. The governor speed-reducing switch function shall comply with the following:
 - a. It shall be used only with direct drive machines; i.e., no gear reduction is permitted between the drive motor and the suspension means.
 - b. The velocity encoder shall be coupled to the driving machine motor shaft. The “C” channel of the encoder shall be utilized for velocity measurements required by the speed reducing system. The signal from “C” channel of the encoder shall be verified with the “A” and “B” channels for failure. If a failure is detected then an emergency stop shall be initiated.
 - c. Control system parameters utilized in the speed-reducing system shall be held in non-volatile memory.
 - d. It shall be used in conjunction with approved car-mounted speed governors only.
 - e. It shall be used in conjunction with an effective traction monitoring system that detects a loss of traction between the driving sheave and the suspension means. If a loss of traction is detected, then an emergency stop shall be initiated.
 - f. A successful test of the speed-reducing switch system’s functionality shall be conducted at least once a year (the record of the annual test of the speed-reducing switch system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - g. A successful test of the traction monitoring system’s functionality shall be conducted at least once a year (the record of the annual test of the traction monitoring system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).

- h. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the maintenance, inspection, and testing of the speed-reducing switch and traction monitoring systems. The Applicant shall make the procedures available to Cal/OSHA upon request.

12. The speed governor rope and sheaves shall comply with the following:

- a. The governor shall be used in conjunction with a 6 mm (0.25 in.) diameter steel governor rope with 6-strand, regular lay construction.
- b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
- c. The governor sheaves shall have a pitch diameter of not less than 180 mm (7.1 in.).

13. All medical emergency service elevators shall comply with the following:

- a. The requirements of the 2019 California Building Code (CBC), section 3002.4.1a;

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5inch (127 mm) radius corners] in the horizontal, open position.

- b. All medical emergency service elevators shall be identified in the building construction documents in accordance with the 2019 CBC, section 3002.4a.
- c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).

- 14. The elevator shall be serviced, maintained, adjusted, tested, and inspected only by Certified Competent Conveyance Mechanics who have been trained to, and are competent to, perform those tasks on the Gen3 Edge/Gen2S/Gen3 Core elevator system in accordance with the written procedures and criteria required by Condition No. 3 and in accordance with the terms of this permanent variance.
- 15. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing, or testing of the elevators shall be provided a copy of this variance decision.
- 16. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and a Permit to Operate shall be issued before the elevator is placed in service.
- 17. The Applicant shall be subject to the Suspension Means – Replacement Reporting Condition stated in Addendum 2, as hereby incorporated by this reference.
- 18. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives

are to be notified of docketed permanent variance applications.

19. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in accordance with the Board's procedural regulations at section 426, subdivision (b).

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 29, 2026



Kelly Chau, Hearing Officer

ADDENDUM 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and, Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA-Elevator Unit HQS

ADDENDUM 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Otis Gen2S/Gen3Edge/Gen3 Core Elevator & Medical Emergency Car Dimensions

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-341	18337 Kittridge LP	18337 W. Kittridge St. Reseda, CA	1

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Dan Leacox, with Leacox & Associates, and Wolter Geesink with Otis Elevator Company appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each Applicant intends to utilize Otis Gen3 Edge/Gen2S/Gen3 Core elevators at the locations and in the numbers stated in the above section A.1 table. Applicant may utilize the variance from minimum inside car platform dimensions for other elevators designated for emergency medical service at the same variance location.
2. The installation contracts for these elevators were or will be signed on or after May 1, 2008, making the elevators subject to the Group IV Elevator Safety Orders.
3. The Board incorporates by reference the relevant findings in previous Board decisions:
 - a. Items D.3 through D.9 of the Proposed Decision adopted by the Board on July 18, 2013 for Permanent Variance No. 12-V-093;
 - b. Item D.4 of the Proposed Decision adopted by the Board on September 25, 2014 for Permanent Variance No. 14-V-206;
 - c. Item B of the Proposed Decision adopted by the Board on September 15, 2022 for Permanent Variance No. 22-V-302 regarding medical emergency car dimensions; and
 - d. Items C and D of the Proposed Decision adopted by the Board on June 20, 2024 for Permanent Variance No. 24-V-193 regarding the Gen3 Core elevator equivalent safety.
4. Cal/OSHA, by way of written submissions to the record (Exhibit PD-3), and position stated at hearing, is of the well informed opinion that grant of requested permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment, and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the Elevator Safety Order requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A table shall have permanent variances from the following sections of ASME A17.1-2004 that section 3141 makes applicable to the elevators the subject of those applications:

- **Car top railing:** sections 2.14.1.7.1 (to permit an inset car top railing, if, in fact, the car top railing is inset);
- **Speed governor over-speed switch:** 2.18.4.2.5(a) (to permit the use of the speed reducing system proposed by the Applicants, where the speed reducing switch resides in the controller algorithms, rather than on the governor, with the necessary speed input supplied by the main encoder signal from the motor);
- **Governor rope diameter:** 2.18.5.1 (to allow the use of reduced diameter governor rope);
- **Pitch diameter:** 2.18.7.4 (to permit the use of the speed-reducing system proposed by the Applicant, where the rope sheave pitch diameter is not less than 180 mm [7.1 in.]);
- **Suspension means:** 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4 and 2.20.9.5.4—the variances from these “suspension means” provisions to permit the use of Otis Gen2 flat coated steel suspension belts in lieu of conventional steel suspension ropes;
- **Inspection transfer switch:** 2.26.1.4.4(a) (to allow the inspection transfer switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room); and
- **Seismic reset switch:** 8.4.10.1.1(a)(2)(b) (to allow the seismic reset switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room).
- **Minimum Inside Car Platform Dimensions:** 3041(e)(1)(C) and 3141.7(b) (to comply with the performance-based requirements of the 2019 California Building Code section 3002.4.1a)

These variances apply to the locations and numbers of elevators stated in the section A table (so long as the elevators are Gen3 Edge/Gen2S Group and Gen3 Core & Medical Emergency Elevator Car Dimensions (Group IV) that are designed, equipped, and installed in accordance with, and are otherwise consistent with, and are subject to the following conditions:

1. The suspension system shall comply with the following:
 - a. The coated steel belt and connections shall have factors of safety equal to those permitted for use by section 3141 [ASME A17.1-2004, section 2.20.3] on wire rope suspended elevators.
 - b. Steel coated belts that have been installed and used on another installation shall not be reused.
 - c. The coated steel belt shall be fitted with a monitoring device which has been accepted by Cal/OSHA and which will automatically stop the car if the residual strength of any single belt drops below 60 percent. If the residual strength of any single belt drops below 60 percent, the device shall prevent the elevator from restarting after a normal stop at a landing.
 - d. Upon initial inspection, the readings from the monitoring device shall be documented and submitted to Cal/OSHA.
 - e. A successful test of the monitoring device’s functionality shall be conducted at least once a year (the record of the annual test of the monitoring device shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - f. The coated steel belts used shall be accepted by Cal/OSHA.

2. With respect to each elevator subject to this variance, the applicant shall comply with Cal/OSHA Circular Letter E-10-04, the substance of which is attached hereto as Addendum 1 and incorporated herein by this reference.
3. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection, and testing of the belts and monitoring device and criteria for belt replacement, and the applicant shall make those procedures and criteria available to Cal/OSHA upon request.
4. The flat coated steel belts shall be provided with a metal data tag that is securely attached to one of those belts. This data tag shall bear the following flat steel coated belt data:
 - a. The width and thickness in millimeters or inches;
 - b. The manufacturer's rated breaking strength in (kN) or (lbf);
 - c. The name of the person or organization that installed the flat coated steel belts;
 - d. The month and year the flat coated steel belts were installed;
 - e. The month and year the flat coated steel belts were first shortened;
 - f. The name or trademark of the manufacturer of the flat coated steel belts; and
 - g. Lubrication information.
5. There shall be a crosshead data plate of the sort required by section 2.20.2.1, and that plate shall bear the following flat steel coated belt data:
 - a. The number of belts;
 - b. The belt width and thickness in millimeters or inches; and
 - c. The manufacturer's rated breaking strength per belt in (kN) or (lbf).
6. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of elevator equipment in the hoistway is required. If service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
7. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on railings to perform adjustment, maintenance, repairs or inspections. The applicant shall not permit anyone to stand on or climb over the car top railing.
 - b. The distance that the car top railing may be inset shall be limited to no more than 6 inches.
 - c. All exposed areas outside the car top railing shall preclude standing or placing objects or persons which may fall and shall be beveled from the mid- or top rail to the outside of the car top.
 - d. The top of the beveled area and/or car top outside the railing, shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
 - e. The applicant shall provide durable signs with lettering not less than ½ inch on a

contrasting background on each inset railing; each sign shall state:

**CAUTION
DO NOT STAND ON OR CLIMB OVER RAILING**

- f. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing shall be measured from the car top and not from the required bevel).
8. If the seismic reset switch does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
9. If the inspection transfer switch required by ASME A17.1, rule 2.26.1.4.4(a) does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
10. When the inspection and testing panel is located in the hoistway door jamb, the inspection and test control panel shall be openable only by use of a Security Group I restricted key.
11. The governor speed-reducing switch function shall comply with the following:
 - a. It shall be used only with direct drive machines; i.e., no gear reduction is permitted between the drive motor and the suspension means.
 - b. The velocity encoder shall be coupled to the driving machine motor shaft. The “C” channel of the encoder shall be utilized for velocity measurements required by the speed reducing system. The signal from “C” channel of the encoder shall be verified with the “A” and “B” channels for failure. If a failure is detected then an emergency stop shall be initiated.
 - c. Control system parameters utilized in the speed-reducing system shall be held in non-volatile memory.
 - d. It shall be used in conjunction with approved car-mounted speed governors only.
 - e. It shall be used in conjunction with an effective traction monitoring system that detects a loss of traction between the driving sheave and the suspension means. If a loss of traction is detected, then an emergency stop shall be initiated.
 - f. A successful test of the speed-reducing switch system’s functionality shall be conducted at least once a year (the record of the annual test of the speed-reducing switch system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - g. A successful test of the traction monitoring system’s functionality shall be conducted at least once a year (the record of the annual test of the traction monitoring system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - h. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the maintenance, inspection, and testing of the speed-reducing switch and traction monitoring systems. The Applicant shall make the procedures available to Cal/OSHA upon

request.

12. The speed governor rope and sheaves shall comply with the following:

- a. The governor shall be used in conjunction with a 6 mm (0.25 in.) diameter steel governor rope with 6-strand, regular lay construction.
- b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
- c. The governor sheaves shall have a pitch diameter of not less than 180 mm (7.1 in.).

13. All medical emergency service elevators shall comply with the following:

- a. The requirements of the 2019 California Building Code (CBC), section 3002.4.1a;

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5inch (127 mm) radius corners] in the horizontal, open position.

- b. All medical emergency service elevators shall be identified in the building construction documents in accordance with the 2019 CBC, section 3002.4a.
- c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).

- 14. The elevator shall be serviced, maintained, adjusted, tested, and inspected only by Certified Competent Conveyance Mechanics who have been trained to, and are competent to, perform those tasks on the Gen3 Edge/Gen2S/Gen3 Core elevator system in accordance with the written procedures and criteria required by Condition No. 3 and in accordance with the terms of this permanent variance.
- 15. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing, or testing of the elevators shall be provided a copy of this variance decision.
- 16. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and a Permit to Operate shall be issued before the elevator is placed in service.
- 17. The Applicant shall be subject to the Suspension Means – Replacement Reporting Condition stated in Addendum 2, as hereby incorporated by this reference.
- 18. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications.
- 19. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in

accordance with the Board's procedural regulations at section 426, subdivision (b).

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 29, 2026



Kelly Chau, Hearing Officer

ADDENDUM 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and, Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA-Elevator Unit HQS

ADDENDUM 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Otis Gen2S/Gen3Edge/Gen3 Core Elevator & Medical Emergency Car Dimensions

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-342	Aztec Shops LTD	SDSU Evolve Meteppec 5475 55th St. San Diego, CA	2

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Dan Leacox, with Leacox & Associates, and Wolter Geesink with Otis Elevator Company appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table

PD2	OSHSB Notice of Hearing
PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each Applicant intends to utilize Otis Gen3 Edge/Gen2S/Gen3 Core elevators at the locations and in the numbers stated in the above section A.1 table. Applicant may utilize the variance from minimum inside car platform dimensions for other elevators designated for emergency medical service at the same variance location.
2. The installation contracts for these elevators were or will be signed on or after May 1, 2008, making the elevators subject to the Group IV Elevator Safety Orders.
3. The Board incorporates by reference the relevant findings in previous Board decisions:
 - a. Items D.3 through D.9 of the Proposed Decision adopted by the Board on July 18, 2013 for Permanent Variance No. 12-V-093;
 - b. Item D.4 of the Proposed Decision adopted by the Board on September 25, 2014 for Permanent Variance No. 14-V-206;
 - c. Item B of the Proposed Decision adopted by the Board on September 15, 2022 for Permanent Variance No. 22-V-302 regarding medical emergency car dimensions; and
 - d. Items C and D of the Proposed Decision adopted by the Board on June 20, 2024 for Permanent Variance No. 24-V-193 regarding the Gen3 Core elevator equivalent safety.
4. Cal/OSHA, by way of written submissions to the record (Exhibit PD-3), and position stated at hearing, is of the well informed opinion that grant of requested permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment, and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the Elevator Safety Order requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A table shall have permanent variances from the following sections of ASME A17.1-2004 that section 3141 makes applicable to the elevators the

subject of those applications:

- **Car top railing:** sections 2.14.1.7.1 (to permit an inset car top railing, if, in fact, the car top railing is inset);
- **Speed governor over-speed switch:** 2.18.4.2.5(a) (to permit the use of the speed reducing system proposed by the Applicants, where the speed reducing switch resides in the controller algorithms, rather than on the governor, with the necessary speed input supplied by the main encoder signal from the motor);
- **Governor rope diameter:** 2.18.5.1 (to allow the use of reduced diameter governor rope);
- **Pitch diameter:** 2.18.7.4 (to permit the use of the speed-reducing system proposed by the Applicant, where the rope sheave pitch diameter is not less than 180 mm [7.1 in.]);
- **Suspension means:** 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4 and 2.20.9.5.4—the variances from these “suspension means” provisions to permit the use of Otis Gen2 flat coated steel suspension belts in lieu of conventional steel suspension ropes;
- **Inspection transfer switch:** 2.26.1.4.4(a) (to allow the inspection transfer switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room); and
- **Seismic reset switch:** 8.4.10.1.1(a)(2)(b) (to allow the seismic reset switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room).
- **Minimum Inside Car Platform Dimensions:** 3041(e)(1)(C) and 3141.7(b) (to comply with the performance-based requirements of the 2019 California Building Code section 3002.4.1a)

These variances apply to the locations and numbers of elevators stated in the section A table (so long as the elevators are Gen3 Edge/Gen2S Group and Gen3 Core & Medical Emergency Elevator Car Dimensions (Group IV) that are designed, equipped, and installed in accordance with, and are otherwise consistent with, and are subject to the following conditions:

1. The suspension system shall comply with the following:
 - a. The coated steel belt and connections shall have factors of safety equal to those permitted for use by section 3141 [ASME A17.1-2004, section 2.20.3] on wire rope suspended elevators.
 - b. Steel coated belts that have been installed and used on another installation shall not be reused.
 - c. The coated steel belt shall be fitted with a monitoring device which has been accepted by Cal/OSHA and which will automatically stop the car if the residual strength of any single belt drops below 60 percent. If the residual strength of any single belt drops below 60 percent, the device shall prevent the elevator from restarting after a normal stop at a landing.
 - d. Upon initial inspection, the readings from the monitoring device shall be documented and submitted to Cal/OSHA.
 - e. A successful test of the monitoring device’s functionality shall be conducted at least once a year (the record of the annual test of the monitoring device shall be a maintenance

record subject to ASME A17.1-2004, section 8.6.1.4).

- f. The coated steel belts used shall be accepted by Cal/OSHA.
2. With respect to each elevator subject to this variance, the applicant shall comply with Cal/OSHA Circular Letter E-10-04, the substance of which is attached hereto as Addendum 1 and incorporated herein by this reference.
3. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection, and testing of the belts and monitoring device and criteria for belt replacement, and the applicant shall make those procedures and criteria available to Cal/OSHA upon request.
4. The flat coated steel belts shall be provided with a metal data tag that is securely attached to one of those belts. This data tag shall bear the following flat steel coated belt data:
 - a. The width and thickness in millimeters or inches;
 - b. The manufacturer's rated breaking strength in (kN) or (lbf);
 - c. The name of the person or organization that installed the flat coated steel belts;
 - d. The month and year the flat coated steel belts were installed;
 - e. The month and year the flat coated steel belts were first shortened;
 - f. The name or trademark of the manufacturer of the flat coated steel belts; and
 - g. Lubrication information.
5. There shall be a crosshead data plate of the sort required by section 2.20.2.1, and that plate shall bear the following flat steel coated belt data:
 - a. The number of belts;
 - b. The belt width and thickness in millimeters or inches; and
 - c. The manufacturer's rated breaking strength per belt in (kN) or (lbf).
6. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of elevator equipment in the hoistway is required. If service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
7. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on railings to perform adjustment, maintenance, repairs or inspections. The applicant shall not permit anyone to stand on or climb over the car top railing.
 - b. The distance that the car top railing may be inset shall be limited to no more than 6 inches.
 - c. All exposed areas outside the car top railing shall preclude standing or placing objects or persons which may fall and shall be beveled from the mid- or top rail to the outside of the car top.

- d. The top of the beveled area and/or car top outside the railing, shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
- e. The applicant shall provide durable signs with lettering not less than ½ inch on a contrasting background on each inset railing; each sign shall state:

CAUTION
DO NOT STAND ON OR CLIMB OVER RAILING

- f. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing shall be measured from the car top and not from the required bevel).
-
- 8. If the seismic reset switch does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
 - 9. If the inspection transfer switch required by ASME A17.1, rule 2.26.1.4.4(a) does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
 - 10. When the inspection and testing panel is located in the hoistway door jamb, the inspection and test control panel shall be openable only by use of a Security Group I restricted key.
 - 11. The governor speed-reducing switch function shall comply with the following:
 - a. It shall be used only with direct drive machines; i.e., no gear reduction is permitted between the drive motor and the suspension means.
 - b. The velocity encoder shall be coupled to the driving machine motor shaft. The “C” channel of the encoder shall be utilized for velocity measurements required by the speed reducing system. The signal from “C” channel of the encoder shall be verified with the “A” and “B” channels for failure. If a failure is detected then an emergency stop shall be initiated.
 - c. Control system parameters utilized in the speed-reducing system shall be held in non-volatile memory.
 - d. It shall be used in conjunction with approved car-mounted speed governors only.
 - e. It shall be used in conjunction with an effective traction monitoring system that detects a loss of traction between the driving sheave and the suspension means. If a loss of traction is detected, then an emergency stop shall be initiated.
 - f. A successful test of the speed-reducing switch system’s functionality shall be conducted at least once a year (the record of the annual test of the speed-reducing switch system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - g. A successful test of the traction monitoring system’s functionality shall be conducted at least once a year (the record of the annual test of the traction monitoring system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).

- h. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the maintenance, inspection, and testing of the speed-reducing switch and traction monitoring systems. The Applicant shall make the procedures available to Cal/OSHA upon request.

12. The speed governor rope and sheaves shall comply with the following:

- a. The governor shall be used in conjunction with a 6 mm (0.25 in.) diameter steel governor rope with 6-strand, regular lay construction.
- b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
- c. The governor sheaves shall have a pitch diameter of not less than 180 mm (7.1 in.).

13. All medical emergency service elevators shall comply with the following:

- a. The requirements of the 2019 California Building Code (CBC), section 3002.4.1a;

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5inch (127 mm) radius corners] in the horizontal, open position.

- b. All medical emergency service elevators shall be identified in the building construction documents in accordance with the 2019 CBC, section 3002.4a.
- c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).

- 14. The elevator shall be serviced, maintained, adjusted, tested, and inspected only by Certified Competent Conveyance Mechanics who have been trained to, and are competent to, perform those tasks on the Gen3 Edge/Gen2S/Gen3 Core elevator system in accordance with the written procedures and criteria required by Condition No. 3 and in accordance with the terms of this permanent variance.
- 15. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing, or testing of the elevators shall be provided a copy of this variance decision.
- 16. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and a Permit to Operate shall be issued before the elevator is placed in service.
- 17. The Applicant shall be subject to the Suspension Means – Replacement Reporting Condition stated in Addendum 2, as hereby incorporated by this reference.
- 18. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives

are to be notified of docketed permanent variance applications.

19. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in accordance with the Board's procedural regulations at section 426, subdivision (b).

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 29, 2026



Kelly Chau, Hearing Officer

ADDENDUM 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and, Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA-Elevator Unit HQS

ADDENDUM 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Otis Gen2S/Gen3Edge/Gen3 Core Elevator & Medical Emergency Car Dimensions

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-343	Rincon Property West, LLC	100 West Rincon Ave. Campbell, CA	1

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Dan Leacox, with Leacox & Associates, and Wolter Geesink with Otis Elevator Company appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each Applicant intends to utilize Otis Gen3 Edge/Gen2S/Gen3 Core elevators at the locations and in the numbers stated in the above section A.1 table. Applicant may utilize the variance from minimum inside car platform dimensions for other elevators designated for emergency medical service at the same variance location.
2. The installation contracts for these elevators were or will be signed on or after May 1, 2008, making the elevators subject to the Group IV Elevator Safety Orders.
3. The Board incorporates by reference the relevant findings in previous Board decisions:
 - a. Items D.3 through D.9 of the Proposed Decision adopted by the Board on July 18, 2013 for Permanent Variance No. 12-V-093;
 - b. Item D.4 of the Proposed Decision adopted by the Board on September 25, 2014 for Permanent Variance No. 14-V-206;
 - c. Item B of the Proposed Decision adopted by the Board on September 15, 2022 for Permanent Variance No. 22-V-302 regarding medical emergency car dimensions; and
 - d. Items C and D of the Proposed Decision adopted by the Board on June 20, 2024 for Permanent Variance No. 24-V-193 regarding the Gen3 Core elevator equivalent safety.
4. Cal/OSHA, by way of written submissions to the record (Exhibit PD-3), and position stated at hearing, is of the well informed opinion that grant of requested permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment, and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the Elevator Safety Order requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A table shall have permanent variances from the following sections of ASME A17.1-2004 that section 3141 makes applicable to the elevators the subject of those applications:

- **Car top railing:** sections 2.14.1.7.1 (to permit an inset car top railing, if, in fact, the car top railing is inset);
- **Speed governor over-speed switch:** 2.18.4.2.5(a) (to permit the use of the speed reducing system proposed by the Applicants, where the speed reducing switch resides in the controller algorithms, rather than on the governor, with the necessary speed input supplied by the main encoder signal from the motor);
- **Governor rope diameter:** 2.18.5.1 (to allow the use of reduced diameter governor rope);
- **Pitch diameter:** 2.18.7.4 (to permit the use of the speed-reducing system proposed by the Applicant, where the rope sheave pitch diameter is not less than 180 mm [7.1 in.]);
- **Suspension means:** 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4 and 2.20.9.5.4—the variances from these “suspension means” provisions to permit the use of Otis Gen2 flat coated steel suspension belts in lieu of conventional steel suspension ropes;
- **Inspection transfer switch:** 2.26.1.4.4(a) (to allow the inspection transfer switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room); and
- **Seismic reset switch:** 8.4.10.1.1(a)(2)(b) (to allow the seismic reset switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room).
- **Minimum Inside Car Platform Dimensions:** 3041(e)(1)(C) and 3141.7(b) (to comply with the performance-based requirements of the 2019 California Building Code section 3002.4.1a)

These variances apply to the locations and numbers of elevators stated in the section A table (so long as the elevators are Gen3 Edge/Gen2S Group and Gen3 Core & Medical Emergency Elevator Car Dimensions (Group IV) that are designed, equipped, and installed in accordance with, and are otherwise consistent with, and are subject to the following conditions:

1. The suspension system shall comply with the following:
 - a. The coated steel belt and connections shall have factors of safety equal to those permitted for use by section 3141 [ASME A17.1-2004, section 2.20.3] on wire rope suspended elevators.
 - b. Steel coated belts that have been installed and used on another installation shall not be reused.
 - c. The coated steel belt shall be fitted with a monitoring device which has been accepted by Cal/OSHA and which will automatically stop the car if the residual strength of any single belt drops below 60 percent. If the residual strength of any single belt drops below 60 percent, the device shall prevent the elevator from restarting after a normal stop at a landing.
 - d. Upon initial inspection, the readings from the monitoring device shall be documented and submitted to Cal/OSHA.
 - e. A successful test of the monitoring device’s functionality shall be conducted at least once a year (the record of the annual test of the monitoring device shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - f. The coated steel belts used shall be accepted by Cal/OSHA.

2. With respect to each elevator subject to this variance, the applicant shall comply with Cal/OSHA Circular Letter E-10-04, the substance of which is attached hereto as Addendum 1 and incorporated herein by this reference.
3. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection, and testing of the belts and monitoring device and criteria for belt replacement, and the applicant shall make those procedures and criteria available to Cal/OSHA upon request.
4. The flat coated steel belts shall be provided with a metal data tag that is securely attached to one of those belts. This data tag shall bear the following flat steel coated belt data:
 - a. The width and thickness in millimeters or inches;
 - b. The manufacturer's rated breaking strength in (kN) or (lbf);
 - c. The name of the person or organization that installed the flat coated steel belts;
 - d. The month and year the flat coated steel belts were installed;
 - e. The month and year the flat coated steel belts were first shortened;
 - f. The name or trademark of the manufacturer of the flat coated steel belts; and
 - g. Lubrication information.
5. There shall be a crosshead data plate of the sort required by section 2.20.2.1, and that plate shall bear the following flat steel coated belt data:
 - a. The number of belts;
 - b. The belt width and thickness in millimeters or inches; and
 - c. The manufacturer's rated breaking strength per belt in (kN) or (lbf).
6. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of elevator equipment in the hoistway is required. If service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
7. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on railings to perform adjustment, maintenance, repairs or inspections. The applicant shall not permit anyone to stand on or climb over the car top railing.
 - b. The distance that the car top railing may be inset shall be limited to no more than 6 inches.
 - c. All exposed areas outside the car top railing shall preclude standing or placing objects or persons which may fall and shall be beveled from the mid- or top rail to the outside of the car top.
 - d. The top of the beveled area and/or car top outside the railing, shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
 - e. The applicant shall provide durable signs with lettering not less than ½ inch on a

contrasting background on each inset railing; each sign shall state:

**CAUTION
DO NOT STAND ON OR CLIMB OVER RAILING**

- f. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing shall be measured from the car top and not from the required bevel).
- 8. If the seismic reset switch does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
- 9. If the inspection transfer switch required by ASME A17.1, rule 2.26.1.4.4(a) does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
- 10. When the inspection and testing panel is located in the hoistway door jamb, the inspection and test control panel shall be openable only by use of a Security Group I restricted key.
- 11. The governor speed-reducing switch function shall comply with the following:
 - a. It shall be used only with direct drive machines; i.e., no gear reduction is permitted between the drive motor and the suspension means.
 - b. The velocity encoder shall be coupled to the driving machine motor shaft. The “C” channel of the encoder shall be utilized for velocity measurements required by the speed reducing system. The signal from “C” channel of the encoder shall be verified with the “A” and “B” channels for failure. If a failure is detected then an emergency stop shall be initiated.
 - c. Control system parameters utilized in the speed-reducing system shall be held in non-volatile memory.
 - d. It shall be used in conjunction with approved car-mounted speed governors only.
 - e. It shall be used in conjunction with an effective traction monitoring system that detects a loss of traction between the driving sheave and the suspension means. If a loss of traction is detected, then an emergency stop shall be initiated.
 - f. A successful test of the speed-reducing switch system’s functionality shall be conducted at least once a year (the record of the annual test of the speed-reducing switch system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - g. A successful test of the traction monitoring system’s functionality shall be conducted at least once a year (the record of the annual test of the traction monitoring system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - h. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the maintenance, inspection, and testing of the speed-reducing switch and traction monitoring systems. The Applicant shall make the procedures available to Cal/OSHA upon

request.

12. The speed governor rope and sheaves shall comply with the following:

- a. The governor shall be used in conjunction with a 6 mm (0.25 in.) diameter steel governor rope with 6-strand, regular lay construction.
- b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
- c. The governor sheaves shall have a pitch diameter of not less than 180 mm (7.1 in.).

13. All medical emergency service elevators shall comply with the following:

- a. The requirements of the 2019 California Building Code (CBC), section 3002.4.1a;

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5inch (127 mm) radius corners] in the horizontal, open position.

- b. All medical emergency service elevators shall be identified in the building construction documents in accordance with the 2019 CBC, section 3002.4a.
- c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).

- 14. The elevator shall be serviced, maintained, adjusted, tested, and inspected only by Certified Competent Conveyance Mechanics who have been trained to, and are competent to, perform those tasks on the Gen3 Edge/Gen2S/Gen3 Core elevator system in accordance with the written procedures and criteria required by Condition No. 3 and in accordance with the terms of this permanent variance.
- 15. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing, or testing of the elevators shall be provided a copy of this variance decision.
- 16. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and a Permit to Operate shall be issued before the elevator is placed in service.
- 17. The Applicant shall be subject to the Suspension Means – Replacement Reporting Condition stated in Addendum 2, as hereby incorporated by this reference.
- 18. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications.
- 19. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in

accordance with the Board's procedural regulations at section 426, subdivision (b).

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 29, 2026



Kelly Chau, Hearing Officer

ADDENDUM 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and, Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA-Elevator Unit HQS

ADDENDUM 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

KONE Monospace 300 Elevators & Medical Emergency Elevator Car Dimensions (Group IV)

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-344	North Brea Housing Partners LP	323 North Brea Blvd. Brea, CA	1

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Fuei Saetern, with KONE INC., appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each respective Applicant intends to utilize the KONE, Inc. Monospace 300 type elevator, in the quantity, at the location, specified per the above section A.1 table.
2. The installation contract for this elevator was or will be signed on or after May 1, 2008, thus making the elevator subject to the Group IV Elevator Safety Orders.
3. Each Applicant proposes to use hoisting ropes that are 8 mm in diameter which also consist of 0.51 mm diameter outer wires, in variance from the express requirements of ASME A17.1-2004, section 2.20.4.
4. In relevant part, ASME A17.1-2004, section 2.20.4 states:

2.20.4 Minimum Number and Diameter of Suspension Ropes

...The minimum diameter of hoisting and counterweight ropes shall be 9.5 mm (0.375 in.). Outer wires of the ropes shall be not less than 0.56 mm (0.024 in.) in diameter.

5. An intent of ASME A17.1-2004, section 2.20.4, is to ensure that the number, diameter, and construction of suspension ropes are adequate to provided safely robust and durable suspension means over the course of the ropes' foreseen service life.
6. KONE has represented to Cal/OSHA, having established an engineering practice for purposes of Monospace 300 elevator design, of meeting or exceeding the minimum factor of safety of 12 for 8 mm suspension members, as required in ASME A17.1-2010 - under which, given that factor of safety, supplemental broken suspension member protection is not required.
7. Also, each Applicant proposes as a further means of maintaining safety equivalence, monitoring the rope in conformity with the criteria specified within the *Inspector's Guide to 6 mm Diameter Governor and 8 mm Diameter Suspension Ropes for KONE Elevators* (per Application attachment "B", or as thereafter revised by KONE subject Cal/OSHA approval).
8. In addition, each Applicant has proposed to utilize 6 mm diameter governor ropes in variance from Title 8, section 3141, incorporated ASME A17.1-2004, section 2.18.5.1.
9. ASME A17.1-2004, section 2.18.5.1, specifies, in relevant part:

2.18.5.1 Material and Factor of Safety.

... [Governor ropes] not less than 9.5 mm (0.375 in.) in diameter. The factor of safety of governor ropes shall be not less than 5...

10. The Board takes notice of section 3141.7, subpart (a)(10):

A reduced diameter governor rope of equivalent construction and material to that required by ASME A17.1-2004, is permissible if the factor of safety as related to the strength necessary to

activate the safety is 5 or greater;

11. Applicants propose use of 6mm governor rope having a safety factor of 5 or greater, in conformity with section 3141.7(a)(10), the specific parameters of which, being expressly set out within the Elevator Safety Orders (ESO), take precedence over more generally referenced governor rope diameter requirements per ASME A17.1-2004, section 2.18.5.1. Accordingly, the governor rope specifications being presently proposed, inclusive of a factor of safety of 5 or greater, would comply with current requirements, and therefore not be subject to issuance of permanent variance.
12. Absent evident diminution in elevator safety, over the past decade the Board has issued numerous permanent variances for use in KONE (Ecospace) elevator systems of 8 mm diameter suspension rope materially similar to that presently proposed (e.g. Permanent Variance Nos. 06-V-203, 08-V-245, and 13-V-303).
13. As noted by the Board in permanent Variance Nos. 18-V-044, and 18-V-045, Decision and Order Findings, subpart B.17 (hereby incorporated by reference), the strength of wire rope operating as an elevator's suspension means does not remain constant over its years of projected service life. With increasing usage cycles, a reduction in the cross-sectional area of the wire rope normally occurs, resulting in decreased residual strength. This characteristic is of particular relevance to the present matter because, decreasing wire rope diameter is associated with a higher rate of residual strength loss. This foreseeable reduction in cross-sectional area primarily results from elongation under sheave rounding load, as well as from wear, and wire or strand breaks. However, these characteristics need not compromise elevator safety when properly accounted for in the engineering of elevator suspension means, and associated components.
14. The presently proposed wire rope is Wuxi Universal steel rope Co LTD. 8 mm 8x19S+8x7+PP, with a manufacturer rated breaking strength of 35.8 kN, and an outer wire diameter of less than 0.56 mm, but not less than 0.51 mm. Cal/OSHA's safety engineer has scrutinized the material and structural specifications, and performance testing data, of this particular proposed rope, and concluded it will provide for safety equivalent to ESO compliant 9.5 mm wire rope, with 0.56 mm outer wire (under conditions of use included within the below Decision and Order).
15. The applicant supplies tabulated data regarding the "Maximum Static Load on All Suspension Ropes." To obtain the tabulated data, the applicant uses the following formula derived from ASME A17.1 2004, section 2.20.3:

$$W = \frac{(S \times N)}{f} \quad \text{where:}$$

W = maximum static load imposed on all car ropes with the car and its rated load at any position in the hoistway

N = number of runs of rope under load. For 2:1 roping, N shall be two times the number of ropes used, etc.

S = manufacturer's rated breaking strength of one rope

f = the factor of safety from Table 2.20.3

16. ASME A17.1-2010 sections 2.20.3 and 2.20.4 utilize the same formula, but provide for use of suspension ropes having a diameter smaller than 9.5 mm, under specified conditions, key among them being that use of ropes having a diameter of between 8 mm to 9.5 mm be engineered with a factor of safety of 12 or higher. This is a higher minimum factor of safety than that proposed by Applicant but a minimum recommended by Cal/OSHA as a condition of variance necessary to the achieving of safety equivalence to 9.5 mm rope.
17. Cal/OSHA is in accord with Applicant, in proposing as a condition of safety equivalence, that periodic physical examination of the wire ropes be performed to confirm the ropes continue to meet the criteria set out in the (Application attachment) *Inspector's Guide to 6 mm Diameter Governor and 8 mm Diameter Suspension Ropes for KONE Elevators*. Adherence to this condition will provide an additional assurance of safety equivalence, regarding smaller minimum diameter suspension rope outer wire performance over the course of its service life.
18. Applicant requests a permanent variance from section 3041, subdivision (e)(1)(C), which states:
- (1) All buildings and structures constructed after the effective date of this order that are provided with one or more passenger elevators shall be provided with not less than one passenger elevator designed and designated to accommodate the loading and transport of an ambulance gurney or stretcher maximum size 22 ½ in. (572 mm) by 75 in. (1.90 m) in its horizontal position and arranged to serve all landings in conformance with the following:
- ...
- (C) The elevator car shall have a minimum inside car platform of 80 in. (2.03 m) wide by 51 in. (1.30 m) deep.
- The intent of this language is to ensure that there is enough space to accommodate the access and egress of a gurney and medical personnel inside of a medical service elevator.
- This standard is made applicable to Group IV by section 3141.7, subdivision (b), which reads, "Elevators utilized to provide medical emergency service shall comply with Group II, section 3041(e)."
19. Applicant proposes to comply with the requirements of the 2019 California Building Code, section 3002.4.1a in the design of its medical emergency service elevator. That section requires:
- The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5-inch (127 mm) radius corners] in the horizontal, open position.
- The purpose of this requirement is to ensure that an elevator designated for emergency medical service will accommodate a minimum of two emergency personnel with an ambulance gurney or stretcher.
20. Cal/OSHA, by way of written submission to the record (Exhibit PD3), and stated position at hearing, is of the well informed opinion that grant of permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment, and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each Application being the subject of this proceeding, per above section A.1 table, is conditionally GRANTED, to the extent that each such Applicant shall be issued permanent variance from section 3141 incorporated ASME A17.1-2004, section 2.20.4, in as much as it precludes use of suspension rope of between 8 mm and 9.5 mm, or outer wire of between 0.51 mm and 0.56 mm in diameter, at such locations and numbers of Group IV KONE Monospace 300 elevators identified in each respective Application, subject to the following conditions:

1. The diameter of the hoisting steel ropes shall be not less than 8 mm (0.315 in) diameter and the roping ratio shall be two to one (2:1).
2. The outer wires of the suspension ropes shall be not less than 0.51 mm (0.02 in.) in diameter.
3. The number of suspension ropes shall be not fewer than those specified per hereby incorporated Decision and Order Appendix 1 Table.
4. The ropes shall be inspected annually for wire damage (rouge, valley break etc.) in accordance with "KONE, Inc. Inspector's Guide to 6 mm diameter and 8 mm diameter steel ropes for KONE Elevators" (per Application Exhibit B, or as thereafter amended by KONE subject to Cal/OSHA approval).
5. A rope inspection log shall be maintained and available in the elevator controller room / space at all times.
6. The elevator rated speed shall not exceed those speeds specified per the Decision and Order Appendix 1 Table.
7. The maximum suspended load shall not exceed those weights (plus 5%) specified per the Decision and Order Appendix 1 Table.
8. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of the elevator equipment in the hoistway is required. If the service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
9. The installation shall meet the suspension wire rope factor of safety requirements of ASME A17.1-2013 section 2.20.3.
10. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing or testing the elevators shall be provided a copy of this variance decision.
11. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA and a "Permit to Operate" issued before the elevator is placed in service.
12. The Applicant shall comply with suspension means replacement reporting condition per hereby

incorporated Decision and Order Appendix 2.

13. All medical emergency service elevator(s) shall comply with the following:

a. The requirements of the 2019 California Building Code (CBC) section 3002.4.1a:

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5-inch (127 mm) radius corners] in the horizontal, open position.

b. All medical emergency service elevator(s) shall be identified in the building construction documents in accordance with the 2019 California Building Code, section 3002.4a.

c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).

14. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications pursuant to sections 411.2 and 411.3.

15. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in the procedural manner prescribed.

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 23, 2026



Kelly Chau, Hearing Officer

APPENDIX 1

File Number	Elevator ID	Minimum Suspension Ropes Per Elevator	Maximum Suspended Weight Per Elevator	Maximum Speed	Rated Capacity
26-V-344	Elevator 1	7	12247	150	3500

APPENDIX 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Otis Gen2S/Gen3Edge/Gen3 Core Elevator & Medical Emergency Car Dimensions

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-345	County of Los Angeles	North Hollywood Health Center 5300 Tujunga Ave. North Hollywood, CA	4

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Dan Leacox, with Leacox & Associates, and Wolter Geesink with Otis Elevator Company appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table

PD2	OSHSB Notice of Hearing
PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each Applicant intends to utilize Otis Gen3 Edge/Gen2S/Gen3 Core elevators at the locations and in the numbers stated in the above section A.1 table. Applicant may utilize the variance from minimum inside car platform dimensions for other elevators designated for emergency medical service at the same variance location.
2. The installation contracts for these elevators were or will be signed on or after May 1, 2008, making the elevators subject to the Group IV Elevator Safety Orders.
3. The Board incorporates by reference the relevant findings in previous Board decisions:
 - a. Items D.3 through D.9 of the Proposed Decision adopted by the Board on July 18, 2013 for Permanent Variance No. 12-V-093;
 - b. Item D.4 of the Proposed Decision adopted by the Board on September 25, 2014 for Permanent Variance No. 14-V-206;
 - c. Item B of the Proposed Decision adopted by the Board on September 15, 2022 for Permanent Variance No. 22-V-302 regarding medical emergency car dimensions; and
 - d. Items C and D of the Proposed Decision adopted by the Board on June 20, 2024 for Permanent Variance No. 24-V-193 regarding the Gen3 Core elevator equivalent safety.
4. Cal/OSHA, by way of written submissions to the record (Exhibit PD-3), and position stated at hearing, is of the well informed opinion that grant of requested permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment, and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the Elevator Safety Order requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A table shall have permanent variances from the

following sections of ASME A17.1-2004 that section 3141 makes applicable to the elevators the subject of those applications:

- **Car top railing:** sections 2.14.1.7.1 (to permit an inset car top railing, if, in fact, the car top railing is inset);
- **Speed governor over-speed switch:** 2.18.4.2.5(a) (to permit the use of the speed reducing system proposed by the Applicants, where the speed reducing switch resides in the controller algorithms, rather than on the governor, with the necessary speed input supplied by the main encoder signal from the motor);
- **Governor rope diameter:** 2.18.5.1 (to allow the use of reduced diameter governor rope);
- **Pitch diameter:** 2.18.7.4 (to permit the use of the speed-reducing system proposed by the Applicant, where the rope sheave pitch diameter is not less than 180 mm [7.1 in.]);
- **Suspension means:** 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4 and 2.20.9.5.4—the variances from these “suspension means” provisions to permit the use of Otis Gen2 flat coated steel suspension belts in lieu of conventional steel suspension ropes;
- **Inspection transfer switch:** 2.26.1.4.4(a) (to allow the inspection transfer switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room); and
- **Seismic reset switch:** 8.4.10.1.1(a)(2)(b) (to allow the seismic reset switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room).
- **Minimum Inside Car Platform Dimensions:** 3041(e)(1)(C) and 3141.7(b) (to comply with the performance-based requirements of the 2019 California Building Code section 3002.4.1a)

These variances apply to the locations and numbers of elevators stated in the section A table (so long as the elevators are Gen3 Edge/Gen2S Group and Gen3 Core & Medical Emergency Elevator Car Dimensions (Group IV) that are designed, equipped, and installed in accordance with, and are otherwise consistent with, and are subject to the following conditions:

1. The suspension system shall comply with the following:
 - a. The coated steel belt and connections shall have factors of safety equal to those permitted for use by section 3141 [ASME A17.1-2004, section 2.20.3] on wire rope suspended elevators.
 - b. Steel coated belts that have been installed and used on another installation shall not be reused.
 - c. The coated steel belt shall be fitted with a monitoring device which has been accepted by Cal/OSHA and which will automatically stop the car if the residual strength of any single belt drops below 60 percent. If the residual strength of any single belt drops below 60 percent, the device shall prevent the elevator from restarting after a normal stop at a landing.
 - d. Upon initial inspection, the readings from the monitoring device shall be documented and submitted to Cal/OSHA.
 - e. A successful test of the monitoring device’s functionality shall be conducted at least once

a year (the record of the annual test of the monitoring device shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).

- f. The coated steel belts used shall be accepted by Cal/OSHA.
2. With respect to each elevator subject to this variance, the applicant shall comply with Cal/OSHA Circular Letter E-10-04, the substance of which is attached hereto as Addendum 1 and incorporated herein by this reference.
3. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection, and testing of the belts and monitoring device and criteria for belt replacement, and the applicant shall make those procedures and criteria available to Cal/OSHA upon request.
4. The flat coated steel belts shall be provided with a metal data tag that is securely attached to one of those belts. This data tag shall bear the following flat steel coated belt data:
 - a. The width and thickness in millimeters or inches;
 - b. The manufacturer's rated breaking strength in (kN) or (lbf);
 - c. The name of the person or organization that installed the flat coated steel belts;
 - d. The month and year the flat coated steel belts were installed;
 - e. The month and year the flat coated steel belts were first shortened;
 - f. The name or trademark of the manufacturer of the flat coated steel belts; and
 - g. Lubrication information.
5. There shall be a crosshead data plate of the sort required by section 2.20.2.1, and that plate shall bear the following flat steel coated belt data:
 - a. The number of belts;
 - b. The belt width and thickness in millimeters or inches; and
 - c. The manufacturer's rated breaking strength per belt in (kN) or (lbf).
6. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of elevator equipment in the hoistway is required. If service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
7. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on railings to perform adjustment, maintenance, repairs or inspections. The applicant shall not permit anyone to stand on or climb over the car top railing.
 - b. The distance that the car top railing may be inset shall be limited to no more than 6 inches.
 - c. All exposed areas outside the car top railing shall preclude standing or placing objects or persons which may fall and shall be beveled from the mid- or top rail to the outside of the car top.

- d. The top of the beveled area and/or car top outside the railing, shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
- e. The applicant shall provide durable signs with lettering not less than ½ inch on a contrasting background on each inset railing; each sign shall state:

CAUTION
DO NOT STAND ON OR CLIMB OVER RAILING

- f. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing shall be measured from the car top and not from the required bevel).
-
- 8. If the seismic reset switch does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
 - 9. If the inspection transfer switch required by ASME A17.1, rule 2.26.1.4.4(a) does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
 - 10. When the inspection and testing panel is located in the hoistway door jamb, the inspection and test control panel shall be openable only by use of a Security Group I restricted key.
 - 11. The governor speed-reducing switch function shall comply with the following:
 - a. It shall be used only with direct drive machines; i.e., no gear reduction is permitted between the drive motor and the suspension means.
 - b. The velocity encoder shall be coupled to the driving machine motor shaft. The “C” channel of the encoder shall be utilized for velocity measurements required by the speed reducing system. The signal from “C” channel of the encoder shall be verified with the “A” and “B” channels for failure. If a failure is detected then an emergency stop shall be initiated.
 - c. Control system parameters utilized in the speed-reducing system shall be held in non-volatile memory.
 - d. It shall be used in conjunction with approved car-mounted speed governors only.
 - e. It shall be used in conjunction with an effective traction monitoring system that detects a loss of traction between the driving sheave and the suspension means. If a loss of traction is detected, then an emergency stop shall be initiated.
 - f. A successful test of the speed-reducing switch system’s functionality shall be conducted at least once a year (the record of the annual test of the speed-reducing switch system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - g. A successful test of the traction monitoring system’s functionality shall be conducted at least once a year (the record of the annual test of the traction monitoring system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).

- h. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the maintenance, inspection, and testing of the speed-reducing switch and traction monitoring systems. The Applicant shall make the procedures available to Cal/OSHA upon request.

12. The speed governor rope and sheaves shall comply with the following:

- a. The governor shall be used in conjunction with a 6 mm (0.25 in.) diameter steel governor rope with 6-strand, regular lay construction.
- b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
- c. The governor sheaves shall have a pitch diameter of not less than 180 mm (7.1 in.).

13. All medical emergency service elevators shall comply with the following:

- a. The requirements of the 2019 California Building Code (CBC), section 3002.4.1a;

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5inch (127 mm) radius corners] in the horizontal, open position.

- b. All medical emergency service elevators shall be identified in the building construction documents in accordance with the 2019 CBC, section 3002.4a.
- c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).

- 14. The elevator shall be serviced, maintained, adjusted, tested, and inspected only by Certified Competent Conveyance Mechanics who have been trained to, and are competent to, perform those tasks on the Gen3 Edge/Gen2S/Gen3 Core elevator system in accordance with the written procedures and criteria required by Condition No. 3 and in accordance with the terms of this permanent variance.
- 15. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing, or testing of the elevators shall be provided a copy of this variance decision.
- 16. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and a Permit to Operate shall be issued before the elevator is placed in service.
- 17. The Applicant shall be subject to the Suspension Means – Replacement Reporting Condition stated in Addendum 2, as hereby incorporated by this reference.
- 18. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives

are to be notified of docketed permanent variance applications.

19. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in accordance with the Board's procedural regulations at section 426, subdivision (b).

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 29, 2026



Kelly Chau, Hearing Officer

ADDENDUM 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and, Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA-Elevator Unit HQS

ADDENDUM 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Otis Gen2S/Gen3Edge/Gen3 Core Elevator & Medical Emergency Car Dimensions

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-346	Hospital Corporation of America (HCA)	Riverside Community Hospital Garage 4410 Brockton Ave. Riverside, CA	2

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Dan Leacox, with Leacox & Associates, and Wolter Geesink with Otis Elevator Company appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table

PD2	OSHSB Notice of Hearing
PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each Applicant intends to utilize Otis Gen3 Edge/Gen2S/Gen3 Core elevators at the locations and in the numbers stated in the above section A.1 table. Applicant may utilize the variance from minimum inside car platform dimensions for other elevators designated for emergency medical service at the same variance location.
2. The installation contracts for these elevators were or will be signed on or after May 1, 2008, making the elevators subject to the Group IV Elevator Safety Orders.
3. The Board incorporates by reference the relevant findings in previous Board decisions:
 - a. Items D.3 through D.9 of the Proposed Decision adopted by the Board on July 18, 2013 for Permanent Variance No. 12-V-093;
 - b. Item D.4 of the Proposed Decision adopted by the Board on September 25, 2014 for Permanent Variance No. 14-V-206;
 - c. Item B of the Proposed Decision adopted by the Board on September 15, 2022 for Permanent Variance No. 22-V-302 regarding medical emergency car dimensions; and
 - d. Items C and D of the Proposed Decision adopted by the Board on June 20, 2024 for Permanent Variance No. 24-V-193 regarding the Gen3 Core elevator equivalent safety.
4. Cal/OSHA, by way of written submissions to the record (Exhibit PD-3), and position stated at hearing, is of the well informed opinion that grant of requested permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment, and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the Elevator Safety Order requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A table shall have permanent variances from the

following sections of ASME A17.1-2004 that section 3141 makes applicable to the elevators the subject of those applications:

- **Car top railing:** sections 2.14.1.7.1 (to permit an inset car top railing, if, in fact, the car top railing is inset);
- **Speed governor over-speed switch:** 2.18.4.2.5(a) (to permit the use of the speed reducing system proposed by the Applicants, where the speed reducing switch resides in the controller algorithms, rather than on the governor, with the necessary speed input supplied by the main encoder signal from the motor);
- **Governor rope diameter:** 2.18.5.1 (to allow the use of reduced diameter governor rope);
- **Pitch diameter:** 2.18.7.4 (to permit the use of the speed-reducing system proposed by the Applicant, where the rope sheave pitch diameter is not less than 180 mm [7.1 in.]);
- **Suspension means:** 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4 and 2.20.9.5.4—the variances from these “suspension means” provisions to permit the use of Otis Gen2 flat coated steel suspension belts in lieu of conventional steel suspension ropes;
- **Inspection transfer switch:** 2.26.1.4.4(a) (to allow the inspection transfer switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room); and
- **Seismic reset switch:** 8.4.10.1.1(a)(2)(b) (to allow the seismic reset switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room).
- **Minimum Inside Car Platform Dimensions:** 3041(e)(1)(C) and 3141.7(b) (to comply with the performance-based requirements of the 2019 California Building Code section 3002.4.1a)

These variances apply to the locations and numbers of elevators stated in the section A table (so long as the elevators are Gen3 Edge/Gen2S Group and Gen3 Core & Medical Emergency Elevator Car Dimensions (Group IV) that are designed, equipped, and installed in accordance with, and are otherwise consistent with, and are subject to the following conditions:

1. The suspension system shall comply with the following:
 - a. The coated steel belt and connections shall have factors of safety equal to those permitted for use by section 3141 [ASME A17.1-2004, section 2.20.3] on wire rope suspended elevators.
 - b. Steel coated belts that have been installed and used on another installation shall not be reused.
 - c. The coated steel belt shall be fitted with a monitoring device which has been accepted by Cal/OSHA and which will automatically stop the car if the residual strength of any single belt drops below 60 percent. If the residual strength of any single belt drops below 60 percent, the device shall prevent the elevator from restarting after a normal stop at a landing.
 - d. Upon initial inspection, the readings from the monitoring device shall be documented and submitted to Cal/OSHA.
 - e. A successful test of the monitoring device’s functionality shall be conducted at least once

a year (the record of the annual test of the monitoring device shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).

f. The coated steel belts used shall be accepted by Cal/OSHA.

2. With respect to each elevator subject to this variance, the applicant shall comply with Cal/OSHA Circular Letter E-10-04, the substance of which is attached hereto as Addendum 1 and incorporated herein by this reference.
3. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection, and testing of the belts and monitoring device and criteria for belt replacement, and the applicant shall make those procedures and criteria available to Cal/OSHA upon request.
4. The flat coated steel belts shall be provided with a metal data tag that is securely attached to one of those belts. This data tag shall bear the following flat steel coated belt data:
 - a. The width and thickness in millimeters or inches;
 - b. The manufacturer's rated breaking strength in (kN) or (lbf);
 - c. The name of the person or organization that installed the flat coated steel belts;
 - d. The month and year the flat coated steel belts were installed;
 - e. The month and year the flat coated steel belts were first shortened;
 - f. The name or trademark of the manufacturer of the flat coated steel belts; and
 - g. Lubrication information.
5. There shall be a crosshead data plate of the sort required by section 2.20.2.1, and that plate shall bear the following flat steel coated belt data:
 - a. The number of belts;
 - b. The belt width and thickness in millimeters or inches; and
 - c. The manufacturer's rated breaking strength per belt in (kN) or (lbf).
6. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of elevator equipment in the hoistway is required. If service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
7. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on railings to perform adjustment, maintenance, repairs or inspections. The applicant shall not permit anyone to stand on or climb over the car top railing.
 - b. The distance that the car top railing may be inset shall be limited to no more than 6 inches.
 - c. All exposed areas outside the car top railing shall preclude standing or placing objects or persons which may fall and shall be beveled from the mid- or top rail to the outside of the car top.

- d. The top of the beveled area and/or car top outside the railing, shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
- e. The applicant shall provide durable signs with lettering not less than ½ inch on a contrasting background on each inset railing; each sign shall state:

CAUTION
DO NOT STAND ON OR CLIMB OVER RAILING

- f. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing shall be measured from the car top and not from the required bevel).
-
- 8. If the seismic reset switch does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
 - 9. If the inspection transfer switch required by ASME A17.1, rule 2.26.1.4.4(a) does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
 - 10. When the inspection and testing panel is located in the hoistway door jamb, the inspection and test control panel shall be openable only by use of a Security Group I restricted key.
 - 11. The governor speed-reducing switch function shall comply with the following:
 - a. It shall be used only with direct drive machines; i.e., no gear reduction is permitted between the drive motor and the suspension means.
 - b. The velocity encoder shall be coupled to the driving machine motor shaft. The “C” channel of the encoder shall be utilized for velocity measurements required by the speed reducing system. The signal from “C” channel of the encoder shall be verified with the “A” and “B” channels for failure. If a failure is detected then an emergency stop shall be initiated.
 - c. Control system parameters utilized in the speed-reducing system shall be held in non-volatile memory.
 - d. It shall be used in conjunction with approved car-mounted speed governors only.
 - e. It shall be used in conjunction with an effective traction monitoring system that detects a loss of traction between the driving sheave and the suspension means. If a loss of traction is detected, then an emergency stop shall be initiated.
 - f. A successful test of the speed-reducing switch system’s functionality shall be conducted at least once a year (the record of the annual test of the speed-reducing switch system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - g. A successful test of the traction monitoring system’s functionality shall be conducted at least once a year (the record of the annual test of the traction monitoring system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).

h. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the maintenance, inspection, and testing of the speed-reducing switch and traction monitoring systems. The Applicant shall make the procedures available to Cal/OSHA upon request.

12. The speed governor rope and sheaves shall comply with the following:

- a. The governor shall be used in conjunction with a 6 mm (0.25 in.) diameter steel governor rope with 6-strand, regular lay construction.
- b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
- c. The governor sheaves shall have a pitch diameter of not less than 180 mm (7.1 in.).

13. All medical emergency service elevators shall comply with the following:

- a. The requirements of the 2019 California Building Code (CBC), section 3002.4.1a;

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5inch (127 mm) radius corners] in the horizontal, open position.

- b. All medical emergency service elevators shall be identified in the building construction documents in accordance with the 2019 CBC, section 3002.4a.
- c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).

14. The elevator shall be serviced, maintained, adjusted, tested, and inspected only by Certified Competent Conveyance Mechanics who have been trained to, and are competent to, perform those tasks on the Gen3 Edge/Gen2S/Gen3 Core elevator system in accordance with the written procedures and criteria required by Condition No. 3 and in accordance with the terms of this permanent variance.
15. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing, or testing of the elevators shall be provided a copy of this variance decision.
16. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and a Permit to Operate shall be issued before the elevator is placed in service.
17. The Applicant shall be subject to the Suspension Means – Replacement Reporting Condition stated in Addendum 2, as hereby incorporated by this reference.
18. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives

are to be notified of docketed permanent variance applications.

19. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in accordance with the Board's procedural regulations at section 426, subdivision (b).

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 29, 2026



Kelly Chau, Hearing Officer

ADDENDUM 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and, Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA-Elevator Unit HQS

ADDENDUM 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Otis Medical Emergency Elevator Car Dimensions

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-347	United Indian Health Services, Inc	1801 Weeot Way Arcata, CA	

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Dan Leacox, with Leacox & Associates, and Wolter Geesink with Otis Elevator Company appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact and Applicable Regulations

1. Applicant requests a permanent variance from section 3041, subdivision (e)(1)(C), which states:

(1) All buildings and structures constructed after the effective date of this order that are provided with one or more passenger elevators shall be provided with not less than one passenger elevator designed and designated to accommodate the loading and transport of an ambulance gurney or stretcher maximum size 22 ½ in. (572 mm) by 75 in. (1.90 m) in its horizontal position and arranged to serve all landings in conformance with the following:

...

(C) The elevator car shall have a minimum inside car platform of 80 in. (2.03 m) wide by 51 in. (1.30 m) deep.

The intent of this language is to ensure that there is enough space to accommodate the access and egress of a gurney and medical personnel inside of a medical service elevator.

This standard is made applicable to Group IV by section 3141.7, subdivision (b), which reads, "Elevators utilized to provide medical emergency service shall comply with Group II, section 3041(e)."

2. Applicant proposes to comply with the requirements of the 2019 California Building Code, section 3002.4.1a in the design of its medical emergency service elevator. That section requires:

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5-inch (127 mm) radius corners] in the horizontal, open position.

The purpose of this requirement is to ensure that an elevator designated for emergency medical service will accommodate a minimum of two emergency personnel with an ambulance gurney or stretcher.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A.1 table shall have permanent variances from sections 3041, subdivision (e)(1)(C) and 3141.7, subdivision (b) subject of the following conditions:


1. All medical emergency service elevator(s) shall comply with the requirements of the 2019 California Building Code section 3002.4.1a:

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5-inch (127 mm) radius corners] in the horizontal, open position.

2. All medical emergency service elevator(s) shall be identified in the building construction documents in accordance with the 2019 California Building Code, section 3002.4a.
3. Dimensional drawings and other information necessary to demonstrate compliance with the conditions of this permanent variance decision shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).
4. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing, or testing the elevators shall be provided a copy of this variance decision.
5. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and all applicable requirements met, including conditions of this permanent variance, prior to a Permit to Operate the elevator being issued. The elevator shall not be placed in service prior to the Permit to Operate being issued by Cal/OSHA.
6. Applicant shall notify its employees and their authorized representative, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications pursuant to sections 411.2 and 411.3.
7. This Decision and Order shall remain in effect unless duly modified or revoked upon application by Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in accordance with then in effect administrative procedures of the Board.

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 29, 2026

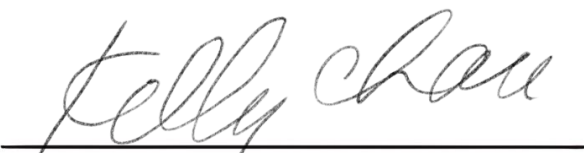

Kelly Chau, Hearing Officer

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Schindler 3300 with SIL-Rated Drive to De-energize Drive Motor (Group IV)

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-348	112 Vera Ave, L.P.	112 Vera Ave. Redwood City, CA	2

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Pete Cuellar, with SCHINDLER ELEVATOR CORPORATION, appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each Applicant intends to utilize Schindler model 3300 MRL elevator cars, in the quantity, at the locations, specified per the above Section A.1 table.
2. The installation contract for these elevator was or will be signed on or after May 1, 2008, thus making the elevator subject to the Group IV Elevator Safety Orders.
3. The Schindler model 3300 MRL elevator cars are not supported by circular steel wire ropes, as required by the Elevator Safety Orders (ESO). They utilize non-circular elastomeric-coated steel belts and specialized suspension means fastenings.
4. No machine room is provided, preventing the inspection transfer switch from being located in the elevator machine room. The lack of machine room also prevents the seismic reset switch from being located in the elevator machine room.
5. Applicant proposes to relocate the inspection transfer switch and seismic reset switch in an alternative enclosure.
6. The driving machine and governor are positioned in the hoistway and restrict the required overhead clearance to the elevator car top.
7. Applicant proposes to insert the car-top railings at the perimeter of the car top.
8. Applicant intends to use an elevator control system, model CO NX100NA, with a standalone, solid-state motor control drive system that includes devices and circuits having a Safety Integrity Level (SIL) rating to execute specific elevator safety functions.

D. Relevant Safety Order Provisions

Applicant seeks a permanent variance from section 3141 [ASME A17.1-2004, sections 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.5.4, 2.26.1.4.4(a), 8.4.10.1.1(a)(2)(B), 2.14.1.7.1, and 2.26.9.6.1].

The relevant language of those sections are below.

1. Suspension Means

- Section 3141 [ASME A17.1-2004, section 2.20.1, Suspension Means] states in part:
 - Elevator cars shall be suspended by steel wire ropes attached to the car frame or passing around sheaves attached to the car frame specified in 2.15.1. Ropes that have previously been installed and used on another installation shall not be reused. Only iron (low-carbon steel) or steel wire ropes, having the commercial classification "Elevator Wire Rope," or wire rope specifically constructed for elevator use, shall be

used for the suspension of elevator cars and for the suspension of counterweights. The wire material for ropes shall be manufactured by the open-hearth or electric furnace process, or their equivalent.

- Section 3141 [ASME A17.1-2004, section 2.20.2.1(b), On Crosshead Data Plate] states in part:

The crosshead data plate required by 2.16.3 shall bear the following wire-rope data:

(b) the diameter in millimeters (mm) or inches (in.)

- Section 3141 [ASME A17.1-2004, section 2.20.2.2(a) and (f) On Rope Data Tag] states in part:

A metal data tag shall be securely attached-to-one of the wire-rope fastenings. This data tag shall bear the following wire-rope data:

(a) the diameter in millimeters (mm) or inches (in.)

[...]

(f) whether the ropes were non preformed or preformed

- Section 3141 [ASME A17.1-2004, section 2.20.3, Factor of Safety] states:

The factor of safety of the suspension wire ropes shall be not less than shown in Table 2.20.3. Figure 8.2.7 gives the minimum factor of safety for intermediate rope speeds. The factor of safety shall be based on the actual rope speed corresponding to the rated speed of the car.

The factor of safety shall be calculated by the following formula:

$$f = \frac{(S \times N)}{W}$$

where:

N = number of runs of rope under load. For 2:1 roping, N shall be two times the number of ropes used, etc.

S = manufacturer's rated breaking strength of one rope

W = maximum static load imposed on all car ropes with the car and its rated load at any position in the hoistway

- Section 3141 [ASME A17.1-2004, section 2.20.4, Minimum Number and Diameter of Suspension Ropes] states:

The minimum number of hoisting ropes used shall be three for traction elevators and two for drum-type elevators.

Where a car counterweight is used, the number of counterweight ropes used shall be not less than two.

The term “diameter,” where used in reference to ropes, shall refer to the nominal diameter as given by the rope manufacturer.

The minimum diameter of hoisting and counterweight ropes shall be 9.5 mm (0.375 in.). Outer wires of the ropes shall be not less than 0.56 mm (0.024 in.) in diameter.

- Section 3141 [ASME A17.1-2004, section 2.20.9.3.4] states:

Cast or forged steel rope sockets, shackle rods, and their connections shall be made of unwelded steel, having an elongation of not less than 20% in a gauge length of 50 mm (2 in.), when measured in accordance with ASTM E 8, and conforming to ASTM A 668, Class B for forged steel, and ASTM A 27, Grade 60/30 for cast steel, and shall be stress relieved. Steels of greater strength shall be permitted, provided they have an elongation of not less than 20% in a length of 50 mm (2 in.).

- Section 3141 [ASME A17.1-2004, section 2.20.9.5.4] states:

When the rope has been seated in the wedge socket by the load on the rope, the wedge shall be visible, and at least two wire-rope retaining clips shall be provided to attach the termination side to the load-carrying side of the rope (see Fig. 2.20.9.5). The first clip shall be placed a maximum of 4 times the rope diameter above the socket, and the second clip shall be located within 8 times the rope diameter above the first clip. The purpose of the two clips is to retain the wedge and prevent the rope from slipping in the socket should the load on the rope be removed for any reason. The clips shall be designed and installed so that they do not distort or damage the rope in any manner.

2. Inspection Transfer Switch

- Section 3141[ASME A17.1-2004, section 2.26.1.4.4(a), Machine Room Inspection Operation] states:

When machine room inspection operation is provided, it shall conform to 2.26.1.4.1, and the transfer switch shall be

(a) located in the machine room[.]

3. Seismic Reset Switch

- Section 3141[ASME A17.1-2004, section 8.4.10.1.1(a)(2)(b), Earthquake Equipment] states:

(a) All traction elevators operating at a rated speed of 0.75 m/s (150 ft/min) or more and having counterweights located in the same hoistway shall be provided with the following:

(1) seismic zone 3 or greater: a minimum of one seismic switch per building

(2) seismic zone 2 or greater:

(a) a displacement switch for each elevator

(b) an identified momentary reset button or switch for each elevator, located in the control panel in the elevator machine room

4. Car-top Railings

- Section 3141[ASME A17.1-2004, section 2.14.1.7.1] states:

A standard railing conforming to 2.10.2 shall be provided on the outside perimeter of the car top on all sides where the perpendicular distance between the edges of the car top and the adjacent hoistway enclosure exceeds 300 mm (12 in.) horizontal clearance.

5. SIL-Rated System to Inhibit Current Flow to AC Drive Motor

- Section 3141[ASME A17.1-2004, section 2.26.9.6.1] states:

Two separate means shall be provided to independently inhibit the flow of alternating current through the solid state devices that connect the direct current power source to the alternating-current driving motor. At least one of the means shall be an electromechanical relay.

E. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

F. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A.1 table shall have permanent variances from sections 3041, subdivision (e)(1)(C) and 3141.7, subdivision (b) subject to the following conditions:

Elevator Safety Orders:

- Suspension Means: 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4, and 2.20.9.5.4 (Only to the extent necessary to permit the use of the Elastomeric-coated Steel Belts proposed by the Applicant, in lieu of circular steel suspension ropes.);
- Inspection transfer switch: 2.26.1.4.4(a) (Only to the extent necessary to permit the inspection transfer switch to reside at a location other than the machine room);

- Seismic reset switch: 8.4.10.1.1(a)(2)(b) (Only to the extent necessary to permit the seismic reset switch to reside at a location other than the machine room.);
- Car-Top Railing: 2.14.1.7.1 (Only to the extent necessary to permit the use of the car-top railing system proposed by the Applicant, where the railing system is located inset from the elevator car top perimeter);
- Means of Removing Power: 2.26.9.6.1 (Only to the extent necessary to permit the use of SIL-rated devices and circuits as a means to remove power from the AC driving motor, where the redundant monitoring of electrical protective devices is required by the Elevator Safety Orders).

Conditions:

1. The elevator suspension system shall comply to the following:
 - a. The suspension traction media (STM) members and their associated fastenings shall conform to the applicable requirements of ASME A17.1-2013, sections:
 - 2.20.4.3 - Minimum Number of Suspension Members
 - 2.20.3 - Factor of Safety
 - 2.20.9 - Suspension Member Fastening
 - b. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection and testing of the STM members and fastenings and related monitoring and detection systems and criteria for STM replacement, and the Applicant shall make those procedures and criteria available to the Certified Competent Conveyance Mechanic (CCCM) at the location of the elevator, and to Cal/OSHA upon request.

STM member mandatory replacement criteria shall include:

 - i. Any exposed wire, strand or cord;
 - ii. Any wire, strand or cord breaks through the elastomeric coating;
 - iii. Any evidence of rouging (steel tension element corrosion) on any part of the elastomeric-coated steel suspension member;
 - iv. Any deformation in the elastomeric suspension member such as, but not limited to, kinks or bends;
 - c. Traction drive sheaves must have a minimum diameter of 72 mm. The maximum speed of STM members running on 72 mm, 87 mm and 125 mm drive sheaves shall be no greater than 2.5 m/s, 6.0 m/s and 8.0 m/s respectively.
 - d. If any one STM member needs replacement, the complete set of suspension members on the elevator shall be replaced. Exception: if a new suspension member is damaged during installation, and prior to any contemporaneously installed STM having been placed into service, it is permissible to replace the individual damaged suspension member. STM members that have been installed on another installation shall not be re-used.

- e. A traction loss detection means shall be provided that conforms to the requirements of ASME A17.1-2013, section 2.20.8.1. The means shall be tested for correct function annually in accordance with ASME A17.1-2013, section 8.6.4.19.12.
 - f. A broken suspension member detection means shall be provided that conforms to the requirements of ASME A17.1-2013, section 2.20.8.2. The means shall be tested for correct function annually in accordance with ASME A17.1-2013, section 8.6.4.19.13(a).
 - g. An elevator controller integrated bend cycle monitoring system shall monitor actual STM bend cycles, by means of continuously counting, and storing in nonvolatile memory, the number of trips that the STM makes traveling, and thereby being bent, over the elevator sheaves. The bend cycle limit monitoring means shall automatically stop the car normally at the next available landing before the bend cycle correlated residual strength of any single STM member drops below 80 percent of full rated strength. The monitoring means shall prevent the car from restarting. The bend cycle monitoring system shall be tested annually in accordance with the procedures required by condition 1b above.
 - h. The elevator shall be provided with a device to monitor the remaining residual strength of each STM member. The device shall conform to the requirements of Cal/OSHA Circular Letter E-10-04, a copy of which is attached hereto as Exhibit 1 and incorporated herein by reference.
 - i. The elevator crosshead data plate shall comply with the requirements of ASME A17.1-2013, section 2.20.2.1.
 - j. A suspension means data tag shall be provided that complies with the requirements of ASME A17.1-2013, section 2.20.2.2.
 - k. Comprehensive visual inspections of the entire length of each and all installed suspension members, to the criteria developed in condition 1b, shall be conducted and documented every six months by a CCM.
 - l. The Applicant shall be subject to the requirements set out in Exhibit 2 of this Decision and Order, "Suspension Means Replacement Reporting Condition," Incorporated herein by this reference.
 - m. Records of all tests and inspections shall be maintenance records subject to ASME A17.1-2004, sections 8.6.1.2 and 8.6.1.4, respectively.
2. If the inspection transfer switch required by ASME A17.1-2004, section 2.26.1.4.4 does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the control/machinery room/space containing the elevator's control equipment in an enclosure secured by a lock openable by a Group 1 security key. The enclosure is to remain locked at all times when not in use.
 3. If the seismic reset switch does not reside in the machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the control/machinery room/space containing the elevator's control equipment in an enclosure secured by a lock openable by a Group 1 security key. The enclosure is to remain locked at all times when not in use.
 4. If there is an inset car-top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on the railings to perform adjustments, maintenance, repairs or inspections. The

Applicant shall not permit anyone to stand or climb over the car-top railing.

- b. The distance that the railing can be inset shall be limited to not more than 6 inches.
- c. All exposed areas of the car-top outside the car top railing where the distance from the railing to the edge of the car top exceeds 2 inches, shall be beveled with metal, at an angle of not less than 75 degrees with the horizontal, from the mid or top rail to the outside of the car top, such that no person or object can stand, sit, kneel, rest, or be placed in the exposed areas.
- d. The top of the beveled area and/or car top outside the railing shall be clearly marked. The markings shall consist of alternating 4-inch diagonal red and white stripes.
- e. The applicant shall provide durable signs with lettering not less than 1/2 inch on a contrasting background on each inset railing. Each sign shall state:

**CAUTION
STAY INSIDE RAILING
NO LEANING BEYOND RAILING
NO STEPPING ON, OR BEYOND, RAILING**

- f. The Group IV requirements for car-top clearances shall be maintained (car-top clearances outside the railing will be measured from the car top and not from the required bevel).
5. The SIL-rated devices and circuits used to inhibit electrical current flow in accordance with ASME A17.1-2004, section 2.26.9.6.1 shall comply with the following:
- a. The SIL-rated devices and circuits shall consist of a Variodyn SIL-3 rated Regenerative, Variable Voltage Variable Frequency (VVVF) motor drive unit, model VAF013 or VAF023, labeled or marked with the SIL rating (not less than SIL 3), the name or mark of the certifying organization, and the SIL certification number (968/FSP 1556.00), and followed by the applicable revision number (as in 968/FSP 1556.00/19).
 - b. The devices and circuits shall be certified for compliance with the applicable requirements of ASME A17.1-2013, section 2.26.4.3.2.
 - c. The access door or cover of the enclosures containing the SIL-rated components shall be clearly labeled or tagged on their exterior with the statement:

**Assembly contains SIL-rated devices
Refer to Maintenance Control Program and
wiring diagrams prior to performing work**

- d. Unique maintenance procedures or methods required for the inspection, testing, or replacement of the SIL-rated circuits shall be developed and a copy maintained in the elevator machine/control room/space. The procedures or methods shall include clear color photographs of each SIL-rated component, with notations identifying parts and locations.
- e. Wiring diagrams that include part identification, SIL, and certification information shall be maintained in the elevator machine/control room/space.
- f. A successful test of the SIL-rated devices and circuits shall be conducted initially and not less than annually in accordance with the testing procedure. The test shall demonstrate that SIL-rated devices, safety functions, and related circuits operate as intended.

- g. Any alterations to the SIL-rated devices and circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the alteration of SIL-rated devices, the alterations shall be made in conformance with ASME A17.1-2013, section 8.7.1.9.
 - h. Any replacement of the SIL-rated devices and circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the replacement of SIL-rated devices, the replacement shall be made in conformance with ASME A17.1-2013, section 8.6.3.14.
 - i. Any repairs to the SIL-rated devices and circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the repair of SIL-rated devices, the repairs shall be made in conformance with ASME A17.1-2013, section 8.6.2.6.
 - j. Any space containing SIL-rated devices and circuits shall be maintained within the temperature and humidity range specified by Schindler Elevator Corporation. The temperature and humidity range shall be posted on each enclosure containing SIL-rated devices and circuits.
 - k. Field changes to the SIL-rated system are not permitted. Any changes to the SIL-rated system's devices and circuitry will require recertification and all necessary updates to the documentation and diagrams required by conditions d. and e. above.
6. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and all applicable requirements met, including conditions of this permanent variance, prior to a Permit to Operate the elevator being issued. The elevator shall not be placed in service prior to the Permit to Operate being issued by Cal/OSHA.
7. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way that the Applicant was required to notify them of the docketed application for permanent variance per sections 411.2 and 411.3.
8. This Decision and Order shall remain in effect unless duly modified or revoked upon application by Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in the procedural manner prescribed.

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 28, 2026



Kelly Chau, Hearing Officer

EXHIBIT 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA Elevator Unit HQS

EXHIBIT 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings. Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future):
CAL/OSHA Elevator Unit, 2 MacArthur Pl., Suite 700, Santa Ana, CA 92707, Attn: Engineering Section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance file number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.

- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Otis Gen2S/Gen3Edge/Gen3 Core Elevator & Medical Emergency Car Dimensions

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-350	Alexandria Associates LLC	714 N. Alexandria Ave. Los Angeles, CA	1

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Dan Leacox, with Leacox & Associates, and Wolter Geesink with Otis Elevator Company appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each Applicant intends to utilize Otis Gen3 Edge/Gen2S/Gen3 Core elevators at the locations and in the numbers stated in the above section A.1 table. Applicant may utilize the variance from minimum inside car platform dimensions for other elevators designated for emergency medical service at the same variance location.
2. The installation contracts for these elevators were or will be signed on or after May 1, 2008, making the elevators subject to the Group IV Elevator Safety Orders.
3. The Board incorporates by reference the relevant findings in previous Board decisions:
 - a. Items D.3 through D.9 of the Proposed Decision adopted by the Board on July 18, 2013 for Permanent Variance No. 12-V-093;
 - b. Item D.4 of the Proposed Decision adopted by the Board on September 25, 2014 for Permanent Variance No. 14-V-206;
 - c. Item B of the Proposed Decision adopted by the Board on September 15, 2022 for Permanent Variance No. 22-V-302 regarding medical emergency car dimensions; and
 - d. Items C and D of the Proposed Decision adopted by the Board on June 20, 2024 for Permanent Variance No. 24-V-193 regarding the Gen3 Core elevator equivalent safety.
4. Cal/OSHA, by way of written submissions to the record (Exhibit PD-3), and position stated at hearing, is of the well informed opinion that grant of requested permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment, and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the Elevator Safety Order requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A table shall have permanent variances from the following sections of ASME A17.1-2004 that section 3141 makes applicable to the elevators the subject of those applications:

- **Car top railing:** sections 2.14.1.7.1 (to permit an inset car top railing, if, in fact, the car top railing is inset);
- **Speed governor over-speed switch:** 2.18.4.2.5(a) (to permit the use of the speed reducing system proposed by the Applicants, where the speed reducing switch resides in the controller algorithms, rather than on the governor, with the necessary speed input supplied by the main encoder signal from the motor);
- **Governor rope diameter:** 2.18.5.1 (to allow the use of reduced diameter governor rope);
- **Pitch diameter:** 2.18.7.4 (to permit the use of the speed-reducing system proposed by the Applicant, where the rope sheave pitch diameter is not less than 180 mm [7.1 in.]);
- **Suspension means:** 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4 and 2.20.9.5.4—the variances from these “suspension means” provisions to permit the use of Otis Gen2 flat coated steel suspension belts in lieu of conventional steel suspension ropes;
- **Inspection transfer switch:** 2.26.1.4.4(a) (to allow the inspection transfer switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room); and
- **Seismic reset switch:** 8.4.10.1.1(a)(2)(b) (to allow the seismic reset switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room).
- **Minimum Inside Car Platform Dimensions:** 3041(e)(1)(C) and 3141.7(b) (to comply with the performance-based requirements of the 2019 California Building Code section 3002.4.1a)

These variances apply to the locations and numbers of elevators stated in the section A table (so long as the elevators are Gen3 Edge/Gen2S Group and Gen3 Core & Medical Emergency Elevator Car Dimensions (Group IV) that are designed, equipped, and installed in accordance with, and are otherwise consistent with, and are subject to the following conditions:

1. The suspension system shall comply with the following:
 - a. The coated steel belt and connections shall have factors of safety equal to those permitted for use by section 3141 [ASME A17.1-2004, section 2.20.3] on wire rope suspended elevators.
 - b. Steel coated belts that have been installed and used on another installation shall not be reused.
 - c. The coated steel belt shall be fitted with a monitoring device which has been accepted by Cal/OSHA and which will automatically stop the car if the residual strength of any single belt drops below 60 percent. If the residual strength of any single belt drops below 60 percent, the device shall prevent the elevator from restarting after a normal stop at a landing.
 - d. Upon initial inspection, the readings from the monitoring device shall be documented and submitted to Cal/OSHA.
 - e. A successful test of the monitoring device’s functionality shall be conducted at least once a year (the record of the annual test of the monitoring device shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - f. The coated steel belts used shall be accepted by Cal/OSHA.

2. With respect to each elevator subject to this variance, the applicant shall comply with Cal/OSHA Circular Letter E-10-04, the substance of which is attached hereto as Addendum 1 and incorporated herein by this reference.
3. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection, and testing of the belts and monitoring device and criteria for belt replacement, and the applicant shall make those procedures and criteria available to Cal/OSHA upon request.
4. The flat coated steel belts shall be provided with a metal data tag that is securely attached to one of those belts. This data tag shall bear the following flat steel coated belt data:
 - a. The width and thickness in millimeters or inches;
 - b. The manufacturer's rated breaking strength in (kN) or (lbf);
 - c. The name of the person or organization that installed the flat coated steel belts;
 - d. The month and year the flat coated steel belts were installed;
 - e. The month and year the flat coated steel belts were first shortened;
 - f. The name or trademark of the manufacturer of the flat coated steel belts; and
 - g. Lubrication information.
5. There shall be a crosshead data plate of the sort required by section 2.20.2.1, and that plate shall bear the following flat steel coated belt data:
 - a. The number of belts;
 - b. The belt width and thickness in millimeters or inches; and
 - c. The manufacturer's rated breaking strength per belt in (kN) or (lbf).
6. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of elevator equipment in the hoistway is required. If service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
7. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on railings to perform adjustment, maintenance, repairs or inspections. The applicant shall not permit anyone to stand on or climb over the car top railing.
 - b. The distance that the car top railing may be inset shall be limited to no more than 6 inches.
 - c. All exposed areas outside the car top railing shall preclude standing or placing objects or persons which may fall and shall be beveled from the mid- or top rail to the outside of the car top.
 - d. The top of the beveled area and/or car top outside the railing, shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
 - e. The applicant shall provide durable signs with lettering not less than ½ inch on a

contrasting background on each inset railing; each sign shall state:

**CAUTION
DO NOT STAND ON OR CLIMB OVER RAILING**

- f. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing shall be measured from the car top and not from the required bevel).
- 8. If the seismic reset switch does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
- 9. If the inspection transfer switch required by ASME A17.1, rule 2.26.1.4.4(a) does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
- 10. When the inspection and testing panel is located in the hoistway door jamb, the inspection and test control panel shall be openable only by use of a Security Group I restricted key.
- 11. The governor speed-reducing switch function shall comply with the following:
 - a. It shall be used only with direct drive machines; i.e., no gear reduction is permitted between the drive motor and the suspension means.
 - b. The velocity encoder shall be coupled to the driving machine motor shaft. The “C” channel of the encoder shall be utilized for velocity measurements required by the speed reducing system. The signal from “C” channel of the encoder shall be verified with the “A” and “B” channels for failure. If a failure is detected then an emergency stop shall be initiated.
 - c. Control system parameters utilized in the speed-reducing system shall be held in non-volatile memory.
 - d. It shall be used in conjunction with approved car-mounted speed governors only.
 - e. It shall be used in conjunction with an effective traction monitoring system that detects a loss of traction between the driving sheave and the suspension means. If a loss of traction is detected, then an emergency stop shall be initiated.
 - f. A successful test of the speed-reducing switch system’s functionality shall be conducted at least once a year (the record of the annual test of the speed-reducing switch system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - g. A successful test of the traction monitoring system’s functionality shall be conducted at least once a year (the record of the annual test of the traction monitoring system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - h. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the maintenance, inspection, and testing of the speed-reducing switch and traction monitoring systems. The Applicant shall make the procedures available to Cal/OSHA upon

request.

12. The speed governor rope and sheaves shall comply with the following:

- a. The governor shall be used in conjunction with a 6 mm (0.25 in.) diameter steel governor rope with 6-strand, regular lay construction.
- b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
- c. The governor sheaves shall have a pitch diameter of not less than 180 mm (7.1 in.).

13. All medical emergency service elevators shall comply with the following:

- a. The requirements of the 2019 California Building Code (CBC), section 3002.4.1a;

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5inch (127 mm) radius corners] in the horizontal, open position.

- b. All medical emergency service elevators shall be identified in the building construction documents in accordance with the 2019 CBC, section 3002.4a.
- c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).

14. The elevator shall be serviced, maintained, adjusted, tested, and inspected only by Certified Competent Conveyance Mechanics who have been trained to, and are competent to, perform those tasks on the Gen3 Edge/Gen2S/Gen3 Core elevator system in accordance with the written procedures and criteria required by Condition No. 3 and in accordance with the terms of this permanent variance.
15. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing, or testing of the elevators shall be provided a copy of this variance decision.
16. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and a Permit to Operate shall be issued before the elevator is placed in service.
17. The Applicant shall be subject to the Suspension Means – Replacement Reporting Condition stated in Addendum 2, as hereby incorporated by this reference.
18. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications.
19. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in

accordance with the Board's procedural regulations at section 426, subdivision (b).

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 29, 2026



Kelly Chau, Hearing Officer

ADDENDUM 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and, Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA-Elevator Unit HQS

ADDENDUM 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Otis Gen2S/Gen3Edge/Gen3 Core Elevator & Medical Emergency Car Dimensions

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-351	Logos St Rest Holdings 1, LLC	706 W. 85th St. Los Angeles, CA	1

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Dan Leacox, with Leacox & Associates, and Wolter Geesink with Otis Elevator Company appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each Applicant intends to utilize Otis Gen3 Edge/Gen2S/Gen3 Core elevators at the locations and in the numbers stated in the above section A.1 table. Applicant may utilize the variance from minimum inside car platform dimensions for other elevators designated for emergency medical service at the same variance location.
2. The installation contracts for these elevators were or will be signed on or after May 1, 2008, making the elevators subject to the Group IV Elevator Safety Orders.
3. The Board incorporates by reference the relevant findings in previous Board decisions:
 - a. Items D.3 through D.9 of the Proposed Decision adopted by the Board on July 18, 2013 for Permanent Variance No. 12-V-093;
 - b. Item D.4 of the Proposed Decision adopted by the Board on September 25, 2014 for Permanent Variance No. 14-V-206;
 - c. Item B of the Proposed Decision adopted by the Board on September 15, 2022 for Permanent Variance No. 22-V-302 regarding medical emergency car dimensions; and
 - d. Items C and D of the Proposed Decision adopted by the Board on June 20, 2024 for Permanent Variance No. 24-V-193 regarding the Gen3 Core elevator equivalent safety.
4. Cal/OSHA, by way of written submissions to the record (Exhibit PD-3), and position stated at hearing, is of the well informed opinion that grant of requested permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment, and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the Elevator Safety Order requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above section A table shall have permanent variances from the following sections of ASME A17.1-2004 that section 3141 makes applicable to the elevators the subject of those applications:

- **Car top railing:** sections 2.14.1.7.1 (to permit an inset car top railing, if, in fact, the car top railing is inset);
- **Speed governor over-speed switch:** 2.18.4.2.5(a) (to permit the use of the speed reducing system proposed by the Applicants, where the speed reducing switch resides in the controller algorithms, rather than on the governor, with the necessary speed input supplied by the main encoder signal from the motor);
- **Governor rope diameter:** 2.18.5.1 (to allow the use of reduced diameter governor rope);
- **Pitch diameter:** 2.18.7.4 (to permit the use of the speed-reducing system proposed by the Applicant, where the rope sheave pitch diameter is not less than 180 mm [7.1 in.]);
- **Suspension means:** 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4 and 2.20.9.5.4—the variances from these “suspension means” provisions to permit the use of Otis Gen2 flat coated steel suspension belts in lieu of conventional steel suspension ropes;
- **Inspection transfer switch:** 2.26.1.4.4(a) (to allow the inspection transfer switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room); and
- **Seismic reset switch:** 8.4.10.1.1(a)(2)(b) (to allow the seismic reset switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room).
- **Minimum Inside Car Platform Dimensions:** 3041(e)(1)(C) and 3141.7(b) (to comply with the performance-based requirements of the 2019 California Building Code section 3002.4.1a)

These variances apply to the locations and numbers of elevators stated in the section A table (so long as the elevators are Gen3 Edge/Gen2S Group and Gen3 Core & Medical Emergency Elevator Car Dimensions (Group IV) that are designed, equipped, and installed in accordance with, and are otherwise consistent with, and are subject to the following conditions:

1. The suspension system shall comply with the following:
 - a. The coated steel belt and connections shall have factors of safety equal to those permitted for use by section 3141 [ASME A17.1-2004, section 2.20.3] on wire rope suspended elevators.
 - b. Steel coated belts that have been installed and used on another installation shall not be reused.
 - c. The coated steel belt shall be fitted with a monitoring device which has been accepted by Cal/OSHA and which will automatically stop the car if the residual strength of any single belt drops below 60 percent. If the residual strength of any single belt drops below 60 percent, the device shall prevent the elevator from restarting after a normal stop at a landing.
 - d. Upon initial inspection, the readings from the monitoring device shall be documented and submitted to Cal/OSHA.
 - e. A successful test of the monitoring device’s functionality shall be conducted at least once a year (the record of the annual test of the monitoring device shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - f. The coated steel belts used shall be accepted by Cal/OSHA.

2. With respect to each elevator subject to this variance, the applicant shall comply with Cal/OSHA Circular Letter E-10-04, the substance of which is attached hereto as Addendum 1 and incorporated herein by this reference.
3. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection, and testing of the belts and monitoring device and criteria for belt replacement, and the applicant shall make those procedures and criteria available to Cal/OSHA upon request.
4. The flat coated steel belts shall be provided with a metal data tag that is securely attached to one of those belts. This data tag shall bear the following flat steel coated belt data:
 - a. The width and thickness in millimeters or inches;
 - b. The manufacturer's rated breaking strength in (kN) or (lbf);
 - c. The name of the person or organization that installed the flat coated steel belts;
 - d. The month and year the flat coated steel belts were installed;
 - e. The month and year the flat coated steel belts were first shortened;
 - f. The name or trademark of the manufacturer of the flat coated steel belts; and
 - g. Lubrication information.
5. There shall be a crosshead data plate of the sort required by section 2.20.2.1, and that plate shall bear the following flat steel coated belt data:
 - a. The number of belts;
 - b. The belt width and thickness in millimeters or inches; and
 - c. The manufacturer's rated breaking strength per belt in (kN) or (lbf).
6. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of elevator equipment in the hoistway is required. If service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
7. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on railings to perform adjustment, maintenance, repairs or inspections. The applicant shall not permit anyone to stand on or climb over the car top railing.
 - b. The distance that the car top railing may be inset shall be limited to no more than 6 inches.
 - c. All exposed areas outside the car top railing shall preclude standing or placing objects or persons which may fall and shall be beveled from the mid- or top rail to the outside of the car top.
 - d. The top of the beveled area and/or car top outside the railing, shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
 - e. The applicant shall provide durable signs with lettering not less than ½ inch on a

contrasting background on each inset railing; each sign shall state:

**CAUTION
DO NOT STAND ON OR CLIMB OVER RAILING**

- f. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing shall be measured from the car top and not from the required bevel).
- 8. If the seismic reset switch does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
- 9. If the inspection transfer switch required by ASME A17.1, rule 2.26.1.4.4(a) does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
- 10. When the inspection and testing panel is located in the hoistway door jamb, the inspection and test control panel shall be openable only by use of a Security Group I restricted key.
- 11. The governor speed-reducing switch function shall comply with the following:
 - a. It shall be used only with direct drive machines; i.e., no gear reduction is permitted between the drive motor and the suspension means.
 - b. The velocity encoder shall be coupled to the driving machine motor shaft. The “C” channel of the encoder shall be utilized for velocity measurements required by the speed reducing system. The signal from “C” channel of the encoder shall be verified with the “A” and “B” channels for failure. If a failure is detected then an emergency stop shall be initiated.
 - c. Control system parameters utilized in the speed-reducing system shall be held in non-volatile memory.
 - d. It shall be used in conjunction with approved car-mounted speed governors only.
 - e. It shall be used in conjunction with an effective traction monitoring system that detects a loss of traction between the driving sheave and the suspension means. If a loss of traction is detected, then an emergency stop shall be initiated.
 - f. A successful test of the speed-reducing switch system’s functionality shall be conducted at least once a year (the record of the annual test of the speed-reducing switch system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - g. A successful test of the traction monitoring system’s functionality shall be conducted at least once a year (the record of the annual test of the traction monitoring system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - h. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the maintenance, inspection, and testing of the speed-reducing switch and traction monitoring systems. The Applicant shall make the procedures available to Cal/OSHA upon

request.

12. The speed governor rope and sheaves shall comply with the following:

- a. The governor shall be used in conjunction with a 6 mm (0.25 in.) diameter steel governor rope with 6-strand, regular lay construction.
- b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
- c. The governor sheaves shall have a pitch diameter of not less than 180 mm (7.1 in.).

13. All medical emergency service elevators shall comply with the following:

- a. The requirements of the 2019 California Building Code (CBC), section 3002.4.1a;

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5inch (127 mm) radius corners] in the horizontal, open position.

- b. All medical emergency service elevators shall be identified in the building construction documents in accordance with the 2019 CBC, section 3002.4a.
- c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).

- 14. The elevator shall be serviced, maintained, adjusted, tested, and inspected only by Certified Competent Conveyance Mechanics who have been trained to, and are competent to, perform those tasks on the Gen3 Edge/Gen2S/Gen3 Core elevator system in accordance with the written procedures and criteria required by Condition No. 3 and in accordance with the terms of this permanent variance.
- 15. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing, or testing of the elevators shall be provided a copy of this variance decision.
- 16. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and a Permit to Operate shall be issued before the elevator is placed in service.
- 17. The Applicant shall be subject to the Suspension Means – Replacement Reporting Condition stated in Addendum 2, as hereby incorporated by this reference.
- 18. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications.
- 19. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in

accordance with the Board's procedural regulations at section 426, subdivision (b).

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 29, 2026



Kelly Chau, Hearing Officer

ADDENDUM 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and, Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA-Elevator Unit HQS

ADDENDUM 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Otis Gen2S/Gen3Edge/Gen3 Core Elevator & Medical Emergency Car Dimensions

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-352	Chinese Christian Alliance Church, Inc. of the Christian and Missionary Alliance of Northridge California	15950 Chatsworth St. Granada Hills, CA	1

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Dan Leacox, with Leacox & Associates, and Wolter Geesink with Otis Elevator Company appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit

PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing
PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each Applicant intends to utilize Otis Gen3 Edge/Gen2S/Gen3 Core elevators at the locations and in the numbers stated in the above section A.1 table. Applicant may utilize the variance from minimum inside car platform dimensions for other elevators designated for emergency medical service at the same variance location.
2. The installation contracts for these elevators were or will be signed on or after May 1, 2008, making the elevators subject to the Group IV Elevator Safety Orders.
3. The Board incorporates by reference the relevant findings in previous Board decisions:
 - a. Items D.3 through D.9 of the Proposed Decision adopted by the Board on July 18, 2013 for Permanent Variance No. 12-V-093;
 - b. Item D.4 of the Proposed Decision adopted by the Board on September 25, 2014 for Permanent Variance No. 14-V-206;
 - c. Item B of the Proposed Decision adopted by the Board on September 15, 2022 for Permanent Variance No. 22-V-302 regarding medical emergency car dimensions; and
 - d. Items C and D of the Proposed Decision adopted by the Board on June 20, 2024 for Permanent Variance No. 24-V-193 regarding the Gen3 Core elevator equivalent safety.
4. Cal/OSHA, by way of written submissions to the record (Exhibit PD-3), and position stated at hearing, is of the well informed opinion that grant of requested permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment, and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the Elevator Safety Order requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision,

each Applicant listed in the above section A table shall have permanent variances from the following sections of ASME A17.1-2004 that section 3141 makes applicable to the elevators the subject of those applications:

- **Car top railing:** sections 2.14.1.7.1 (to permit an inset car top railing, if, in fact, the car top railing is inset);
- **Speed governor over-speed switch:** 2.18.4.2.5(a) (to permit the use of the speed reducing system proposed by the Applicants, where the speed reducing switch resides in the controller algorithms, rather than on the governor, with the necessary speed input supplied by the main encoder signal from the motor);
- **Governor rope diameter:** 2.18.5.1 (to allow the use of reduced diameter governor rope);
- **Pitch diameter:** 2.18.7.4 (to permit the use of the speed-reducing system proposed by the Applicant, where the rope sheave pitch diameter is not less than 180 mm [7.1 in.]);
- **Suspension means:** 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4 and 2.20.9.5.4—the variances from these “suspension means” provisions to permit the use of Otis Gen2 flat coated steel suspension belts in lieu of conventional steel suspension ropes;
- **Inspection transfer switch:** 2.26.1.4.4(a) (to allow the inspection transfer switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room); and
- **Seismic reset switch:** 8.4.10.1.1(a)(2)(b) (to allow the seismic reset switch to reside at a location other than a machine room, if, in fact, it does not reside in the machine room).
- **Minimum Inside Car Platform Dimensions:** 3041(e)(1)(C) and 3141.7(b) (to comply with the performance-based requirements of the 2019 California Building Code section 3002.4.1a)

These variances apply to the locations and numbers of elevators stated in the section A table (so long as the elevators are Gen3 Edge/Gen2S Group and Gen3 Core & Medical Emergency Elevator Car Dimensions (Group IV) that are designed, equipped, and installed in accordance with, and are otherwise consistent with, and are subject to the following conditions:

1. The suspension system shall comply with the following:
 - a. The coated steel belt and connections shall have factors of safety equal to those permitted for use by section 3141 [ASME A17.1-2004, section 2.20.3] on wire rope suspended elevators.
 - b. Steel coated belts that have been installed and used on another installation shall not be reused.
 - c. The coated steel belt shall be fitted with a monitoring device which has been accepted by Cal/OSHA and which will automatically stop the car if the residual strength of any single belt drops below 60 percent. If the residual strength of any single belt drops below 60 percent, the device shall prevent the elevator from restarting after a normal stop at a landing.
 - d. Upon initial inspection, the readings from the monitoring device shall be documented and submitted to Cal/OSHA.

- e. A successful test of the monitoring device's functionality shall be conducted at least once a year (the record of the annual test of the monitoring device shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - f. The coated steel belts used shall be accepted by Cal/OSHA.
2. With respect to each elevator subject to this variance, the applicant shall comply with Cal/OSHA Circular Letter E-10-04, the substance of which is attached hereto as Addendum 1 and incorporated herein by this reference.
 3. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection, and testing of the belts and monitoring device and criteria for belt replacement, and the applicant shall make those procedures and criteria available to Cal/OSHA upon request.
 4. The flat coated steel belts shall be provided with a metal data tag that is securely attached to one of those belts. This data tag shall bear the following flat steel coated belt data:
 - a. The width and thickness in millimeters or inches;
 - b. The manufacturer's rated breaking strength in (kN) or (lbf);
 - c. The name of the person or organization that installed the flat coated steel belts;
 - d. The month and year the flat coated steel belts were installed;
 - e. The month and year the flat coated steel belts were first shortened;
 - f. The name or trademark of the manufacturer of the flat coated steel belts; and
 - g. Lubrication information.
 5. There shall be a crosshead data plate of the sort required by section 2.20.2.1, and that plate shall bear the following flat steel coated belt data:
 - a. The number of belts;
 - b. The belt width and thickness in millimeters or inches; and
 - c. The manufacturer's rated breaking strength per belt in (kN) or (lbf).
 6. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of elevator equipment in the hoistway is required. If service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
 7. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on railings to perform adjustment, maintenance, repairs or inspections. The applicant shall not permit anyone to stand on or climb over the car top railing.
 - b. The distance that the car top railing may be inset shall be limited to no more than 6 inches.
 - c. All exposed areas outside the car top railing shall preclude standing or placing objects or persons which may fall and shall be beveled from the mid- or top rail to the outside of the

car top.

- d. The top of the beveled area and/or car top outside the railing, shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
- e. The applicant shall provide durable signs with lettering not less than ½ inch on a contrasting background on each inset railing; each sign shall state:

CAUTION
DO NOT STAND ON OR CLIMB OVER RAILING

- f. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing shall be measured from the car top and not from the required bevel).
-
- 8. If the seismic reset switch does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
 - 9. If the inspection transfer switch required by ASME A17.1, rule 2.26.1.4.4(a) does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the inspection and test control panel located in one upper floor hoistway door jamb or in the control space (outside the hoistway) used by the motion controller.
 - 10. When the inspection and testing panel is located in the hoistway door jamb, the inspection and test control panel shall be openable only by use of a Security Group I restricted key.
 - 11. The governor speed-reducing switch function shall comply with the following:
 - a. It shall be used only with direct drive machines; i.e., no gear reduction is permitted between the drive motor and the suspension means.
 - b. The velocity encoder shall be coupled to the driving machine motor shaft. The “C” channel of the encoder shall be utilized for velocity measurements required by the speed reducing system. The signal from “C” channel of the encoder shall be verified with the “A” and “B” channels for failure. If a failure is detected then an emergency stop shall be initiated.
 - c. Control system parameters utilized in the speed-reducing system shall be held in non-volatile memory.
 - d. It shall be used in conjunction with approved car-mounted speed governors only.
 - e. It shall be used in conjunction with an effective traction monitoring system that detects a loss of traction between the driving sheave and the suspension means. If a loss of traction is detected, then an emergency stop shall be initiated.
 - f. A successful test of the speed-reducing switch system’s functionality shall be conducted at least once a year (the record of the annual test of the speed-reducing switch system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).
 - g. A successful test of the traction monitoring system’s functionality shall be conducted at

least once a year (the record of the annual test of the traction monitoring system shall be a maintenance record subject to ASME A17.1-2004, section 8.6.1.4).

- h. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the maintenance, inspection, and testing of the speed-reducing switch and traction monitoring systems. The Applicant shall make the procedures available to Cal/OSHA upon request.

12. The speed governor rope and sheaves shall comply with the following:

- a. The governor shall be used in conjunction with a 6 mm (0.25 in.) diameter steel governor rope with 6-strand, regular lay construction.
- b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
- c. The governor sheaves shall have a pitch diameter of not less than 180 mm (7.1 in.).

13. All medical emergency service elevators shall comply with the following:

- a. The requirements of the 2019 California Building Code (CBC), section 3002.4.1a;

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5inch (127 mm) radius corners] in the horizontal, open position.

- b. All medical emergency service elevators shall be identified in the building construction documents in accordance with the 2019 CBC, section 3002.4a.
- c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).

14. The elevator shall be serviced, maintained, adjusted, tested, and inspected only by Certified Competent Conveyance Mechanics who have been trained to, and are competent to, perform those tasks on the Gen3 Edge/Gen2S/Gen3 Core elevator system in accordance with the written procedures and criteria required by Condition No. 3 and in accordance with the terms of this permanent variance.

15. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing, or testing of the elevators shall be provided a copy of this variance decision.


16. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and a Permit to Operate shall be issued before the elevator is placed in service.

17. The Applicant shall be subject to the Suspension Means – Replacement Reporting Condition stated in Addendum 2, as hereby incorporated by this reference.

18. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications.
19. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in accordance with the Board's procedural regulations at section 426, subdivision (b).

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 29, 2026

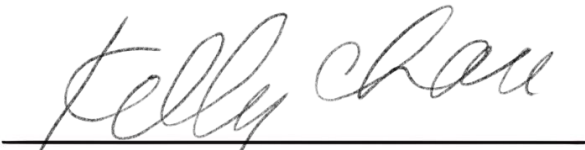

Kelly Chau, Hearing Officer

ADDENDUM 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and, Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA-Elevator Unit HQS

ADDENDUM 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

KONE Monospace 500 Elevators & Medical Emergency Elevator Car Dimensions (Group IV)

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-353	Jefferson Union H.S. District	6996 Mission St. Daly City, CA	2

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Fuei Saetern, with KONE INC., appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each respective Applicant intends to utilize the KONE, Inc. Monospace 500 type elevator, in the quantity, at the location, specified per the above section A.1 table.
2. The installation contract for this elevator was or will be signed on or after May 1, 2008, thus making the elevator subject to the Group IV Elevator Safety Orders.
3. Each Applicant proposes to use hoisting ropes that are 8 mm in diameter which also consist of 0.51 mm diameter outer wires, in variance from the express requirements of ASME A17.1-2004, section 2.20.4.
4. In relevant part, ASME A17.1-2004, section 2.20.4 states:

2.20.4 Minimum Number and Diameter of Suspension Ropes

...The minimum diameter of hoisting and counterweight ropes shall be 9.5 mm (0.375 in.). Outer wires of the ropes shall be not less than 0.56 mm (0.024 in.) in diameter.

5. An intent of ASME A17.1-2004, section 2.20.4, is to ensure that the number, diameter, and construction of suspension ropes are adequate to provided safely robust and durable suspension means over the course of the ropes' foreseen service life.
6. KONE has represented to Cal/OSHA, having established an engineering practice for purposes of Monospace 500 elevator design, of meeting or exceeding the minimum factor of safety of 12 for 8 mm suspension members, as required in ASME A17.1-2010 - under which, given that factor of safety, supplemental broken suspension member protection is not required.
7. Also, each Applicant proposes as a further means of maintaining safety equivalence, monitoring the rope in conformity with the criteria specified within the *Inspector's Guide to 6 mm Diameter Governor and 8 mm Diameter Suspension Ropes for KONE Elevators* (per Application attachment "B", or as thereafter revised by KONE subject Cal/OSHA approval).
8. In addition, each Applicant has proposed to utilize 6 mm diameter governor ropes in variance from Title 8, section 3141, incorporated ASME A17.1-2004, section 2.18.5.1.
9. ASME A17.1-2004, section 2.18.5.1, specifies, in relevant part:

2.18.5.1 Material and Factor of Safety.

... [Governor ropes] not less than 9.5 mm (0.375 in.) in diameter. The factor of safety of governor ropes shall be not less than 5...

10. The Board takes notice of section 3141.7, subpart (a)(10):

A reduced diameter governor rope of equivalent construction and material to that required by ASME A17.1-2004, is permissible if the factor of safety as related to the strength necessary to

activate the safety is 5 or greater;

11. Applicants propose use of 6mm governor rope having a safety factor of 5 or greater, in conformity with section 3141.7(a)(10), the specific parameters of which, being expressly set out within the Elevator Safety Orders (ESO), take precedence over more generally referenced governor rope diameter requirements per ASME A17.1-2004, section 2.18.5.1. Accordingly, the governor rope specifications being presently proposed, inclusive of a factor of safety of 5 or greater, would comply with current requirements, and therefore not be subject to issuance of permanent variance.
12. Absent evident diminution in elevator safety, over the past decade the Board has issued numerous permanent variances for use in KONE (Ecospace) elevator systems of 8 mm diameter suspension rope materially similar to that presently proposed (e.g. Permanent Variance Nos. 06-V-203, 08-V-245, and 13-V-303).
13. As noted by the Board in permanent Variance Nos. 18-V-044, and 18-V-045, Decision and Order Findings, subpart B.17 (hereby incorporated by reference), the strength of wire rope operating as an elevator's suspension means does not remain constant over its years of projected service life. With increasing usage cycles, a reduction in the cross-sectional area of the wire rope normally occurs, resulting in decreased residual strength. This characteristic is of particular relevance to the present matter because, decreasing wire rope diameter is associated with a higher rate of residual strength loss. This foreseeable reduction in cross-sectional area primarily results from elongation under sheave rounding load, as well as from wear, and wire or strand breaks. However, these characteristics need not compromise elevator safety when properly accounted for in the engineering of elevator suspension means, and associated components.
14. The presently proposed wire rope is Wuxi Universal steel rope Co LTD. 8 mm 8x19S+8x7+PP, with a manufacturer rated breaking strength of 35.8 kN, and an outer wire diameter of less than 0.56 mm, but not less than 0.51 mm. Cal/OSHA's safety engineer has scrutinized the material and structural specifications, and performance testing data, of this particular proposed rope, and concluded it will provide for safety equivalent to ESO compliant 9.5 mm wire rope, with 0.56 mm outer wire (under conditions of use included within the below Decision and Order).
15. The applicant supplies tabulated data regarding the "Maximum Static Load on All Suspension Ropes." To obtain the tabulated data, the applicant uses the following formula derived from ASME A17.1-2004, section 2.20.3:

$$W = \frac{(S \times N)}{f} \quad \text{where:}$$

W = maximum static load imposed on all car ropes with the car and its rated load at any position in the hoistway

N = number of runs of rope under load. For 2:1 roping, N shall be two times the number of ropes used, etc.

S = manufacturer's rated breaking strength of one rope

f = the factor of safety from Table 2.20.3

16. ASME A17.1-2010 sections 2.20.3 and 2.20.4 utilize the same formula, but provide for use of suspension ropes having a diameter smaller than 9.5 mm, under specified conditions, key among them being that use of ropes having a diameter of between 8 mm to 9.5 mm be engineered with a factor of safety of 12 or higher. This is a higher minimum factor of safety than that proposed by Applicant but a minimum recommended by Cal/OSHA as a condition of variance necessary to the achieving of safety equivalence to 9.5 mm rope.
17. Cal/OSHA is in accord with Applicant, in proposing as a condition of safety equivalence, that periodic physical examination of the wire ropes be performed to confirm the ropes continue to meet the criteria set out in the (Application attachment) *Inspector's Guide to 6 mm Diameter Governor and 8 mm Diameter Suspension Ropes for KONE Elevators*. Adherence to this condition will provide an additional assurance of safety equivalence, regarding smaller minimum diameter suspension rope outer wire performance over the course of its service life.
18. Applicant requests a permanent variance from section 3041, subdivision (e)(1)(C), which states:
- (1) All buildings and structures constructed after the effective date of this order that are provided with one or more passenger elevators shall be provided with not less than one passenger elevator designed and designated to accommodate the loading and transport of an ambulance gurney or stretcher maximum size 22 ½ in. (572 mm) by 75 in. (1.90 m) in its horizontal position and arranged to serve all landings in conformance with the following:
- ...
- (C) The elevator car shall have a minimum inside car platform of 80 in. (2.03 m) wide by 51 in. (1.30 m) deep.
- The intent of this language is to ensure that there is enough space to accommodate the access and egress of a gurney and medical personnel inside of a medical service elevator.
- This standard is made applicable to Group IV by section 3141.7, subdivision (b), which reads, "Elevators utilized to provide medical emergency service shall comply with Group II, section 3041(e)."
19. Applicant proposes to comply with the requirements of the 2019 California Building Code, section 3002.4.1a in the design of its medical emergency service elevator. That section requires:
- The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5-inch (127 mm) radius corners] in the horizontal, open position.
- The purpose of this requirement is to ensure that an elevator designated for emergency medical service will accommodate a minimum of two emergency personnel with an ambulance gurney or stretcher.
20. Cal/OSHA, by way of written submission to the record (Exhibit PD3), and stated position at hearing, is of the well informed opinion that grant of permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment, and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each Application being the subject of this proceeding, per above section A.1 table, is conditionally GRANTED, to the extent that each such Applicant shall be issued permanent variance from section 3141 incorporated ASME A17.1-2004, section 2.20.4, in as much as it precludes use of suspension rope of between 8 mm and 9.5 mm, or outer wire of between 0.51 mm and 0.56 mm in diameter, at such locations and numbers of Group IV KONE Monospace 500 elevators identified in each respective Application, subject to the following conditions:

1. The diameter of the hoisting steel ropes shall be not less than 8 mm (0.315 in) diameter and the roping ratio shall be two to one (2:1).
2. The outer wires of the suspension ropes shall be not less than 0.51 mm (0.02 in.) in diameter.
3. The number of suspension ropes shall be not fewer than those specified per hereby incorporated Decision and Order Appendix 1 Table.
4. The ropes shall be inspected annually for wire damage (rouge, valley break etc.) in accordance with "KONE, Inc. Inspector's Guide to 6 mm diameter and 8 mm diameter steel ropes for KONE Elevators" (per Application Exhibit B, or as thereafter amended by KONE subject to Cal/OSHA approval).
5. A rope inspection log shall be maintained and available in the elevator controller room/space at all times.
6. The elevator rated speed shall not exceed those speeds specified per the Decision and Order Appendix 1 Table.
7. The maximum suspended load shall not exceed those weights (plus 5%) specified per the Decision and Order Appendix 1 Table.
8. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of the elevator equipment in the hoistway is required. If the service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
9. The installation shall meet the suspension wire rope factor of safety requirements of ASME A17.1-2013 section 2.20.3.
10. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing or testing the elevators shall be provided a copy of this variance decision.
11. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA and a "Permit to Operate" issued before the elevator is placed in service.
12. The Applicant shall comply with suspension means replacement reporting condition per hereby

incorporated Decision and Order Appendix 2.

13. All medical emergency service elevator(s) shall comply with the following:

a. The requirements of the 2019 California Building Code (CBC) section 3002.4.1a:

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5-inch (127 mm) radius corners] in the horizontal, open position.

b. All medical emergency service elevator(s) shall be identified in the building construction documents in accordance with the 2019 California Building Code, section 3002.4a.

c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).

14. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications pursuant to sections 411.2 and 411.3.

15. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in the procedural manner prescribed.

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 23, 2026



Kelly Chau, Hearing Officer

APPENDIX 1

File Number	Elevator ID	Minimum Suspension Ropes Per Elevator	Maximum Suspended Weight Per Elevator	Maximum Speed	Rated Capacity
26-V-353	1	7	12247	150	3500
26-V-353	2	7	12247	150	3500

APPENDIX 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

KONE Monospace 300 Elevators & Medical Emergency Elevator Car Dimensions (Group IV)

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-354	Little Manila Rising Center, LLC	2154 S. San Joaquin St. Stockton, CA	1

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Fuei Saetern, with KONE INC., appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table

PD2	OSHSB Notice of Hearing
PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each respective Applicant intends to utilize the KONE, Inc. Monospace 300 type elevator, in the quantity, at the location, specified per the above section A.1 table.
2. The installation contract for this elevator was or will be signed on or after May 1, 2008, thus making the elevator subject to the Group IV Elevator Safety Orders.
3. Each Applicant proposes to use hoisting ropes that are 8 mm in diameter which also consist of 0.51 mm diameter outer wires, in variance from the express requirements of ASME A17.1-2004, section 2.20.4.
4. In relevant part, ASME A17.1-2004, section 2.20.4 states:

2.20.4 Minimum Number and Diameter of Suspension Ropes

...The minimum diameter of hoisting and counterweight ropes shall be 9.5 mm (0.375 in.). Outer wires of the ropes shall be not less than 0.56 mm (0.024 in.) in diameter.

5. An intent of ASME A17.1-2004, section 2.20.4, is to ensure that the number, diameter, and construction of suspension ropes are adequate to provide safely robust and durable suspension means over the course of the ropes' foreseen service life.
6. KONE has represented to Cal/OSHA, having established an engineering practice for purposes of Monospace 300 elevator design, of meeting or exceeding the minimum factor of safety of 12 for 8 mm suspension members, as required in ASME A17.1-2010 - under which, given that factor of safety, supplemental broken suspension member protection is not required.
7. Also, each Applicant proposes as a further means of maintaining safety equivalence, monitoring the rope in conformity with the criteria specified within the *Inspector's Guide to 6 mm Diameter Governor and 8 mm Diameter Suspension Ropes for KONE Elevators* (per Application attachment "B", or as thereafter revised by KONE subject Cal/OSHA approval).
8. In addition, each Applicant has proposed to utilize 6 mm diameter governor ropes in variance from Title 8, section 3141, incorporated ASME A17.1-2004, section 2.18.5.1.
9. ASME A17.1-2004, section 2.18.5.1, specifies, in relevant part:

2.18.5.1 Material and Factor of Safety.

... [Governor ropes] not less than 9.5 mm (0.375 in.) in diameter. The factor of safety of governor ropes shall be not less than 5...

10. The Board takes notice of section 3141.7, subpart (a)(10):

A reduced diameter governor rope of equivalent construction and material to that required by ASME A17.1-2004, is permissible if the factor of safety as related to the strength necessary to activate the safety is 5 or greater;

11. Applicants propose use of 6mm governor rope having a safety factor of 5 or greater, in conformity with section 3141.7(a)(10), the specific parameters of which, being expressly set out within the Elevator Safety Orders (ESO), take precedence over more generally referenced governor rope diameter requirements per ASME A17.1-2004, section 2.18.5.1. Accordingly, the governor rope specifications being presently proposed, inclusive of a factor of safety of 5 or greater, would comply with current requirements, and therefore not be subject to issuance of permanent variance.
12. Absent evident diminution in elevator safety, over the past decade the Board has issued numerous permanent variances for use in KONE (Ecospace) elevator systems of 8 mm diameter suspension rope materially similar to that presently proposed (e.g. Permanent Variance Nos. 06-V-203, 08-V-245, and 13-V-303).
13. As noted by the Board in permanent Variance Nos. 18-V-044, and 18-V-045, Decision and Order Findings, subpart B.17 (hereby incorporated by reference), the strength of wire rope operating as an elevator's suspension means does not remain constant over its years of projected service life. With increasing usage cycles, a reduction in the cross-sectional area of the wire rope normally occurs, resulting in decreased residual strength. This characteristic is of particular relevance to the present matter because, decreasing wire rope diameter is associated with a higher rate of residual strength loss. This foreseeable reduction in cross-sectional area primarily results from elongation under sheave rounding load, as well as from wear, and wire or strand breaks. However, these characteristics need not compromise elevator safety when properly accounted for in the engineering of elevator suspension means, and associated components.
14. The presently proposed wire rope is Wuxi Universal steel rope Co LTD. 8 mm 8x19S+8x7+PP, with a manufacturer rated breaking strength of 35.8 kN, and an outer wire diameter of less than 0.56 mm, but not less than 0.51 mm. Cal/OSHA's safety engineer has scrutinized the material and structural specifications, and performance testing data, of this particular proposed rope, and concluded it will provide for safety equivalent to ESO compliant 9.5 mm wire rope, with 0.56 mm outer wire (under conditions of use included within the below Decision and Order).
15. The applicant supplies tabulated data regarding the "Maximum Static Load on All Suspension Ropes." To obtain the tabulated data, the applicant uses the following formula derived from ASME A17.1 2004, section 2.20.3:

$$W = \frac{(S \times N)}{f} \quad \text{where:}$$

W = maximum static load imposed on all car ropes with the car and its rated load at any position in the hoistway

N = number of runs of rope under load. For 2:1 roping, N shall be two times the number of ropes used, etc.

S = manufacturer's rated breaking strength of one rope

f = the factor of safety from Table 2.20.3

16. ASME A17.1-2010 sections 2.20.3 and 2.20.4 utilize the same formula, but provide for use of suspension ropes having a diameter smaller than 9.5 mm, under specified conditions, key among them being that use of ropes having a diameter of between 8 mm to 9.5 mm be engineered with a factor of safety of 12 or higher. This is a higher minimum factor of safety than that proposed by Applicant but a minimum recommended by Cal/OSHA as a condition of variance necessary to the achieving of safety equivalence to 9.5 mm rope.
17. Cal/OSHA is in accord with Applicant, in proposing as a condition of safety equivalence, that periodic physical examination of the wire ropes be performed to confirm the ropes continue to meet the criteria set out in the (Application attachment) *Inspector's Guide to 6 mm Diameter Governor and 8 mm Diameter Suspension Ropes for KONE Elevators*. Adherence to this condition will provide an additional assurance of safety equivalence, regarding smaller minimum diameter suspension rope outer wire performance over the course of its service life.
18. Applicant requests a permanent variance from section 3041, subdivision (e)(1)(C), which states:

(1) All buildings and structures constructed after the effective date of this order that are provided with one or more passenger elevators shall be provided with not less than one passenger elevator designed and designated to accommodate the loading and transport of an ambulance gurney or stretcher maximum size 22 ½ in. (572 mm) by 75 in. (1.90 m) in its horizontal position and arranged to serve all landings in conformance with the following:

...

(C) The elevator car shall have a minimum inside car platform of 80 in. (2.03 m) wide by 51 in. (1.30 m) deep.

The intent of this language is to ensure that there is enough space to accommodate the access and egress of a gurney and medical personnel inside of a medical service elevator.

This standard is made applicable to Group IV by section 3141.7, subdivision (b), which reads, "Elevators utilized to provide medical emergency service shall comply with Group II, section 3041(e)."
19. Applicant proposes to comply with the requirements of the 2019 California Building Code, section 3002.4.1a in the design of its medical emergency service elevator. That section requires:

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5-inch (127 mm) radius corners] in the horizontal, open position.

The purpose of this requirement is to ensure that an elevator designated for emergency medical service will accommodate a minimum of two emergency personnel with an ambulance gurney or stretcher.
20. Cal/OSHA, by way of written submission to the record (Exhibit PD3), and stated position at hearing, is of the well informed opinion that grant of permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment,

and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each Application being the subject of this proceeding, per above section A.1 table, is conditionally GRANTED, to the extent that each such Applicant shall be issued permanent variance from section 3141 incorporated ASME A17.1-2004, section 2.20.4, in as much as it precludes use of suspension rope of between 8 mm and 9.5 mm, or outer wire of between 0.51 mm and 0.56 mm in diameter, at such locations and numbers of Group IV KONE Monospace 300 elevators identified in each respective Application, subject to the following conditions:

1. The diameter of the hoisting steel ropes shall be not less than 8 mm (0.315 in) diameter and the roping ratio shall be two to one (2:1).
2. The outer wires of the suspension ropes shall be not less than 0.51 mm (0.02 in.) in diameter.
3. The number of suspension ropes shall be not fewer than those specified per hereby incorporated Decision and Order Appendix 1 Table.
4. The ropes shall be inspected annually for wire damage (rouge, valley break etc.) in accordance with "KONE, Inc. Inspector's Guide to 6 mm diameter and 8 mm diameter steel ropes for KONE Elevators" (per Application Exhibit B, or as thereafter amended by KONE subject to Cal/OSHA approval).
5. A rope inspection log shall be maintained and available in the elevator controller room / space at all times.
6. The elevator rated speed shall not exceed those speeds specified per the Decision and Order Appendix 1 Table.
7. The maximum suspended load shall not exceed those weights (plus 5%) specified per the Decision and Order Appendix 1 Table.
8. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of the elevator equipment in the hoistway is required. If the service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
9. The installation shall meet the suspension wire rope factor of safety requirements of ASME A17.1-2013 section 2.20.3.
10. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing or testing the elevators shall be provided a copy of this variance decision.
11. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be


inspected by Cal/OSHA and a "Permit to Operate" issued before the elevator is placed in service.

12. The Applicant shall comply with suspension means replacement reporting condition per hereby incorporated Decision and Order Appendix 2.
13. All medical emergency service elevator(s) shall comply with the following:
 - a. The requirements of the 2019 California Building Code (CBC) section 3002.4.1a:

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5-inch (127 mm) radius corners] in the horizontal, open position.
 - b. All medical emergency service elevator(s) shall be identified in the building construction documents in accordance with the 2019 California Building Code, section 3002.4a.
 - c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).
14. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications pursuant to sections 411.2 and 411.3.
15. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in the procedural manner prescribed.

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 23, 2026

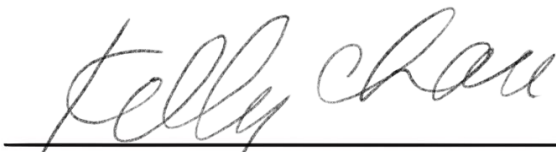

Kelly Chau, Hearing Officer

APPENDIX 1

File Number	Elevator ID	Minimum Suspension Ropes Per Elevator	Maximum Suspended Weight Per Elevator	Maximum Speed	Rated Capacity
26-V-354	1	7	12247	150	3500

APPENDIX 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding: Ascension Clarity Platform Lift	Permanent Variance No: See section A.1 table below PROPOSED DECISION Hearing Date: July 22, 2026 Location: Zoom

A. Subject Matter

1. The applicants (“Applicant”) below have applied for permanent variance from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-355	First Southern Baptist Church Beaumont	630 Oak Valley Parkway Beaumont, CA	1

2. These proceedings are conducted in accordance with Labor Code section 143, and section 401, et seq. of the Occupation Safety and Health Standards Board’s (“Board” or “OSHSB”) procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026, via videoconference by the Board with Hearing Officer, Kelly Chau, presiding and hearing the matter on its merit in accordance with section 426.
2. At the hearing, Tod Farson, appeared on behalf of the Applicant. Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health (“Cal/OSHA”).
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD-1	Application(s) for Permanent Variance per section A.1 table
PD-2	OSHSB Notice of Hearing
PD-3	Cal/OSHA Review of Variance Application
PD-4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. The Applicant proposes to utilize the Ascension Clarity 16E conveyance in the quantity, at the location, specified per the above section A.1. table.
2. The conveyance(s) at issue will have a vertical travel range of approximately 168 inches. That range of travel exceeds the 12 foot maximum vertical rise allowed by ASME A18.1-2003, section 2.7.1—the State of California standard in force at the time of this Decision.
3. Cal/OSHA's evaluation in this matter states that the more recent consensus code ASME A18.1-2005 allows for vertical platform lifts to have a travel not exceeding 14 feet (168 in.).
4. Permanent variances regarding the extended travel of vertical platform lifts, of similar configuration to that of the subject proposed model, have been previously granted, absent subsequent harm attributable to such variance being reported by Cal/OSHA. (E.g., Permanent Variance Nos. 13-V-260, 15-V-097, 17-V-270, 18-V-278, 19-V-256).
5. With respect to the equivalence or superior of safety, conditions and limitations of the Decision and Order are in material conformity with findings and conditions of prior Board permanent variance decisions, including the above cited.
6. Per its written Review of Application for Permanent Variance, Exhibit PD-3, it is the informed opinion of Cal/OSHA that equivalent safety (at minimum) will be achieved upon grant of presently requested permanent variance, subject to conditions and limitations incorporated into the below Decision and Order.

CI. Conclusive Findings

1. On the basis of the above procedural matters, legal authority, and findings of fact, the Board finds that Applicant has complied with the statutory and regulatory requirements that must be met before an application for a

permanent variance may be granted and that a preponderance of the evidence establishes that the Applicant's proposal, subject to all limiting conditions set forth in the below Decision and Order, will provide for conveyance safety, and employment and a place of employment that are as safe and healthful, as those that would prevail if the Applicant complied with the safety orders at issue.


E. Decision and Order

1. Each permanent variance application the subject of this proceeding, per above section A.1. table, is conditionally GRANTED to the extent that each such Applicant shall have permanent variance from sections 3142(a) and 3142.1 incorporated ASME A18.1-2003, section 2.7.1, inasmuch as it restricts the vertical rise of a wheelchair lift to a maximum of 12 feet, at such locations and numbers of Ascension Clarity Vertical Platform Lift conveyances identified in each respective Application, subject to the following conditions:
2. This lift may travel up to 168 inches, unless the manufacturer's instructions provide for a lesser vertical travel limit, or lesser total elevation change, in which case, travel shall be limited to the lesser limit or elevation change.
3. Durable signs with lettering not less than 5/16 inch on a contrasting background shall be permanently and conspicuously posted inside the car and at all landings indicating that the lift is for the exclusive use of persons with physical impairments and that the lift is not to be used to transport material or equipment. The use of the lift shall be limited in accordance with these signs.
4. A maintenance contract shall be executed between the owner/operator and a Certified Qualified Conveyance Company (CQCC). The contract shall stipulate that the routine preventive maintenance required by section 3094.5(a)(1) shall be performed at least quarterly and shall include but not be limited to:
 - (a) Platform driving means examination;
 - (b) Platform examination;
 - (c) Suspension means examination;
 - (d) Platform alignment;
 - (e) Vibration examination;
 - (f) Door/gate electrical; and
 - (g) Mechanical lock examination.

5. The lift shall be tested annually for proper operation under rated load conditions. Cal/OSHA's Elevator Unit District Office shall be provided written notification in advance of the test, and the test shall include a check of car or platform safety device.
6. The lift shall be shut down immediately if the lift experiences unusual noise and vibration, and the Applicant shall notify the CQCC immediately. The lift shall only be restarted by the CQCC.
7. The Applicant shall notify the CQCC if the lift shuts down for any reason. The lift shall only be restarted by the CQCC.
8. Service logs including, but not limited to, the device shutdown(s) shall be kept in the maintenance office and shall be available to Cal/OSHA. The shutdown information shall contain the date of the shutdown, cause of the shutdown, and the action taken to correct the shutdown.
9. The Applicant shall provide training on the safe operation of the lift in accordance with section 3203. Such training shall be conducted annually for all employees using or who will be assisting others in using the lift. The Applicant shall notify Cal/OSHA in writing that training has been conducted. A copy of the training manual (used for the subject training), and documentation identifying the trainer and attendees shall be maintained for at least 1 year and provided to Cal/OSHA upon request.
10. Any CQCC performing inspections, maintenance, servicing or testing of the elevators shall be provided a copy of this variance decision.
11. Cal/OSHA shall be notified when the lift is ready for inspection, and the lift shall be inspected by Cal/OSHA and a Permit to Operate shall be issued before the lift is put into service.
12. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications pursuant to California Code of Regulations, title 8, sections 411.2 and 411.3.
13. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in the procedural manner prescribed.

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

Date: July 29, 2026

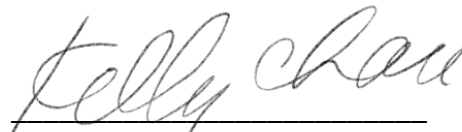

Kelly Chau, Hearing Officer

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

TK Elevator Evolution (Group IV)

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-356	Super Micro Computer Inc.	688 E. Brokaw Rd. San Jose, CA	2

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, James Day, with TK Elevator Corporation, appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Applicant proposes to utilize inset car top railings and guards in compliance with ASME 17.1-2013, section 2.14.1.7.1 and the Vivante Westside, LLC File No. 18-V-364 (Nov. 20, 2020) decision (Vivante). Applicant further claims that the request is consistent with the Vivante, the Mack Urban, LLC, Permanent Variance No. 15-V-349 (Nov. 17, 2016), and the Patton Equities, LLC Permanent Variance No. 20-V-128 (Nov. 12, 2020) decisions (Patton Equities).
2. Applicant proposes to utilize noncircular elastomeric-coated steel belts ("ECSBs") rather than steel ropes in a machine room-less ("MRL") elevator installation, with updated data plates, data tags, and wedge sockets designed for use with ECSBs, as well as the appropriate factor of safety criteria conforming to ASME 17.1-2013, with a continuous residual strength detection device ("RSDD") compliant with the San Francisco Public Works (Permanent Variance No. 21-V-061, et al.) decisions.
3. The installation shall utilize the TK Elevator Model 104DP001 RSDD, accepted by Cal/OSHA on May 4, 2021.
4. Applicant proposes to comply with ASME A17.1-2013 sections 2.26.9.3, "Protection Against Failures", rather than the requirements of 2.26.9.3 and 2.26.9.4 in the ASME 2004 code.
5. Applicant proposes to use TKE's control systems, using the TKE TAC32T Controller with SIL3 rated elements, to provide equivalent safety to ASME A17.1-2004, section 2.26.9.4 as a means to inhibit flow of Alternating Current to the Driving Motor in compliance with ASME A17.1-2013, section 2.26.9.6.
6. Applicant proposes to locate the Inspection Transfer Switch within the machinery/control room/space in the MRL installation, in compliance with ASME 17.1-2013, section 2.26.1.4.
7. Applicant proposes to locate the Seismic-Operation Reset Switch in the machinery/control room/space in the MRL installation.

D. Relevant Safety Orders

Variance Request No. 1 (ASME A17.1-2004, section 2.14.1.7.1)

2.14.1.7.1 A standard railing conforming to 2.10.2 shall be provided on the outside perimeter of the car top on all sides where the perpendicular distance between the edges of the car top and the adjacent hoistway enclosure exceeds 300 mm (12 in.) horizontal clearance.

Variance Request No. 2A (ASME A17.1-2004, section 2.20.1)

2.20.1 Suspension Means

Elevator cars shall be suspended by steel wire ropes attached to the car frame or passing around sheaves attached to the car frame specified in 2.15.1. Ropes that have previously been installed and used on another installation shall not be reused.

Only iron (low-carbon steel) or steel wire ropes, having the commercial classification "Elevator Wire Rope," or wire rope specifically constructed for elevator use, shall be used for the suspension of elevator cars and for the suspension of counterweights. The wire material for ropes shall be manufactured by the open-hearth or electric furnace process or their equivalent.

Variance Request No. 2B (ASME A17.1-2004, section 2.20.2[.1])

2.20.2.1 On Crosshead Data Plate.

The crosshead data plate required by 2.16.3 shall bear the following wire-rope data:

- (a) the number of ropes
- (b) the diameter in millimeters (mm) or inches (in.)
- (c) the manufacturer's rated breaking strength per rope in kilo Newton (kN) or pounds (lb)

Variance Request No. 2C (ASME A17.1-2004, section 2.20.2.2)

2.20.2.2 On Rope Data Tag.

A metal data tag shall be securely attached to one of the wire-rope fastenings. This data tag shall bear the following wire-rope data:

- (a) the diameter in millimeters (mm) or inches (in.)
- [...]
- (f) whether the ropes were nonpreformed or preformed
- [...]

Variance Request No. 2D. (ASME A17.1-2004, section 2.20.3)

2.20.3 Factor of Safety

The factor of safety of the suspension wire ropes shall be not less than shown in Table 2.20.3. Figure 8.2.7 gives the minimum factor of safety for intermediate rope speeds. The factor of safety shall be based on the actual rope speed corresponding to the rated speed of the car.

The factor of safety shall be calculated by the following formula:

$$f = \frac{(S \times N)}{W}$$

where:

N = number of runs of rope under load. For 2:1 roping, N shall be two times the number of ropes used, etc.

S = manufacturer's rated breaking strength of one rope

W = maximum static load imposed on all car ropes with the car and its rated load at any position in the hoistway

Variance Request No. 2E (ASME A17.1-2004, section 2.20.4)

2.20.4 Minimum Number and Diameter of Suspension Ropes

The minimum number of hoisting ropes used shall be three for traction elevators and two for drum-type elevators.

Where a car counterweight is used, the number of counterweight ropes used shall be not less than two.

The term "diameter," where used in reference to ropes, shall refer to the nominal diameter as given by the rope manufacturer.

The minimum diameter of hoisting and counterweight ropes shall be 9.5 mm (0.375 in.). Outer wires of the ropes shall be not less than 0.56 mm (0.024 in.) in diameter.

Variance Request No. 2F (ASME A17.1-2004, section 2.20.9[.1])

2.20.9 Suspension-Rope Fastening

2.20.9.1 Type of Rope Fastenings. The car and counterweight ends of suspension wire ropes, or the stationary hitch-ends where multiple roping is used, shall be fastened in such a manner that all portions of the rope, except the portion inside the rope sockets, shall be readily visible.

Fastening shall be

(a) by individual tapered rope sockets (see 2.20.9.4) or other types of rope fastenings that have undergone adequate tensile engineering tests, provided that

(1) such fastenings conform to 2.20.9.2 and 2.20.9.3;

(2) the rope socketing is such as to develop at least 80% of the ultimate breaking strength of the strongest rope to be used in such fastenings; or

(b) by individual wedge rope sockets (see 2.20.9.5); and

(c) U-bolt-type rope clamps or similar devices shall not be used for suspension rope fastenings.

Variance Request No. 3 (ASME A17.1-2004, section 2.26.9.4)

2.26.9.4 Redundant devices used to satisfy 2.26.9.3 in the determination of the occurrence of a single ground, or the failure of any single magnetically operated switch, contactor or relay, or of any single solid state device, or any single device that limits the leveling or truck zone, or a software system failure, shall be checked prior to each start of the elevator from a landing, when on automatic operation. When a single ground or failure, as specified in 2.26.9.3, occurs, the car shall not be permitted to restart. Implementation of redundancy by a software system is permitted, provided that the removal of power from the driving-machine motor and brake shall not be solely dependent on software-controlled means.

Variance Request No. 4 (ASME A17.1-2004, section 2.26.9.6.1)

2.26.9.6.1 Two separate means shall be provided to independently inhibit the flow of alternating-current through the solid state devices that connect the direct-current power source to the alternating-current driving motor. At least one of the means shall be an electromechanical relay.

Variance Request No. 5 (ASME A17.1-2004, section 2.26.1.4.4(a))

2.26.1.4.4 Machine Room Inspection Operation

(a) When machine room inspection operation is provided, it shall conform to 2.26.1.4.1, and the transfer switch shall be located in the machine room.

Variance Request No. 6 (ASME A17.1-2004, section 8.4.10.1.1(a)(2)(b))

8.4.10.1.1 Earthquake Equipment (See Also Fig. 8.4.10.1.1)

(a) All traction elevators operating at a rated speed of 0.75 m/s (150 ft/min) or more and having counterweights located in the same hoistway shall be provided with the following:

(1) seismic zone 3 or greater: a minimum of one seismic switch per building

(2) seismic zone 2 or greater:

(a) a displacement switch for each elevator

(b) an identified momentary reset button or switch for each elevator, located in the control panel in the elevator machine room [see 8.4.10.1.3(i)]

E. Decision and Order

Applicant is hereby conditionally GRANTED Permanent Variance as specified below, and to the limited extent, as of the date the Board adopts this Proposed Decision, with respect to the section A specified number of TKE EVO 200 elevator(s), at the specified location, each shall conditionally hold permanent variance from the following subparts of ASME A17.1-2004, currently incorporated by reference into section 3141 of the Elevator Safety Orders:

- Car-Top Railing: 2.14.1.7.1 (Limited to the extent necessary to permit the use of an inset car-top railing)
- Suspension Means: 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, and 2.20.9.1

(Limited to the extent necessary to permit the use of the elastomeric-coated steel belts in lieu of circular steel suspension ropes)

- Inspection transfer switch: 2.26.1.4.4(a) (Limited to the extent necessary to permit the inspection transfer switch to reside at a location other than the machine room)
- Software Reliant Means to Remove Power: 2.26.9.4 (Limited to the extent necessary to permit the exclusive use of SIL-rated software systems as a means to remove power from the driving machine motor and brake)
- SIL-Rated Circuitry to Inhibit Current Flow: 2.26.9.6.1 (Limited to the extent necessary to permit the use of SIL-rated circuitry in place of an electromechanical relay to inhibit current flow to the drive motor)
- Seismic reset switch: 8.4.10.1.1(a)(2)(b) (Limited to the extent necessary to permit the seismic reset switch to reside at a location other than the machine room)

Inset Car Top Railing (Variance Request No. 1):

1.0 Any and all inset car top railings shall comply with the following:

1.1 Serviceable equipment shall be positioned so that mechanics and inspectors do not have to stand on or climb over the railings to perform adjustments, maintenance, repairs or inspections. The Applicant shall not permit trained elevator mechanics or elevator service personnel to stand or climb over the car top railing.

1.2 The distance that the railing can be inset shall be limited to not more than six inches (6").

1.3 All exposed areas of the car top outside the car top railing where the distance from the railing to the edge of the car top exceeds two inches (2"), shall be beveled with metal, at an angle of not less than 75 degrees with the horizontal, from the mid or top rail to the outside of the car top, such that no person or object can stand, sit, kneel, rest, or be placed in the exposed areas.

1.4 The top surface of the beveled area and/or car top outside the railing, shall be clearly marked. The markings shall consist of alternating 4" diagonal red and white stripes.

1.5 The Applicant shall provide durable signs with lettering not less than 1/2 inch on a contrasting background on each inset railing; each sign shall state:

**CAUTION
STAY INSIDE RAILING
NO LEANING BEYOND RAILING
NO STEPPING ON, OR BEYOND, RAILING**

1.6 The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing will be measured from the car top and not from the required bevel).

Suspension Means (Variance Request No. 2):

2.0 The elevator suspension system shall comply with the following:

2.1 The elastomeric coated steel belts (ECSBs) and their associated fastenings shall conform to the applicable requirements of ASME A17.1-2013, sections:

2.20.4.3 – Minimum Number of Suspension Members

2.20.3 – Factor of Safety

2.20.9 – Suspension Member Fastening

2.2 Additionally, ECSBs shall meet or exceed all requirements of ASME A17.6-2010, Standard for Elevator Suspension, Compensation, and Governor Systems, Part 3 Noncircular Elastomeric Coated Steel Suspension Members for Elevators.

2.3 The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection and testing of the ECSBs and fastenings and related monitoring and detection systems and criteria for ECSB replacement, and the Applicant shall make those procedures and criteria available to the Certified Competent Conveyance Mechanic (CCCM) at the location of the elevator, and to Cal/OSHA upon request.

2.4 ECSB mandatory replacement criteria shall include:

2.4.1. Any exposed wire, strand or cord;

2.4.2. Any wire, strand or cord breaks through the elastomeric coating;

2.4.3. Any evidence of rouging (steel tension element corrosion) on any part of the elastomeric coated steel suspension member;

2.4.4. Any deformation in the elastomeric suspension member such as, but not limited to, kinks or bends.

2.5 Traction drive sheaves must have a minimum diameter of 112 mm. The maximum speed of ECSBs running on 112 mm drive sheaves shall be no greater than 6.1 m/s.

2.6 If any one (1) ECSB needs replacement, the complete set of suspension members on the elevator shall be replaced. Exception: If a new suspension member is damaged during installation, and prior to any contemporaneously installed ECSB having been placed into service, it is permissible to replace the individual damaged suspension member. ECSBs that have been installed on another installation shall not be re used.

2.7 A traction loss detection means shall be provided that conforms to the requirements of ASME A17.1-2013, section 2.20.8.1. The means shall be tested for correct function annually in accordance with ASME A17.1-2013, section 8.6.4.19.12.

2.8 A broken suspension member detection means shall be provided that conforms to the requirements of ASME A17.1-2013, section 2.20.8.2. The means shall be tested for correct function annually in accordance with ASME A17.1-2013, section 8.6.4.19.13(a).

2.9 An elevator controller integrated bend cycle monitoring system shall monitor actual ECSB bend cycles, by means of continuously counting, and storing in nonvolatile memory, the number of trips that

the ECSB makes traveling, and thereby being bent, over the elevator sheaves. The bend cycle limit monitoring means shall automatically stop the car normally at the next available landing before the bend cycle correlated residual strength of any single ECSB member drops below (60%) sixty percent of full rated strength. The monitoring means shall prevent the car from restarting. Notwithstanding any less frequent periodic testing requirement per Addendum 2 (Cal/OSHA Circular Letter), the bend cycle monitoring system shall be tested semiannually in accordance with the procedures required per above Conditions 2.3 and 2.4.

2.10 The elevator crosshead data plate shall comply with the requirements of ASME A17.1-2013, section 2.20.2.1.

2.11 A suspension means data tag shall be provided that complies with the requirements of ASME A17.1-2013, section 2.20.2.2.

2.12 Comprehensive visual inspections of the entire length of each and all installed suspension members, in conformity with above Conditions 2.3 and 2.4 specified criteria, shall be conducted and documented every six (6) months by a CCCM.

2.13 The Applicant shall be subject to the requirements per hereto attached, and inhere incorporated, Addendum 1, "Suspension Means Replacement Reporting Condition."

2.14 Records of all tests and inspections shall be maintenance records subject to ASME A17.1-2004, sections 8.6.1.2, and 8.6.1.4, respectively.

2.15 The subject elevators(s) shall be equipped with a TK Elevator Model 104DP001 Residual Strength Detection Device accepted by Cal/OSHA on May 4, 2021 or Cal/OSHA accepted equivalent device.

Control and Operating Circuits

Combined Software Redundant Devices with Software Removal of Power from Driving Motor and Brake (Variance Request No. 3)

Removal of Power from Driving Motor Without Electro-mechanical Switches (Variance Request No. 4)

3.0 The SIL rated circuitry used to provide device/circuit redundancy and to inhibit electrical current flow in accordance with ASME A17.1-2004, sections 2.26.9.4 and 2.26.9.6.1 shall comply with the following:

3.1 The SIL rated systems and related circuits shall consist of:

3.1.1. ELGO LIMAX33 RED, (aka LIMAX3R-03-050-0500-CNXTG-RJU), Safe Magnetic Absolute Shaft Information System, labeled or marked with the SIL rating (not less than SIL 3), the name or mark of the certifying organization, and the SIL certification number (968/A 163), followed by the applicable revision number (as in 968/A 163.07/19).

3.1.2 Printed circuit board assembly SSOA (6300 AHE001), labeled or marked with the SIL rating (not less than SIL 3), the name or mark of the certifying organization, and the SIL certification number (968/FSP 1347), followed by the applicable revision number (as in 968/FSP 1347.00/16).

3.1.3 Two circuit board components (Serializer S3I and S3O), each labeled or marked with the SIL rating (not less than SIL 3), the name or mark of the certifying organization and the SIL certification number (968/A 162), followed by the applicable revision number (as in 968/A 162.04/18)

3.2 The software system and related circuits shall be certified for compliance with the applicable requirements of ASME A17.1-2013, section 2.26.4.3.2.

3.3 The access door or cover of the enclosures containing the SIL rated components shall be clearly labeled or tagged on their exterior with the statement:

**Assembly contains SIL rated devices.
Refer to maintenance Control Program and wiring diagrams
prior to performing work.**

3.4 Unique maintenance procedures or methods required for the inspection, testing, or replacement of the SIL rated circuits shall be developed and a copy maintained in the elevator machine/control room/space. The procedures or methods shall include clear color photographs of each SIL rated component, with notations identifying parts and locations.

3.5 Wiring diagrams that include part identification, SIL, and certification information shall be maintained in the elevator machine/control room/space.

3.6 A successful test of the SIL rated circuits shall be conducted initially and not less than annually in accordance with the testing procedure. The test shall demonstrate that SIL rated devices, safety functions, and related circuits operate as intended.

3.7 Any alterations to the SIL rated circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the alteration of SIL rated devices, the alterations shall be made in conformance with ASME A17.1-2013, section 8.7.1.9.

3.8 Any replacement of the SIL rated circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the replacement of SIL rated devices, the replacement shall be made in conformance with ASME A17.1-2013, section 8.6.3.14.

3.9 Any repairs to the SIL rated circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the repair of SIL rated devices, the repairs shall be made in conformance with ASME A17.1-2013, section 8.6.2.6.

3.10 Any space containing SIL rated circuits shall be maintained within the temperature and humidity range specified by TKE. The temperature and humidity range shall be posted on each enclosure containing SIL rated software or circuits.

3.11 Field software changes to the SIL rated system are not permitted. Any changes to the SIL rated system's circuitry will require recertification and all necessary updates to the documentation and diagrams required by Conditions 3.4 and 3.5 above.

Inspection Transfer Switch and Seismic Reset Switch (Variance Request Nos. 5 and 6):

4.0 Inspection Transfer switch and Seismic Reset switch placement and enclosure shall comply with the following:

4.1 If the inspection transfer switch required by ASME A17.1-2004, section 2.26.1.4.4, does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the control/machinery room/space containing the elevator's control equipment in an enclosure secured by a lock openable by a Group 1 security key. The enclosure is to remain locked at all times when not in use.

4.2 If the seismic reset switch does not reside in the machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the control/machinery room/space containing the elevator's control equipment in an enclosure secured by a lock openable by a Group 1 security key. The enclosure is to remain locked at all times when not in use.

5.0 The elevator shall be serviced, maintained, adjusted, tested, and inspected only by CCCM having been trained, and competent, to perform those tasks on the TKE EVO 200 elevator system in accordance with written procedures and criteria, including as required per above Conditions 2.3, and 2.4.

6.0 Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and all applicable requirements met, including conditions of this permanent variance, prior to a Permit to Operate the elevator being issued. The elevator shall not be placed in full service prior to the Permit to Operate being issued by Cal/OSHA.

7.0 The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications pursuant to sections 411.2, and 411.3.

8.0 This Decision and Order shall remain in effect unless duly modified or revoked upon application by Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in the procedural manner prescribed by the Board's regulations.

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 28, 2026



Kelly Chau, Hearing Officer

ADDENDUM 1

SUSPENSION MEANS REPLACEMENT REPORTING REQUIREMENTS

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future):
Cal/OSHA Elevator Unit, Attn: Engineering section, 2 MacArthur Place Suite 700, Santa Ana, CA 92707.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State issued conveyance number, complete address, and Permanent Variance file number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, and certification expiration date of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which

case, the information to be reported shall be the information required by the ASME provision as modified by the variance.

- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.

In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2(a) above.

ADDENDUM 2

CIRCULAR LETTER E-10-04, October 6, 2010

TO: Installers, Manufacturers of Conveyances and Related Equipment and, Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a nonfunctional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be nonfunctional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA Elevator Unit HQ

ADDENDUM 3

- A. A Residual Strength Detection Device (RSDD) shall continuously monitor all Elastomeric Coated Steel Belt suspension members (ECSB), automatically stopping the car if the residual strength of any belt drops below 60%. The RSDD shall prevent the elevator from restarting after a normal stop at a landing. The RSDD shall device shall apply a form of electrical current and/or signal through the entire length of the steel tension elements of the ECSB and measure the current and/or signal on its return. The values measured shall be continuously compared to values that have been correlated to the remaining residual strength of the ECSB through testing. The required RSDD shall not rely upon giant magnetoresistance technology, or other magnetic measurement means, for residual strength detection or monitoring.

The RSDD must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room or controller location. The removed RSDD must be replaced or returned to proper service within 30 days. If upon routine inspection, the RSDD device is found to be in a nonfunctional state, the date and findings are to be conspicuously documented in the elevator machine room or controller location.

If upon inspection by Cal/OSHA, the RSDD is found to be nonfunctional or removed, and the required documentation is not in place, the elevator will be removed from service. If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

- B. On or before November 21 2021, and thereafter, the above specified and documented RSDD shall be installed and operational on the subject elevator.
- C. A successful functionality test of each RSDD shall be conducted once a year, and a copy of completed testing documentation conspicuously located in the machine room or within proximity of the controller.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Schindler Model 3300 Elevators, w/variant Gov. Ropes and Sheaves (Group IV)

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-358	Clairemont Rental Properties LP	4599 Clairemont Dr. San Diego, CA	1

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Pete Cuellar, with SCHINDLER ELEVATOR CORPORATION, appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each respective Applicant intends to utilize Schindler model 3300 MRL elevator cars, in the quantity, at the locations specified in Jurisdictional and Procedural Matters, section 1.
2. The installation contract for these elevators was or will be signed on or after May 1, 2008, thus making the elevator subject to the Group IV Elevator Safety Orders.
3. The Schindler model 3300 MRL elevator cars are not supported by circular steel wire ropes, as required by the Elevator Safety Orders. They utilize non circular elastomeric coated steel belts and specialized suspension means fastenings.
4. No machine room is provided, preventing the inspection transfer switch from being located in the elevator machine room. The lack of machine room also prevents the seismic reset switch from being located in the elevator machine room.
5. Applicant proposes to relocate the inspection transfer switch and seismic reset switch in an alternative enclosure.
6. Due to the use of a 6 mm (0.25 in.) governor rope with 6-strand construction, the provided governor sheave pitch diameter is less than that required by the Elevator Safety Orders.
7. The driving machine and governor are positioned in the hoistway and restrict the required overhead clearance to the elevator car top.
8. Applicant proposes to insert the car top railings at the perimeter of the car top.
9. Applicant intends to use an elevator control system, model CO NX100NA or CO NX300NA, with a standalone, solid state motor control drive system that includes devices and circuits having a Safety Integrity Level (SIL) rating to execute specific elevator safety functions.

D. Relevant Safety Order Provisions

Applicant seeks a permanent variance from section 3141 [ASME A17.1-2004, sections 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4, 2.20.9.5.4, 2.26.1.4.4(a), 8.4.10.1.1(a)(2)(b), 2.14.1.7.1, 2.18.7.4, and 2.26.9.6.1] of the Elevator Safety Orders, with respect to the suspension ropes and connections, inspection transfer switch relocation, seismic reset switch relocation, the location and construction of car-top railings, governor-sheave diameter, and means of removing power from the driving machine motor for one (1) Schindler model 3300 MRL elevator.

The relevant language of those sections are below.

1. Suspension Means

- Section 3141 [ASME A17.1-2004, section 2.20.1, Suspension Means] states in part:

- Elevator cars shall be suspended by steel wire ropes attached to the car frame or passing around sheaves attached to the car frame specified in 2.15.1. Ropes that have previously been installed and used on another installation shall not be reused. Only iron (low carbon steel) or steel wire ropes, having the commercial classification “Elevator Wire Rope,” or wire rope specifically constructed for elevator use, shall be used for the suspension of elevator cars and for the suspension of counterweights. The wire material for ropes shall be manufactured by the open hearth or electric furnace process, or their equivalent.
- Section 3141 [ASME A17.1-2004, section 2.20.2.1(b), On Crosshead Data Plate] states in part:
 - The crosshead data plate required by 2.16.3 shall bear the following wire rope data:
 - (b) the diameter in millimeters (mm) or inches (in.)
- Section 3141 [ASME A17.1-2004, section 2.20.2.2(a) and (f) On Rope Data Tag] states in part:
 - A metal data tag shall be securely attached to one of the wire rope fastenings. This data tag shall bear the following wire rope data:
 - (a) the diameter in millimeters (mm) or inches (in.)
 - [...]
 - (f) whether the ropes were non preformed or preformed
- Section 3141 [ASME A17.1-2004, section 2.20.3, Factor of Safety] states:
 - The factor of safety of the suspension wire ropes shall be not less than shown in Table 2.20.3. Figure 8.2.7 gives the minimum factor of safety for intermediate rope speeds. The factor of safety shall be based on the actual rope speed corresponding to the rated speed of the car.
 - The factor of safety shall be calculated by the following formula:

$$f = \frac{(S \times N)}{W}$$

- where:
 - N = number of runs of rope under load. For 2:1 roping, N shall be two times the number of ropes used, etc.
 - S = manufacturer's rated breaking strength of one rope
 - W = maximum static load imposed on all car ropes with the car and its rated load at any position in the hoistway

- Section 3141 [ASME A17.1-2004, section 2.20.4, Minimum Number and Diameter of Suspension Ropes] states:
 - The minimum number of hoisting ropes used shall be three for traction elevators and two for drum type elevators.
 - Where a car counterweight is used, the number of counterweight ropes used shall be not less than two.
 - The term “diameter,” where used in reference to ropes, shall refer to the nominal diameter as given by the rope manufacturer.
 - The minimum diameter of hoisting and counterweight ropes shall be 9.5 mm (0.375 in.). Outer wires of the ropes shall be not less than 0.56 mm (0.024 in.) in diameter.
- Section 3141 [ASME A17.1-2004, section 2.20.9.3.4] states:
 - Cast or forged steel rope sockets, shackle rods, and their connections shall be made of unwelded steel, having an elongation of not less than 20% in a gauge length of 50 mm (2 in.), when measured in accordance with ASTM E 8, and conforming to ASTM A 668, Class B for forged steel, and ASTM A 27, Grade 60/30 for cast steel, and shall be stress relieved. Steels of greater strength shall be permitted, provided they have an elongation of not less than 20% in a length of 50 mm (2 in.).
- Section 3141 [ASME A17.1-2004, section 2.20.9.5.4] states:
 - When the rope has been seated in the wedge socket by the load on the rope, the wedge shall be visible, and at least two wire rope retaining clips shall be provided to attach the termination side to the load carrying side of the rope (see Fig. 2.20.9.5). The first clip shall be placed a maximum of 4 times the rope diameter above the socket, and the second clip shall be located within 8 times the rope diameter above the first clip. The purpose of the two clips is to retain the wedge and prevent the rope from slipping in the socket should the load on the rope be removed for any reason. The clips shall be designed and installed so that they do not distort or damage the rope in any manner.

2. Requested Transfer Switch Placement Variance

- As it pertains to installation of the requisite transfer switch within a “machine room” location incompatible with machine-room-less design of the Schindler Model 3300 elevator, the Applicant presently seeks permanent variance from the following Elevator Safety Order incorporated ASME Code A17.1-2004, subsection:
 - Subsection 2.26.1.4.4(a)--Transfer Switch Placement in Machine Room
- Section 3141[ASME A17.1-2004, section 2.26.1.4.4(a), Machine Room Inspection Operation] states:
- When machine room inspection operation is provided, it shall conform to 2.26.1.4.1, and the transfer switch shall be
- (a) located in the machine room[.]

3. Requested Seismic Reset Switch Placement Variance

- As it pertains to installation of the requisite seismic reset switch within a “machine room” location incompatible with machine-room-less design of the Schindler Model 3300 elevator, the Applicant presently seeks permanent variance from the following Elevator Safety Order incorporated ASME Code subsection:
 - Subsection 8.4.10.1.1(a)(2)(b)--Seismic Reset Switch Placement in Machine Room
- Section 3141[ASME A17.1-2004, section 8.4.10.1.1(a)(2)(b), Earthquake Equipment] states:
 - (a) All traction elevators operating at a rated speed of 0.75 m/s (150 ft/min) or more and having counterweights located in the same hoistway shall be provided with the following:
 - (1) seismic zone 3 or greater: a minimum of one seismic switch per building
 - (2) seismic zone 2 or greater:
 - (a) a displacement switch for each elevator
 - (b) an identified momentary reset button or switch for each elevator, located in the control panel in the elevator machine room

4. Requested Car Top Railing Inset Variance

- As it pertains to top of car railing placement requiring space occupied by upper hoistway mounted elevator machinery characteristic of the Schindler Model 3300 elevator, the Applicant presently seeks permanent variance from the following Elevator Safety Order incorporated ASME Code A17.1-2004, section:
 - Section 2.14.1.7.1—Top of Car Perimeter Railing Placement
- Section 3141[ASME A17.1-2004, section 2.14.1.7.1] states:
 - A standard railing conforming to 2.10.2 shall be provided on the outside perimeter of the car top on all sides where the perpendicular distance between the edges of the car top and the adjacent hoistway enclosure exceeds 300 mm (12 in.) horizontal clearance.

5. Pitch Diameter of Governor Sheaves

- Section 3141 [ASME A17.1-2004, Section 2.18.7.4] states:
 - “The pitch diameter of governor sheaves and governor tension sheaves shall be not less than the product of the diameter of the rope and the applicable multiplier listed in Table 2.18.7.4, based on the rated speed and the number of strands in the rope.”

Table 2.18.7.4 Multiplier for Determining Governor Sheave Pitch Diameter
[from ASME A17.1-2004]

<u>Rated Speed m/s (ft./min)</u>	<u>Number of Strands</u>	<u>Multiplier</u>
1.00 or less (200 or less)	6	42
1.00 or less (200 or less)	8	30
Over 1.0 (over 200)	6	46
Over 1.0 (over 200)	8	32

6. SIL Rated System to Inhibit Current Flow to AC Drive Motor

- Section 3141[ASME A17.1-2004, section 2.26.9.6.1] states:
 - Two separate means shall be provided to independently inhibit the flow of alternating current through the solid state devices that connect the direct current power source to the alternating current driving motor. At least one of the means shall be an electromechanical relay.

E. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicant's proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Order from which variance is being sought.

F. Decision and Order

Each permanent variance application the subject of this proceeding is conditionally GRANTED as specified below, and to the extent, as of the date the Board adopts this Proposed Decision, each Applicant listed in the above table in Jurisdictional and Procedural Matters shall have permanent variances from sections 3041, subdivision (e)(1)(C) and 3141.7, subdivision (b) subject of the following conditions:

Elevator Safety Orders:

- Suspension Means: 2.20.1, 2.20.2.1, 2.20.2.2(a), 2.20.2.2(f), 2.20.3, 2.20.4, 2.20.9.3.4, and 2.20.9.5.4 (Only to the extent necessary to permit the use of the Elastomeric coated Steel Belts proposed by the Applicant, in lieu of circular steel suspension ropes.);
- Inspection transfer switch: 2.26.1.4.4(a) (Only to the extent necessary to permit the inspection transfer switch to reside at a location other than the machine room);
- Seismic reset switch: 8.4.10.1.1(a)(2)(b) (Only to the extent necessary to permit the seismic reset switch to reside at a location other than the machine room. room);

- Car Top Railing: 2.14.1.7.1 (Only to the extent necessary to permit the use of the car top railing system proposed by the Applicant, where the railing system is located inset from the elevator car top perimeter);
- Governor Rope and Sheave: The Applicant shall conditionally hold permanent variance from certain requirements of section 3141, incorporated section of ASME A17.1-2004, to the limited extent variance is necessary to allow for the below specified governor rope and governor sheave parameters: section 2.18.7.4.
- Means of Removing Power: 2.26.9.6.1 (Only to the extent necessary to permit the use of SIL rated devices and circuits as a means to remove power from the AC driving motor, where the redundant monitoring of electrical protective devices is required by the Elevator Safety Orders).

Conditions:

1. The elevator suspension system shall comply to the following:
 - a. The suspension traction media (STM) members and their associated fastenings shall conform to the applicable requirements of ASME A17.1-2013, sections:
 - 2.20.4.3 - Minimum Number of Suspension Members
 - 2.20.3 - Factor of Safety
 - 2.20.9 - Suspension Member Fastening
 - b. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection and testing of the STM members, fastenings, related monitoring and detection systems, and criteria for STM replacement. The Applicant shall make those procedures and criteria available to the Certified Competent Conveyance Mechanic (CCCM) at the location of the elevator, and to the Cal/OSHA upon request.
 - STM member mandatory replacement criteria shall include:
 - i. Any exposed wire, strand or cord;
 - ii. Any wire, strand or cord breaks through the elastomeric coating;
 - iii. Any evidence of rouging (steel tension element corrosion) on any part of the elastomeric coated steel suspension member;
 - iv. Any deformation in the elastomeric suspension member such as, but not limited to, kinks or bends;
 - c. Traction drive sheaves must have a minimum diameter of 72 mm. The maximum speed of STM members running on 72 mm, 87 mm and 125 mm drive sheaves shall be no greater than 2.5 m/s, 6.0 m/s and 8.0 m/s respectively.
 - d. If any one STM member needs replacement, the complete set of suspension members on the elevator shall be replaced. Exception: if a new suspension member is damaged during installation, and prior to any contemporaneously installed STM having been placed into service, it is permissible to replace the individual damaged suspension member. STM members that have been installed on another installation shall not be re used.

- e. A traction loss detection means shall be provided that conforms to the requirements of ASME A17.1-2013, section 2.20.8.1. The means shall be tested for correct function annually in accordance with ASME A17.1-2013, section 8.6.4.19.12.
 - f. A broken suspension member detection means shall be provided that conforms to the requirements of ASME A17.1-2013, section 2.20.8.2. The means shall be tested for correct function annually in accordance with ASME A17.1-2013, section 8.6.4.19.13(a).
 - g. An elevator controller integrated bend cycle monitoring system shall monitor actual STM bend cycles, by means of continuously counting, and storing in nonvolatile memory, the number of trips that the STM makes traveling, and thereby being bent, over the elevator sheaves. The bend cycle limit monitoring means shall automatically stop the car normally at the next available landing before the bend cycle correlated residual strength of any single STM member drops below 80 percent of full rated strength. The monitoring means shall prevent the car from restarting. The bend cycle monitoring system shall be tested annually in accordance with the procedures required by condition 1b above.
 - h. The elevator shall be provided with a device to monitor the remaining residual strength of each STM member. The device shall conform to the requirements of Cal/OSHA Circular Letter E-10-04, a copy of which is attached hereto as Exhibit 1 and incorporated herein by reference.
 - i. The elevator crosshead data plate shall comply with the requirements of ASME A17.1 2013, section 2.20.2.1.
 - j. A suspension means data tag shall be provided that complies with the requirements of ASME A17.1 2013, section 2.20.2.2.
 - k. Comprehensive visual inspections of the entire length of each and all installed suspension members, to the criteria developed in condition 1b, shall be conducted and documented every six months by a CCCM.
 - l. The Applicant shall be subject to the requirements set out in Exhibit 2 of this Decision and Order, "Suspension Means Replacement Reporting Condition," Incorporated herein by this reference.
 - m. Records of all tests and inspections shall be maintenance records subject to ASME A17.1 2004, sections 8.6.1.2 and 8.6.1.4, respectively.
2. If the inspection transfer switch required by ASME A17.1-2004, section 2.26.1.4.4 does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the control/machinery room/space containing the elevator's control equipment in an enclosure secured by a lock openable by a Group 1 security key. The enclosure is to remain locked at all times when not in use.
 3. If the seismic reset switch does not reside in the machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the control/machinery room/space containing the elevator's control equipment in an enclosure secured by a lock openable by a Group 1 security key. The enclosure is to remain locked at all times when not in use.
 4. If there is an inset car top railing:
 - a. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to climb on the railings to perform adjustments, maintenance, repairs or inspections. The

Applicant shall not permit anyone to stand or climb over the car top railing.

- b. The distance that the railing can be inset shall be limited to not more than 6 inches.
- c. All exposed areas of the car top outside the car top railing where the distance from the railing to the edge of the car top exceeds 2 inches, shall be beveled with metal, at an angle of not less than 75 degrees with the horizontal, from the mid or top rail to the outside of the car top, such that no person or object can stand, sit, kneel, rest, or be placed in the exposed areas.
- d. The top of the beveled area and/or car top outside the railing shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.
- e. The applicant shall provide durable signs with lettering not less than 1/2 inch on a contrasting background on each inset railing. Each sign shall state:

**CAUTION
STAY INSIDE RAILING
NO LEANING BEYOND RAILING
NO STEPPING ON, OR BEYOND, RAILING**

- f. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing will be measured from the car top and not from the required bevel).

5. The speed governor rope and sheaves shall comply with the following:

- a. The governor shall be used in conjunction with a steel 6 mm (0.25 in.) diameter governor rope with 6 strand, regular lay construction.
- b. The governor rope shall have a factor of safety of 8 or greater as related to the strength necessary to activate the safety.
- c. The governor sheaves shall have a pitch diameter of not less than 200 mm (7.87 in.).

6. The SIL rated devices and circuits used to inhibit electrical current flow in accordance with ASME A17.1-2004, section 2.26.9.6.1 shall comply with the following:

- a. The SIL-rated devices and circuits shall consist of a Variodyn SIL3 rated Regenerative, Variable Voltage Variable Frequency (VVVF) motor drive unit, model VAF013, VAF023, or VAF043 labeled or marked with the SIL rating (not less than SIL 3), the name or mark of the certifying organization, and the SIL certification number (968/FSP 1556.00), and followed by the applicable revision number (as in 968/FSP 1556.00/19).
- b. The devices and circuits shall be certified for compliance with the applicable requirements of ASME A17.1-2013, section 2.26.4.3.2.
- c. The access door or cover of the enclosures containing the SIL rated components shall be clearly labeled or tagged on their exterior with the statement:

Assembly contains SIL rated devices.

**Refer to Maintenance Control Program and
wiring diagrams prior to performing work.**

- d. Unique maintenance procedures or methods required for the inspection, testing, or replacement of the SIL rated circuits shall be developed and a copy maintained in the elevator machine/control room/space. The procedures or methods shall include clear color photographs of each SIL rated component, with notations identifying parts and locations.
 - e. Wiring diagrams that include part identification, SIL, and certification information shall be maintained in the elevator machine/control room/space.
 - f. A successful test of the SIL rated devices and circuits shall be conducted initially and not less than annually in accordance with the testing procedure. The test shall demonstrate that SIL rated devices, safety functions, and related circuits operate as intended.
 - g. Any alterations to the SIL rated devices and circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the alteration of SIL rated devices, the alterations shall be made in conformance with ASME A17.1-2013, section 8.7.1.9.
 - h. Any replacement of the SIL rated devices and circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the replacement of SIL rated devices, the replacement shall be made in conformance with ASME A17.1-2013, section 8.6.3.14.
 - i. Any repairs to the SIL rated devices and circuits shall be made in compliance with the Elevator Safety Orders. If the Elevator Safety Orders do not contain specific provisions for the repair of SIL rated devices, the repairs shall be made in conformance with ASME A17.1-2013, section 8.6.2.6.
 - j. Any space containing SIL rated devices and circuits shall be maintained within the temperature and humidity range specified by Schindler Elevator Corporation. The temperature and humidity range shall be posted on each enclosure containing SIL rated devices and circuits.
 - k. Field changes to the SIL rated system are not permitted. Any changes to the SIL rated system's devices and circuitry will require recertification and all necessary updates to the documentation and diagrams required by conditions d. and e. above.
7. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and all applicable requirements met, including conditions of this permanent variance, prior to a Permit to Operate the elevator being issued. The elevator shall not be placed in service prior to the Permit to Operate being issued by Cal/OSHA.
8. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way that the Applicant was required to notify them of the docketed application for permanent variance per sections 411.2 and 411.3.
9. This Decision and Order shall remain in effect unless duly modified or revoked upon application by Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in the procedural manner prescribed.

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 28, 2026



Kelly Chau, Hearing Officer

EXHIBIT 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA Elevator Unit HQS

EXHIBIT 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings. Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future):
CAL/OSHA Elevator Unit, 2 MacArthur Pl., Suite 700, Santa Ana, CA 92707, Attn: Engineering Section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance file number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.

- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

Schindler Model 5500 Elevator (Group IV)

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-359	NREA-TRC 700 LLC	750 W. 7th St. Los Angeles, CA	1

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Pete Cuellar, with SCHINDLER ELEVATOR CORPORATION, appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table
PD2	OSHSB Notice of Hearing

PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

Requested Suspension Means Related Variance:

1. As each pertains to the non-circular elastomeric coated suspension members characteristic of the Schindler Model 5500 elevator, Applicant presently seeks permanent variance from the following Elevator Safety Order incorporated ASME Safety Code for Elevators and Escalators (ASME Code) A17.1-2004 sections and subsections:
 - Section 2.20.1 - Wire rope suspension means;
 - Section 2.20.2.1 - Crosshead data plate;
 - Subsection 2.20.2.2(a) - Wire rope data tag;
 - Subsection 2.20.2.2(f) - ID of steel wire rope as preformed or nonpreformed;
 - Section 2.20.3 - Wire rope safety factor;
 - Section 2.20.4 - Number and diameter of wire ropes;
 - Section 2.20.9.3.4 - Wire rope end connections;
 - Section 2.20.9.5 - Wire rope sockets;

Requested Car Top Railing Inset Variance:

2. As it pertains to top of car railing placement requiring space occupied by upper hoistway mounted elevator machinery characteristic of the Schindler Model 5500 elevator, Applicant presently seeks permanent variance from the following title 8, Elevator Safety Order incorporated ASME Code A17.1-2004 section:

Section 2.14.1.7.1 - Top of Car Perimeter Railing Placement

Requested Seismic Reset Switch Placement Variance:

3. As it pertains to installation of the requisite seismic reset switch within a "machine room" location incompatible with machine-room-less design of the Schindler Model 5500 elevator, Applicant presently seeks permanent variance from the following title 8, Elevator Safety Order incorporated ASME Code subsection:

Subsection 8.4.10.1.1(a)(2)(b)--Seismic Reset Switch Placement in Machine Room

Requested Transfer Switch Placement Variance:

4. As it pertains to installation of the requisite transfer switch within a "machine room" location incompatible with machine-room-less design of the Schindler Model 5500 elevator, Applicant presently seeks permanent variance from the following title 8, Elevator Safety Order incorporated ASME Code A17.1-2004 subsection:

Subsection 2.26.1.4.4(a)--Transfer Switch Placement in Machine Room

Official Notice and Incorporation by Reference - Permanent Variance No. 15-V-349:

5. Per hereby entered stipulation offered at hearing by Applicant, and Cal/OSHA, concerning preexisting Board records, including decisions in matters of permanent variance from Elevator Safety Order requirements, the Board takes Official Notice and expressly incorporates herein by reference, Permanent Variance No. 15-V-349, Decision and Order adopted November 17, 2016, section D.1 - D.75 findings, and therein entered record upon which it was based.

Positions of Cal/OSHA:

6. Having fully reviewed Applicant's request for variance from the above identified Elevator Safety Order requirements, it is the opinion of Cal/OSHA, that conditionally limited grant to Applicant of permanent variance as specified per the below Decision and Order, will provide for elevator safety, and occupational safety and health, equivalent or superior to that of the Elevator Safety Order requirements from which variance is being sought. The present opinion of Cal/OSHA, to any extent it may vary from those previously held with respect to the previously heard matter in Permanent Variance No. 15-V-349, reflects further scrutiny of the subject matter, consultation between Cal/OSHA, Applicant representatives, and refinement of recommended conditions and limitations.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Applicant is hereby conditionally GRANTED Permanent Variance as stated below, to the limited extent that each enumerated conveyance at the given location shall be subject to conditionally limited permanent variance from the below specified ASME A17.1-2004, requirements incorporated by reference into section 3141.

Suspension Members: Applicant shall conditionally hold permanent variance from the following section 3141 incorporated sections and subsections of ASME A17.1-2004, to the limited extent variance is necessary to provide for use of noncircular elastomeric- coated steel suspension members and concomitant components, and configurations - section 2.20.1; section 2.20.2.1; subsection 2.20.2.2(a); subsection 2.20.2.2(f); section 2.20.3; section 2.20.4; section 2.20.9.3.4; and section 2.20.9.5.4.

Inspection Transfer Switch: Applicant shall conditionally hold permanent variance from certain requirements of the following section 3141 incorporated section of ASME A17.1-2004, to the extent variance is necessary to having the requisite inspection transfer switch located elsewhere than a machine room, within a Security Group I enclosure built into an upper floor landing door jam, or within other readily accessible and secure space shared with the motion controller outside the hoistway: section 2.26.1.4.4(a).

Seismic Safety Switch Placement: Applicant shall conditionally hold permanent variance from certain requirements of the following section 3141 incorporated section of ASME A17.1-2004, to the limited extent variance is necessary to having the requisite seismic reset switch located elsewhere than a machine room, within a Security Group I enclosure built into an upper floor landing door jam, or within other readily accessible and secure space shared with the motion controller outside the hoistway: section 8.4.10.1.1(a)(2)(b).

Car Top Railing: Applicant shall conditionally hold permanent variance from certain requirements of the following section 3141 incorporated section of ASME A17.1-2004, to the limited extent variance is necessary to provide for the below specified inseting of the subject elevator's top of car railing: section 2.14.1.7.1.

Further Conditions and Limitations:

1. The elevator suspension system shall comply with the following:

1.1. The suspension traction media (STM) members and their associated fastenings shall conform to the applicable requirements of ASME A17.1-2013, sections:

- Section 2.20.4.3 - Minimum Number of Suspension Members
- Section 2.20.3 - Factor of Safety
- Section 2.20.9 - Suspension Member Fastening

1.2. Additionally, STMs shall meet or exceed all requirements of ASME A17.6-2010 Standard for Elevator Suspension, Compensation, and Governor Systems, Part 3, Noncircular Elastomeric Coated Steel Suspension Members for Elevators.

1.3. The Applicant shall not utilize the elevator unless the manufacturer has written procedures for the installation, maintenance, inspection and testing of the STM members and fastenings and related monitoring and detection systems and criteria for STM replacement, and the Applicant shall make those procedures and criteria available to the Certified Competent Conveyance Mechanic (CCCM) at the location of the elevator, and to Cal/OSHA upon request.

1.4. STM member mandatory replacement criteria shall include:

1.4.1 Any exposed wire, strand or cord;

1.4.2 Any wire, strand or cord breaks through the elastomeric coating;

1.4.3 Any evidence of rouging (steel tension element corrosion) on any part of the

elastomeric coated steel suspension member;

1.4.4 Any deformation in the elastomeric suspension member such as, but not limited to, kinks or bends.

1.5. Traction drive sheaves must have a minimum diameter of 72 mm. The maximum speed of STM members running on 72 mm, 87 mm and 125 mm drive sheaves shall be no greater than 2.5 m/s, 6.0 m/s and 8.0 m/s respectively.

1.6. If any one STM member needs replacement, the complete set of suspension members on the elevator shall be replaced. Exception: If a new suspension member is damaged during installation, and prior to any contemporaneously installed STM having been placed into service, it is permissible to replace the individual damaged suspension member. STM members that have been installed on another installation shall not be re-used.

1.7. A traction loss detection means shall be provided that conforms to the requirements of ASME A17.1-2013, section 2.20.8.1. The means shall be tested for correct function annually in accordance with ASME A17.1-2013, section 8.6.4.19.12.

1.8. A broken suspension member detection means shall be provided that conforms to the requirements of ASME A17.1-2013, section 2.20.8.2. The means shall be tested for correct function annually in accordance with ASME A17.1-2013, section 8.6.4.19.13(a).

1.9. An elevator controller integrated bend cycle monitoring system shall monitor actual STM bend cycles, by means of continuously counting, and storing in nonvolatile memory, the number of trips that the STM makes traveling, and thereby being bent, over the elevator sheaves. The bend cycle limit monitoring means shall automatically stop the car normally at the next available landing before the bend cycle correlated residual strength of any single STM member drops below 80 percent of full rated strength. The monitoring means shall prevent the car from restarting. Notwithstanding any less frequent periodic testing requirement per Addendum 1 (Cal/OSHA Circular Letter), the bend cycle monitoring system shall be tested semi-annually in accordance with the procedures required per above Conditions 1.2, and 1.3.

1.10. Each elevator shall be provided with a device that electronically detects a reduction in residual strength of each STM member. The device shall be in compliance with Cal/OSHA Circular Letter E-10-04, a copy of which is attached hereto as Addendum 1, and incorporated herein by reference.

1.11. The elevator crosshead data plate shall comply with the requirements of ASME A17.1-2013, section 2.20.2.1.

1.12. A suspension means data tag shall be provided that complies with the requirements of ASME A17.1-2013, section 2.20.2.2.

1.13. Comprehensive visual inspections of the entire length of each and all installed suspension members, in conformity with above Conditions 1.2 and 1.3 specified criteria, shall be conducted and documented every six months by a CCM.

1.14. The Applicant shall be subject to the requirements per hereto attached, and inhere incorporated, Addendum 2, "Suspension Means Replacement Reporting Condition."

1.15. Records of all tests and inspections shall be maintenance records subject to ASME A17.1-2004, sections 8.6.1.2 and 8.6.1.4, respectively.

2. Inspection Transfer switch and Seismic Reset switch placement and enclosure shall comply with the following:

2.1. If the inspection transfer switch required by ASME A17.1-2004, Rule 2.26.1.4.4 does not reside in a machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the control/machinery room/space containing the elevator's control equipment in an enclosure secured by a lock openable by a Group 1 security key. The enclosure is to remain locked at all times when not in use.

2.2. If the seismic reset switch does not reside in the machine room, that switch shall not reside in the elevator hoistway. The switch shall reside in the control/machinery room/space containing the elevator's control equipment in an enclosure secured by a lock openable by a Group 1 security key. The enclosure is to remain locked at all times when not in use.

3. Any and all inset car top railing shall comply with the following:

3.1. Serviceable equipment shall be positioned so that mechanics and inspectors do not have to stand on or climb over the railings to perform adjustments, maintenance, repairs or inspections. The Applicant shall not permit anyone to stand or climb over the car top railing.

3.2. The distance that the railing can be inset shall be limited to not more than 12 inches.

3.3. All exposed areas of the car top outside the car top railing where the distance from the railing to the edge of the car top exceeds 2 inches, shall be beveled with metal, at an angle of not less than 75 degrees with the horizontal, from the mid or top rail to the outside of the car top, such that no person or object can stand, sit, kneel, rest, or be placed in the exposed areas.

3.4. The top surface of the beveled area and/or car top outside the railing, shall be clearly marked. The markings shall consist of alternating 4 inch diagonal red and white stripes.

3.5. The applicant shall provide durable signs with lettering not less than 1/2 inch on a contrasting background on each inset railing; each sign shall state:

**CAUTION
STAY INSIDE RAILING
NO LEANING BEYOND RAILING
NO STEPPING ON, OR BEYOND, RAILING**

3.6. The Group IV requirements for car top clearances shall be maintained (car top clearances outside the railing will be measured from the car top and not from the required

bevel).

4. The elevator shall be serviced, maintained, adjusted, tested, and inspected only by CCCM having been trained, and competent, to perform those tasks on the Schindler Model 5500 elevator system in accordance with written procedures and criteria, including as required per above Conditions 1.2, and 1.3.
5. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be inspected by Cal/OSHA, and all applicable requirements met, including conditions of this permanent variance, prior to a Permit to Operate the elevator being issued. The elevator shall not be placed in service prior to the Permit to Operate being issued by Cal/OSHA.
6. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications pursuant to sections 411.2 and 411.3.
7. This Decision and Order shall remain in effect unless modified or revoked upon application by Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in the procedural manner prescribed.

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 28, 2026



Kelly Chau, Hearing Officer

ADDENDUM 1

October 6, 2010

CIRCULAR LETTER E-10-04

TO: Installers, Manufacturers of Conveyances and Related Equipment and, Other Interested Parties

SUBJECT: Coated Steel Belt Monitoring

The Elevator Safety Orders require routine inspection of the suspension means of an elevator to assure its safe operation.

The California Labor Code section 7318 allows Cal/OSHA to promulgate special safety orders in the absence of regulation.

As it is not possible to see the steel cable suspension means of a Coated Steel Belt, a monitoring device which has been accepted by Cal/OSHA is required on all Coated Steel Belts which will automatically stop the car if the residual strength of any belt drops below 60%. The Device shall prevent the elevator from restarting after a normal stop at a landing.

The monitoring device must be properly installed and functional. A functioning device may be removed only after a determination has been made that the residual strength of each belt exceeds 60%. These findings and the date of removal are to be conspicuously documented in the elevator machine room. The removed device must be replaced or returned to proper service within 30 days.

If upon routine inspection, the monitoring device is found to be in a non-functional state, the date and findings are to be conspicuously documented in the elevator machine room.

If upon inspection by Cal/OSHA, the monitoring device is found to be non-functional or removed, and the required documentation is not in place, the elevator will be removed from service.

If the device is removed to facilitate belt replacement, it must be properly installed and functional before the elevator is returned to service.

A successful test of the device's functionality shall be conducted once a year.

This circular does not preempt Cal/OSHA from adopting regulations in the future, which may address the monitoring of Coated Steel Belts or any other suspension means.

This circular does not create an obligation on the part of Cal/OSHA to permit new conveyances utilizing Coated Steel Belts.

Debra Tudor
Principal Engineer
Cal/OSHA-Elevator Unit HQS

ADDENDUM 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.

BEFORE THE
OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
DEPARTMENT OF INDUSTRIAL RELATIONS
STATE OF CALIFORNIA

In the Matter of Application for Permanent Variance Regarding:

KONE Monospace 500 Elevators & Medical Emergency Elevator Car Dimensions (Group IV)

Permanent Variance No: See section A.1 table below

PROPOSED DECISION

Hearing Date: July 22, 2026

Location: Zoom

A. Subject Matter

1. The applicants ("Applicants") below have applied for permanent variances from provisions of the Elevator Safety Orders, found at title 8 of the California Code of Regulations. Unless otherwise noted, all references in this matter are to the California Code of Regulations, title 8. The variance applications are as follows:

Permanent Variance No.	Applicant Name	Variance Location Address	No. of Conveyances
26-V-360	Primestar Norwalk Living, LLC	12301 Ave Manuel Salinas Norwalk, CA	2

2. This proceeding is conducted in accordance with Labor Code section 143 and section 401, et seq. of the Occupational Safety and Health Standards Board's ("Board" or "OSHSB") procedural regulations.

B. Procedural

1. This hearing was held on July 22, 2026 via videoconference by the Board with Hearing Officer Kelly Chau, both presiding and hearing the matter on its merit as a basis of proposed decision to be advanced to the Board for its consideration.
2. At the hearing, Fuei Saetern, with KONE INC., appeared on behalf of each Applicant; Jose Ceja and Mark Wickens appeared on behalf of the Division of Occupational Safety and Health ("Cal/OSHA").
3. Documentary and oral evidence was received at the hearing, and by stipulation of all parties, documents were admitted into evidence:

Exhibit Number	Description of Exhibit
PD1	Application(s) for Permanent Variance per section A.1 table

PD2	OSHSB Notice of Hearing
PD3	Cal/OSHA Review of Variance Application
PD4	Review Draft-1 Proposed Decision

4. Official notice is taken of the Board's files, records, recordings and decisions concerning the Elevator Safety Order requirements from which variance shall issue. On July 22, 2026, the hearing and record closed, and the matter was taken under submission by the Hearing Officer.

C. Findings of Fact

1. Each respective Applicant intends to utilize the KONE, Inc. Monospace 500 type elevator, in the quantity, at the location, specified per the above section A.1 table.
2. The installation contract for this elevator was or will be signed on or after May 1, 2008, thus making the elevator subject to the Group IV Elevator Safety Orders.
3. Each Applicant proposes to use hoisting ropes that are 8 mm in diameter which also consist of 0.51 mm diameter outer wires, in variance from the express requirements of ASME A17.1-2004, section 2.20.4.
4. In relevant part, ASME A17.1-2004, section 2.20.4 states:

2.20.4 Minimum Number and Diameter of Suspension Ropes

...The minimum diameter of hoisting and counterweight ropes shall be 9.5 mm (0.375 in.). Outer wires of the ropes shall be not less than 0.56 mm (0.024 in.) in diameter.

5. An intent of ASME A17.1-2004, section 2.20.4, is to ensure that the number, diameter, and construction of suspension ropes are adequate to provide safely robust and durable suspension means over the course of the ropes' foreseen service life.
6. KONE has represented to Cal/OSHA, having established an engineering practice for purposes of Monospace 500 elevator design, of meeting or exceeding the minimum factor of safety of 12 for 8 mm suspension members, as required in ASME A17.1-2010 - under which, given that factor of safety, supplemental broken suspension member protection is not required.
7. Also, each Applicant proposes as a further means of maintaining safety equivalence, monitoring the rope in conformity with the criteria specified within the *Inspector's Guide to 6 mm Diameter Governor and 8 mm Diameter Suspension Ropes for KONE Elevators* (per Application attachment "B", or as thereafter revised by KONE subject Cal/OSHA approval).
8. In addition, each Applicant has proposed to utilize 6 mm diameter governor ropes in variance from Title 8, section 3141, incorporated ASME A17.1-2004, section 2.18.5.1.
9. ASME A17.1-2004, section 2.18.5.1, specifies, in relevant part:

2.18.5.1 Material and Factor of Safety.

... [Governor ropes] not less than 9.5 mm (0.375 in.) in diameter. The factor of safety of governor ropes shall be not less than 5...

10. The Board takes notice of section 3141.7, subpart (a)(10):

A reduced diameter governor rope of equivalent construction and material to that required by ASME A17.1-2004, is permissible if the factor of safety as related to the strength necessary to activate the safety is 5 or greater;

11. Applicants propose use of 6mm governor rope having a safety factor of 5 or greater, in conformity with section 3141.7(a)(10), the specific parameters of which, being expressly set out within the Elevator Safety Orders (ESO), take precedence over more generally referenced governor rope diameter requirements per ASME A17.1-2004, section 2.18.5.1. Accordingly, the governor rope specifications being presently proposed, inclusive of a factor of safety of 5 or greater, would comply with current requirements, and therefore not be subject to issuance of permanent variance.
12. Absent evident diminution in elevator safety, over the past decade the Board has issued numerous permanent variances for use in KONE (Ecospace) elevator systems of 8 mm diameter suspension rope materially similar to that presently proposed (e.g. Permanent Variance Nos. 06-V-203, 08-V-245, and 13-V-303).
13. As noted by the Board in permanent Variance Nos. 18-V-044, and 18-V-045, Decision and Order Findings, subpart B.17 (hereby incorporated by reference), the strength of wire rope operating as an elevator's suspension means does not remain constant over its years of projected service life. With increasing usage cycles, a reduction in the cross-sectional area of the wire rope normally occurs, resulting in decreased residual strength. This characteristic is of particular relevance to the present matter because, decreasing wire rope diameter is associated with a higher rate of residual strength loss. This foreseeable reduction in cross-sectional area primarily results from elongation under sheave rounding load, as well as from wear, and wire or strand breaks. However, these characteristics need not compromise elevator safety when properly accounted for in the engineering of elevator suspension means, and associated components.
14. The presently proposed wire rope is Wuxi Universal steel rope Co LTD. 8 mm 8x19S+8x7+PP, with a manufacturer rated breaking strength of 35.8 kN, and an outer wire diameter of less than 0.56 mm, but not less than 0.51 mm. Cal/OSHA's safety engineer has scrutinized the material and structural specifications, and performance testing data, of this particular proposed rope, and concluded it will provide for safety equivalent to ESO compliant 9.5 mm wire rope, with 0.56 mm outer wire (under conditions of use included within the below Decision and Order).
15. The applicant supplies tabulated data regarding the "Maximum Static Load on All Suspension Ropes." To obtain the tabulated data, the applicant uses the following formula derived from ASME A17.1-2004, section 2.20.3:

$$W = \frac{(S \times N)}{f} \quad \text{where:}$$

W = maximum static load imposed on all car ropes with the car and its rated load at any position in the hoistway

N = number of runs of rope under load. For 2:1 roping, N shall be two times the number of ropes used, etc.

S = manufacturer's rated breaking strength of one rope

f = the factor of safety from Table 2.20.3

16. ASME A17.1-2010 sections 2.20.3 and 2.20.4 utilize the same formula, but provide for use of suspension ropes having a diameter smaller than 9.5 mm, under specified conditions, key among them being that use of ropes having a diameter of between 8 mm to 9.5 mm be engineered with a factor of safety of 12 or higher. This is a higher minimum factor of safety than that proposed by Applicant but a minimum recommended by Cal/OSHA as a condition of variance necessary to the achieving of safety equivalence to 9.5 mm rope.
17. Cal/OSHA is in accord with Applicant, in proposing as a condition of safety equivalence, that periodic physical examination of the wire ropes be performed to confirm the ropes continue to meet the criteria set out in the (Application attachment) *Inspector's Guide to 6 mm Diameter Governor and 8 mm Diameter Suspension Ropes for KONE Elevators*. Adherence to this condition will provide an additional assurance of safety equivalence, regarding smaller minimum diameter suspension rope outer wire performance over the course of its service life.
18. Applicant requests a permanent variance from section 3041, subdivision (e)(1)(C), which states:

(1) All buildings and structures constructed after the effective date of this order that are provided with one or more passenger elevators shall be provided with not less than one passenger elevator designed and designated to accommodate the loading and transport of an ambulance gurney or stretcher maximum size 22 ½ in. (572 mm) by 75 in. (1.90 m) in its horizontal position and arranged to serve all landings in conformance with the following:

...

(C) The elevator car shall have a minimum inside car platform of 80 in. (2.03 m) wide by 51 in. (1.30 m) deep.

The intent of this language is to ensure that there is enough space to accommodate the access and egress of a gurney and medical personnel inside of a medical service elevator.

This standard is made applicable to Group IV by section 3141.7, subdivision (b), which reads, "Elevators utilized to provide medical emergency service shall comply with Group II, section 3041(e)."

19. Applicant proposes to comply with the requirements of the 2019 California Building Code, section 3002.4.1a in the design of its medical emergency service elevator. That section requires:

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5-inch (127 mm) radius corners] in the horizontal, open position.

The purpose of this requirement is to ensure that an elevator designated for emergency medical service will accommodate a minimum of two emergency personnel with an ambulance gurney or stretcher.

20. Cal/OSHA, by way of written submission to the record (Exhibit PD3), and stated position at hearing, is of the well informed opinion that grant of permanent variance, as limited and conditioned per the below Decision and Order will provide employment, places of employment,

and subject conveyances, as safe and healthful as would prevail given non-variant conformity with the requirements from which variance has been requested.

D. Conclusive Findings

A preponderance of the evidence supports the finding that each Applicants' proposal, subject to all conditions and limitations set forth in the below Decision and Order, will provide equivalent safety and health to that which would prevail upon full compliance with the requirements of the Elevator Safety Orders from which variance is being sought.

E. Decision and Order

Each Application being the subject of this proceeding, per above section A.1 table, is conditionally GRANTED, to the extent that each such Applicant shall be issued permanent variance from section 3141 incorporated ASME A17.1-2004, section 2.20.4, in as much as it precludes use of suspension rope of between 8 mm and 9.5 mm, or outer wire of between 0.51 mm and 0.56 mm in diameter, at such locations and numbers of Group IV KONE Monospace 500 elevators identified in each respective Application, subject to the following conditions:

1. The diameter of the hoisting steel ropes shall be not less than 8 mm (0.315 in) diameter and the roping ratio shall be two to one (2:1).
2. The outer wires of the suspension ropes shall be not less than 0.51 mm (0.02 in.) in diameter.
3. The number of suspension ropes shall be not fewer than those specified per hereby incorporated Decision and Order Appendix 1 Table.
4. The ropes shall be inspected annually for wire damage (rouge, valley break etc.) in accordance with "KONE, Inc. Inspector's Guide to 6 mm diameter and 8 mm diameter steel ropes for KONE Elevators" (per Application Exhibit B, or as thereafter amended by KONE subject to Cal/OSHA approval).
5. A rope inspection log shall be maintained and available in the elevator controller room/space at all times.
6. The elevator rated speed shall not exceed those speeds specified per the Decision and Order Appendix 1 Table.
7. The maximum suspended load shall not exceed those weights (plus 5%) specified per the Decision and Order Appendix 1 Table.
8. The opening to the hoistway shall be effectively barricaded when car top inspection, maintenance, servicing, or testing of the elevator equipment in the hoistway is required. If the service personnel must leave the area for any reason, the hoistway and control room doors shall be closed.
9. The installation shall meet the suspension wire rope factor of safety requirements of ASME A17.1-2013 section 2.20.3.
10. Any Certified Qualified Conveyance Company performing inspections, maintenance, servicing or testing the elevators shall be provided a copy of this variance decision.
11. Cal/OSHA shall be notified when the elevator is ready for inspection. The elevator shall be

inspected by Cal/OSHA and a "Permit to Operate" issued before the elevator is placed in service.

12. The Applicant shall comply with suspension means replacement reporting condition per hereby incorporated Decision and Order Appendix 2.
13. All medical emergency service elevator(s) shall comply with the following:
 - a. The requirements of the 2019 California Building Code (CBC) section 3002.4.1a:

The medical emergency service elevator shall accommodate the loading and transport of two emergency personnel, each requiring a minimum clear 21-inch (533 mm) diameter circular area and an ambulance gurney or stretcher [minimum size 24 inches by 84 inches (610 mm by 2134 mm) with not less than 5-inch (127 mm) radius corners] in the horizontal, open position.
 - b. All medical emergency service elevator(s) shall be identified in the building construction documents in accordance with the 2019 California Building Code, section 3002.4a.
 - c. Dimensional drawings and other information necessary to demonstrate compliance with these conditions shall be provided to Cal/OSHA, at the time of inspection, for all medical emergency service elevator(s).
14. The Applicant shall notify its employees or their authorized representative(s), or both, of this order in the same way and to the same extent that employees and authorized representatives are to be notified of docketed permanent variance applications pursuant to sections 411.2 and 411.3.
15. This Decision and Order shall remain in effect unless modified or revoked upon application by the Applicant, affected employee(s), Cal/OSHA, or by the Board on its own motion, in the procedural manner prescribed.

Pursuant to section 426(b), the Proposed Decision is submitted to the Board for consideration of adoption.

DATED: July 23, 2026



Kelly Chau, Hearing Officer

APPENDIX 1

File Number	Elevator ID	Minimum Suspension Ropes Per Elevator	Maximum Suspended Weight Per Elevator	Maximum Speed	Rated Capacity
26-V-360	1	8	11706	350	3500
26-V-360	2	8	11706	350	3500

APPENDIX 2

Suspension Means - Replacement Reporting Condition

Beginning on the date the Board adopts this Proposed Decision and continuing for a period of two years, the Applicant shall report to Cal/OSHA within 30 days any and all replacement activity performed on the elevator(s) pursuant to the requirements of ASME A17.1-2004, section 8.6.3 involving the suspension means or suspension means fastenings.

Further:

1. A separate report for each elevator shall be submitted, in a manner acceptable to Cal/OSHA, to the following address (or to such other address as Cal/OSHA might specify in the future): Cal/OSHA Elevator Unit, 2 MacArthur Place, Suite 700, Santa Ana, CA 92707, Attn: Engineering section.
2. Each such report shall contain, but not necessarily be limited to, the following information:
 - a. The State-issued conveyance number, complete address, and Permanent Variance number that identifies the permanent variance.
 - b. The business name, complete address, telephone number, and contact person of the elevator responsible party (presumably the Applicant or the subsequent holder of this variance).
 - c. The business name, complete address, telephone number, and Certified Qualified Conveyance Company (CQCC) certification number of the firm performing the replacement work.
 - d. The name (as listed on certification), Certified Competent Conveyance Mechanic (CCCM) certification number, certification expiration date, and signature of each CCCM performing the replacement work.
 - e. The date and time the elevator was removed from normal service for suspension replacement, the date and time the replacement work commenced, the date and time the replacement work was completed, and the date and time the elevator was returned to normal service.
 - f. A detailed description of, and clear color photographs depicting, (1) all the conditions that existed in the suspension components requiring their replacement and (2) any conditions that existed to cause damage or distress to the suspension components being replaced.
 - g. A detailed list of all elevator components adjusted, repaired, or replaced in conjunction with the suspension component replacement.
 - h. All information provided on the crosshead data plate per ASME A17.1-2004, section 2.20.2.1, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - i. For the suspension means being replaced, all information provided on the data tag required per ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is

- modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
- j. For the replacement suspension means, all information provided on the data tag required by ASME A17.1-2004, section 2.20.2.2, unless that ASME requirement is modified by the conditions of a variance that pertains to the elevator in question, in which case, the information to be reported shall be the information required by the ASME provision as modified by the variance.
 - k. Any other information requested by Cal/OSHA regarding the replacement of the suspension means or fastenings.
3. In addition to the submission of the report to Cal/OSHA, the findings of any testing, failure analysis, or other engineering evaluations performed on any portion of the replaced suspension components, or other elevator components replaced in conjunction therewith, shall be submitted to Cal/OSHA referencing the information contained in item 2a above.


CONSENT CALENDAR—PROPOSED VARIANCE DECISIONS
 AUGUST 20, 2026, MONTHLY BUSINESS MEETING
 OF THE OCCUPATIONAL SAFETY AND HEALTH STANDARDS BOARD
**PROPOSED DECISIONS FOR BOARD CONSIDERATION, HEARD ON
 JULY 22, 2026**

Docket Number	Applicant Name	Safety Order(s) at Issue	Proposed Decision Recommendation
1. 10-V-063M1	Santa Clara University	ELEVATOR	GRANT
2. 23-V-223M1	3357-3359 26th Street and 1122 Capp Street Owners Association	ELEVATOR	GRANT
3. 24-V-312M1	AREC RR WOODLAKE JV LLC	ELEVATOR	GRANT
4. 24-V-421M1	Sunnyside, L.P.	ELEVATOR	GRANT
5. 25-V-485M1	University of Santa Barbara	ELEVATOR	GRANT
6. 26-V-276	330 Distel Circle, LP	ELEVATOR	GRANT
7. 26-V-277	SAEW JATC APPRENTICESHIP TRAINING TRUST	ELEVATOR	GRANT
8. 26-V-279	1725 15th Street LLC	ELEVATOR	GRANT
9. 26-V-281	District Council 16 of the International Union of Painters and Allied Trades (DC16 IUPAT)	ELEVATOR	GRANT
10. 26-V-282	10910 Huston, LP	ELEVATOR	GRANT
11. 26-V-283	Beacon Owner, LLC	ELEVATOR	GRANT
12. 26-V-284	Century WLAVA 4 LP	ELEVATOR	GRANT
13. 26-V-285	Grace Villas LP	ELEVATOR	GRANT
14. 26-V-286	La Trinidad Senior Apartments, L.P.	ELEVATOR	GRANT
15. 26-V-287	La Jolla Cove Motel & Hotel Apartments, LLC	ELEVATOR	GRANT

Docket Number	Applicant Name	Safety Order(s) at Issue	Proposed Decision Recommendation
16. 26-V-289	Mulberry Gardens Family, L.P.	ELEVATOR	GRANT
17. 26-V-290	North Fair Oaks Apartments LP	ELEVATOR	GRANT
18. 26-V-291	SMDT Partners LLC	ELEVATOR	GRANT
19. 26-V-292	4141 Whitsett Management LLC	ELEVATOR	GRANT
20. 26-V-293	Pepperdine University	ELEVATOR	GRANT
21. 26-V-294	Kapital Alameda LLC	ELEVATOR	GRANT
22. 26-V-295	Pacific Las Tunas Place LLC	ELEVATOR	GRANT
23. 26-V-296	Raintree Partners	ELEVATOR	GRANT
24. 26-V-297	Sadeghian Rentals VB LLC	ELEVATOR	GRANT
25. 26-V-298	City of Santa Cruz	ELEVATOR	GRANT
26. 26-V-299	City of Santa Cruz	ELEVATOR	GRANT
27. 26-V-300	City of Santa Cruz	ELEVATOR	GRANT
28. 26-V-301	San Francisco Public Utilities Commission Wastewater Enterprise (SFPUC WWE)	ELEVATOR	GRANT
29. 26-V-302	Truly Redlands, LLC	ELEVATOR	GRANT
30. 26-V-303	2270 McKinnon LLC	ELEVATOR	GRANT
31. 26-V-305	Redwood Café at River Islands, LLC	ELEVATOR	GRANT
32. 26-V-306	Affordable Housing Group Ltd, LLC	ELEVATOR	GRANT
33. 26-V-307	Amazon.com LLC	ELEVATOR	GRANT
34. 26-V-308	Sacramento City Unified School District	ELEVATOR	GRANT
35. 26-V-309	Barbara Terrace, LLC	ELEVATOR	GRANT
36. 26-V-310	Chaffey Joint Union High School District	ELEVATOR	GRANT
37. 26-V-311	Commune VTA III, LLC	ELEVATOR	GRANT
38. 26-V-312	LA RE Development Holdings, LLC	ELEVATOR	GRANT

Docket Number	Applicant Name	Safety Order(s) at Issue	Proposed Decision Recommendation
39. 26-V-313	Commune VTA III, LLC	ELEVATOR	GRANT
40. 26-V-314	LA RE Development Holdings, LLC	ELEVATOR	GRANT
41. 26-V-315	Yeshivath Torath Emeth Academy	ELEVATOR	GRANT
42. 26-V-317	San Joaquin County Office of Education	ELEVATOR	GRANT
43. 26-V-318	Crystal Springs Uplands School	ELEVATOR	GRANT
44. 26-V-320	Emperial Hospitality LLC	ELEVATOR	GRANT
45. 26-V-321	Board of Trustees of the California State University	ELEVATOR	GRANT
46. 26-V-322	University Retirement Community at Davis	ELEVATOR	GRANT
47. 26-V-323	Gilead Sciences, Inc.	ELEVATOR	GRANT
48. 26-V-324	Kaiser Foundation Health Plan, Inc.	ELEVATOR	GRANT
49. 26-V-326	Auburn Lake Shore LLC	ELEVATOR	GRANT
50. 26-V-327	Fresno City Center Corporation.	ELEVATOR	GRANT
51. 26-V-328	Sweetwater Union High School District	ELEVATOR	GRANT
52. 26-V-329	6122 Victoria Partners LLC	ELEVATOR	GRANT
53. 26-V-330	Elad Investment LLC	ELEVATOR	GRANT
54. 26-V-331	Burlington Capital LP	ELEVATOR	GRANT
55. 26-V-332	City of Eastvale	ELEVATOR	GRANT
56. 26-V-333	City of Eastvale	ELEVATOR	GRANT
57. 26-V-334	City of Eastvale	ELEVATOR	GRANT
58. 26-V-335	Sutter Bay Hospitals	ELEVATOR	GRANT
59. 26-V-336	Regents of the University of California	ELEVATOR	GRANT
60. 26-V-337	Vista Point SPE LLC	ELEVATOR	GRANT
61. 26-V-338	5637 Broadway, LLC	ELEVATOR	GRANT

Docket Number	Applicant Name	Safety Order(s) at Issue	Proposed Decision Recommendation
62. 26-V-339	TR Costa Mesa Courtyards, LLC	ELEVATOR	GRANT
63. 26-V-340	San Francisco Community College District	ELEVATOR	GRANT
64. 26-V-341	18337 Kittridge LP	ELEVATOR	GRANT
65. 26-V-342	Aztec Shops LTD	ELEVATOR	GRANT
66. 26-V-343	Rincon Property West, LLC	ELEVATOR	GRANT
67. 26-V-344	North Brea Housing Partners LP	ELEVATOR	GRANT
68. 26-V-345	County of Los Angeles	ELEVATOR	GRANT
69. 26-V-346	Hospital Corporation of America (HCA)	ELEVATOR	GRANT
70. 26-V-347	United Indian Health Services, Inc	ELEVATOR	GRANT
71. 26-V-348	112 Vera Ave. L.P.	ELEVATOR	GRANT
72. 26-V-350	Alexandria Associates LLC	ELEVATOR	GRANT
73. 26-V-351	Logos St Rest Holdings 1, LLC	ELEVATOR	GRANT
74. 26-V-352	Chinese Christian Alliance Church, Inc. of the Christian and Missionary Alliance of Northridge California	ELEVATOR	GRANT
75. 26-V-353	Jefferson Union H.S. District	ELEVATOR	GRANT
76. 26-V-354	Little Manila Rising Center, LLC	ELEVATOR	GRANT
77. 26-V-355	First Southern Baptist Church Beaumont	ELEVATOR	GRANT
78. 26-V-356	Super Micro Computer Inc.	ELEVATOR	GRANT
79. 26-V-355	West Valley Mission Community College		GRANT
80. 26-V-358	Clairemont Rental Properties LP	ELEVATOR	GRANT
81. 26-V-359	NREA-TRC 700 LLC	ELEVATOR	GRANT
82. 26-V-360	Primestar Norwalk Living, LLC	ELEVATOR	GRANT

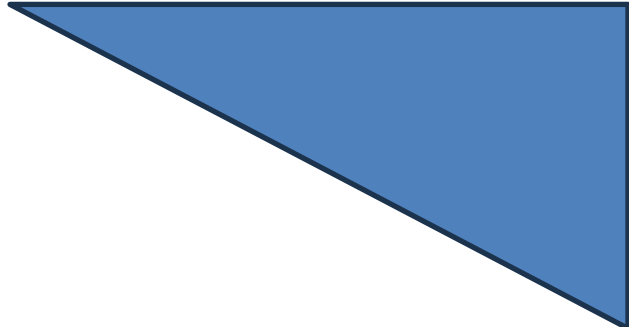

Occupational Safety and Health Standards Board

Business Meeting Legislative Update

Prepared by the Department of Industrial Relations
Available on the DIR web page: [Standards Board \(OSHSB\) 2026 Meeting Schedule](#)

Legislative Update
Prepared August 7, 2026, for the August 20, 2026 Meeting
of the Occupational Safety and Health Standards Board

AB-605 Employment: refineries: task force: staffing management plans. (2025-2026) – UPDATE
(Muratsuchi)

Date	Action
08/03/26	In committee: Referred to APPR. suspense file.
07/02/26	Read second time and amended. Re-referred to Com. on APPR.
07/02/26	From committee: Amend, and do pass as amended and re-refer to Com. on APPR. (Ayes 4. Noes 2.) (July 1).
06/24/26	From committee: Do pass and re-refer to Com. on E.Q. (Ayes 4. Noes 1.) (June 24). Re-referred to Com. on E.Q.
06/15/26	Re-referred to Coms. on L., P.E. & R. and E.Q.
06/11/26	Re-referred to Com. on RLS.
06/11/26	Withdrawn from committee.
06/10/26	From committee chair, with author's amendments: Amend, and re-refer to committee. Read second time, amended, and re-referred to Com. on E.Q.
07/02/25	In committee: Set, first hearing. Hearing canceled at the request of author.
06/18/25	Referred to Coms. on E.Q. and TRANS..
06/05/25	In Senate. Read first time. To Com. on RLS. for assignment.
06/04/25	Read third time. Passed. Ordered to the Senate. (Ayes 78. Noes 0. Page 2055.)
05/27/25	Read second time. Ordered to third reading.
05/23/25	From committee: Do pass. (Ayes 14. Noes 0.) (May 23).
05/07/25	In committee: Set, first hearing. Referred to APPR. suspense file.
04/29/25	From committee: Do pass and re-refer to Com. on APPR. with recommendation: To Consent Calendar. (Ayes 14. Noes 0.)

	(April 28). Re-referred to Com. on APPR.
04/22/25	From committee: Do pass and re-refer to Com. on NAT. RES. (Ayes 15. Noes 0.) (April 21). Re-referred to Com. on NAT. RES.
04/21/25	Re-referred to Com. on TRANS.
04/10/25	From committee chair, with author's amendments: Amend, and re-refer to Com. on TRANS. Read second time and amended.
03/03/25	Referred to Coms. on TRANS. and NAT. RES.
02/14/25	From printer. May be heard in committee March 16.
02/13/25	Read first time. To print.

Summary:

AB 605, as amended, Muratsuchi. Employment: refineries: task force: safe staffing management plans.

Existing law establishes an accidental release prevention program for the state. Under that law, stationary sources subject to the accidental release prevention program may be required to prepare and submit a risk management plan (RMP) to prevent accidental releases of certain substances. Existing law imposes criminal penalties upon a stationary source that knowingly violates the requirements of the accidental release prevention program.

This bill would state findings and declarations concerning refinery closures in California. The bill would create the Refinery Safe Staffing Task Force to develop potential methods and strategies for ensuring maximum employee retention at refineries and addressing employment dislocations associated with oil, gas, and related industries, with membership, as specified, appointed and commencing service no later than January 1, 2028. The bill would require the task force, no later than June 1, 2029, to present to the Legislature and make available online to the public a report documenting a wide range of potential methods and strategies for ensuring maximum employee retention in the time period preceding refinery closure or long-term idling of a refinery, for ensuring safe operation in the event of understaffing, and for transitioning oil and gas workers into sectors that match their skills and experience. The bill would repeal the provisions that would create the task force on January 1, 2030.

This bill would require the California Environmental Protection Agency, by January 1, 2028, to adopt regulations that require all refineries, as specified, to develop safe staffing management plans to address staffing risks associated with anticipated refinery closure or long-term idling. The bill would require the regulations to require the plans to be updated periodically and upon announcement of a refinery closure or long-term idling, as specified. The bill would require the regulations to make the plans subject to public comment and presentation to the agency for approval. The bill would make the agency responsible for conducting inspections and investigations to ensure implementation of the refinery's plan, addressing noncompliance through all available and necessary enforcement authority, and posting the drafts, comments, plans, and updates on its internet website, as specified.

Because the bill would expand the scope of a crime, it would impose a state-mandated local program.

Existing law, the California Refinery and Chemical Plant Worker Safety Act of 1990, the purpose of which is to prevent or minimize the consequences of catastrophic releases of toxic, flammable, or explosive chemicals and eliminate the risks to which workers are exposed in refineries, requires the Division of Occupational Safety and Health to propose, and the Occupational Safety and Health Standards Board to consider for adoption, regulations implementing provisions for refineries, that, among other things, require an employer to develop and implement written operating procedures that provide clear instructions for safely conducting process or business activities.

This bill would require the division, by January 1, 2028, to propose, and the board to consider for adoption, regulations that require refinery employers to develop safe staffing management plans to address staffing risks associated with anticipated refinery closure or long-term idling. The bill would require the regulations to require the plans to be updated periodically and upon announcement of a refinery closure or long-term idling, as specified. The bill would require the regulations to make the plans subject to public comment and presentation to the division for approval. The bill would make the division responsible for conducting inspections and investigations to ensure implementation of an employer's plan, addressing noncompliance through all available and necessary enforcement authority, and posting the drafts, comments, plans, and updates on its internet website, as specified.

The California Constitution requires the state to reimburse local agencies and school districts for certain costs mandated by the state. Statutory provisions establish procedures for making that reimbursement.

This bill would provide that no reimbursement is required by this act for a specified reason.

Board staff is monitoring for potential impacts on Board operations.

**AB-2137 Occupational safety and health: fabrication activities: slab solid surface products.
(2025-2026) – NO UPDATE**

(Chen)

Date	Action
05/14/26	In committee: Held under submission.
05/06/26	In committee: Set, first hearing. Referred to APPR. suspense file.
04/23/26	From committee: Do pass and re-refer to Com. on APPR. (Ayes 7. Noes 0.) (April 22). Re-referred to Com. on APPR.
04/16/26	Re-referred to Com. on L. & E.
04/15/26	From committee chair, with author's amendments: Amend, and re-refer to Com. on L. & E. Read second time and amended.
03/23/26	Re-referred to Com. on L. & E.
03/19/26	From committee chair, with author's amendments: Amend, and re-refer to

	Com. on L. & E. Read second time and amended.
03/19/26	Referred to Com. on L. & E.
02/19/26	From printer. May be heard in committee March 21.
02/18/26	Read first time. To print.

Summary:

AB 2137, as amended, Chen. Occupational safety and health. health: fabrication activities: slab solid surface products.

Existing law establishes the Occupational Safety and Health Standards Board within the Department of Industrial Relations to adopt occupational safety and health standards for the state, including standards dealing with exposure to harmful airborne contaminants. Existing law requires the Division of Occupational Safety and Health within the department to enforce all occupational safety and health standards, as specified.

Existing law imposes restrictions on specified high-exposure trigger tasks on artificial stone, as those terms are defined. Specifically, a person or entity engaged in high-exposure trigger tasks is prohibited from using dry methods, and is required to use effective wet methods when engaging in any high-exposure trigger tasks. Existing law requires the owner or operator of a fabrication shop, or any individual who will employ another individual to perform high-exposure trigger tasks in a fabrication shop, to ensure that an employee who will perform high-exposure tasks receives specified training and to annually attest to the division that these employees have been trained. Existing law requires the division to enforce these provisions by issuing a citation alleging a violation and a notice of civil penalty.

This bill would require, on or before January 1, 2028, the department to develop an application and certification process for fabrication shops to lawfully engage in slab solid surface product fabrication activities. The bill would authorize fabrication shops to engage in those fabrication activities during the pendency of the application development and certification process. The bill would require the department to develop an initial deposit process for fabrication shops to, during the pendency of the application development and certification process, submit a deposit fee for the application and certification subject to specified requirements, including that the deposit amount goes towards the initial certification fee collected by the department.

This bill would require, beginning July 1, 2028, the department to grant a 3-year certification to a fabrication shop that demonstrates satisfaction of specified criteria involving workplace safety conditions and precautions, and would authorize certification renewal, as specified. Among other conditions, the bill would establish certain regulatory fees in amounts to be determined and adjusted by the department, as specified, for the certification and renewal thereof. The bill would authorize the department to suspend or revoke a certification in certain cases, including for gross negligence, as specified. The bill would require the department, in consultation with the division and the State Department of Public Health, to track and keep a record of specified information on fabrication shops, including the number of citations issued to any of the fabrication shops for failure to comply with any temporary or future standards relating to respirable crystalline silica, as specified.

This bill would prohibit a person or entity, or an employee thereof, from engaging in fabrication activities, as defined, on slab solid surface products unless they conduct the fabrication activities at

a fabrication shop that has submitted a valid initial deposit to the department, or, after July 1, 2028, has submitted an application for initial certification or renewal and the application is pending or has a valid certification, as provided. The bill would require the division to enforce this prohibition by issuing a citation alleging a violation and a notice of civil penalty.

This bill would prohibit, beginning July 1, 2028, a person from supplying a slab solid surface product directly to a person, entity, or business engaged in fabrication activities on those products if the person, entity, or business does not have a valid, or pending application for, certification. The bill would require a person that supplies a slab solid surface product to a person, entity, or business engaged in fabrication activities on those products to verify that the person, entity, or business has a certification, or a pending application for certification, as specified. The bill would require a person that supplies a slab solid surface product to a person, entity, or business that is not engaged in fabrication activities to rely on written certification issued under penalty of perjury that, among other things, they will not directly engage in fabrication activities with the product without a certification. By expanding the scope of the crime of perjury, the bill would impose a state-mandated local program. The bill would require a person that seeks services that require fabrication activities and enters into a contract with a person, entity, or business to undertake fabrication activities to verify that the person, entity, or business has a valid certificate before engaging with and providing slab solid surface products to that person, entity, or business. The bill would require the division to enforce these requirements by issuing a citation alleging a violation and a notice of civil penalty.

The bill would establish the Slab Fabrication Activity Account in the Occupational Safety and Health Fund in the State Treasury, and would require all fees, penalties, or other moneys collected by the department under the bill and under the above-described provisions relating to high-exposure trigger tasks to be deposited into the account. The bill would authorize moneys in the account to be expended by the department, upon appropriation by the Legislature, for the purposes of administering the bill and other provisions related to silicosis risk exposure in fabrication shops.

The California Constitution requires the state to reimburse local agencies and school districts for certain costs mandated by the state. Statutory provisions establish procedures for making that reimbursement.

This bill would provide that no reimbursement is required by this act for a specified reason.

Board staff is monitoring for potential impacts on Board operations.

AB 2321, Ortega. Bureau of Investigations. (2025-2026) – UPDATED

(Ortega)

Date	Action
08/03/26	In committee: Referred to APPR. suspense file.
06/29/26	Read second time and amended. Re-referred to Com. on APPR.
06/25/26	From committee: Amend and do pass as amended and re-refer to Com. on APPR.

	(Ayes 4. Noes 1.) (June 24).
06/16/26	From committee chair, with author's amendments: Amend, and re-refer to committee. Read second time, amended, and re-referred to Com. on L., P.E. & R.
06/10/26	Referred to Com. on L., P.E. & R.
05/27/26	In Senate. Read first time. To Com. on RLS. for assignment.
05/26/26	Read third time. Passed. Ordered to the Senate. (Ayes 55. Noes 17.)
05/19/26	Read second time. Ordered to third reading.
05/18/26	Read second time and amended. Ordered returned to second reading.
05/14/26	From committee: Amend, and do pass as amended. (Ayes 11. Noes 3.) (May 14).
04/29/26	In committee: Set, first hearing. Referred to APPR. suspense file.
04/09/26	From committee: Do pass and re-refer to Com. on APPR. (Ayes 5. Noes 0.) (April 8). Re-referred to Com. on APPR.
04/09/26	Coauthors revised.
03/17/26	Re-referred to Com. on L. & E.
03/16/26	From committee chair, with author's amendments: Amend, and re-refer to Com. on L. & E. Read second time and amended.
03/16/26	Referred to Com. on L. & E.
02/20/26	From printer. May be heard in committee March 22.
02/19/26	Read first time. To print.

Summary:

AB 2321, as amended, Ortega. Bureau of Investigations.

Existing law establishes the Department of Industrial Relations, which includes the Division of Occupational Safety and Health. Existing law makes the Bureau of Investigations within the Division of Occupational Safety and Health responsible for directing accident investigations involving violations of laws, standards, and orders in which there is a serious injury to 5 or more employees, death, or request for prosecution by a division representative. Existing law requires the bureau to review inspection reports involving a serious violation if there have been serious injuries to one to 4 employees or a serious exposure, and authorizes the bureau to investigate cases for the purpose of prosecution, as specified. Existing law requires the bureau to refer the results of investigations it is required to conduct to the appropriate prosecuting authority having jurisdiction

for appropriate action unless it determines that there is legally insufficient evidence of a violation of the law.

This bill would require the bureau to establish written policies and procedures for the process of reviewing cases and deciding whether to investigate or refer them for prosecution. The bill would also require the division to establish a routine or automated process for transmitting information to the bureau about incidents with nonfatal injuries so that the bureau can review them.

Existing law authorizes the department, upon the request of a county district attorney, to develop a protocol for the referral of cases that may involve criminal conduct to the appropriate prosecuting authority in lieu of or in cooperation with an investigation by the bureau.

This bill would require the bureau to immediately notify the appropriate prosecuting authority upon learning of an incident in which there is a serious injury to 5 or more employees, death, or request for prosecution by a division representative. The bill would delete the above-described provisions regarding developing a protocol and would instead authorize the department, upon request of an appropriate prosecuting authority, to refer cases that may involve criminal conduct to the appropriate prosecuting authority, as specified. The bill would require the bureau, in cases accepted for investigation, to cooperate with the prosecuting authority and the division.

For an incident in the County of Alameda or the County of Santa Clara resulting in a death, the bill would require the Alameda County District Attorney or the Santa Clara County District Attorney, based on the county in which the incident occurred, until January 1, 2032, to investigate and prepare cases for prosecution and submit a specified report to the Legislature, subject to an appropriation by the Legislature of sufficient funding for this purpose. The bill would also require the division to immediately notify the Alameda County District Attorney or the Santa Clara County District Attorney and provide it with certain relevant information about the incident. The bill would make other related and conforming changes to these provisions. The bill would also authorize moneys in the Occupational Safety and Health Fund or the Labor and Workforce Development Fund to be expended by the Alameda County District Attorney or the Santa Clara County District Attorney, upon appropriation, for the support of these investigatory activities. By imposing new responsibilities on local officials, this bill would impose a state-mandated local program.

Existing law requires the bureau to submit an annual report to the division on its activities.

This bill would additionally require the report to be submitted to the Legislature and to include information relating to job classifications and vacancies within the bureau.

This bill would make legislative findings and declarations as to the necessity of a special statute for the County of Alameda and the County of Santa Clara.

The California Constitution requires the state to reimburse local agencies and school districts for certain costs mandated by the state. Statutory provisions establish procedures for making that reimbursement.

This bill would provide that, if the Commission on State Mandates determines that the bill contains costs mandated by the state, reimbursement for those costs shall be made pursuant to the statutory provisions noted above.

Board staff is monitoring for potential impacts on Board operations.

Date	Action
06/25/26	From committee: Do pass and re-refer to Com. on APPR. (Ayes 5. Noes 2.) (June 24). Re-referred to Com. on APPR.
06/04/26	Referred to Com. on L. & E.
05/27/26	In Assembly. Read first time. Held at Desk.
05/27/26	Read third time. Passed. (Ayes 30. Noes 9.) Ordered to the Assembly.
05/14/26	Read second time. Ordered to third reading.
05/14/26	From committee: Do pass. (Ayes 5. Noes 2.) (May 14).
05/08/26	Set for hearing May 14.
05/04/26	May 4 hearing: Placed on APPR. suspense file.
04/24/26	Set for hearing May 4.
04/23/26	April 27 hearing postponed by committee.
04/17/26	Set for hearing April 27.
04/15/26	From committee: Do pass and re-refer to Com. on APPR. (Ayes 4. Noes 1.) (April 15). Re-referred to Com. on APPR.
04/09/26	Set for hearing April 15.
04/08/26	Re-referred to Com. on L., P.E. & R.
03/25/26	From committee with author's amendments. Read second time and amended. Re-referred to Com. on RLS.
02/11/26	Referred to Com. on RLS.
02/04/26	From printer. May be acted upon on or after March 6.
02/03/26	Introduced. Read first time. To Com. on RLS. for assignment. To print.

Summary:

SB 966, as amended, Gonzalez. Refinery and chemical plants.

Existing law, the California Refinery and Chemical Plant Worker Safety Act of 1990, requires the Occupational Safety and Health Standards Board and the Division of Occupational Safety and Health to promote worker safety through implementation of training and process safety management practices in refineries, chemical plants, and other appropriate facilities, including by adopting process safety management standards and regulations. The act defines “process safety management” and other terms for its purposes. The act also requires an employer to develop and maintain written safety information, emergency action plans, operating procedures, procedures to manage changes, and inspection and testing programs.

This bill would require an employer, in consultation with employees and employee representatives, to develop, implement, and maintain a written plan to effectively provide for employee participation in all process safety management elements. The bill would also require, on or before April 1, 2027, an employer, in consultation with employee and employee representatives, to develop and implement stop work procedures and procedures for reporting and responding to hazards, as specified. The bill would require an employer to document specific information relating to a partial or complete shut down of an operation or process and reports of hazards. The bill would provide how employees who are and who are not represented by an authorized collective bargaining agent participate in the development of these plans and procedures.

Board staff is monitoring for potential impacts on Board operations.

SB-1046 Occupational safety: transboundary pollution. (2025-2026) – NO UPDATE

(Blakespear/Padilla)

Date	Action
07/01/26	July 1 set for first hearing. Placed on suspense file.
06/11/26	From committee: Do pass and re-refer to Com. on APPR. with recommendation: To consent calendar. (Ayes 7. Noes 0.) (June 10). Re-referred to Com. on APPR.
05/26/26	Referred to Com. on L. & E.
05/20/26	In Assembly. Read first time. Held at Desk.
05/20/26	Read third time. Passed. (Ayes 38. Noes 0.) Ordered to the Assembly.
05/14/26	Read second time. Ordered to third reading.
05/14/26	From committee: Do pass. (Ayes 7. Noes 0.) (May 14).
05/08/26	Set for hearing May 14.
04/20/26	April 20 hearing: Placed on APPR. suspense file.
04/14/26	Set for hearing April 20.

04/09/26	Read second time and amended. Re-referred to Com. on APPR.
04/08/26	From committee: Do pass as amended and re-refer to Com. on APPR. (Ayes 4. Noes 0.) (April 8).
03/26/26	Set for hearing April 8.
03/25/26	Re-referred to Com. on L., P.E. & R.
03/17/26	From committee with author's amendments. Read second time and amended. Re-referred to Com. on RLS.
02/18/26	Referred to Com. on RLS.
02/12/26	Referred to Com. on L. & E.
02/20/26	From printer. May be acted upon on or after March 14.
02/11/26	Introduced. Read first time. To Com. on RLS. for assignment. To print.

Summary:

SB 1046, as amended, Blakespear. Occupational safety: transboundary pollution.

Existing law, the California Occupational Safety and Health Act of 1973, exists for the purpose of assuring safe and healthful working conditions for all California workers by authorizing the enforcement of effective standards, assisting and encouraging employers to maintain safe and healthful working conditions, and providing for research, information, education, training, and enforcement in the field of occupational safety and health. Existing law establishes the Occupational Safety and Health Standards Board within the Department of Industrial Relations for the adoption of occupational safety and health standards and establishes the Division of Occupational Safety and Health in that department for the enforcement of those occupational safety and health standards, as prescribed.

This bill would require the division, on or before January 1, 2030, to propose to the board for its review and adoption, a standard that protects the health and safety of employees who risk high or prolonged exposure to transboundary pollution, as defined, in outdoor occupational environments, as specified. The bill would require the board to consider identifying an exposure threshold for hydrogen sulfide at which acute or chronic health effects occur to reference in the standards and may consider exposure thresholds for other relevant pollutants. The bill would authorize the board to develop the standard in consultation with other specified groups. The bill would authorize the board to adopt emergency regulations to implement these provisions.

Board staff is monitoring for potential impacts on Board operations.

H.R.86 NOSHA Act. (2025-2026) – NO UPDATE

(Biggs)

Date	Action
01/03/25	Referred to the House Committee on Education and Workforce.
01/03/25	Introduced in House

Summary:

H.R., as introduced, Biggs. NOSHA Act.

This bill abolishes the Occupational Safety and Health Administration (OSHA) and its functions. OSHA, which is part of the Department of Labor, sets and enforces workplace safety and health standards and provides related training, outreach, education, and assistance.

Board staff is monitoring for potential impacts on Board operations.

H.R.5437 Protection of Lawful Commerce in Stone Slab Products Act. (2025-2026) – NO UPDATE

(McClintock/Biggs)

Date	Action
09/17/25	Referred to the House Committee on the Judiciary
09/17/25	Introduced in House

Summary:

H.R., as introduced, McClintock and Biggs. Protection of Lawful Commerce in Stone Slab Products Act.

To prohibit civil actions brought against a manufacturer or seller of a stone slab product for harm resulting from the alteration of such a product by a fabricator, and for other purposes.

Board staff is monitoring for potential impacts on Board operations.

H.R.6213 Heat Workforce Standards Act of 2025 (2025-2026) – NEW

(Messmer)

Date	Action
07/21/26	Ordered to be Reported (Amended) by the Yeas and Nays: 18 - 15.
07/21/26	Committee Consideration and Mark-up Session Held
11/20/25	Referred to the House Committee on Education and Workforce
11/20/25	Introduced in House

Summary:

H.R., as introduced, Messmer. Heat Workforce Standards Act of 2025.

To prohibit the Secretary of Labor from finalizing, implementing, or enforcing a proposed standard with respect to heat injury and illness prevention.

Board staff is monitoring for potential impacts on Board operations.